



شرکت صنایع پتروشیمی سبلان




VISUAL INSPECTION





KASH

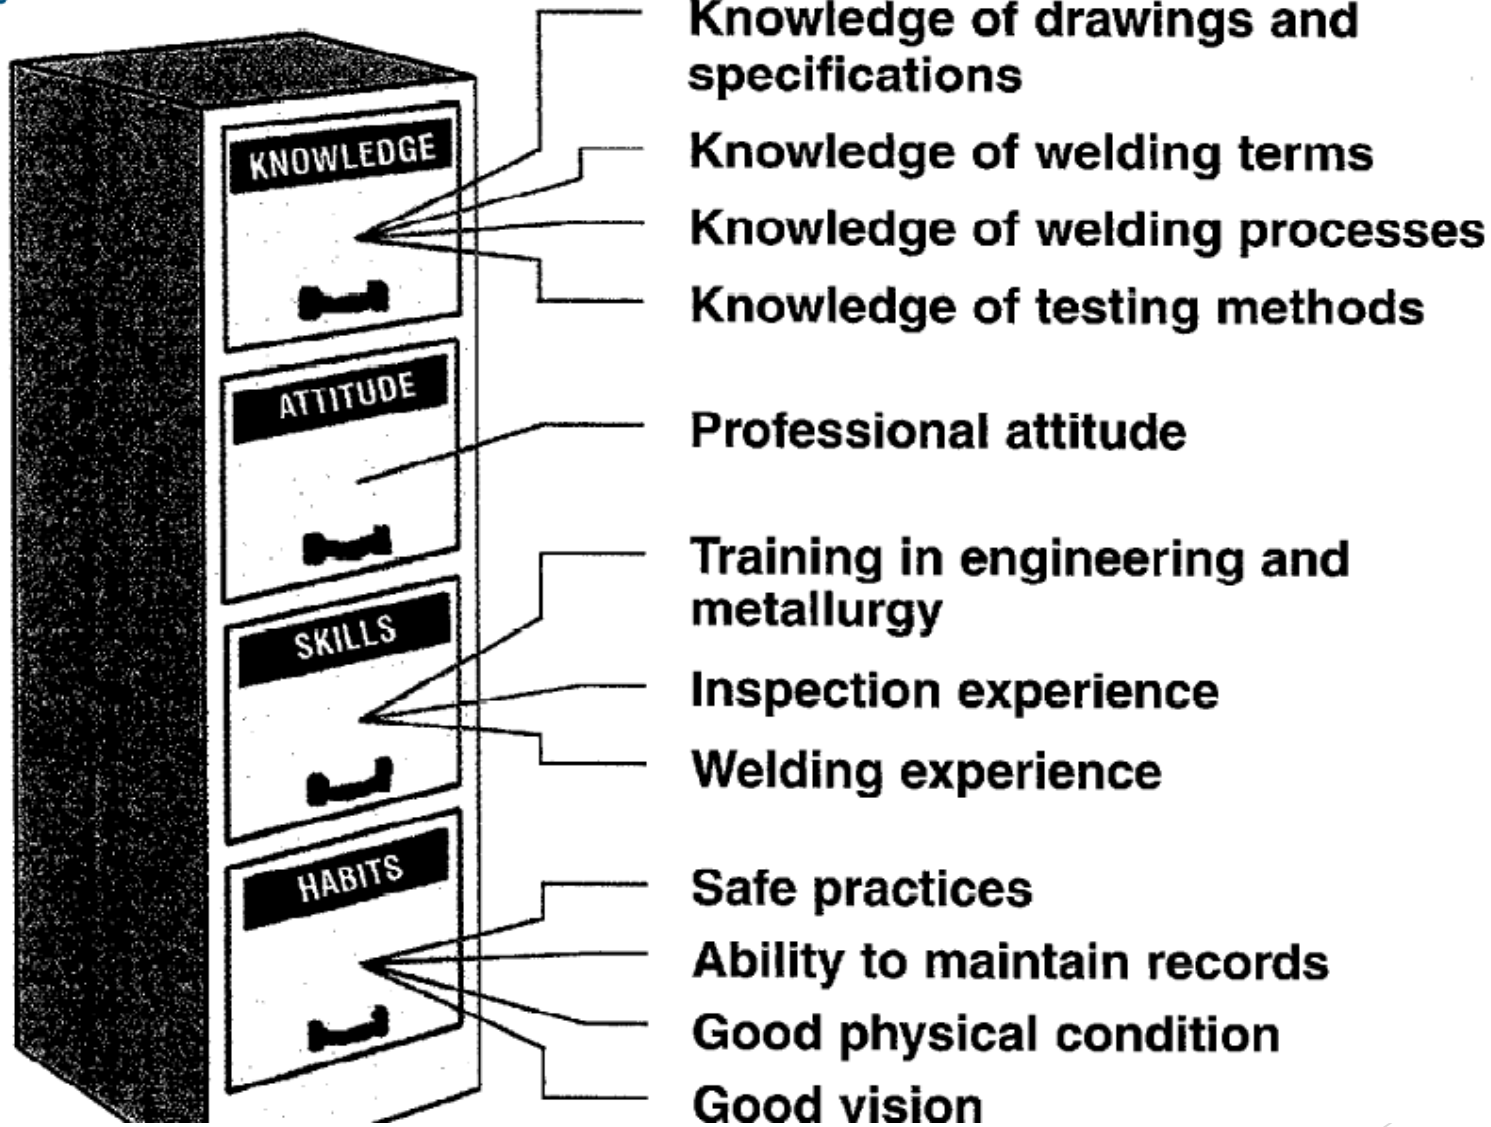



شرکت صنایع پتروشیمی سبلان

بازرس جوش کیست؟

- ▶ مسئولیت نسبت تعیین کیفیت جوش طبق کد و استاندارد.
- ▶ آشنایی با متدهای بازرسی مخرب و غیر مخرب
- ▶ هماهنگ کننده واحدهای تولید و واحدهای تضمین و کنترل کیفیت
- ▶ داشتن شرایط جسمی مناسب برای بازرس
- ▶ بازرس باید از بینایی مناسب برخوردار باشد.
- ▶ بازرس باید به هر منطقه ای که جوشکار میرود بتواند برود.



بازرس جوش کیست؟

- ▶ توانایی در به کارگیری اسناد و مدارک بازرسی مانند WPS , PQR , WQT , SPEC , ITP
- ▶ گذراندن دوره های تخصصی و آموزشی
- ▶ آشنایی با فرایندهای مختلف جوشکاری و حتی انجام این فرایندها جهت درک بیشتر جوشکارها
- ▶ آشنایی با مزیت ها و معایب هر روش جوشکاری و امکان اجرای هر روش
- ▶ آشنایی با ایمنی در هنگام جوشکاری و بازرسی جوش **ANSI Z49**
- ▶ بازرس باید گزارشات تخصصی خود را به زبان ساده و قابلیت ردیابی داشته باشد. **SEGMENT**



ANSI Z49.1:2012
An American National Standard

Safety in Welding,
Cutting, and
Allied Processes

ITEM NO.	PROJECT PHASE & ACTIVITY CODE	TASK / ACTIVITY	QUALITY PROCEDURE	QUALITY RECORD	INSPECTION RESPONSIBILITY ASSIGNMENTS			REMARKS
					QC	PMC	SADARA	
1.0	DOCUMENT REVIEW							
1.1		Not Applicable						
2.0	MATERIAL RECEIVING							
2.1		Gypsum Wall Board System Receiving and Storage Inspection			H	W	S	SADARA - Witness first delivery and one in 2 occurrences thereafter.
3.0	INSTALLATION							
3.1		Gypsum Wall Board Pre-installation Inspection			H	I	S	SADARA - Witness first delivery and one in 2 occurrences thereafter.
3.2		Gypsum Wall Board Framing, Insulation and Pre-closing inspection			H	H	W	
3.3		Gypsum Wall Board System Plastering, Finishing and Final Inspection			H	I	W	
4.0	PRE-COMMISSIONING							
4.1		Not Applicable						





شرکت صنایع پتروشیمی سبلان

		Project: closure			
ULTRASONIC EXAMINATION REPORT					
Company: SAMAN INDUSTRIAL SYSTEM		Report No.:06			
DWG No.: N/A		Date of TEST: 96/09/11		Date of Report: 96/09/28	
Equipment: TRUSONIC		Material: ALTERNATIVE - CARBON STEEL			
Maker: TAIWAN					
Model: TRU TEST		Search Unit: Straight <input checked="" type="checkbox"/> Angle <input type="checkbox"/>			
Serial No.: 3033					
Test block: V1, V2, DAC					
Basic Material: CARBON STEEL					
Couplant: SOL GEL		Exam. Method: PULS ECHO			
Code/Standard: ASME ASTM					
Extent of Examination: 100% OF SURFACE					
Examination Method :					
RL <input type="checkbox"/> RH <input type="checkbox"/> DAC <input checked="" type="checkbox"/> DGS <input checked="" type="checkbox"/>					
Surface Condition: BRUSHED SURFACE		Transfer Correction:			
Scanning Direction				Total Examination Length: all surface mm^2	
Sketch:					
AXE INSPECTOR		AXE CO		SAMAN INDUSTRIAL SYS	
Name:		Name:		Name:	
Date:		Date:		Date:	
Cert. No.		Cert. No.		Sign:	



ویژگی های اخلاقی بازرس جوش



شرکت صنایع پتروشیمی سبلان

- ▶ صداقت و درستي
- ▶ اعلام مخالفت در برابر پیشنهادهای افراد سودجو
- ▶ تصور سازه در صورت عدم بازرسي و بروز اتفاقات ناگوار از قبیل زلزله و انفجار
- ▶ انجام بازرسي بر مبنای ITP و NDT PLAN و تطبیق کامل با آن
- ▶ بازرس نمیتواند نظر همه را جلب کند. اما میتواند فضا را مدیریت کند.



جايگاه مختلف بازرس جوش و قراردادها

QUALITY CONTROL



Third party
Inspection Services



واحد کنترل کيفي ▶

ناظر کارفرما ▶

مشاور کارفرما ▶

بازرس عضو سوم ▶



بازرس جوش به عنوان شخص ارتباط دهنده

- ▶ ارتباط بازرس به صورت یک حلقه می باشد.
- ▶ اشخاصی که بازرس با آنها در ارتباط می باشد: جوشکاران . مهندسین جوش . سرپرستان بازرسی . سرکارگران جوشکاری . مهندسین طراح . سرپرستان تولید.
- ▶ جوشکار نوک حمله فرایند بازرسی جوش می باشد بنابراین ارتباط بین جوشکار و بازرس جوش مهم می باشد.




بازرس جوش به عنوان شخص ارتباط دهنده

▶ در صورت عدم اجراي WPS بازرس اولين شخصي است که متوجه مي گردد.

▶ بهتر است بازرس به جاي ارتباط با جوشکاران با سرپرست آنها در ارتباط باشد.


▶ بازرس ميتواند در صورت عدم اجراي صحيح پروژه به دليل مباحث طراحي با طراح در ارتباط باشد.

▶ بازرس هميشه روبروي توليد مي باشد و توليد به بازرس به عنوان مانع توجه ميكند.

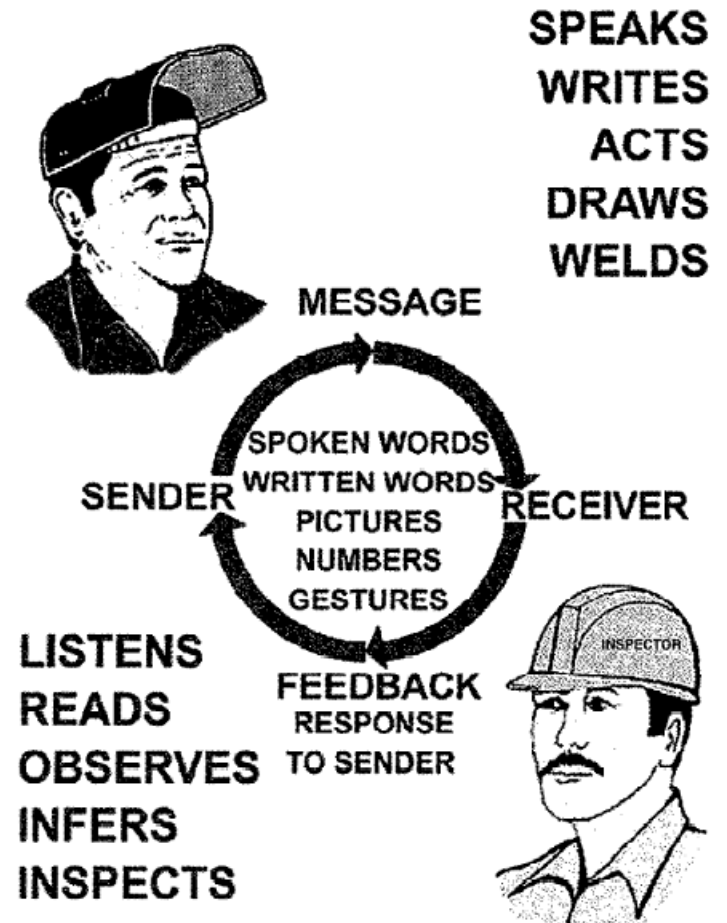



شرکت صنایع پتروشیمی سبلان

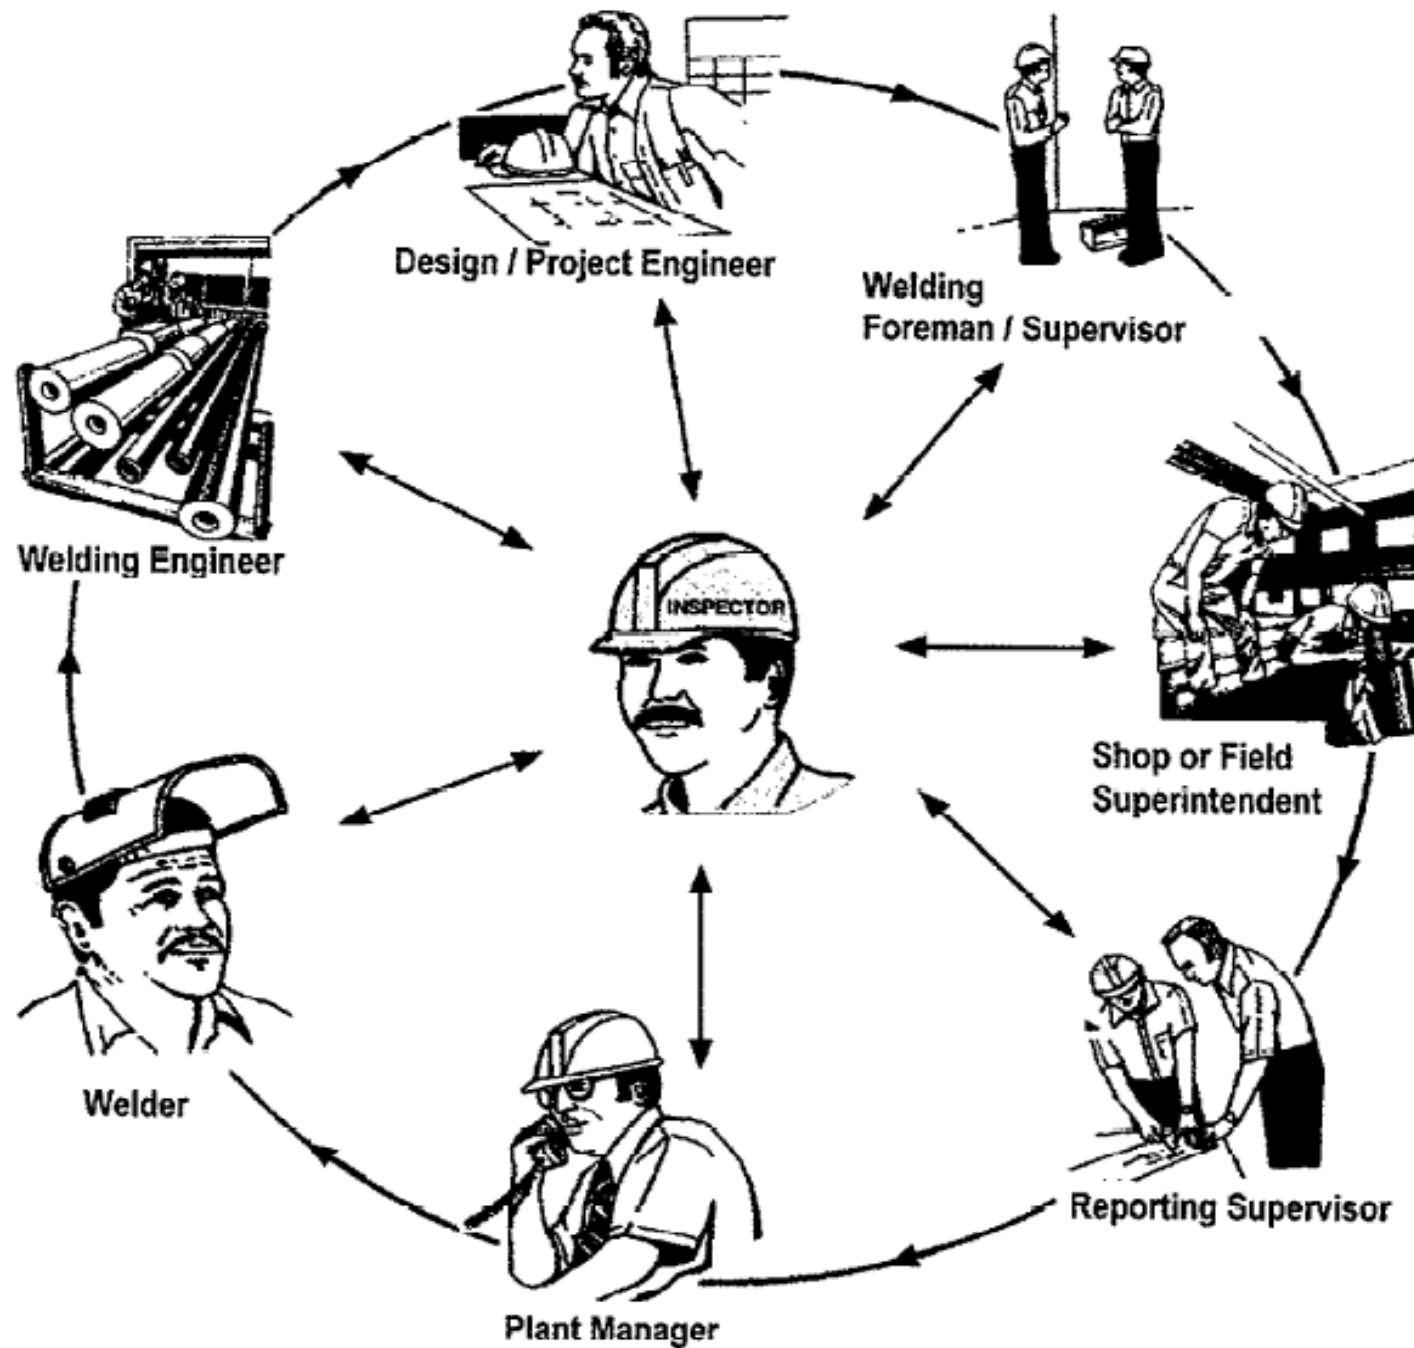

WELDING PROCESS





تعریف جوشکاری طبق استاندارد AWS



- ▶ مطابق استاندارد AWS جوش عبارت است از اتصال موضعی از فلزات و غیر فلزات به یکدیگر از طریق اعمال حرارت یا اعمال فشار با هر دو. بدون فلز پرکننده و با فلز پرکننده. در این میان نیز فاکتورهایی مانند منبع تولید انرژی جهت ایجاد حرارت و روش محافظت از حوضچه مذاب در برابر اتمسفر و فلز پر کننده از اهمیت ویژه ای برخوردار هستند.
- ▶ در تمام فرایندهای جوشکاری پارامترهای فوق مدنظر می باشد.


- ▶ داشتن اطلاعات کافي در مورد فرایندهای جوشکاری به بازرس جوش بسیار کمک می کند.
- ▶ باید بازرس جوش نسبت به فرایندهای و مزیت ها و معایب آن اطلاعات لازم را داشته باشد.
- ▶ بازرس جوش باید بداند که در هر فرایندی احتمال بروز چه عیبی وجود دارد و در هر فرایندی دنبال چه عیبی باید باشد .
- ▶ بازرس جوش باید تجهیزات جوشکاری را به صورت کامل بشناسد و زیرا بسیاری از عیوب ناشی از کارکرد نامناسب تجهیزات می باشد.

Flux Cored Arc Welding (FCAW)

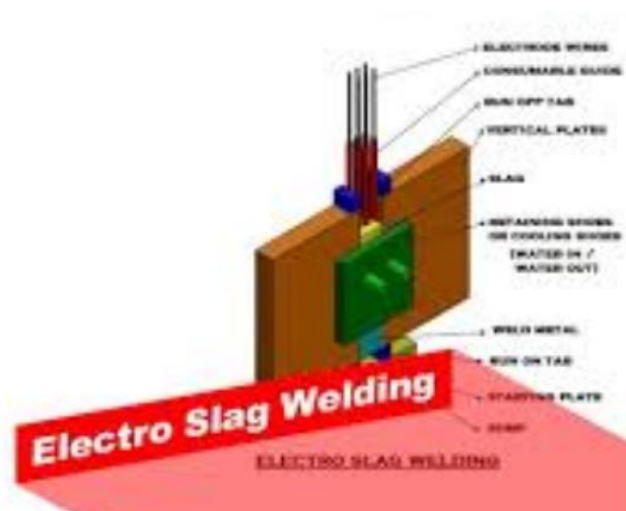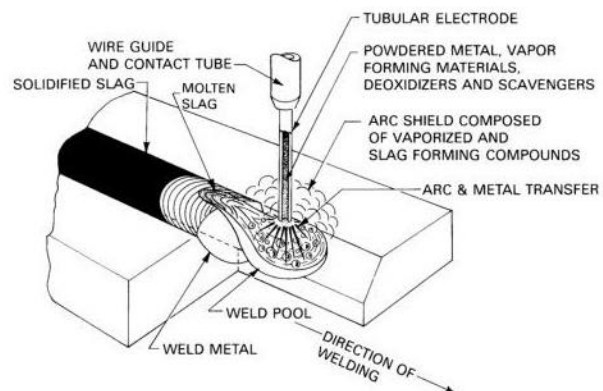



شرکت صنایع پتروشیمی سبلان

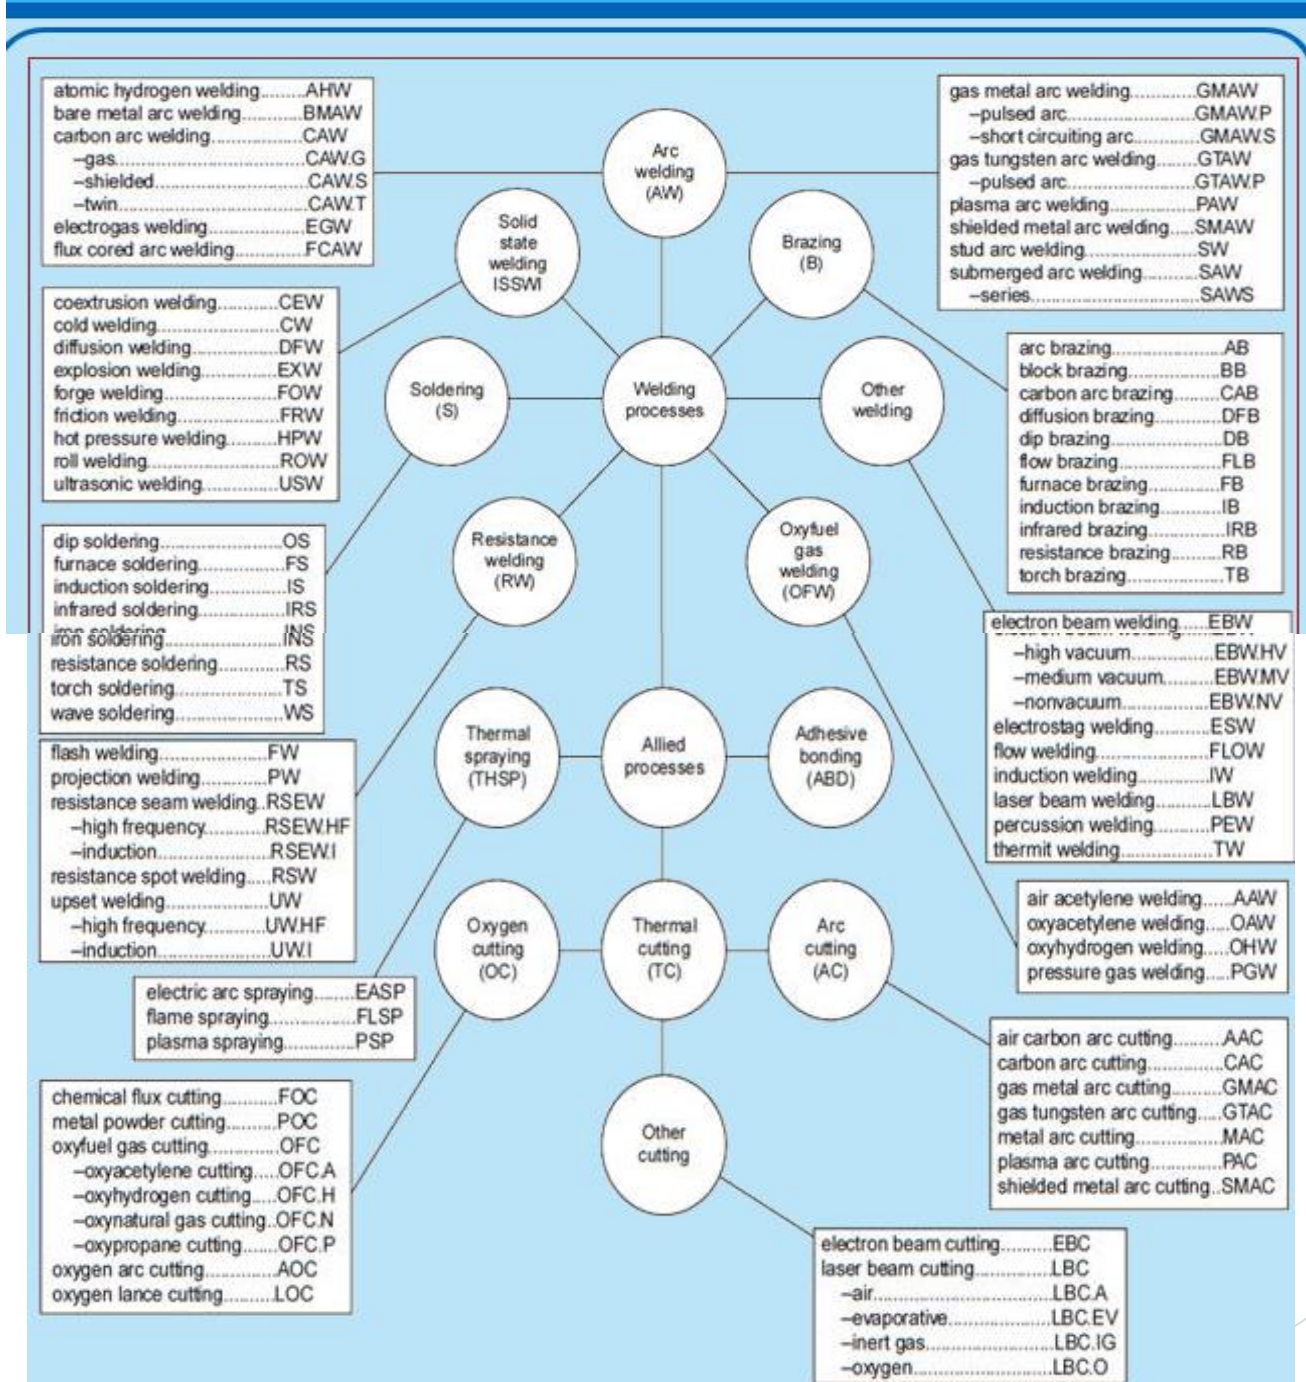



شرکت صنایع پتروشیمی سیلان

Welding Processes

- Shielded Metal Arc Welding
- Gas Metal Arc Welding
- Flux Cored Arc Welding
- Gas Tungsten Arc Welding
- Submerged Arc Welding
- Plasma Arc Welding
- Electroslag Welding
- Oxyacetylene Welding
- Stud Welding
- Laser Beam Welding
- Electron Beam Welding
- Resistance Welding

Brazing Processes

- Torch Brazing
- Furnace Brazing
- Induction Brazing
- Resistance Brazing
- Dip Brazing
- Infrared Brazing

Cutting Processes

- Oxyfuel Cutting
- Air Carbon Arc Cutting
- Plasma Arc Cutting
- Mechanical Cutting





- Consumable electrode
- Flux coated rod
- Flux produces protective gas around weld pool
- Slag keeps oxygen off weld bead during cooling

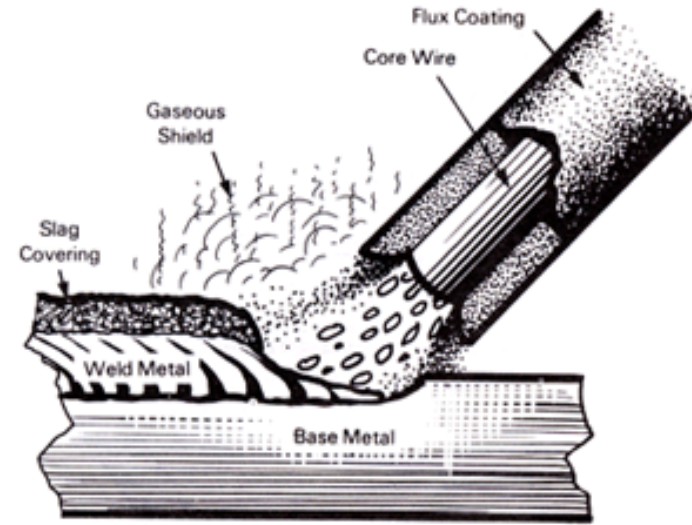


Fig. 6

- General purpose welding—widely used
- Thicknesses 1/8” – 3/4”
- Portable

Power... Current I (50 - 300 amps)
Voltage V (15 - 45 volts)

$$\text{Power} = VI \approx 10 \text{ kW}$$

Shielded Metal-Arc Welding

Figure 27.4 Schematic illustration of the shielded metal-arc welding process. About 50% of all large-scale industrial welding operations use this process.


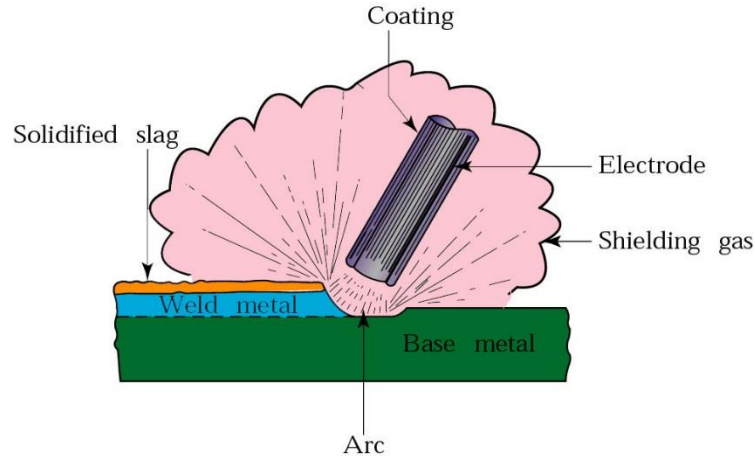



Figure 27.5 Schematic illustration of the shielded metal-arc welding operations (also known as stick welding, because the electrode is in the shape of a stick).



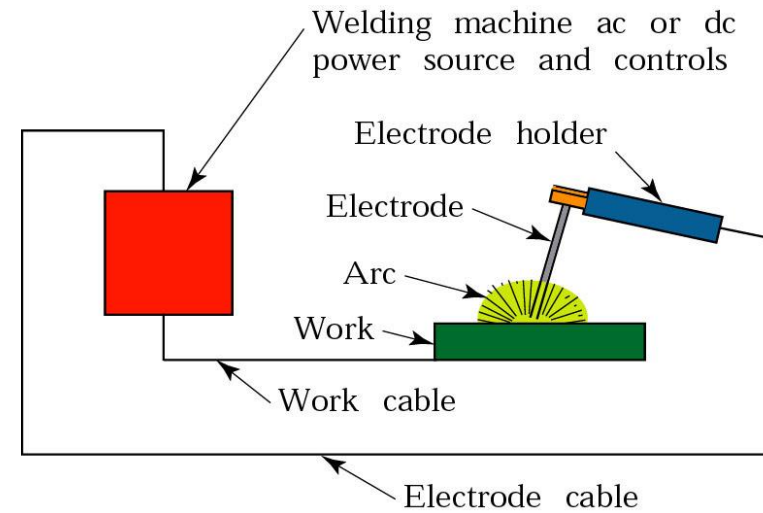


Multiple Pass Deep Weld

Figure 27.6 A deep weld showing the buildup sequence of individual weld beads.

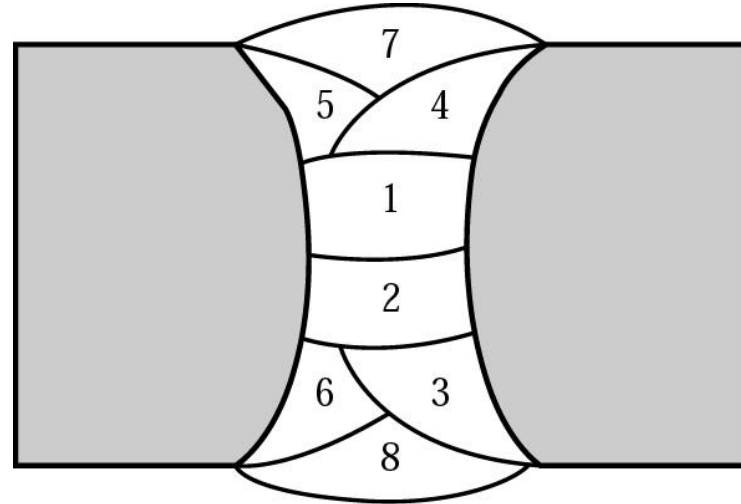

SHIELDED METAL ARC WELDING

- ▶ نام دیگر این فرایند STICK WELDING , MABUAL METAL ARC WELDING می باشد.
- ▶ در ابتدا یک قوس الکتریکی بین الکترود و قطعه کار به وجود می آید و این قوس انرژی لازم جهت رسیدن به نقطه ذوب را ایجاد میکند.
- ▶ پشت سر مذاب سرباره SLAG ایجاد شده و شروع به انجماد میکند.
- ▶ با توجه به سبکتر بودن سرباره نسبت به مذاب و پایین بودن نقطه ذوب کمتر آن سرباره روی سطح شناور شده و سپس منجمد میگردد.

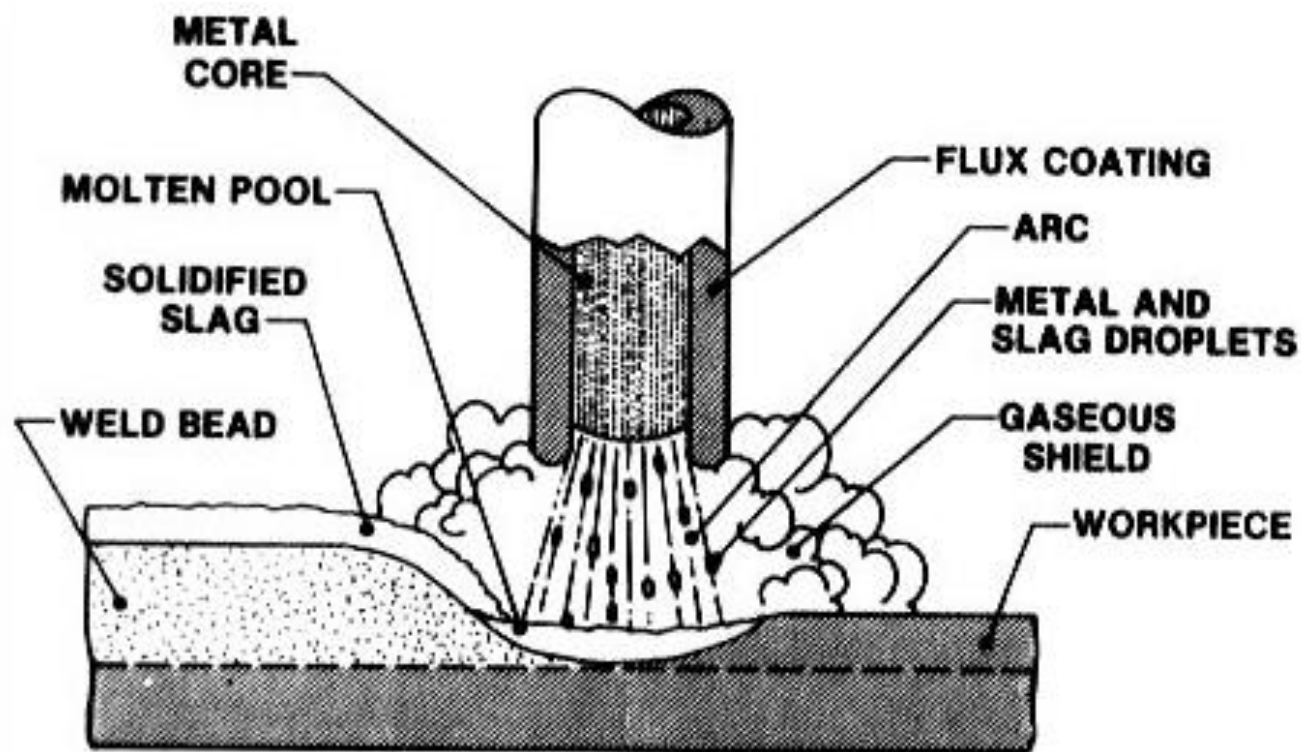

SHIELDED METAL ARC WELDING

- ▶ علاوه بر سرباره گاز محافظي نیز از مذاب محافظت مینماید که این گاز از قوس نیز محافظت مینماید.
- ▶ تمام الکترودهای مخصوص جوشکاری فولاد کربني و کم آلیاژ از مغزي فولاد یکسانی به دست آمده اند. این مغزي از جنس فولاد کم کربن اکسیژن زدایی نشده به دست آمده و بنابراین هر عنصر آلیاژی دیگری میتواند از طریق روکش الکتروود به حوضچه مذاب اضافه گردد.



SHIELDED METAL ARC WELDING



شرکت صنایع پتروشیمی سیلان

وظایف روپوش الكترود:

۱- محافظت : در اثر سوختن روپوش الكترود گازهاي محافظي جهت حفاظت از حوضچه به وجود مي آیند.

اکسیژن زدایی: از طریق انجام واکنش شیمیایی اکسیژن و سایر گازهای جذب شده در حوضچه مذاب را خارج میکند.

آلیاژ سازی: از طریق روکش الكترود عناصر آلیاژی متنوعی به حوضچه مذاب افزوده میگردد.

یونیزاسیون: عناصر موجود عملیات یونیزاسیون را بهبود میبخشد و شروع قوس و پایداری آن افزایش پیدا میکند.

عایق سازی: با توجه به پوشش جوش توسط سرباره عایق حرارتی بر روی جوش ایجاد شده و از سرد شدن جوش جلوگیری میگردد.



در استانداردهای مختلف ، روشهای متفاوتی برای نام گذاری الکترودها و فلزات پرکننده وجود دارد . در فرم WPS که بر اساس استاندارد ASME . Sec IX ارائه شده ، نام الکترودها بر اساس نام گذاری استاندارد AWS نوشته می شود. این نام گذاری در استاندارد ASME . Sec II . Part C نیز استفاده شده است.

به عنوان مثال ، برای الکترودهای فولاد کربنی روپوش دار که در SFA-5.1 ذکر شده اند ، فرم کلی نام الکترودها به صورت EXXXX می باشد. حرف E نشان دهنده و علامت الکتروداست. دو عدد بعد از حرف E نشان دهنده استحکام کششی فلز جوش بر مبنای KSi (کیلو پوند بر اینچ مربع) است . رقم سوم نشان دهنده وضعیت جوشکاری و رقم چهارم نشان دهنده کلاس روپوش الکترودها، نوع جریان الکتریکی و سایر خصوصیات پوشش می باشد.

وضعیت های جوشکاری	رقم سوم
جوشکاری در چهار وضعیت تخت ، افقی ، عمودی و سربالا امکان پذیر است .	1
جوشکاری در دو وضعیت تخت و افقی امکان پذیر است .	2
جوشکاری فقط در وضعیت تخت امکان پذیر است .	3



رقم چهارم	روپوش	نوع جریان برق (الف)
۰	پرسولوز، سدیم (ب) پراکسید آهن (ج)	جریان مستقیم قطب معکوس (ج) (د) متناوب یا مستقیم (ج) (د)
۱	پرسولوز، پتاسیم	متناوب یا مستقیم قطب معکوس
۲	پرتیتان، سدیم	متناوب یا مستقیم قطب معکوس
۳	پرتیتان ، پتاسیم	متناوب یا مستقیم (د)
۴	پودر آهن ، تیتانی	متناوب یا مستقیم (هـ)
۵	کم هیدروژن ، سدیم	مستقیم قطب معکوس
۶	کم هیدروژن ، پتاسیم	متناوب یا مستقیم قطب معکوس
۷	پودر آهن، اکسید آهن	متناوب یا مستقیم (د)
۸	پودر آهن ، کم هیدروژن	متناوب یا مستقیم قطب معکوس



Standard analysis of the important cover types (values in %)

cellulosic-type



cellulose		40 %
rutile	TiO ₂	20 %
quartz	SiO ₂	25 %
FeMn		15 %
waterglass		

no slag

drop transfer:
medium size drops

toughness values:
good

acid-type




magnetite	Fe ₃ O ₄	50 %
quartz	SiO ₂	20 %
lime stone	CaCO ₃	10 %
FeMn		20 %
waterglass		

solidification interval
of the slag: large

drop transfer:
fine size drops up to
spray typed

toughness values:
normal

rutile-type

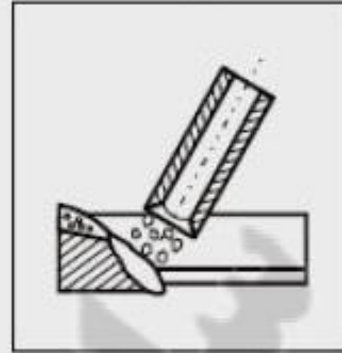


rutile	TiO ₂	45 %
magnetite	Fe ₃ O ₄	10 %
quartz	SiO ₂	20 %
lime stone	CaCO ₃	10 %
FeMn		15 %
waterglass		

solidification interval
of the slag: middle

drop transfer:
medium size drops up to
fine size drops

toughness values:
good

basic-type

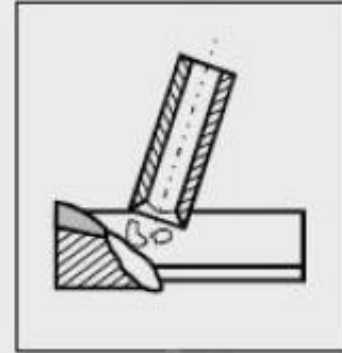

flour spar	CaF ₂	40 %
lime stone	CaCO ₃	20 %
quartz	SiO ₂	25 %
FeMn		15 %
waterglass		

solidification interval
of the slag: large

drop transfer:
medium size drops up to
large size drops

toughness values:
very good

F-No. Classification	Current	Arc	Penetration	Covering & Slag	Iron Powder
F-3 EXX10	DCEP	Digging	Deep	Cellulose-sodium	0-10%
F-3 EXXX1	AC & DCEP	Digging	Deep	Cellulose-potassium	0%
F-2 EXXX2	AC & DCEN	Medium	Medium	Rutile-sodium	0-10%
F-2 EXXX3	AC & DC	Light	Light	Rutile-potassium	0-10%
F-2 EXXX4	AC & DC	Light	Light	Rutile-iron powder	25-40%
F-4 EXXX5	DCEP	Medium	Medium	Low hydrogen-sodium	0%
F-4 EXXX6	AC or DCEP	Medium	Medium	Low hydrogen-potassium	0%
F-4 EXXX8	AC or DCEP	Medium	Medium	Low hydrogen-iron powder	25-45%
F-1 EXX20	AC or DC	Medium	Medium	Iron oxide-sodium	0%
F-1 EXX24	AC or DC	Light	Light	Rutile-iron powder	50%
F-1 EXX27	AC or DC	Medium	Medium	Iron oxide-iron powder	50%
F-1 EXX28	AC or DCEP	Medium	Medium	Low hydrogen-iron powder	50%

Note: Iron powder percentage is based on weight of the covering.



LOW ALLOY STEEL COATED ELECTRODES, CONT'D			
SUFFIX TABLE			
Suffix	Steel Alloy Type	Chemical Composition Weld Deposit	
-A1	Carbon-Molybdenum	0.40 - 0.65 Mo	
-B1	Chromium-Molybdenum	0.40 - 0.65 Cr	0.40 - 0.65 Mo
-B2	Chromium-Molybdenum	1.00 - 1.50 Cr	0.40 - 0.65 Mo
-B2L	Chromium-Molybdenum	Lower Carbon B2	
-B3	Chromium-Molybdenum	2.00 - 2.50 Cr	0.90 - 1.20 Mo
-B3L	Chromium-Molybdenum	Lower Carbon B3	
-B4L	Chromium-Molybdenum	1.75 - 2.25 Cr	0.40 - 0.65 Mo
-B5	Chromium-Molybdenum	0.40 - 0.60 Cr	1.00 - 1.25 Mo
-B6	Chromium-Molybdenum	4.5 - 6.0 Cr	0.40 - 0.65 Mo
-B6L	Chromium-Molybdenum	Lower Carbon B6	
-B7	Chromium-Molybdenum	6.0-8.0 Cr	0.40 - 0.65 Mo
-B7L	Chromium-Molybdenum	Lower Carbon B7	
-B8	Chromium-Molybdenum	8.0 - 10.5 Cr	0.8 - 1.2 Mo
-B8L	Chromium-Molybdenum	Lower Carbon B8	
-B9	Chromium-Molybdenum	8.0 - 10.5 Cr	0.85-1.20 Mo
-C1	Nickel Steel	2.00 - 2.75 Ni	
-C1L	Nickel Steel	Lower Carbon C1	
-C2	Nickel Steel	3.00 - 3.75 Ni	
-C2L	Nickel Steel	Lower Carbon C2	
-C3	Nickel Steel	0.80 - 1.10 Ni	
-C3L	Nickel Steel	Lower Carbon C3	
-NM	Nickel-Molybdenum	0.80 - 1.10 Ni	0.40 - 0.65 Mo
-D1	Manganese-Molybdenum	1.00 - 1.75 Mn	0.25 - 0.45 Mo
-D2	Manganese-Molybdenum	1.65 - 2.00 Mn	0.25 - 0.45 Mo
-D3	Manganese-Molybdenum	1.00 - 1.80 Mn	0.40 - 0.65 Mo
-W	Weathering Steel	Ni, Cr, Mo, Cu	
-G		No required chemistry	
-M	Military grade	May have more requirements	

بررسی حرارت ورودی



(a) Heat input [J/in. (J/mm)]

$$= \frac{\text{Voltage} \times \text{Amperage} \times 60}{\text{Travel Speed [in./min (mm/min)]}}$$

Since heat is a function of voltage, amperage, and time, it can be readily seen that a long arc length (32 volts \times 135 amps \times 60)/10 IPM = 25,920 J/in.) will result in more heat produced than a short arc length (22 volts \times 150 amps \times 60)/IPM = 19,800 J/in.).

- ▶ حرارت ورودی فاکتور مهمی از جهت کنترل حوضچه مذاب توسط طول قوس می باشد.
- ▶ زیرا با افزایش یا کاهش طول قوس میزان سیالیت کنترل می گردد.

trater.

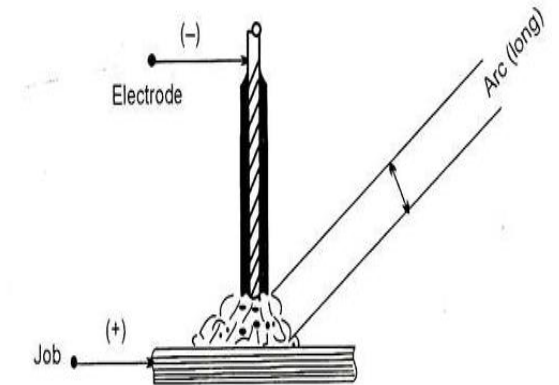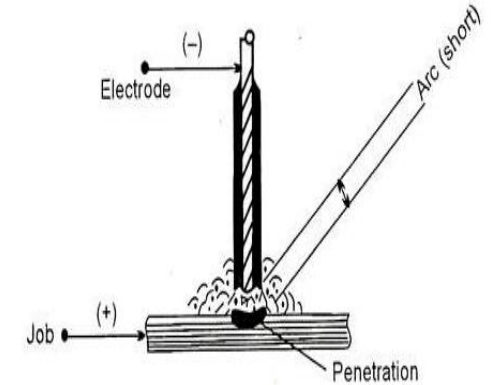


Short Arc and Long Arc





POLRITY IN SAMW


DC Straight polarity

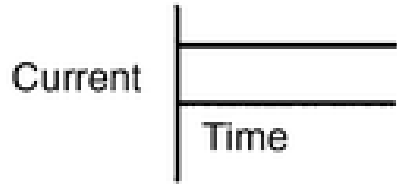


Deep penetration narrow weld

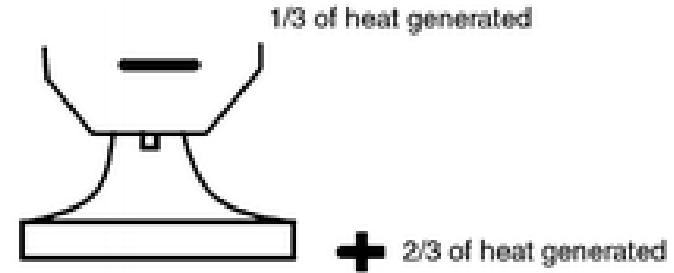 


DC Reverse polarity

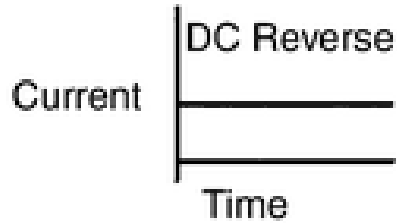



Shallow penetration wide weld

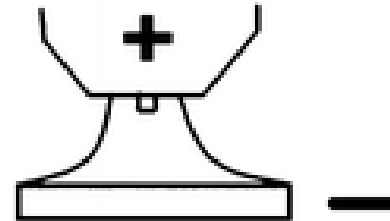

One complete cycle of AC

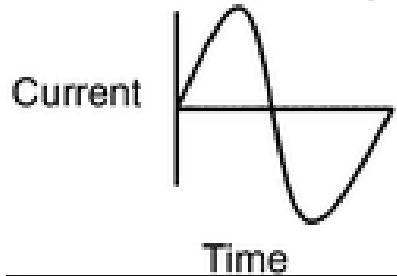


Deep penetration wide weld

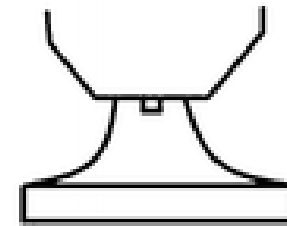 




KEY HOLE IN WELDING

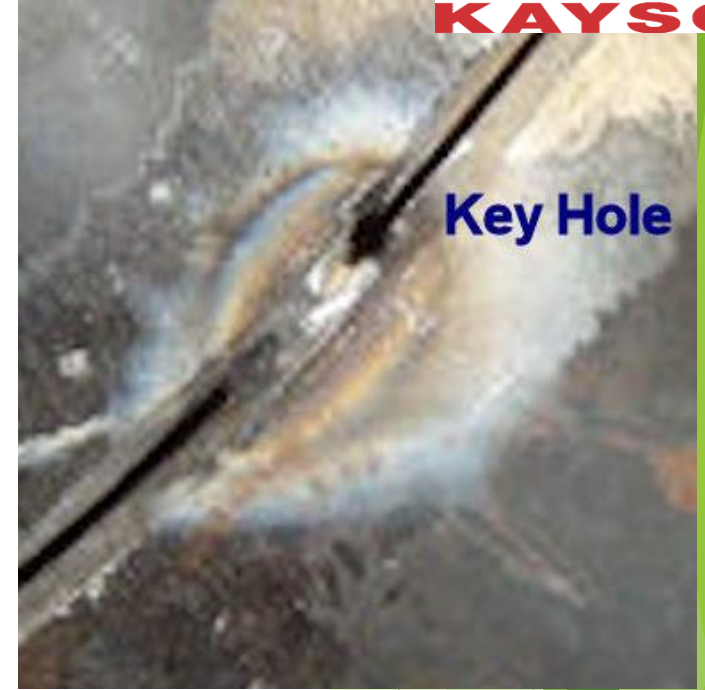

عیوب موجود در جوشکاری SMAW

▶ بروز حفره های گازی در جوش به دلیل حضور رطوبت و چربی و آلودگی در موضع جوش

▶ رطوبت از طریق روپوش الکتروود و اتمسفر اطراف محل جوشکاری و چربی های سطوح آلوده وارد میگردد.

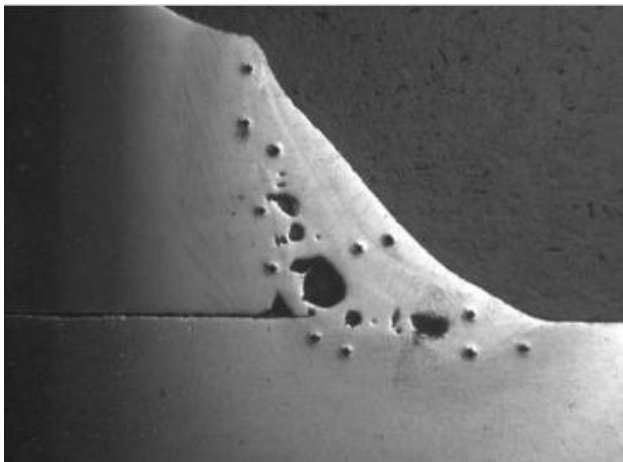

▶ بروز حفرات گازی به دلیل جوشکاری با طول قوس بلند.

▶ حفرات گازی به دلیل بروز ARC BLOW در جریان DC

▶ به دلیل وجود سرباره احتمال بروز حبس سرباره می باشد.

▶ با توجه به دستي بدون روش جوشکاری عیوب , UC , CRACK , LOP , LOF

BAD PROFILE





Slag inclusion





ARC BLOW


هرگاه جریان برق از یک هادی عبور کند و یک دسته از خطوط میدان مغناطیسی به صورت دایره های متحدالمرکز حول هادی به وجود آیند و در اثر بروز یک حوزه مغناطیس دیگر ، حوزه مغناطیس اولیه منحرف گردد.

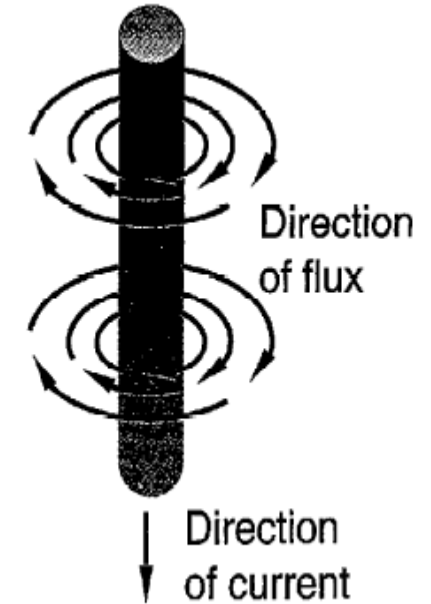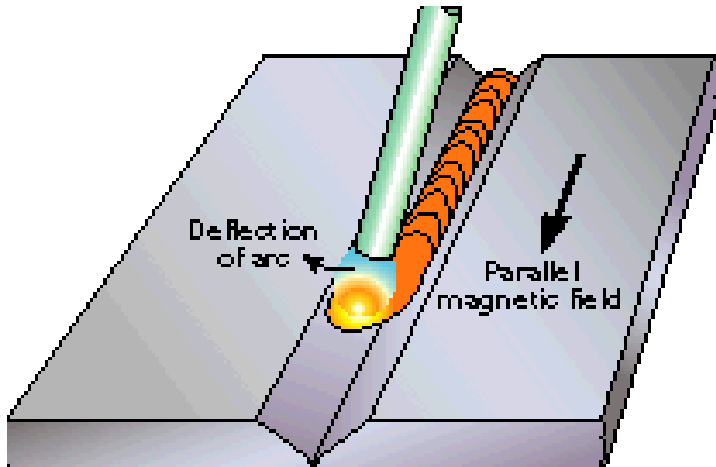



راههای رفع وزش قوس

- ▶ تغییر جریان از DC به AC
- ▶ به حداقل رساندن طول قوس
- ▶ کاهش آمپر جوشکاری
- ▶ متمایل کردن الکتروود به جهتی خلاف جهت وزش قوس
- ▶ استفاده از تکنیک یک گام به عقب
- ▶ جهت پیشرفت جوشکاری به سمت اتصال بدنه
- ▶ چرخاندن کابل دور قطعه تا اثر میدان مغناطیسی وزش قوس رفع گردد.

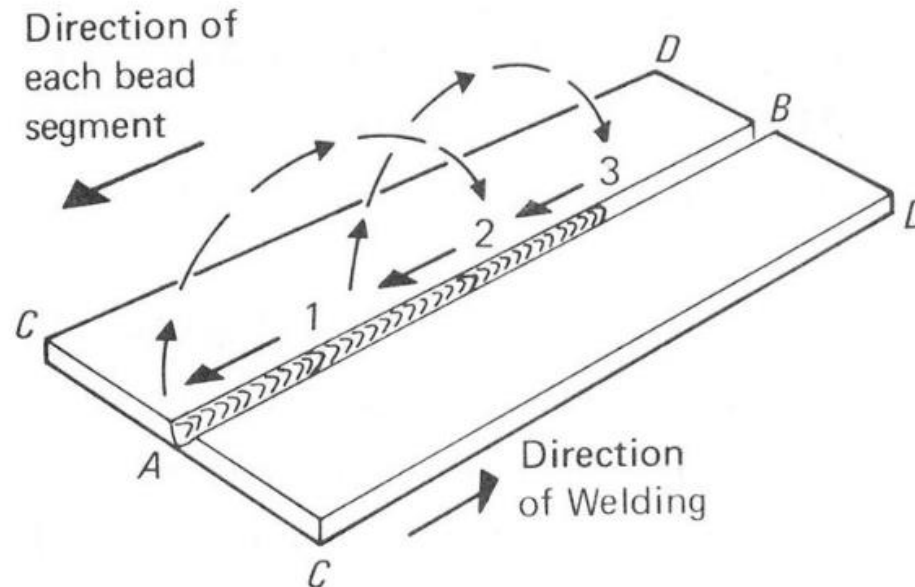



شرکت صنایع پتروشیمی سبلان





بازارهای سرمایه گذاری ICI

KAYSON SA




GMAW MIG/MAG

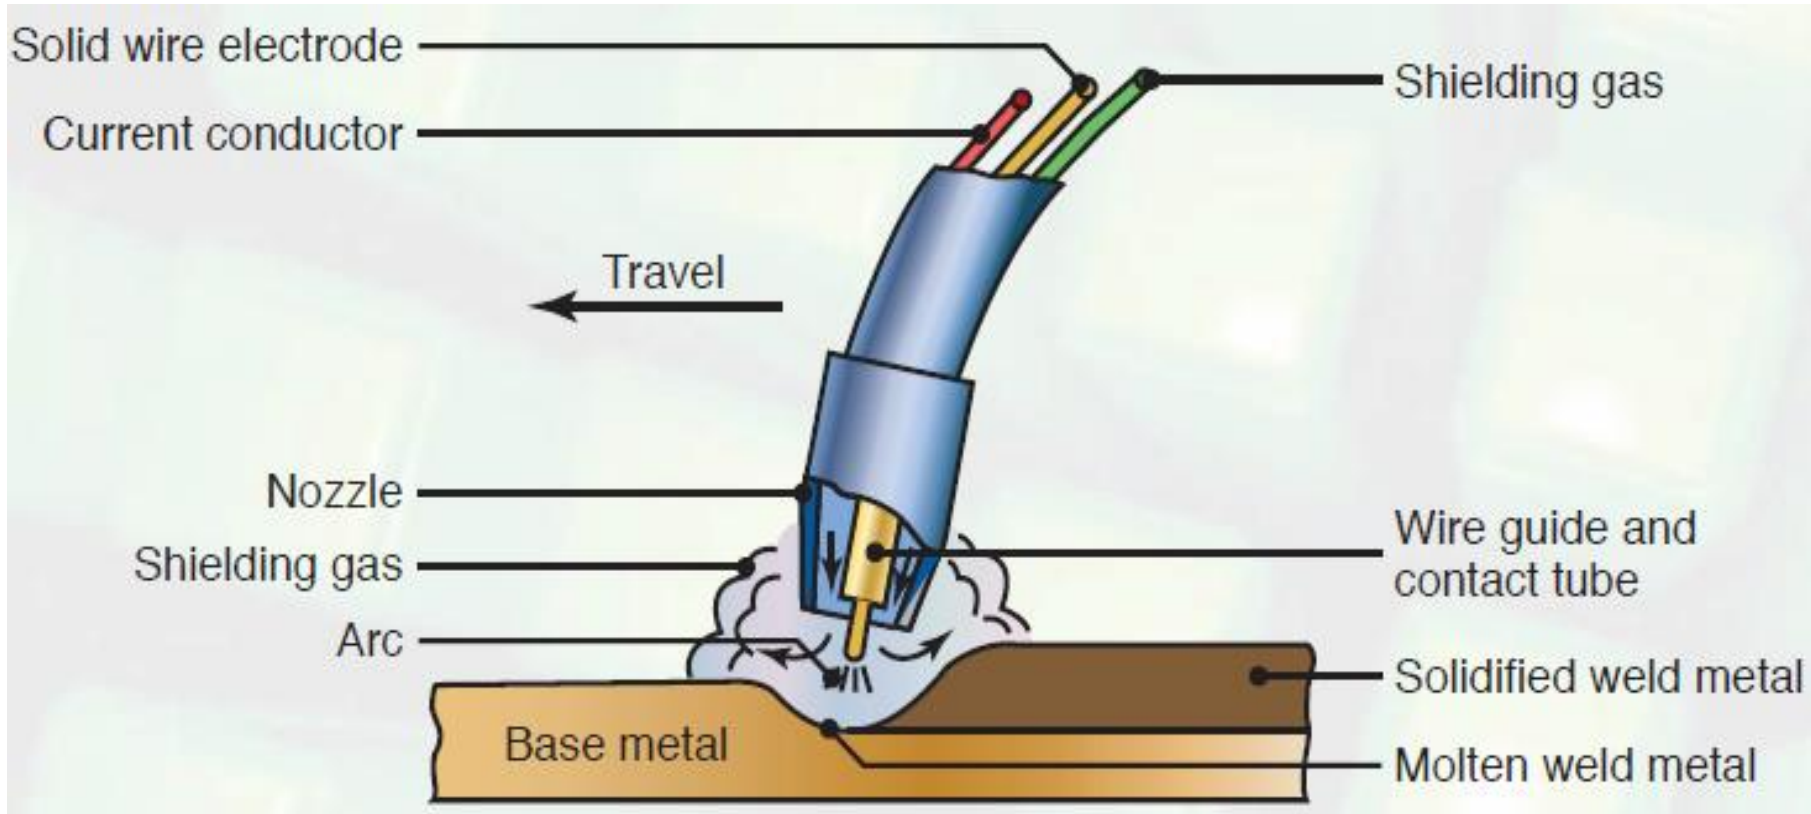

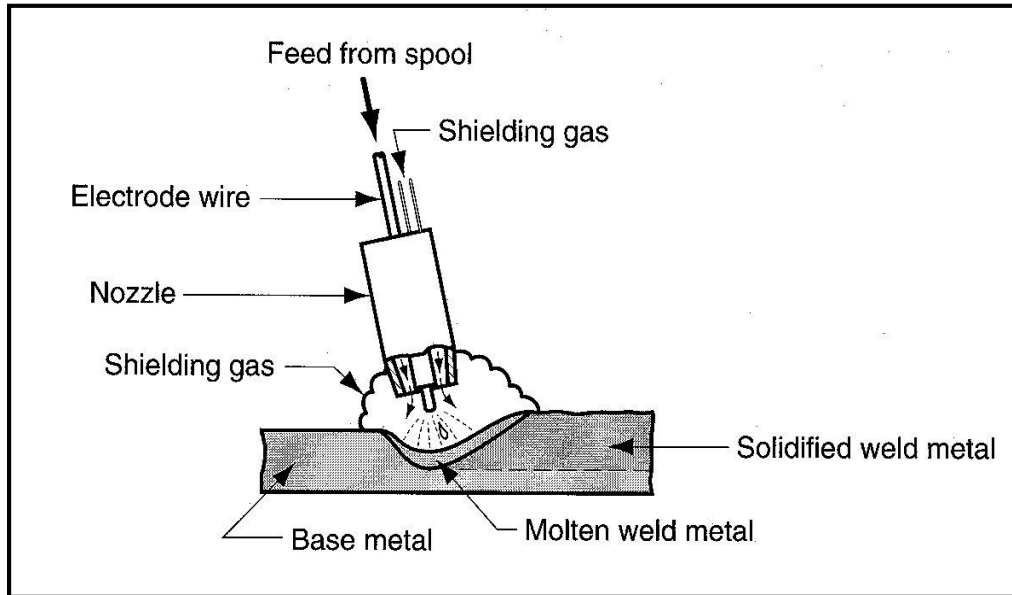

- MIG - Metal Inert Gas
- Consumable wire electrode
- Shielding provided by gas
- Double productivity of SMAW
- Easily automated

- DC reverse polarity - hottest arc
- AC - unstable arc

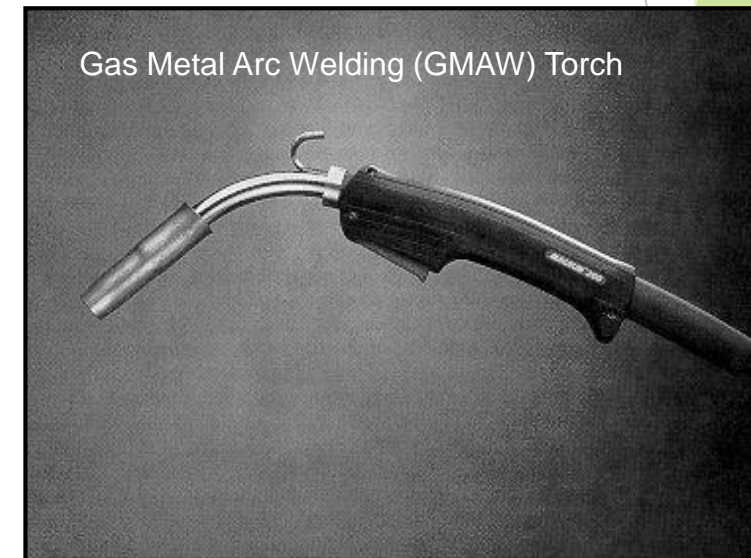



Gas Metal-Arc Welding



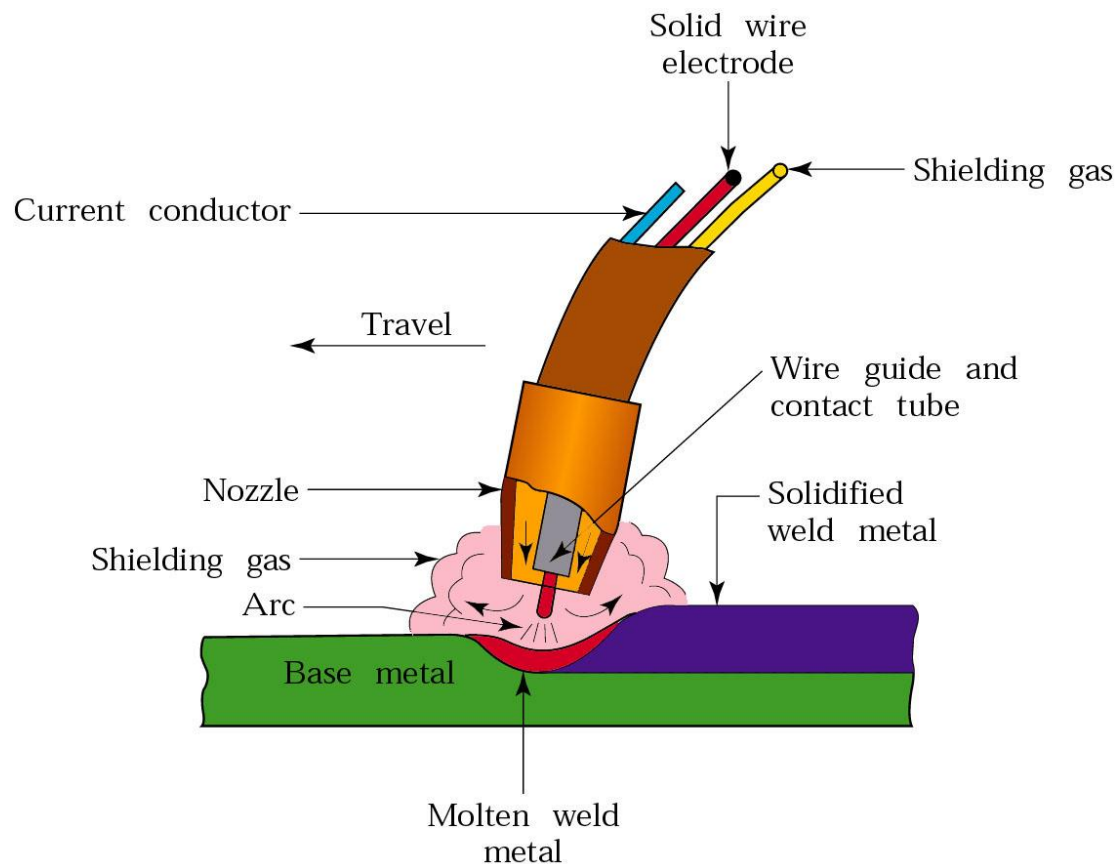


Figure 27.8
Schematic
illustration of the
gas metal-arc
welding process,
formerly known as
MIG (for metal inert
gas) welding.

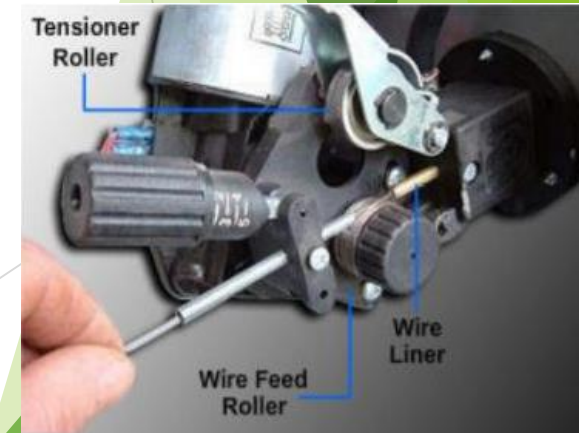


GMAW

- ▶ کاربرد این روش عموماً به صورت نیمه اتومات می باشد اما گاهی به صورت اتومات نیز استفاده می گردد.
- ▶ در این روش الکتروود از داخل یک کلاف سیم وارد درز جوش شده و تولید حرارت شده .
- ▶ قوس توسط یک گاز محافظ که از طریق تورچ به حوضچه مذاب هدایت میگردد ، محافظت می شود.
- ▶ در این فرایند از گازهای آرگن - هلیوم - اکسیژن استفاده میگردد.
- ▶ الکتروودهای این روش توسط حروف ER نشان داده میشوند.

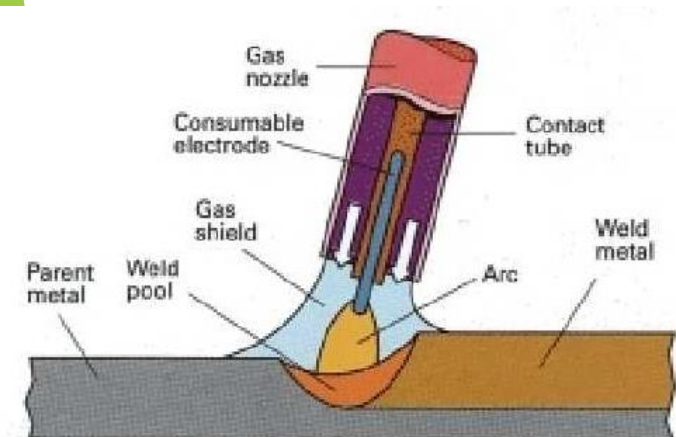



GMAW Torch Nozzle Cutaway Image

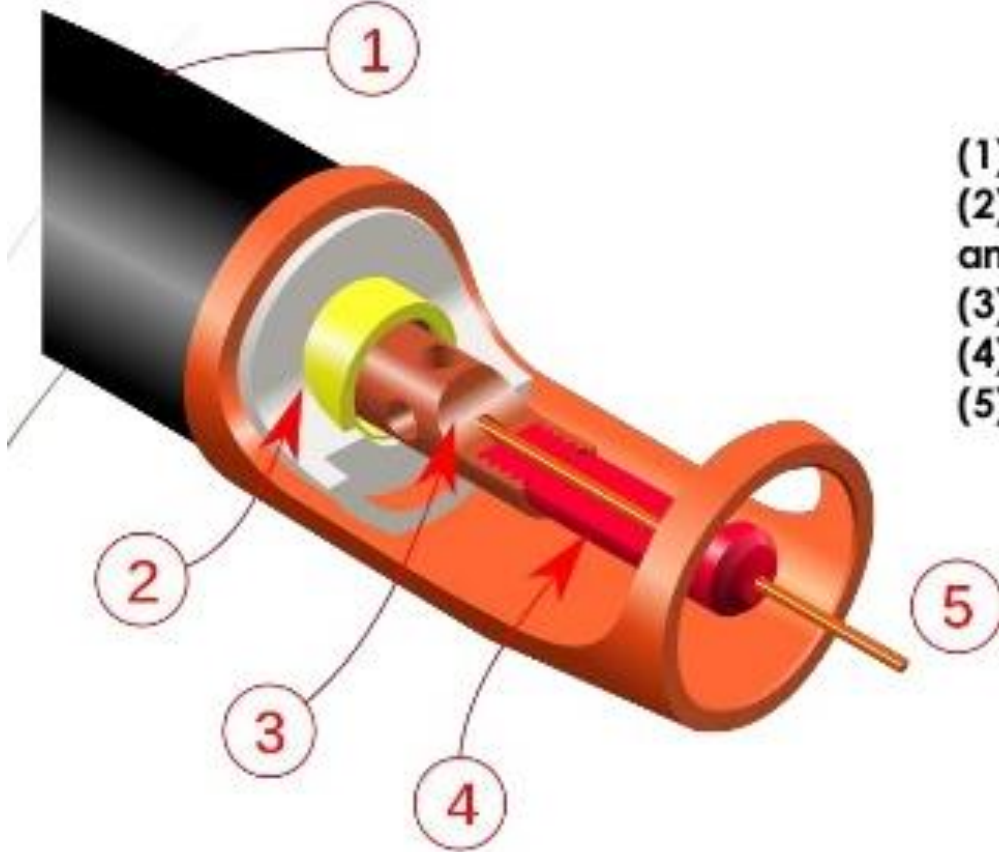

- (1) Torch handle
- (2) Molded phenolic dielectric (white) and threaded metal nut insert (yellow)
- (3) Shielding gas diffuser
- (4) Contact tip
- (5) Nozzle output face



ERXX-X



Designates use as either an electrode or rod (ER), or use only as an electrode (E).

Indicates in 1000 psi increments, the minimum tensile strength of the weld metal produced by the electrode when tested according to the A5.18 specification. In this case, 70 indicates 70 000 psi.

Indicates whether the filler metal is solid (S) or composite (C).

Indicates the chemical composition of a solid electrode or the chemical composition of the weld metal produced by a composite electrode. The use of the "GS" suffix designates filler metals intended for single pass applications only.

ER	70	S	-	X
E	70	C	-	X
ER	48	S	-	X
E	48	C	-	X



EFFECT OF GASES

Use of different shielding gases for gas metal arc welding.

Type of Gas	Typical Mixtures	Primary Uses
Argon		Non-ferrous metals
Helium		Aluminum, magnesium, and copper alloys
Carbon dioxide		Mild and low alloy steel
Argon-helium	20-80%	Aluminum, magnesium, copper and nickel alloys
Argon-oxygen	1-2% O ₂	Stainless steel
	3-5% O ₂	Mild and low alloy steels
Argon-carbon dioxide	20-50% CO ₂	Mild and low alloy steels
Helium-argon-carbon dioxide	90%He-7 1/2%Ar-2 1/2%CO ₂	Stainless steel
	60-70%He-25-35%Ar-5%CO ₂	Low alloy steels
Nitrogen		Copper alloys



GMAW

➤ به دلیل عدم استفاده از روپوش الکتروود نگهداری از این سیم بسیار حساس می باشد

➤ بهترین روش نگهداری در بسته بندی های اولیه می باشد.



➤ منبع قدرت در این روش به صورت CONSTANT VOLTAGE می باشد و الکتروود مثبت می باشد. DCEP.

➤ تجهیزات این روش نسبت به SMAW پیچیده تر می باشد.


➤ سیستم تغذیه الکتروود کپسول گاز و تورچ جوشکاری

➤ استفاده از سیستم CV باعث استفاده از شرایط خود تنظیمی می باشد.


➤ با تغییر در فاصله تورچ نسبت به قطعه کار طول قوس شدیداً اصلاح می گردد.

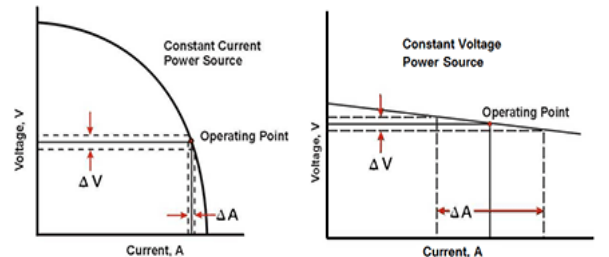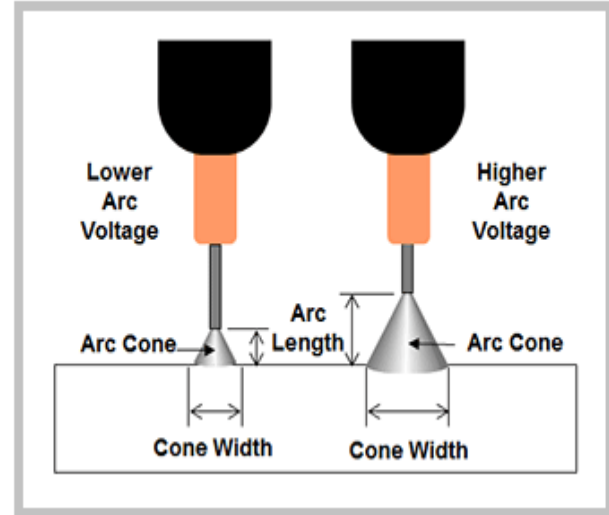

CONSTANT VOLTAGE AND CONSTANT CURRENT

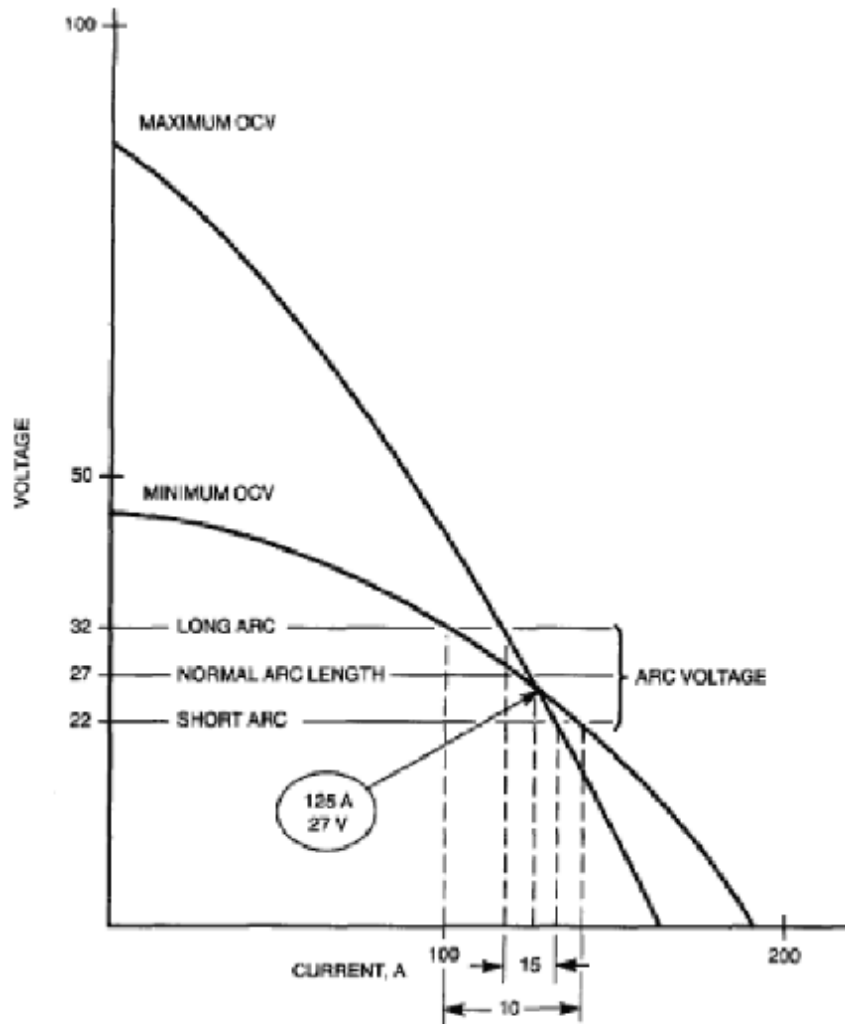

NOTE: LOWER SLOPE GIVES A GREATER CHANGE IN WELDING CURRENT FOR A GIVEN CHANGE IN ARC VOLTAGE.

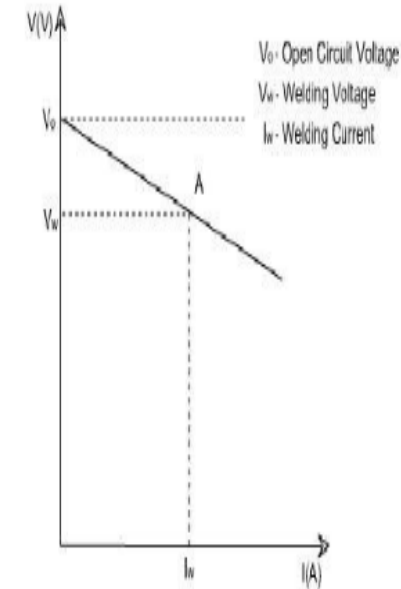

Constant Potential or Constant Voltage or Flat Characteristic.

Figure 5 demonstrates the constant voltage power source diagram, representing that a minimal but noticeable voltage decreases with current increases. This is the typical output used for DC SMAW, where weld pool is fed by wire form electrode. The system is self-regulating in automatic process if the wire is fed at constant speed. If the voltage decreases, that is torch is far away from the work, the feed and the current tends to increase.

When the current increases electrode melting rate also increases, restoring arc length and voltage near to the set point. In fact arc current is directly proportional to feed current. Power sources combination in a single unit is possible to design using electronic controls. Either constant current or constant voltage, depending on the welding process at hand. Single

انواع روش های انتقال مذاب



SHORT CIRCUIT اتصال کوتاه


GLOBULAR قطره ای

SPRAY اسپری یا پاششی

PULSE پالسی - ضربانی

مدل انتقال فلز به فاکتورهایی از قبیل میزان شدت جریان و ولتاژ و نوع گاز محافظ بستگی دارد.
اختلاف در مدل های فوق اختلاف در حرارت ورودی می باشد.



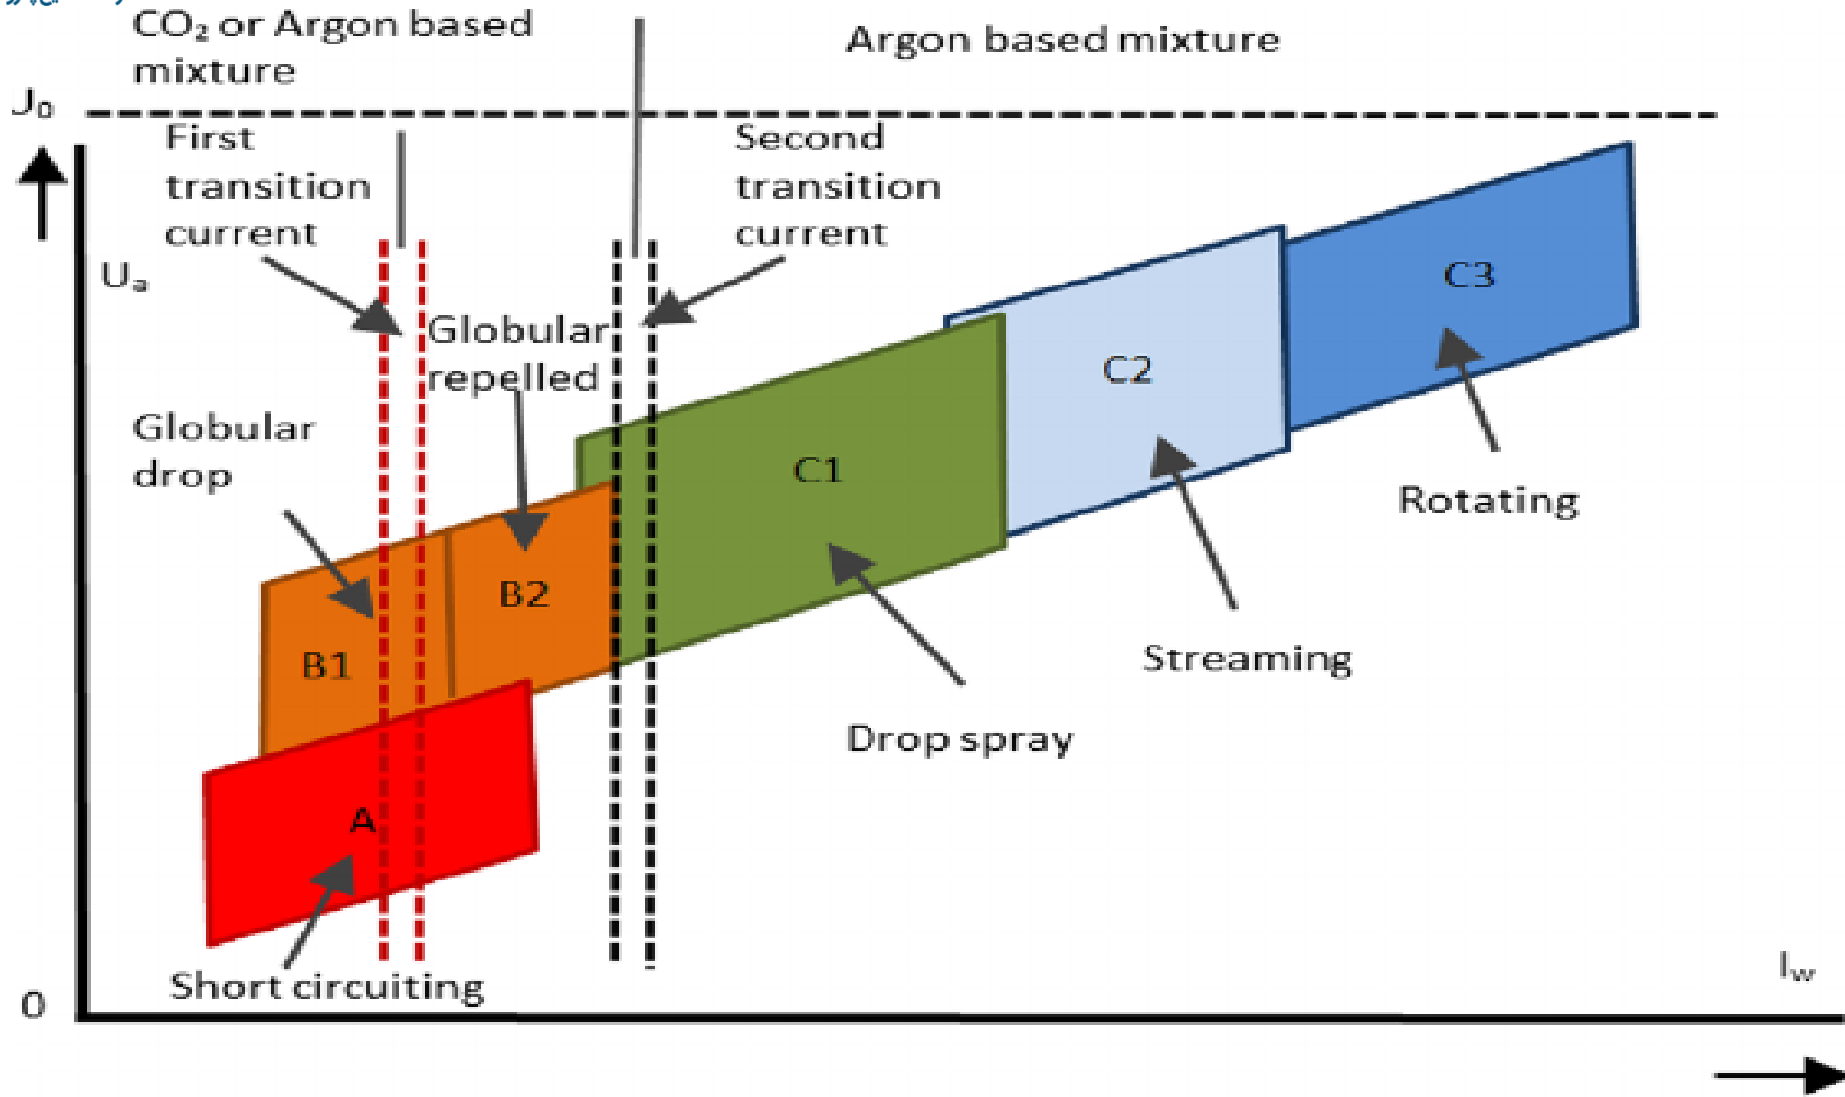



انواع روش های انتقال مذاب

ای مثال قوس اسپری بیشتر در حالت تخت و برای قطعات ضخیم کاربرد دارد.

▶ قوس قطره ای از پاشش زیادی برخوردار است و ثبات کمتری دارد.

▶ قوس پالسی فقط توسط دستگاههایی که مجهز به این سیستم هستند امکان پذیر میباشد. دو شدت جریان اصلی و پایه وجود دارد که باعث ایجاد ضربان می گردد.

▶ قوس کوتاه کمترین حرارت ورودی را ایجاد میکند بنابراین در جوشکاری ورق های نازک و گپ های زیاد استفاده می گردد. قوس کوتاه قطره مذاب قبل از جدا شدن کامل از سطح الکتروود حوضچه مذاب را لمس میکند. در تمام وضعیت ها قابل اجرا می باشد. در جوشکاری قطعات ضخیم عیب lof ایجاد میکند.



Kurzlichtbogen

Draht: SG2 1,2mm
Gas: 82% Ar + 18% CO₂

-0:02:51

GMAW

▶ این روش کاربرد وسیعی در جوشکاری فلزات آهنی و غیر آهنی دارد. با توجه به عدم وجود فلاکس در این روش امکان ورود هیدروژن به مذاب به حداقل می رسد. بنابراین یک روش کم هیدروژن می باشد.

▶ عدم نیاز به تمیز کاری و برداشتن سرباره از روی جوش


▶ امکان جوشکاری بدون توقف. کم شدن عیب CRATER CRACK

▶ حساس بودن روش به وزش باد و انحراف چتر گاز. بنابراین عدم استفاده در فضای باز.

▶ زیاد بودن فشار گاز باعث بروز اغتشاش در حوضچه مذاب می گردد.

عیوب موجود در فرایند GMAW

- ▶ POROSITY
- ▶ LACK OF FUSION ESPECIALLY SIDE WALL LACK OF FUSION
- ▶ LACK OF PENETRATION BECAUSE OF DESIGN
- ▶ SPATTER IN CO2 GAS

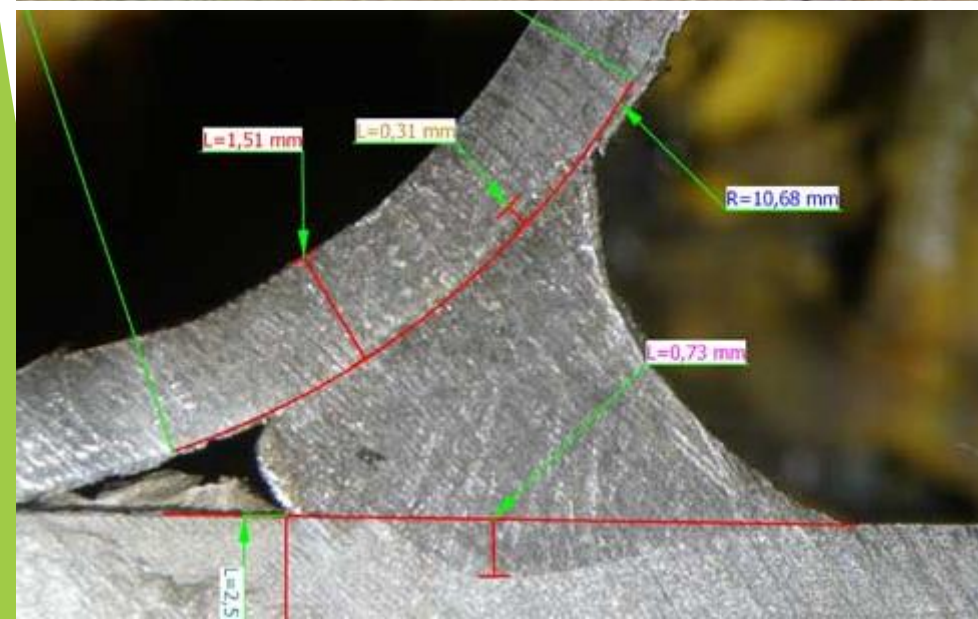




شرکت صنایع پتروشیمی سبلان



GTAW TIG - WIG

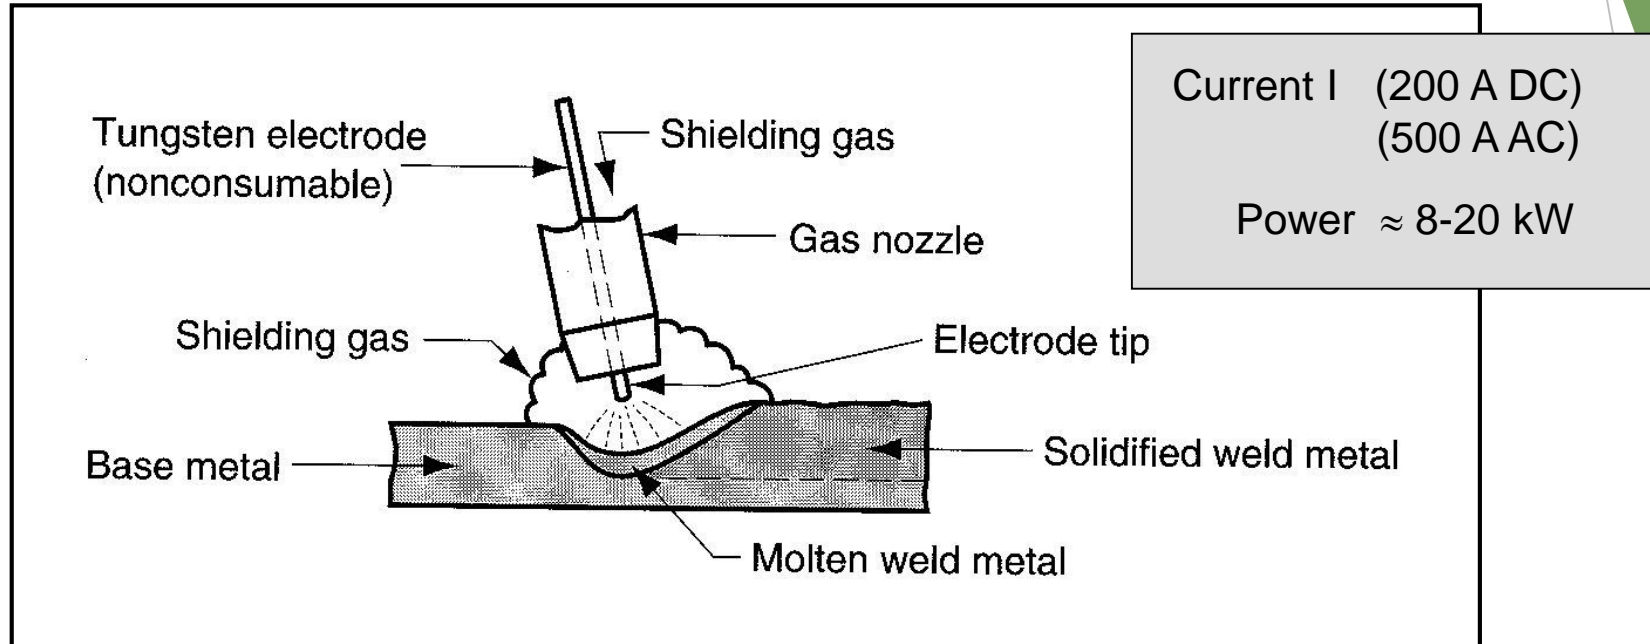

- a.k.a. TIG - Tungsten Inert Gas
- Non-consumable electrode
- With or without filler metal
- Shield gas usually argon
- Used for thin sections of Al, Mg, Ti.
- Most expensive, highest quality



Gas Tungsten-Arc Welding

Figure 27.13 The gas tungsten-arc welding process, formerly known as TIG (for tungsten inert gas) welding.



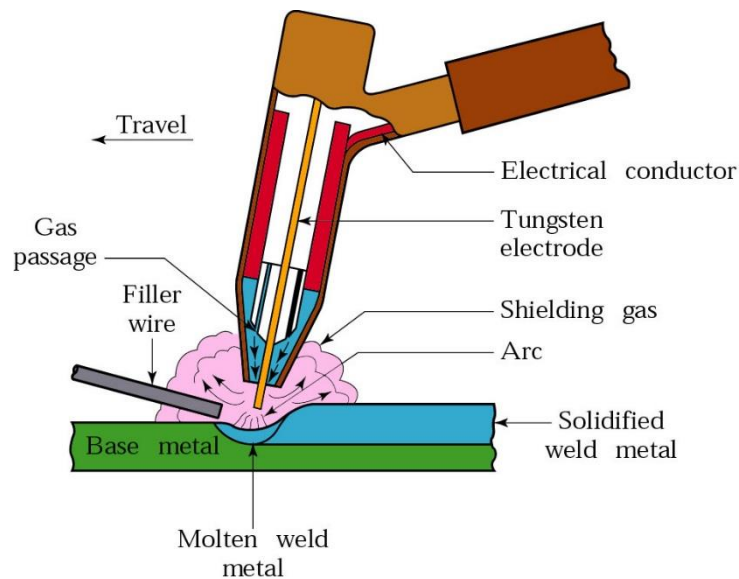


Figure 27.14 Equipment for gas tungsten-arc welding operations. *Source:* American Welding Society.

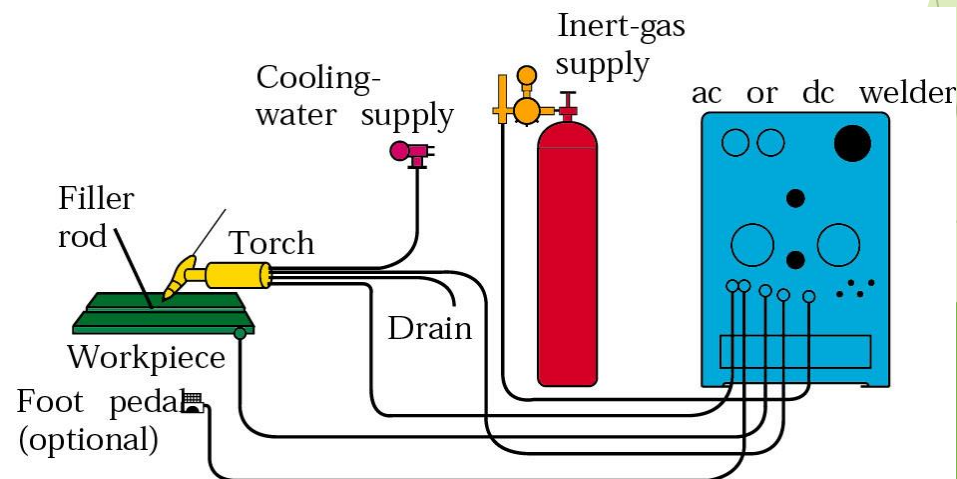

GTAW

- ▶ حرارت لازم در این روش در اثر تشکیل قوس بین الکترود غیر مصرفی از جنس تنگستن یا قطعه کار می باشد.
- ▶ به واسطه یک گاز محافظ که از طریق نازل گاز هدایت می گردد محافظت می شود.
- ▶ این جوش عاری از سرباره می باشد و نیاز به تمیزکاری ندارد.

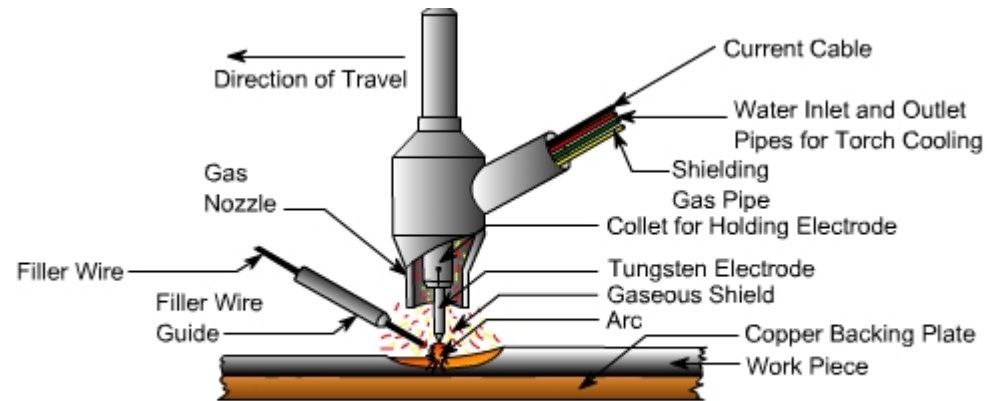



شرکت صنایع پتروشیمی سیلان

ASME SPECIFICATION

SFA 5.1 TO SFA5.34





Table QW-432
F-Numbers

Grouping of Electrodes and Welding Rods for Qualification

F-No.	ASME Specification	AWS Classification	UNS No.
Steel and Steel Alloys			
1	SFA-5.1	EXX20	...
1	SFA-5.1	EXX22	...
1	SFA-5.1	EXX24	...
1	SFA-5.1	EXX27	...
1	SFA-5.1	EXX28	...
1	SFA-5.4	EXXX(X)-26	...
1	SFA-5.5	EXX20-X	...
1	SFA-5.5	EXX27-X	...
2	SFA-5.1	EXX12	...
2	SFA-5.1	EXX13	...
2	SFA-5.1	EXX14	...
2	SFA-5.1	EXX19	...
2	SFA-5.5	E(X)XX13-X	...
3	SFA-5.1	EXX10	...
3	SFA-5.1	EXX11	...
3	SFA-5.5	E(X)XX10-X	...



AWS Filler Metal Specifications by Material and Welding Process

	OFW	SMAW	GTAW, GMAW, PAW	FCAW	SAW	ESW	EGW	BRAZING	THERMAL SPRAYING
Carbon Steel	A5.2	A5.1/A5.1M	A5.18/A5.18M	A5.20/A5.20M	A5.17/A5.17M	A5.25/A5.25M	A5.26/A5.26M	A5.8/A5.8M/A5.31	C2.25/C2.25M
Low-Alloy Steel	A5.2	A5.5	A5.28	A5.29	A5.23/A5.23M	A5.25/A5.25M	A5.26/A5.26M	A5.8/A5.8M/A5.31	C2.25/C2.25M
Stainless Steel		A5.4	A5.9/A5.22	A5.22	A5.9	A5.9	A5.9	A5.8/A5.8M/A5.31	C2.25/C2.25M
Cast Iron	A5.15	A5.15	A5.15	A5.15				A5.8/A5.8M/A5.31	
Nickel Alloys		A5.11/A5.11M	A5.14/A5.14M		A5.14/A5.14M			A5.8/A5.8M/A5.31	C2.25/C2.25M
Aluminum Alloys		A5.3/A5.3M	A5.10/A5.10M					A5.8/A5.8M/A5.31	C2.25/C2.25M
Copper Alloys		A5.6	A5.7					A5.8/A5.8M/A5.31	C2.25/C2.25M
Titanium Alloys			A5.16/A5.16M					A5.8/A5.8M/A5.31	
Zirconium Alloys			A5.24/A5.24M					A5.8/A5.8M/A5.31	
Magnesium Alloys			A5.19					A5.8/A5.8M/A5.31	
Tungsten Electrodes			A5.12/A5.12M						
Brazing Alloys and Fluxes								A5.8/A5.8M/A5.31	
Surfacing Alloys	A5.21	A5.13	A5.21	A5.21	A5.21				C2.25/C2.25M
Consumable Inserts			A5.30						
Shielding Gases			A5.32/A5.32M	A5.32/A5.32M			A5.32/A5.32M		
Ceramics									C2.25/C2.25M

شماره مشخصه	نوع فلز پر کننده
SFA-5.1	مشخصات الکترودهای فولاد کربنی برای جوشکاری قوس الکتروود روپوش دار SFA-5.1
SFA-5.2	مشخصات سیم جوش فولاد کربنی و کم آلیاژی برای جوشکاری با سوخت گاز (گاز (آکسیژن/تیلر))
SFA-5.3	مشخصات الکترودهای آلومینیومی و آلیاژهای آن برای جوشکاری قوس الکتروود روپوش دار
SFA-5.4	مشخصات الکترودهای فولاد زنگ نزن برای جوشکاری قوس الکتروود روپوش دار
SFA-5.5	مشخصات الکترودهای فولاد کم آلیاژی برای جوشکاری قوس الکتروود روپوش دار
SFA-5.6	مشخصات الکترودهای روپوش دار مسی و آلیاژهای مس برای جوشکاری قوسی
SFA-5.7	مشخصات الکتروود و سیم جوشهای بدون پوشش مسی و آلیاژهای مس
SFA-5.8	مشخصات فلزات پرکننده برای لحیم کاری سخت و لحیم جوشکاری
SFA-5.9	مشخصات الکتروود و سیم جوشهای بدون پوشش فولاد زنگ نزن
SFA-5.10	مشخصات الکتروود و سیم جوشهای بدون پوشش آلومینیومی و آلیاژهای آن
SFA-5.11	مشخصات الکترودهای نیکلی و آلیاژهای آن برای جوشکاری قوس الکتروود روپوش دار
SFA-5.12	مشخصات الکترودهای تنگستنی و آلیاژهای آن برای جوشکاری و برشکاری قوسی
SFA-5.13	مشخصات الکتروود و سیم جوشهای جوش روکش کاری (Solid Surfacing)
SFA-5.14	مشخصات الکتروود و سیم جوشهای بدون پوشش نیکلی و آلیاژهای آن
SFA-5.15	مشخصات الکتروود و سیم جوشها برای جوشکاری چدن
SFA-5.16	مشخصات الکتروود و سیم جوشهای تیتانیومی و آلیاژهای آن
SFA-5.17	مشخصات الکتروود و فلاکس های فولاد کربنی برای جوشکاری قوس-زیرپودری
SFA-5.18	مشخصات الکتروود و سیم جوشهای فولاد کربنی برای جوشکاری قوس فلزی یا گاز TIG
SFA-5.20	مشخصات الکترودهای فولاد کربنی برای جوشکاری قوس با الکتروود توپودری
SFA-5.21	مشخصات الکتروود و سیم جوشهای جوش روکش کاری مرکب (Composite Surfacing)
SFA-5.22	مشخصات الکترودهای فولاد زنگ نزن برای جوشکاری قوس با الکتروود توپودری و سیم جوشهای فولاد زنگ نزن برای جوشکاری قوس تنگستنی
SFA-5.23	مشخصات الکتروود و فلاکس های فولاد کم آلیاژی برای جوشکاری قوس-زیرپودری
SFA-5.24	مشخصات الکتروود و سیم جوشهای زیرکونیومی و آلیاژهای آن
SFA-5.25	مشخصات الکتروود و فلاکس های فولاد کربنی و کم آلیاژی برای جوشکاری سرباره الکتریکی
SFA-5.26	مشخصات الکترودهای فولاد کربنی و کم آلیاژی برای جوشکاری گاز الکتریکی
SFA-5.28	مشخصات الکتروود و سیم جوشهای فولاد کم آلیاژی برای جوشکاری قوس فلزی با گاز
SFA-5.29	مشخصات الکترودهای فولاد کم آلیاژی برای جوشکاری قوس با الکتروود توپودری
SFA-5.30	مشخصات لایه های مصرف شدنی



جدول کدهای الیازی انواع الکتروود تنگستن

طبقه بندی AWS	رنگ ^a	اجزای الیازی	اکسید الیازی	وزن اسمی اکسید الیازی (%)
EWP	سیز	-	-	-
EWCe-۲	تارنجی	سرم	CeO _۲	۲
EWLa-۱	مشکی	لانتانیم	La _۲ O _۳	۱
EWTh-۱	زره	توریم	ThO _۲	۱
EWTh-۲	قرمز	توریم	ThO _۲	۲
EWZr-۱	قهوه ای	زیرکیم	ZrO _۲	۱۲.۵
EWG	خاکستری	نامشخص ^b	-	-

a- رنگها به شیوه‌های مختلف مثل نوار، نقطه و... روی الکتروود مشخص می‌شوند.

b- سازنده باید نوع و مقدار عناصر افزوده را مشخص کند.





ترکیب گازهای محافظ GTAW

Table 4 AWS Classification for Typical Gas Mixtures		
AWS Classification	Typical Gas Mixtures (%)	Gas
SG-AC-25	75/25	Argon + Carbon Dioxide
SG-AO-2	98/2	Argon + Oxygen
SG-AHe-10	90/10	Argon + Helium
SG-AH-5	95/5	Argon + Hydrogen
SG-HeA-25	75/25	Helium + Argon
SG-HeAC-7.5/2.5	90/7.5/2.5	Helium + Argon + Carbon Dioxide
SG-ACO-8/2	90/8/2	Argon + Carbon Dioxide + Oxygen
SG-A-G	Special	Argon + Mixture

SG: SHIELD GAS
Source: AWS A5.32



FIG. 1 CLASSIFICATION SYSTEM FOR A SINGLE GAS

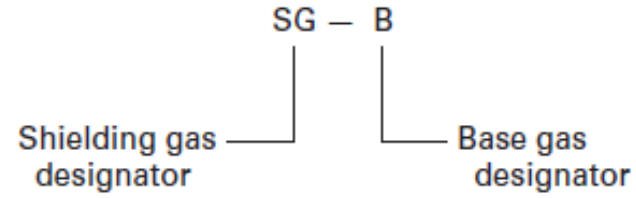


FIG. 2 CLASSIFICATION SYSTEM FOR MULTICOMPONENT SHIELDING GASES


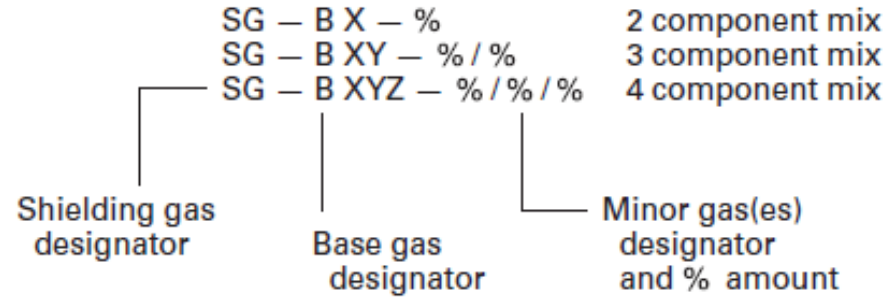


FIG. 3 CLASSIFICATION SYSTEM FOR SPECIAL MULTICOMPONENT SHIELDING GASES






GTAW

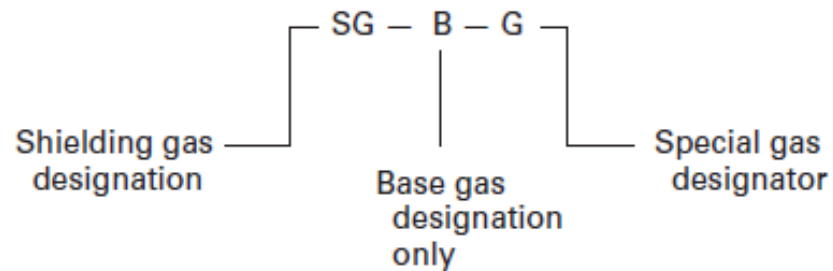

- ▶ حضور عناصری از قبیل توریوم یا زیرکونیوم در الکتروود تنگستن سبب سهولت خروج الکترونها از نوک الکتروود میگردد. سهولت در شروع قوس و پایداری قوس
- ▶ الکتروودهای تنگستن خالص EWP به دلیل قابلیت کروی شدن با اعمال حرارت برای جوشکاری آلومنیوم استفاده میگردد.
- ▶ با توجه به جوشکاری آلومنیوم توسط فرایند AC و توزیع ۵۰ درصدی حرارت در الکتروود کروی شدن نوک الکتروود باعث کاهش تمرکز تنش می گردد.
- ▶ جریان DCEN تقریباً برای همه فلزات غیر از MG , AL قابل استفاده است.
- ▶ گازهای خنثی با فلز ترکیب نمیشوند و فقط جهت محافظت از حوضچه می باشند.
- ▶ آرگن و هلیوم دو گاز پرکاربرد در این فرایند می باشند.
- ▶ اگر فولاد ضد زنگ جوشکاری شود مقداری هیدروژن نیز اضافه می گردد.

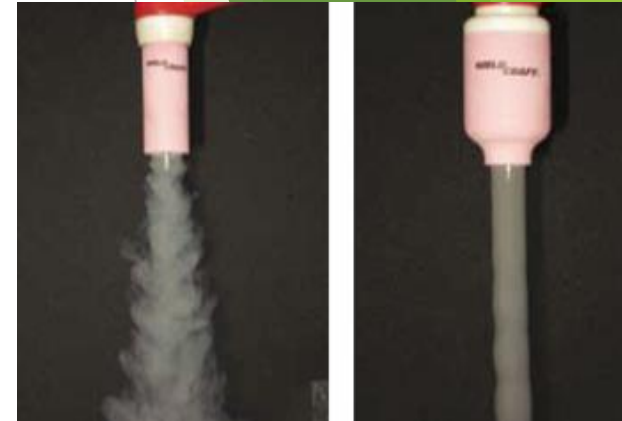



Made with VIDEORAMA





GTAW

- ▶ امکان جوشکاری از این فرایند برای ورق های زیر ۱ میل با قوس پایدار
- ▶ کیفیت بالا . ظاهر مناسب . عدم نیاز به تمیزکاری نهایی . عدم جوشکاری فلزات رنگین مانند تیتانیوم منیزیم
- ▶ امکان اجرای آن بدون فلز پرکننده.
- ▶ حساسیت این روش به تمیزکاری اولیه
- ▶ وابستگی شدید این روش به مهارت اپراتور





شرکت صنایع پتروشیمی سبلان





شرکت صنایع پتروشیمی سیلان

DEFECT IN GTAW

- ▶ TUNGESTAN INCLUSION
- ▶ UNDER CUT








- Consumable wire electrode
- Shielding provided by flux granules
- Low UV radiation & fumes
- Flux acts as thermal insulator
- Automated process (limited to flats)
- High speed & quality (4 – 10x SMAW)
- Suitable for thick plates

- 300 – 2000 amps (440 V)

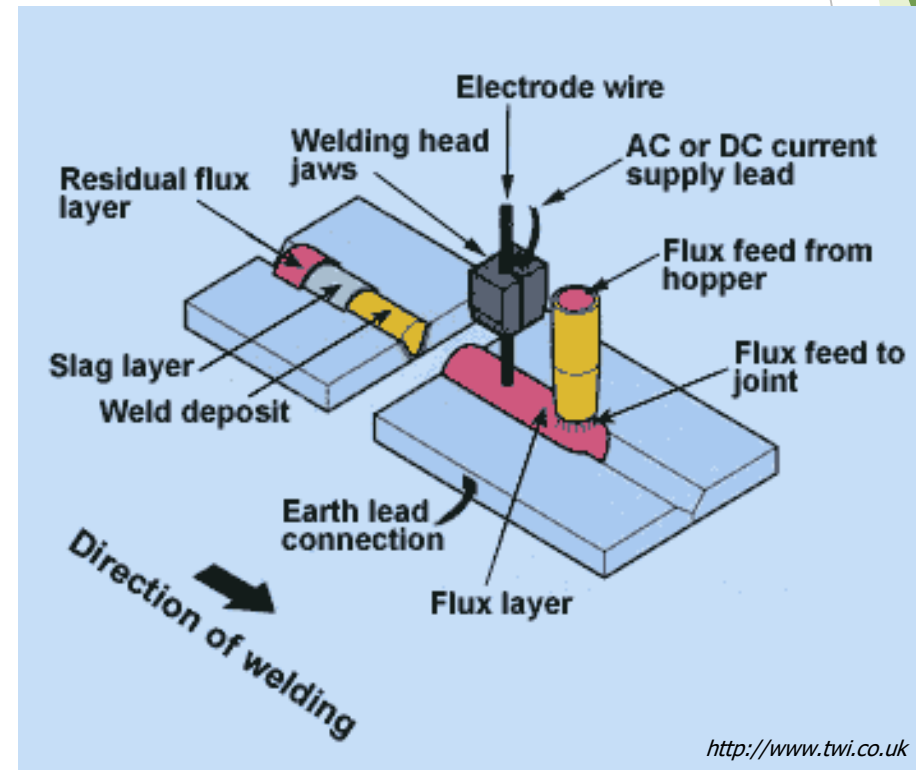

Submerged-Arc Welding

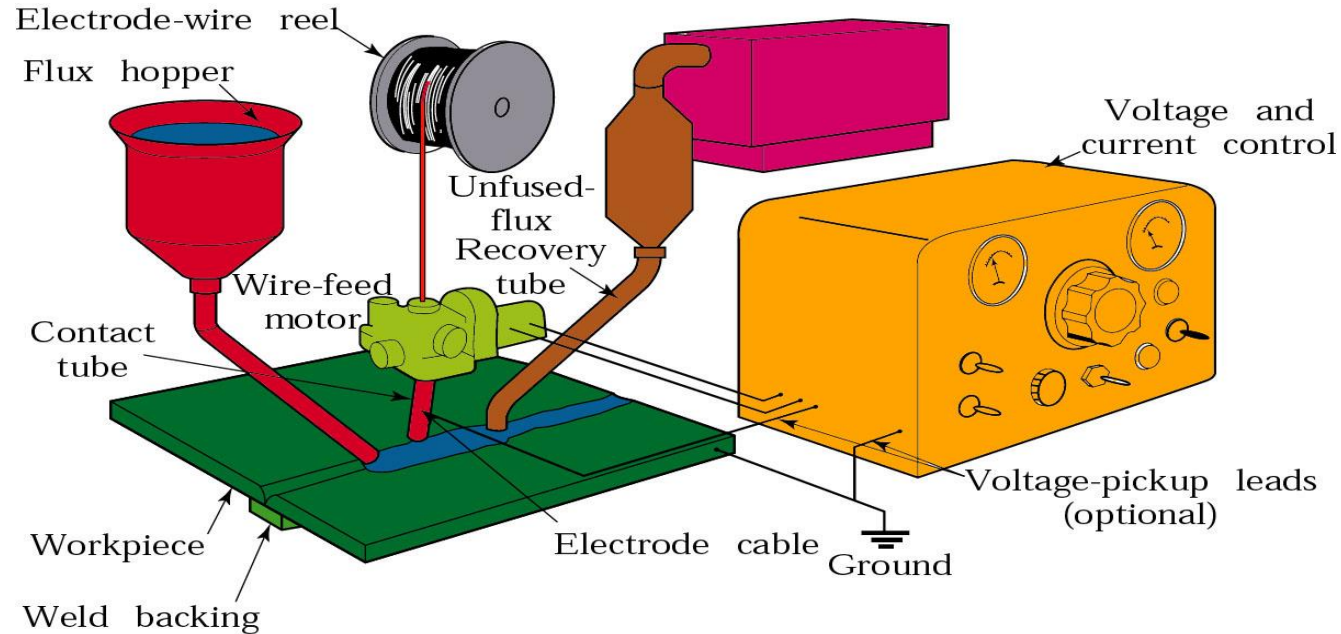


Figure 27.7 Schematic illustration of the submerged-arc welding process and equipment. The unfused flux is recovered and reused. *Source:* American Welding Society.

جوشکاری زیر پودری


▶ در این فرایند حرارت لازم جهت ذوب از طریق قوس الکتریکی بین الکترود کلافی و قطعه کار به وجود می آید.

▶ این فرایند بیشترین نرخ رسوب را دارد نسبت به فرایندهای دیگر.

▶ در این فرایند پودر از طریق نازل مخصوص به جلوی الکترود هدایت میشود.

▶ همزمان با حرکت تراک و انجام عملیات جوشکاری یک لایه از سرباره جدا شده و مقداری از پودر بر روی آن باقی میماند و عموماً قابل استفاده مجدد می باشد.

▶ طبقه بندی پودرها در استاندارد AWS SFA5.17 می باشد.

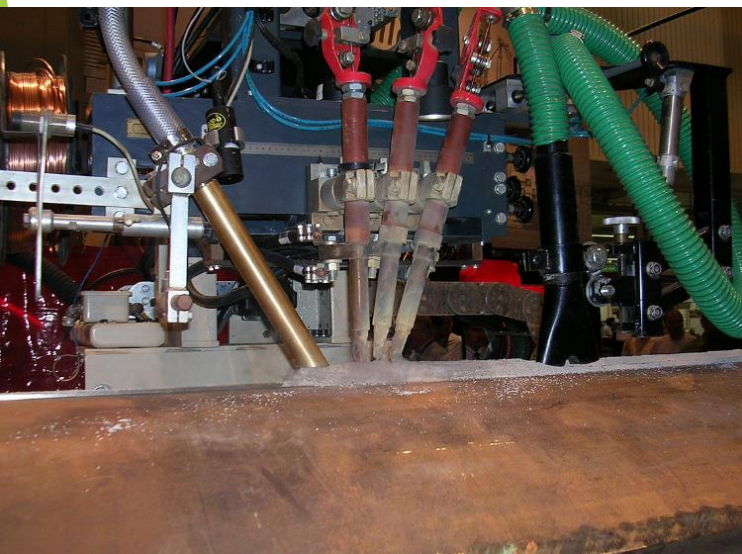

شماره مشخصه	نوع فلز پر کننده
SFA-5.1	مشخصات الکترودهای فولاد کربنی برای جوشکاری قوس الکتروود روپوش دار
SFA-5.2	مشخصات سیم جوش فولاد کربنی و کم آلیاژی برای جوشکاری با سوخت گاز (آکسی-تیلنج)
SFA-5.3	مشخصات الکترودهای آلومینیومی و آلیاژهای آن برای جوشکاری قوس الکتروود روپوش دار
SFA-5.4	مشخصات الکترودهای فولاد زنگ نزن برای جوشکاری قوس الکتروود روپوش دار
SFA-5.5	مشخصات الکترودهای فولاد کم آلیاژی برای جوشکاری قوس الکتروود روپوش دار
SFA-5.6	مشخصات الکترودهای روپوش دار مسی و آلیاژهای مس برای جوشکاری قوسی
SFA-5.7	مشخصات الکتروود و سیم جوشهای بدون پوشش مسی و آلیاژهای مس
SFA-5.8	مشخصات فلزات پرکننده برای لحیم کاری سخت و لحیم جوشکاری
SFA-5.9	مشخصات الکتروود و سیم جوشهای بدون پوشش فولاد زنگ نزن
SFA-5.10	مشخصات الکتروود و سیم جوشهای بدون پوشش آلومینیومی و آلیاژهای آن
SFA-5.11	مشخصات الکترودهای نیکلی و آلیاژهای آن برای جوشکاری قوس الکتروود روپوش دار
SFA-5.12	مشخصات الکترودهای تنگستنی و آلیاژهای آن برای جوشکاری و برشکاری قوسی
SFA-5.13	مشخصات الکتروود و سیم جوشهای جوش روکش کاری (Solid Surfacing)
SFA-5.14	مشخصات الکتروود و سیم جوشهای بدون پوشش نیکلی و آلیاژهای آن
SFA-5.15	مشخصات الکتروود و سیم جوشها برای جوشکاری چدن
SFA-5.16	مشخصات الکتروود و سیم جوشهای تیتانیومی و آلیاژهای آن
SFA-5.17	مشخصات الکتروود و فلاکس های فولاد کربنی برای جوشکاری قوس-زیرپودری
SFA-5.18	مشخصات الکتروود و سیم جوشهای فولاد کربنی برای جوشکاری قوس فلزی با گاز
SFA-5.20	مشخصات الکترودهای فولاد کربنی برای جوشکاری قوس با الکتروود توپودری
SFA-5.21	مشخصات الکتروود و سیم جوشهای جوش روکش کاری مرکب (Composite Surfacing)
SFA-5.22	مشخصات الکترودهای فولاد زنگ نزن برای جوشکاری قوس با الکتروود توپودری و سیم جوشهای فولاد زنگ نزن برای جوشکاری قوس تنگستنی
SFA-5.23	مشخصات الکتروود و فلاکس های فولاد کم آلیاژی برای جوشکاری قوس-زیرپودری
SFA-5.24	مشخصات الکتروود و سیم جوشهای زیرکونیومی و آلیاژهای آن
SFA-5.25	مشخصات الکتروود و فلاکس های فولاد کربنی و کم آلیاژی برای جوشکاری سرباره الکتریکی
SFA-5.26	مشخصات الکترودهای فولاد کربنی و کم آلیاژی برای جوشکاری گاز الکتریکی
SFA-5.28	مشخصات الکتروود و سیم جوشهای فولاد کم آلیاژی برای جوشکاری قوس فلزی با گاز
SFA-5.29	مشخصات الکترودهای فولاد کم آلیاژی برای جوشکاری قوس با الکتروود توپودری
SFA-5.30	مشخصات لایه های مصرف شدنی

SAW

▶ در این فرایند غالباً از مولد CV استفاده میگردد.

▶ فلاکس توسط یک لوله انعطاف پذیر به سمت جوش هدایت میگردد.



▶ بعضی از دستگاهها دارای تجهیزات انتخاب جریان هستند.

▶ گاهی اوقات از چند الکتروود در این فرایند استفاده می گردد.

▶ یکی از کاربردهای این فرایند SURFACING , CLADDING می باشد. استفاده از الکتروودهای مقاوم به سایش .

▶ بعضاً جهت افزایش رسوب از تسمه نیز استفاده میگردد.

▶ در این روش نیاز به محافظت چشم نمی باشد.

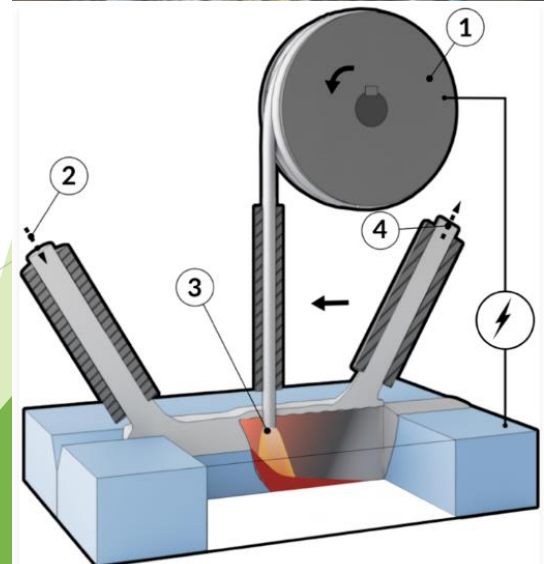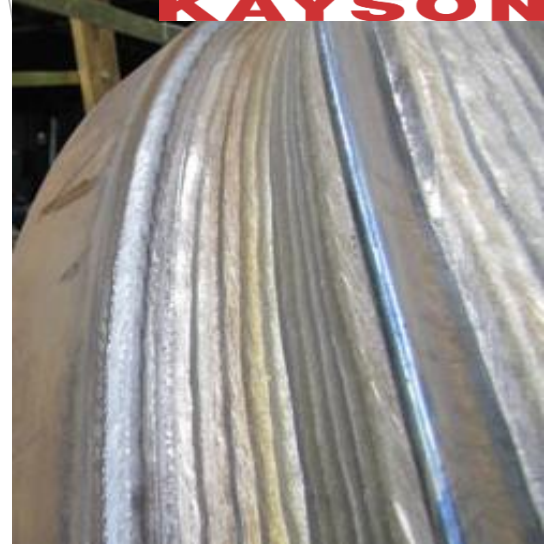



SAW

- ▶ بیشتر جهت جوشکاری مقاطع ضخیم استفاده میگردد.
- ▶ امکان بیشتر این فرایند در جوشکاری در وضعیت تخت می باشد.
- ▶ لزوم استفاده از وضعیت دهنده ها میباشد.
- ▶ تمیزکاری در هر پاس ضروری است.
- ▶ با توجه به اینکه عدم رویت مذاب وجود دارد بنابراین مهارت اپراتور بسیار مهم می باشد.
- ▶ بهتر قبل از شروع جوشکاری یک با تراک کل مسیر را طی نماید.







DEFECT

ترک های هیدروژنی به دلیل حضور رطوبت در پودرها. ▶

ترک های انجمادی: با توجه به حجم رسوب بالا در صورتکیه نسبت عمق به پهنا خیلی زیاد باشد ممکن است در مرکز جوش ترک به وجود آید. ▶

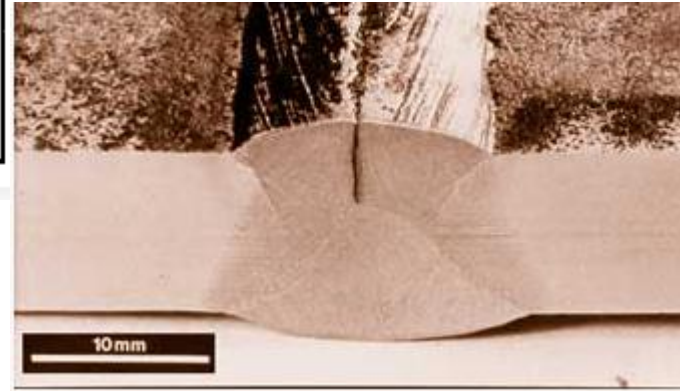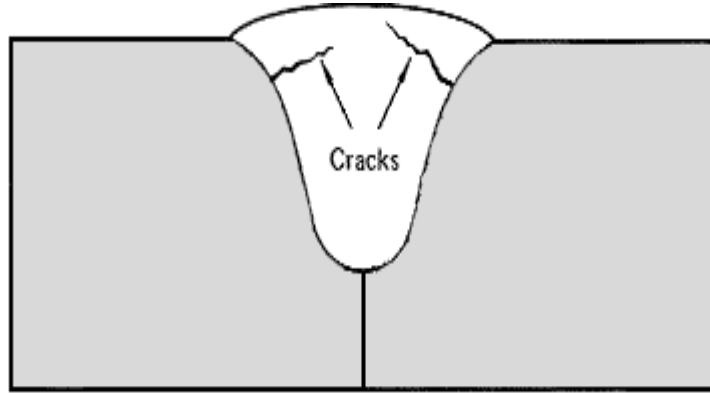

خوردگی کناره جوش ▶



شرکت صنایع پتروشیمی سبلان



بزرگترین شرکت
ICI

KCC
SA
KAYSON

ESW





ESW



recheck WPS and perform PQR
recheck operator experience
recheck by ndt method

HOW TO SOLVE LOF OF ESW?

- 1- DURING WELDING CHECK MOLTEN ZONE FROM BACK OF PLATE
- 2- AFTER WELDING CHECK BY ULTRASONI TESTING
- 3- RECHEK BY METALLOGRAPHY

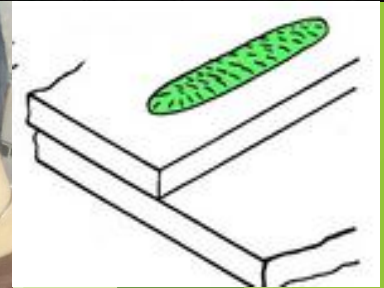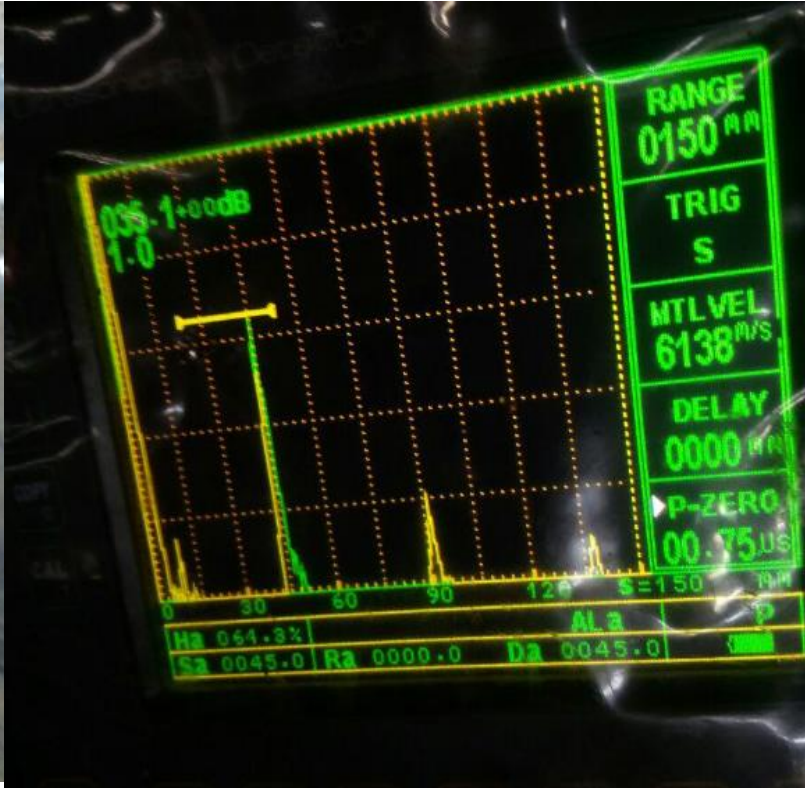




شرکت صنایع پتروشیمی سبلان

ESW






- One part rotated, one stationary
- Stationary part forced against rotating part
- Friction converts kinetic energy to thermal energy
- Metal at interface melts and is joined
- When sufficiently hot, rotation is stopped & axial force increased

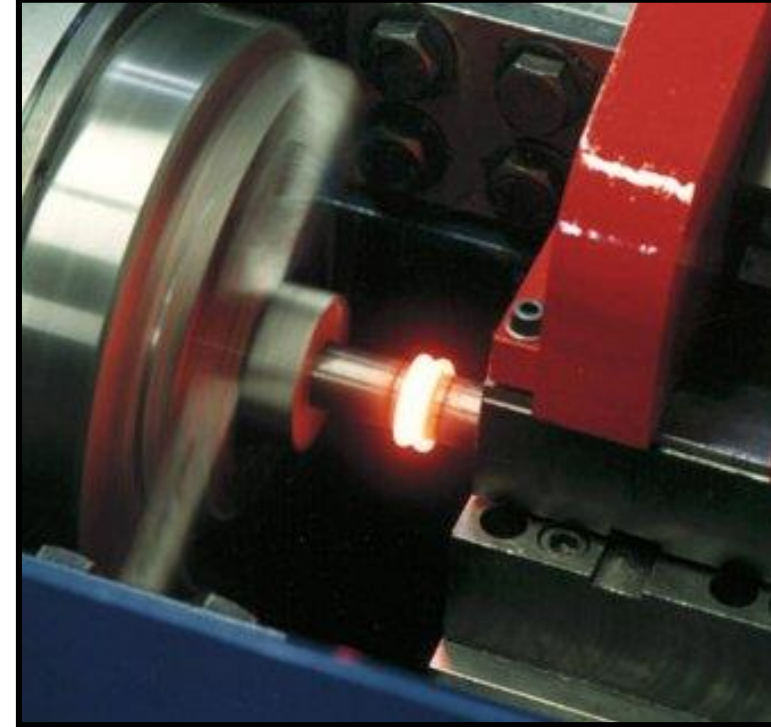

**RWMA**[®]**Resistance Welder
Manufacturers' Association***Joining Together to Promote Resistance Welding Excellence*

Resistance Welding is the coordinated application of electric current and mechanical pressure in the proper magnitudes and for a precise period of time to create a coalescent bond between two base metals.

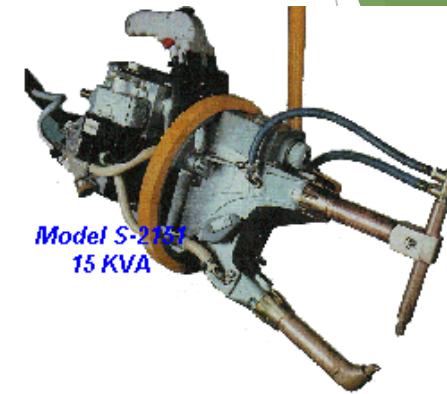


- Heat provided by resistance to electrical current ($Q=I^2Rt$)
- Typical 0.5 – 10 V but up to 100,000 amps!
- Force applied by pneumatic cylinder
- Often fully or partially automated
 - Spot welding
 - Seam welding





Soldering & Brazing

- Only filler metal is melted, not base metal
- Lower temperatures than welding
- Filler metal distributed by capillary action
- Metallurgical bond formed between filler & base metals
- Strength of joint typically
 - stronger than filler metal itself
 - weaker than base metal
 - gap at joint important (0.001 – 0.010”)
- Pros & Cons
 - Can join dissimilar metals
 - Less heat - can join thinner sections (relative to welding)
 - Excessive heat during service can weaken joint

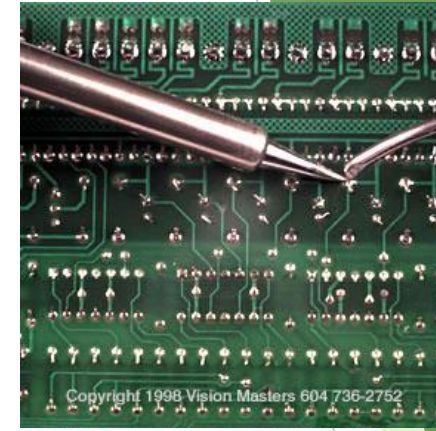




شرکت صنایع پتروشیمی سبلان

WELDING DDEFECT AND REASONS

بازار خدمات 101



SA
KAYSON

تقسیم بندی عیوب

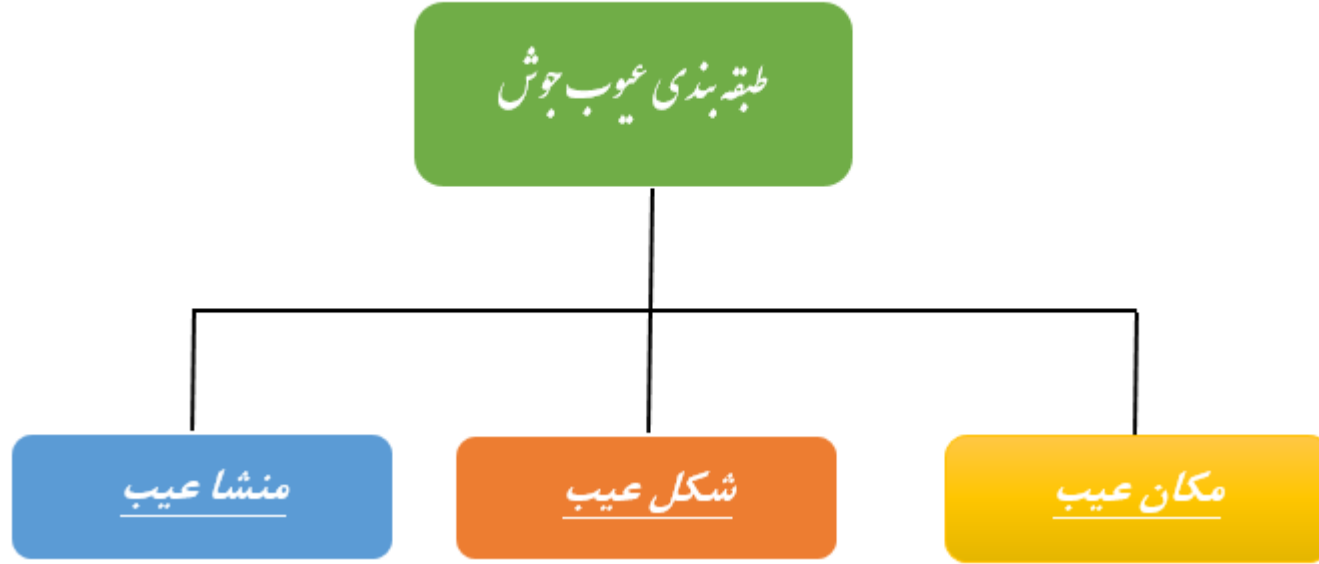





طبقه بندی عیوب موجود در جوش

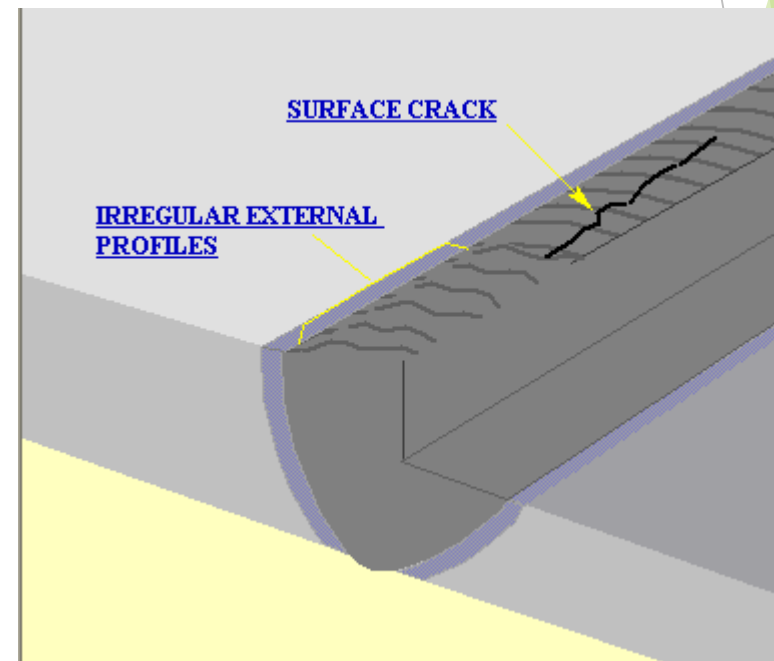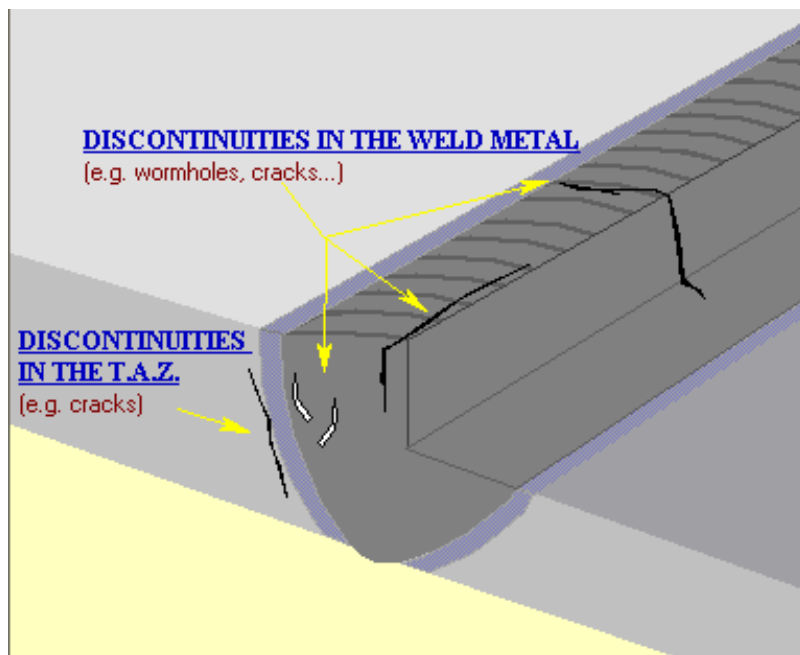





طبقه بندی عیوب موجود در جوش

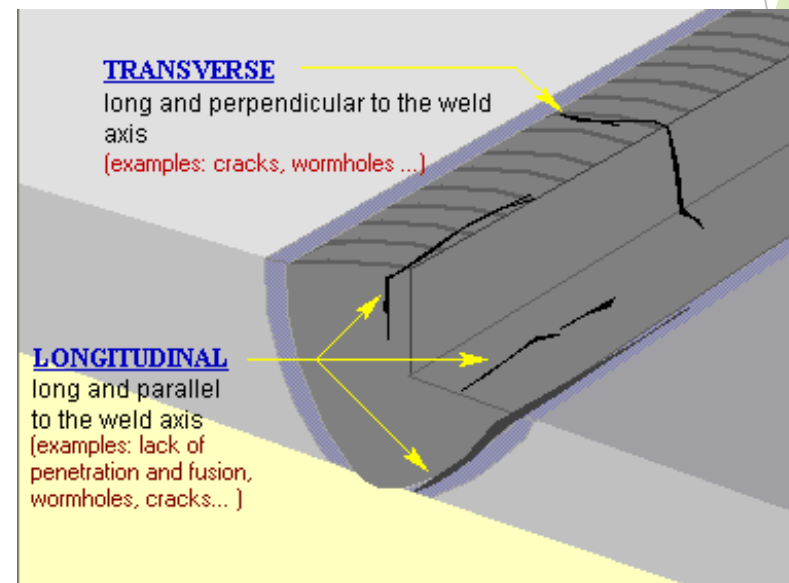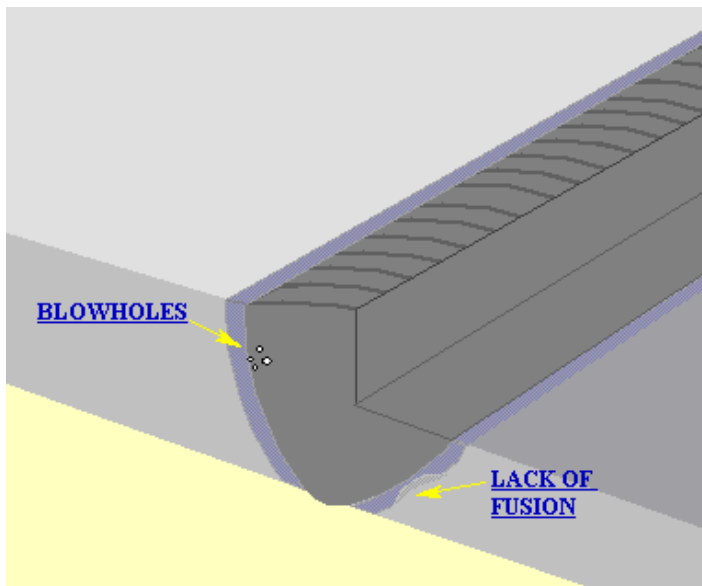



طبقه بندی عیوب موجود در جوش

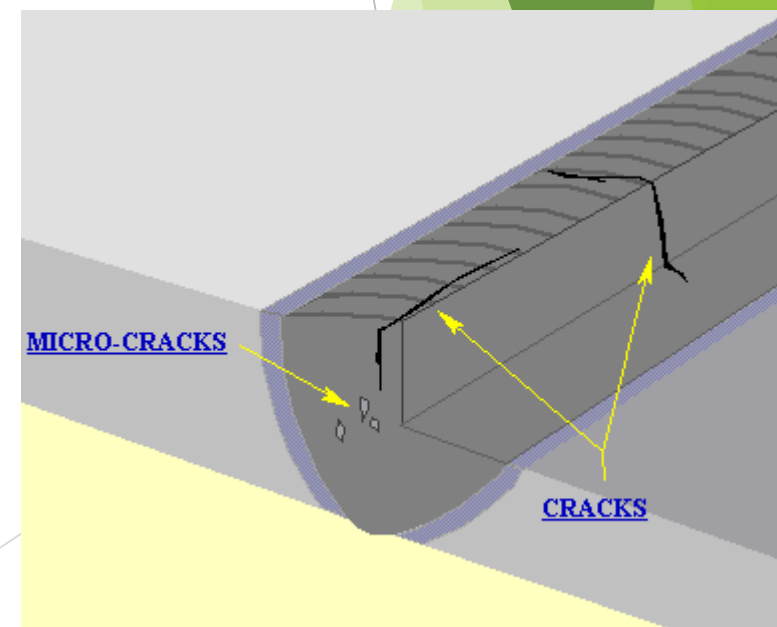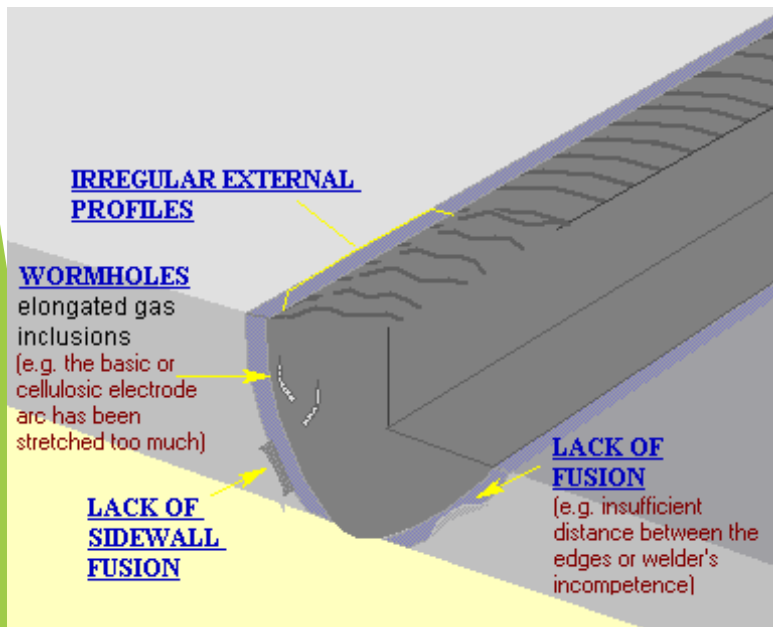



عیوب در اتصالات جوشکاری شده

یک **ناپیوستگی** در حقیقت یک انقطاع در ساختار فلز جوش می باشد مثل وجود ناهمگنی در خواص مکانیکی و متالورژیکی ماده یا فلز جوش.

عیب نیز یک ناپیوستگی است که به واسطه ویژگی خاصش و یا در اثر تجمع آن در قطعه یا محصول، نمی تواند حداقل استانداردهای کاری مورد نیاز را برآورده کند.

عیوب جوش به طور کلی به گروههای زیر تقسیم می شود:

ترکها

حفره های گازی

ناخالصیهای سرباره جوش

عدم نفوذ یا ذوب

شکل ناقص یا طرح ظاهری غیر قابل قبول جوش

و سایر عیوب (مثل اثر پاشش قوس الکتریکی بر روی سطح قطعه




شرکت صنایع پتروشیمی سبلان

Cracks






CRACKS

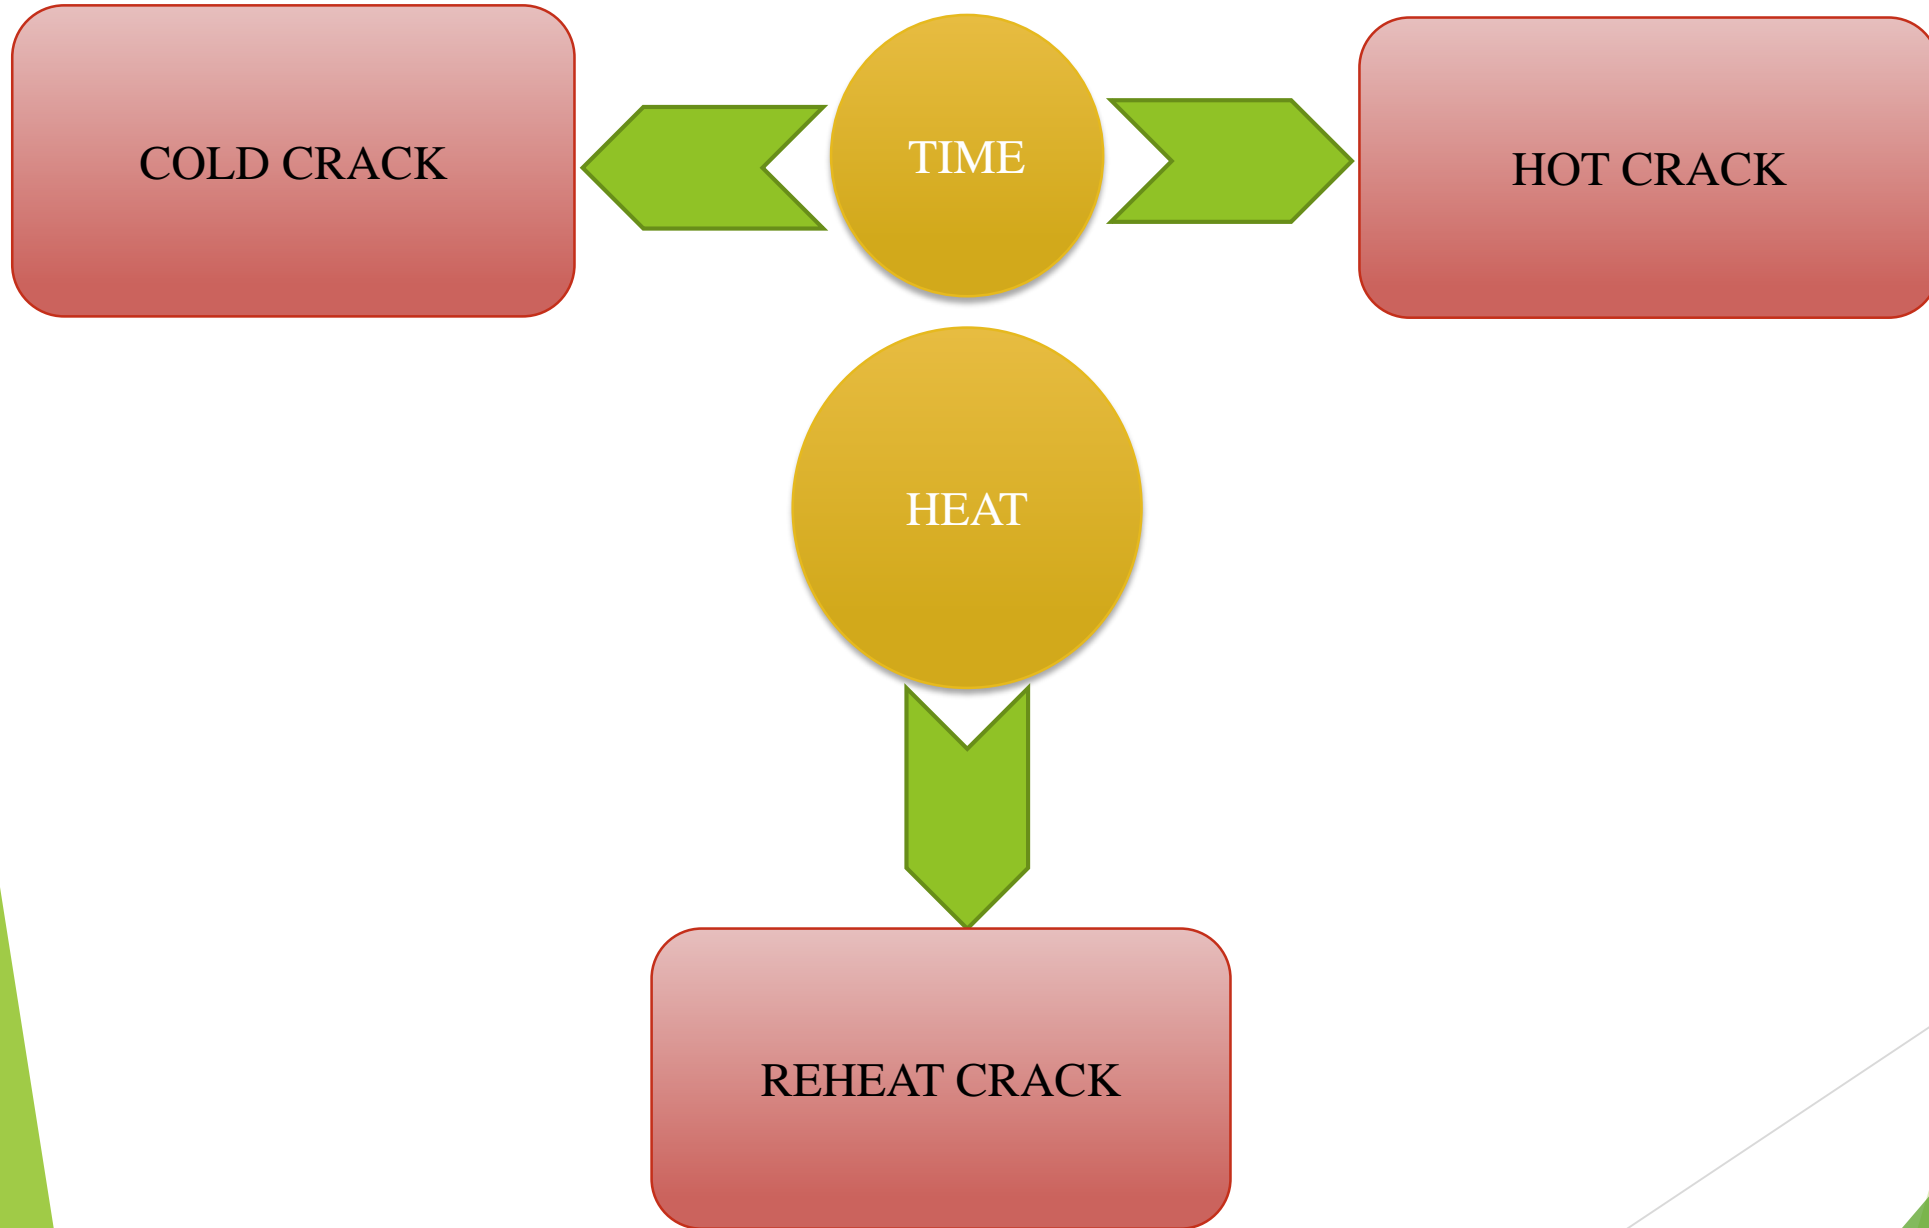

HOT CRACK

از عیوب رایج و خطرناک در جوش که به دو نوع کلی سرد و گرم تقسیم بندی می گردند:

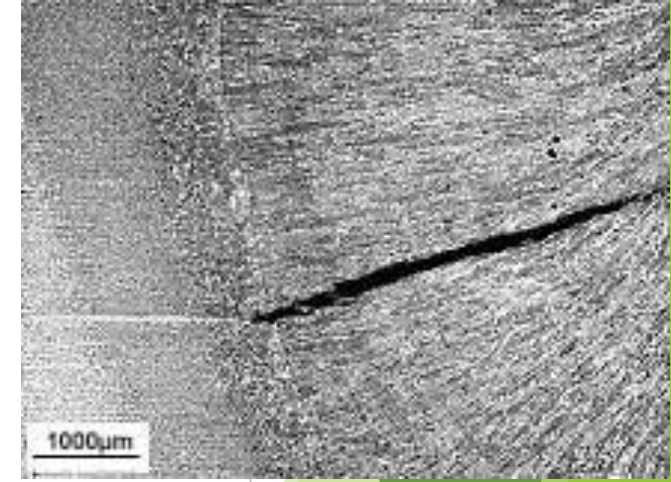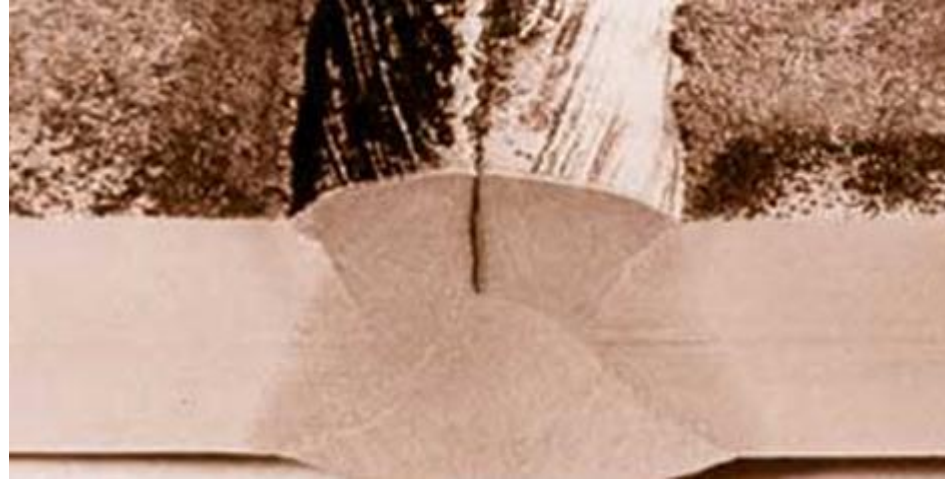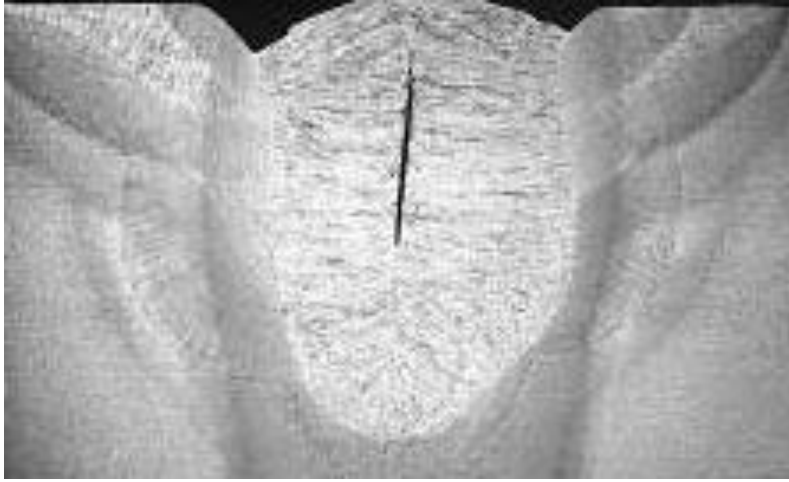

این عیب به دلیل ضعف در محدوده کشسان در در دمای بالا رخ می دهد.


ترک از نوع بین دانه ای می باشد و در حین انجماد رخ می دهد.

حضور ترکیبات با نقطه انجماد پایین تر از نقطه انجماد قطعه اصلی مانند ناخالصی ها یا سولفید آهن

گوگرد نقش مهمی در این نوع ترک دارد اما سیلیکون، فسفر، مس، نیکل نقش کمتری دارند.

منگنز نقش جلوگیری کننده دارد به دلیل هم خوانی بهتر با افزودنی های آهن.

اگر نسبت منگنز به سولفور ۶۰ درصد باشد احتمال بروز این ترک رخ کم می باشد.

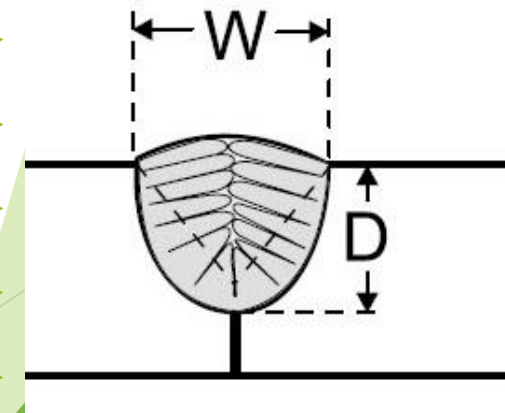


راههای جلوگیری از ترک گرم

عدم اختلاف زیاد بین تنش گسیختگی در جوش و فلز پایه

پیش گرم کردن طبق WPS

رعایت WELDING SEQUENCE طبق WPS

به تعویق انداختن انجماد در قطعه کار

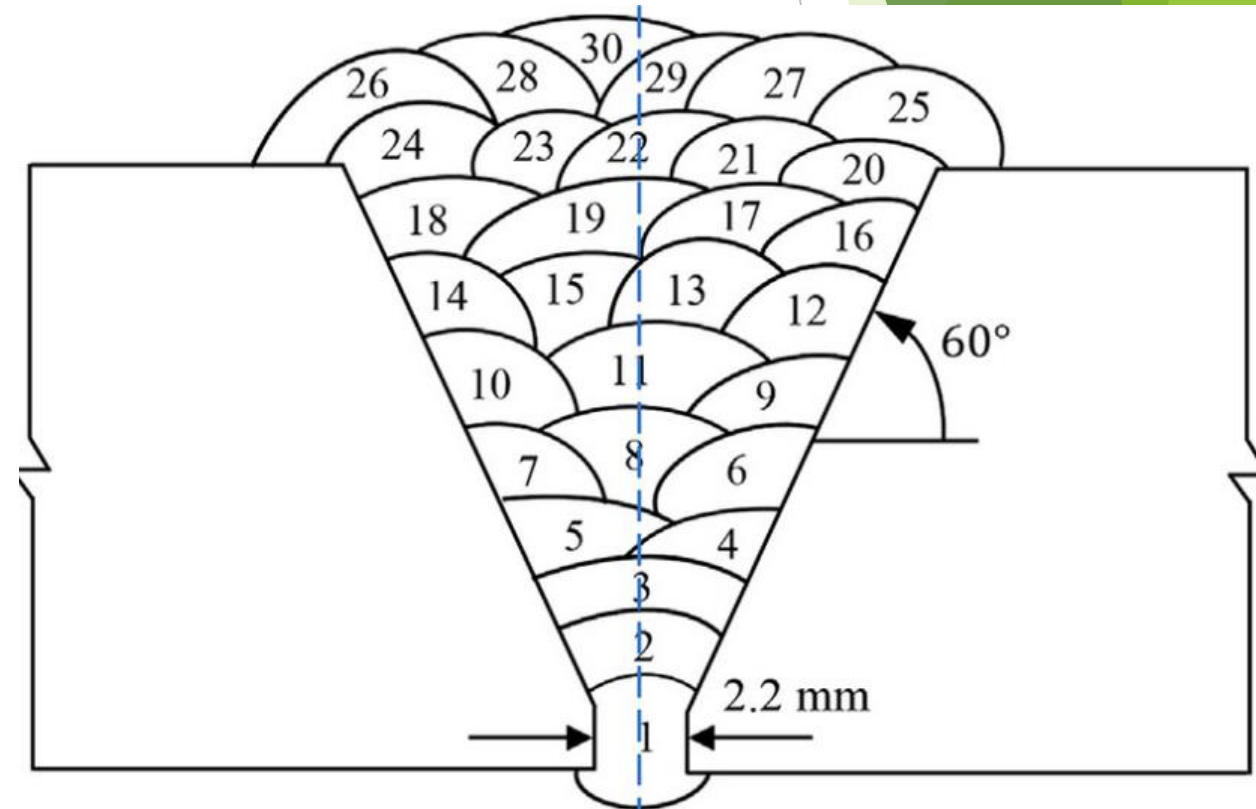

COLD CRACK

IN HAZ

IN WELD METAL

الف: اثرات مکانیکی مانند تنش های خارجی در حین سرویس چنانچه تمهیدات WPS مانند تنش زدایی انجام نشده باشد مستعد برای این ترک هستند.





COLD CRACK

ب: اثر عناصر آلیاژی و ضخامت فلز پایه:

در اثر ضخامت های بیشتر و حضور عناصر آلیاژی احتمال بروز ترک گرم بیشتر است.

افزایش ضخامت و حضور عناصر آلیاژی باعث بروز ترک سرد می گردد.

رعایت عملیات پیش گرم / پس گرم / درجه حرارت بین پاسی

جهت تعمیرات عملیات سنگ زنی به گوجینگ ارجحیت دارد به دلیل کم کردن حرارت ورودی مجدد.

کم کردن میل به ایجاد ساختارهای ترد و شکننده.





COLD CRACK

ج: هیدروژن

هیدروژن به تنهایی میتواند باعث بروز ترک سرد میگردد.




▶ ملکول های هیدروژن وارد حوضچه مذاب می گردد.

▶ در قوش الکتریکی یونیزه می گردد و به صورت ملکول آزاد وارد حوضچه مذاب می گردد.

▶ در اثر سرد شدن به حالت فوق اشبا در می آید و در داخل جوش باقی می ماند.

▶ برای فولادهای کم آلیاژ مانند A517 , A514 احتمال بروز این عیب بیشتر می باشد.

▶ اتم های آزاد هیدروژن به دام افتاده در کنار یکدیگر و تا حدود ۶۰ برابر اضافه حجم خواهند داشت و منجر به ترک سرد می گردد.

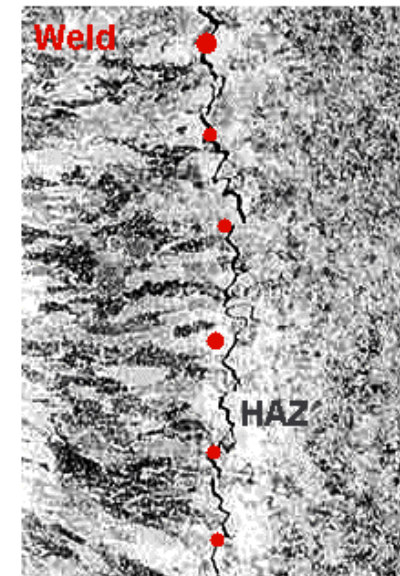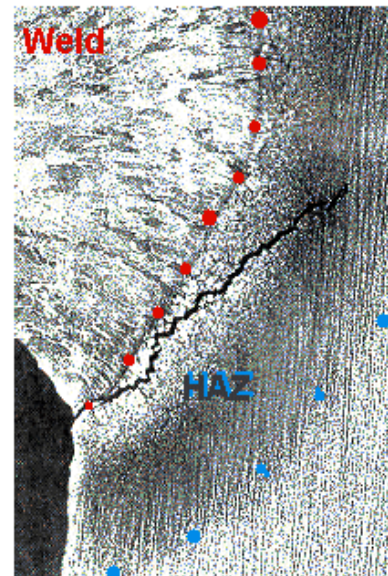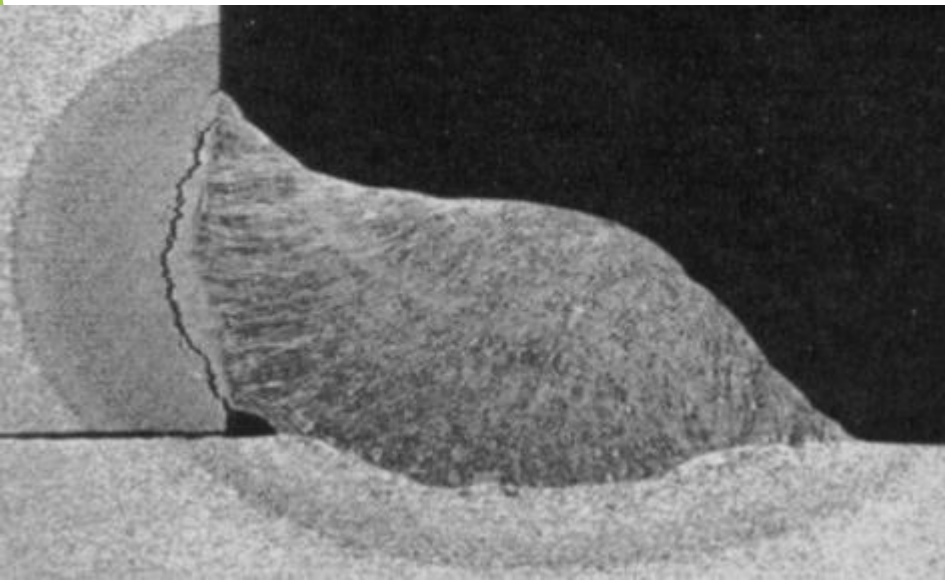

**Table 6.1
Visual Inspection Acceptance Criteria (see 6.9)**

Discontinuity Category and Inspection Criteria	Statically Loaded Nontubular Connections	Cyclically Loaded Nontubular Connections								
(1) Crack Prohibition Any crack shall be unacceptable, regardless of size or location.	X	X								
(2) Weld/Base Metal Fusion Complete fusion shall exist between adjacent layers of weld metal and between weld metal and base metal.	X	X								
(3) Crater Cross Section All craters shall be filled to provide the specified weld size, except for the ends of intermittent fillet welds outside of their effective length.	X	X								
(4) Weld Profiles Weld profiles shall be in conformance with 5.23.	X	X								
(5) Time of Inspection Visual inspection of welds in all steels may begin immediately after the completed welds have cooled to ambient temperature. Acceptance criteria for ASTM A514, A517, and A709 Grade HPS 100W [HPS 690W] steels shall be based on visual inspection performed not less than 48 hours after completion of the weld.	X	X								
(6) Undersized Welds The size of a fillet weld in any continuous weld may be less than the specified nominal size (L) without correction by the following amounts (U): <table style="margin-left: auto; margin-right: auto; border: none;"> <tr> <td style="text-align: center; padding: 5px;">L, specified nominal weld size, in [mm]</td> <td style="text-align: center; padding: 5px;">U, allowable decrease from L, in [mm]</td> </tr> <tr> <td style="text-align: center; padding: 5px;">$\leq 3/16$ [5]</td> <td style="text-align: center; padding: 5px;">$\leq 1/16$ [2]</td> </tr> <tr> <td style="text-align: center; padding: 5px;">$1/4$ [6]</td> <td style="text-align: center; padding: 5px;">$\leq 3/32$ [2.5]</td> </tr> <tr> <td style="text-align: center; padding: 5px;">$\geq 5/16$ [8]</td> <td style="text-align: center; padding: 5px;">$\leq 1/8$ [3]</td> </tr> </table> <p>In all cases, the undersize portion of the weld shall not exceed 10% of the weld length. On web-to-flange welds on girders, underrun shall be prohibited at the ends for a length equal to twice the width of the flange.</p>	L, specified nominal weld size, in [mm]	U, allowable decrease from L, in [mm]	$\leq 3/16$ [5]	$\leq 1/16$ [2]	$1/4$ [6]	$\leq 3/32$ [2.5]	$\geq 5/16$ [8]	$\leq 1/8$ [3]	X	X
L, specified nominal weld size, in [mm]	U, allowable decrease from L, in [mm]									
$\leq 3/16$ [5]	$\leq 1/16$ [2]									
$1/4$ [6]	$\leq 3/32$ [2.5]									
$\geq 5/16$ [8]	$\leq 1/8$ [3]									
(7) Undercut (A) For material less than 1 in [25 mm] thick, undercut shall not exceed 1/32 in [1 mm], with the following exception: undercut shall not exceed 1/16 in [2 mm] for any accumulated length up to 2 in [50 mm] in any 12 in [300 mm]. For material equal to or greater than 1 in [25 mm] thick, undercut shall not exceed 1/16 in [2 mm] for any length of weld.	X									



راههای جلوگیری از ورود هیدروژن




شرکت صنایع پتروشیمی سیلان

- ▶ تمیزکاری قبل از جوشکاری
- ▶ تمیز کردن قطعه از قبیل گریس/ روغن / چربی
- ▶ استفاده از الکتروود کم هیدروژن
- ▶ ایجاد تمهیدات استفاده از الکتروودهای LOW HYDROGEN
- ▶ اعمال عملیات POST WELD HEAT TREATMENT



REHEAT CRACK

این نوع ترک در فولادهای آلیاژی شامل عناصر آلیاژی مانند وانادیوم، مولیبدن که کاربیدساز هستند رخ می دهد. این کاربیدها رگه مقاوم بالاخص در ناحیه HAZ به وجود می آورند. در شرایط بازگذاری این رگه ها باید با یکدیگر وفق داده شوند تا انرژی در مرز این رگه ها تعدیل گردند. اما شکل پذیری کم این رگه ها باعث ترک خواهند شد.

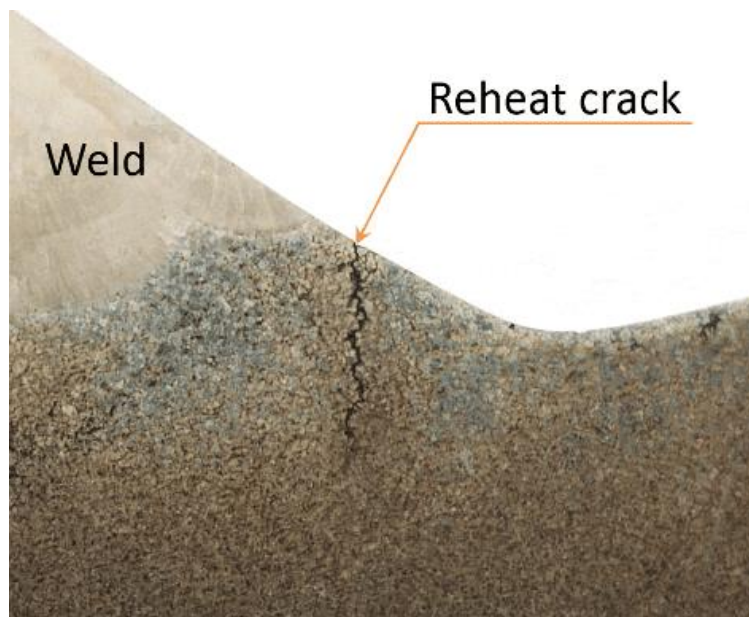

REHEAT CRACK


- ▶ استفاده از الکتروود متناسب از نقطه نظر گسیختگی با فلز پایه
- ▶ جلوگیری از بروز ساختار سخت و شکننده
- ▶ جلوگیری از پاشش مواد مذاب و ایجاد تغییر ساختار در سطح






LOCATIONS OF CRACK

(a) Single-pass fillet welds

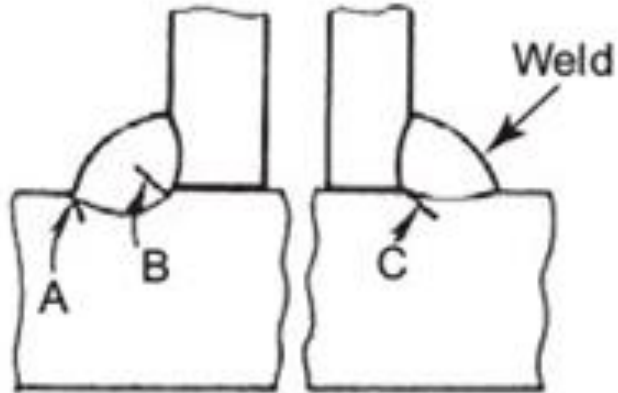


- A: Toe crack
- B: Root crack
- C: Heel crack
- D: Lamellar tear
- E: Underbead crack
- F: Deformation crack
- G: HAZ microcrack
- H: Weld metal microcrack

(b) Multiple-pass fillet welds

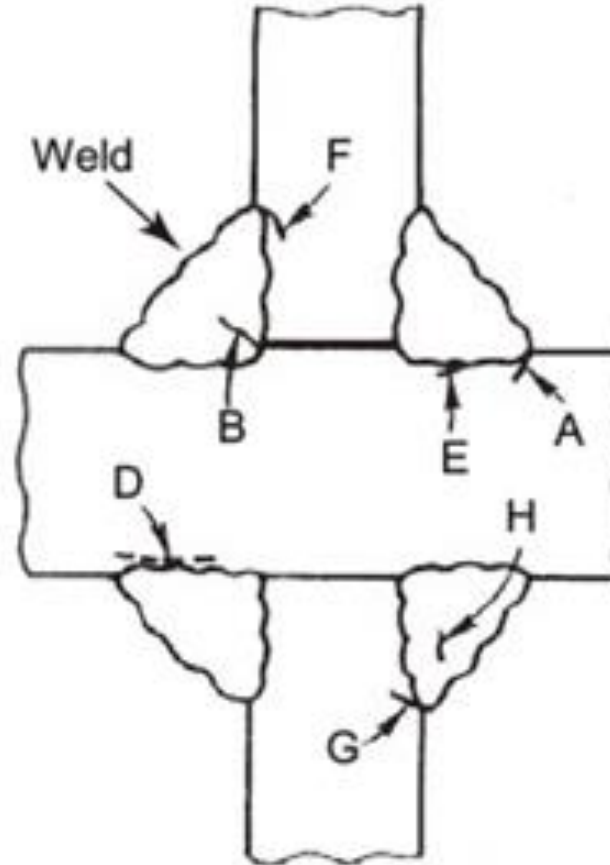




LOCATIONS OF CRACK

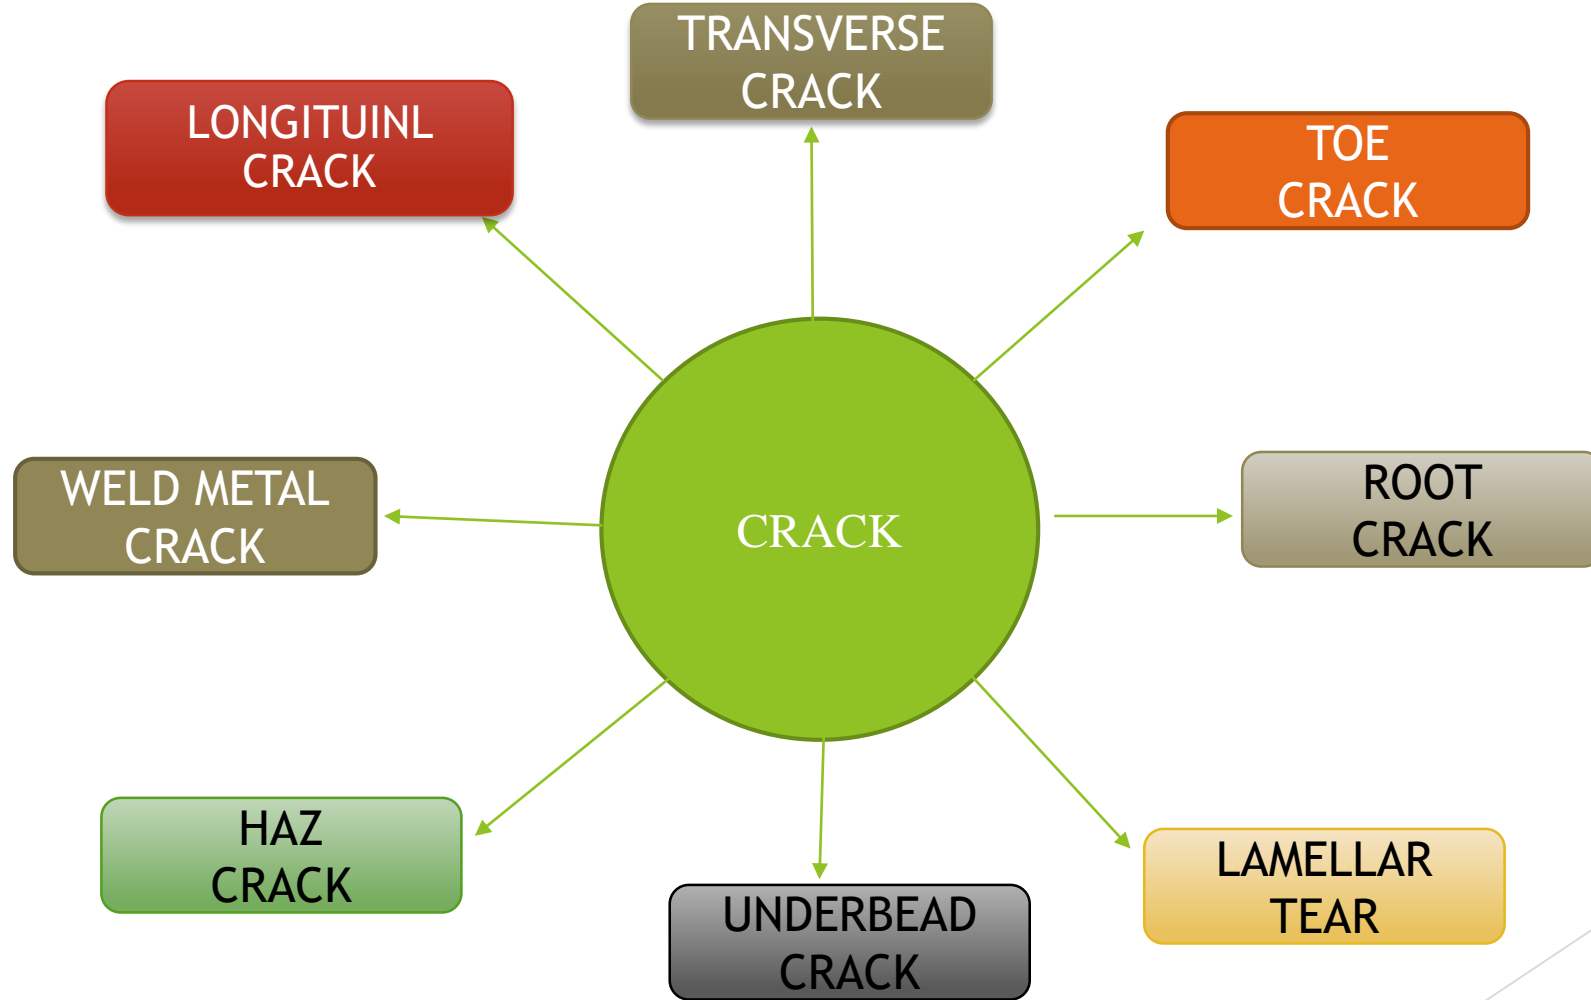





Cracks

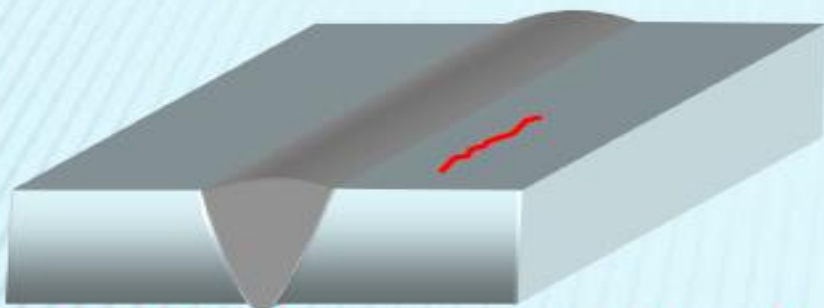


Longitudinal parent metal crack

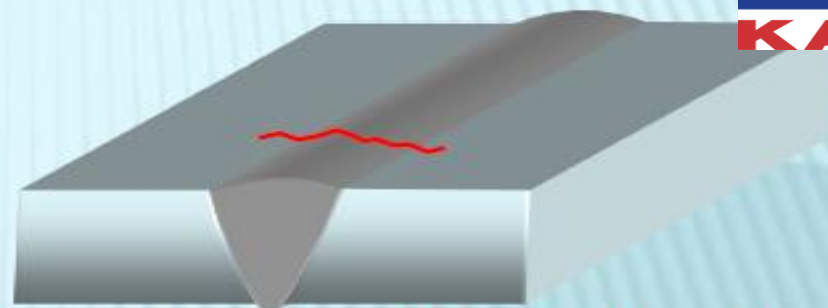

Transverse weld metal crack

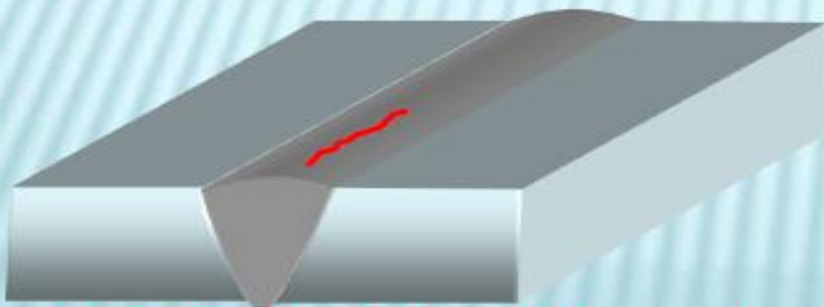



Longitudinal weld metal crack

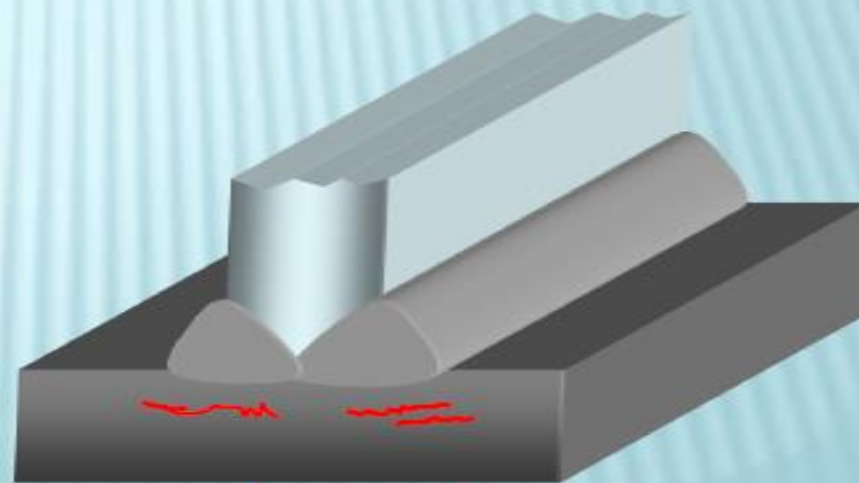



Lamellar tearing



شرکت صنایع پتروشیمی سبلان

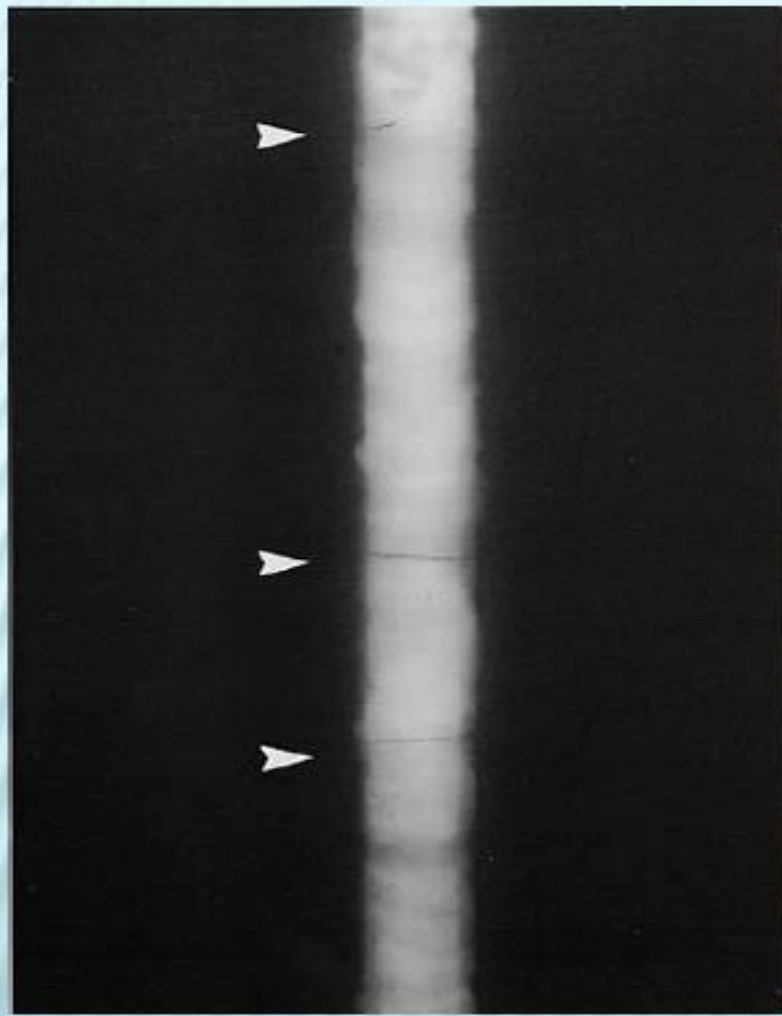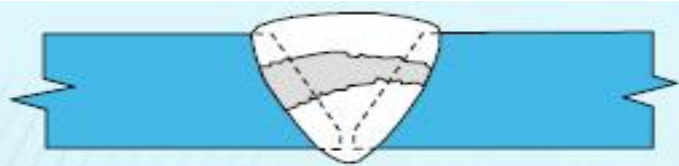

Transverse crack

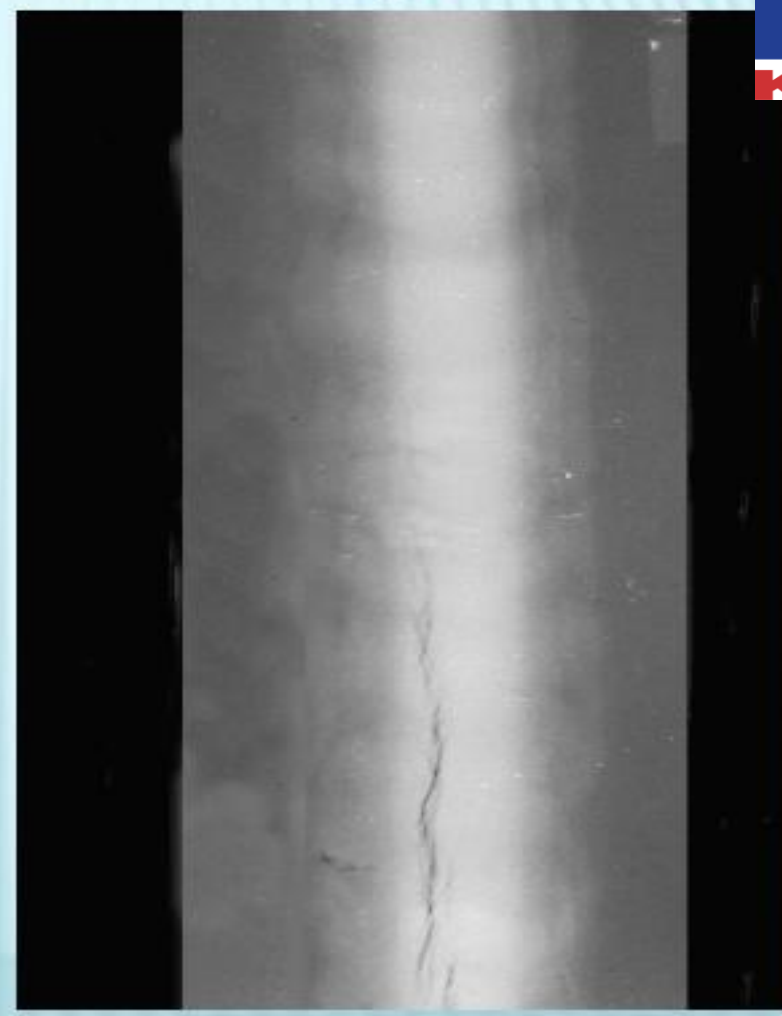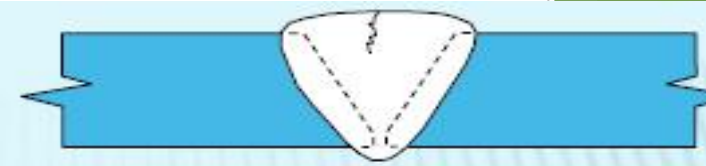


Longitudinal crack






CRATER CRACK

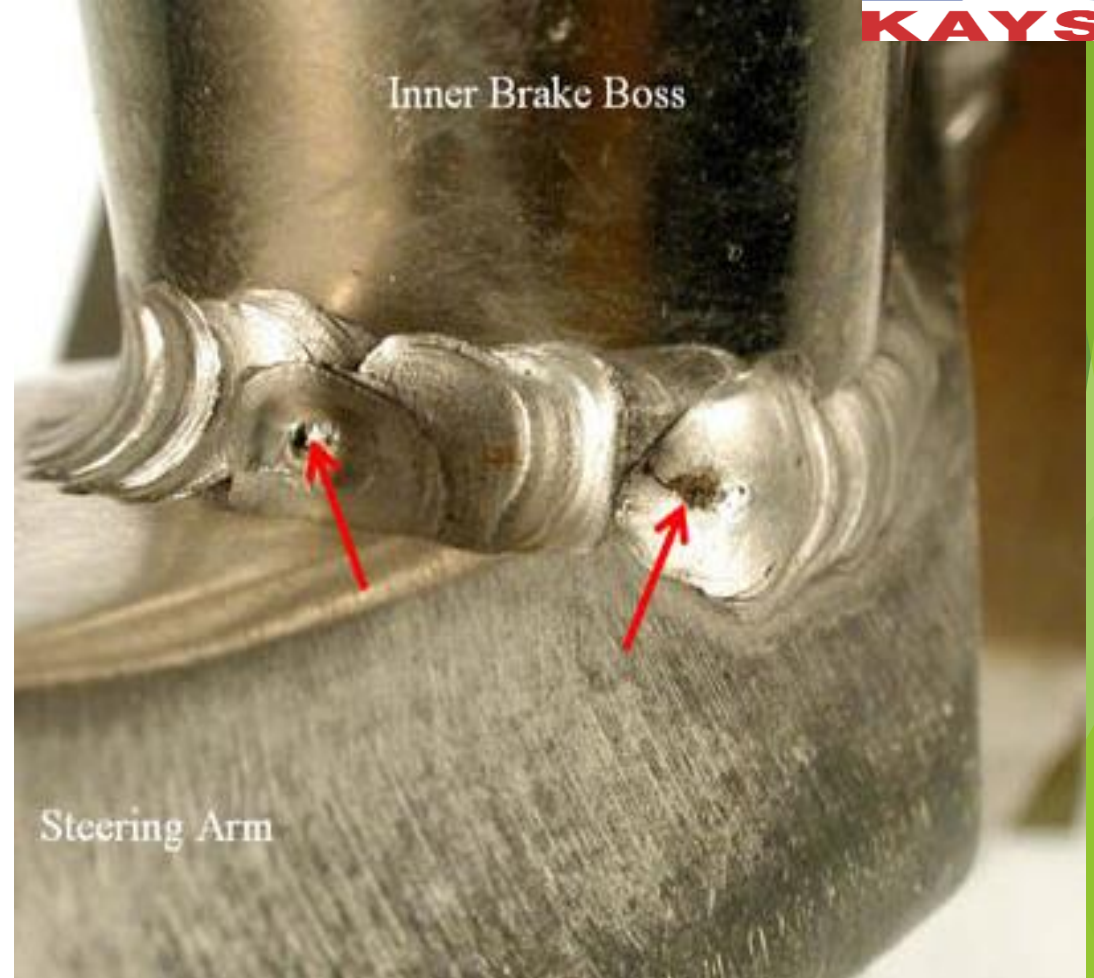





END CRACKING

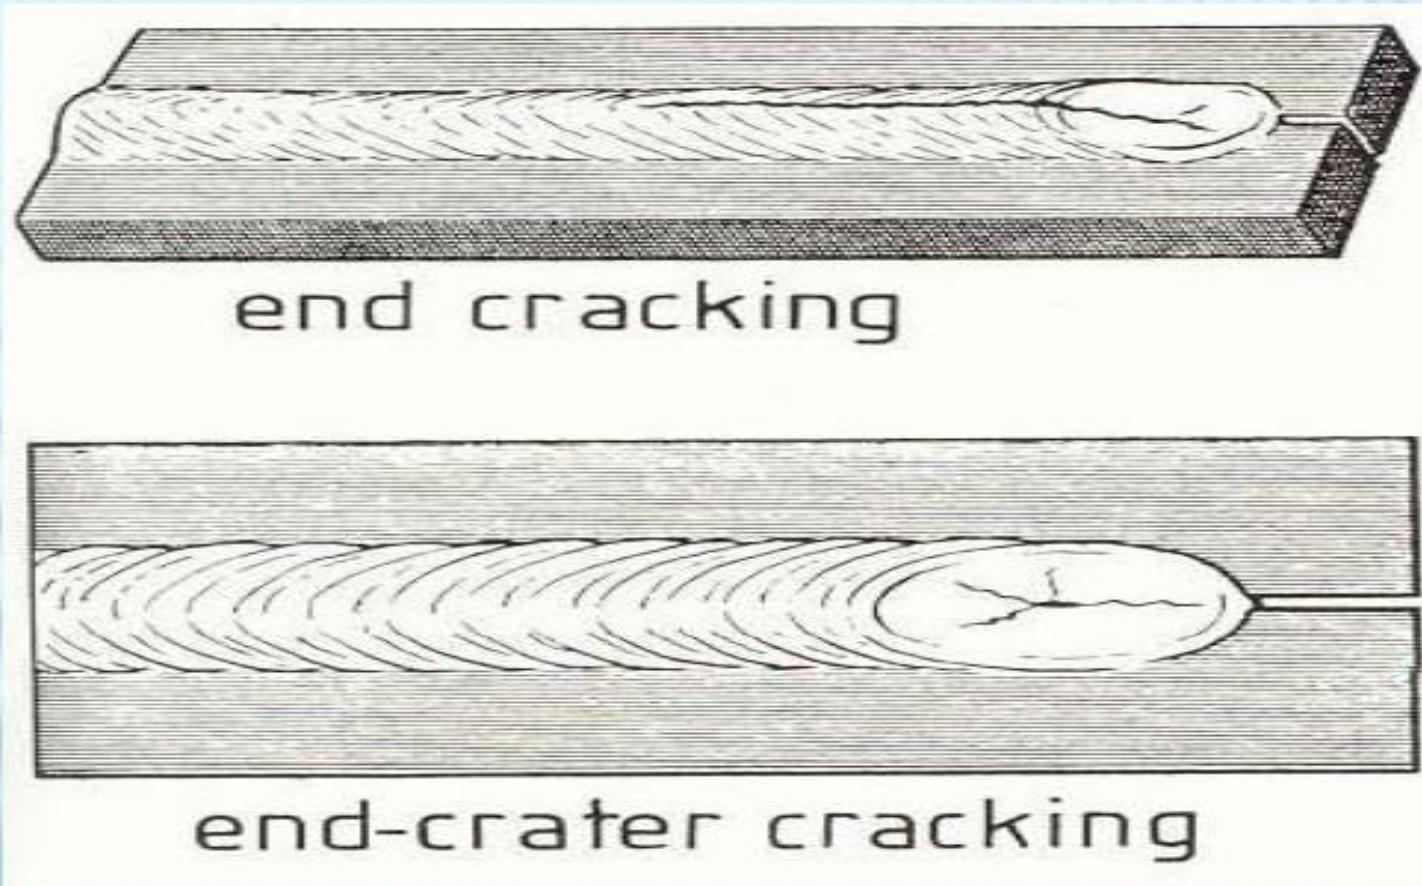



CRATER CRACK


- ▶ سریع سرد شدن جوش در انتهای جوش
- ▶ عدم رعایت یک گام به عقب BACK STEP
- ▶ عدم استفاده از قطعه قراضه در انتهای جوش
- ▶ عدم استفاده از گاز محافظ پس گاز
- ▶ عدم تسلط جوشکار در شروع مجدد جوشکاری

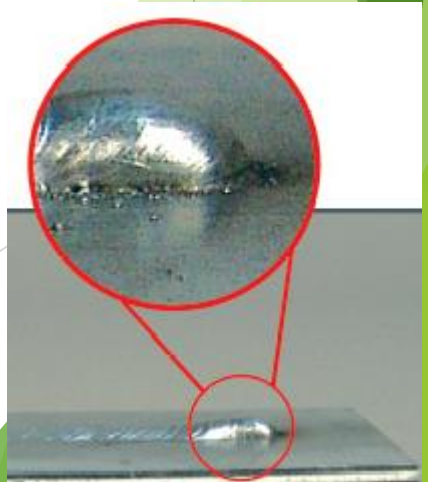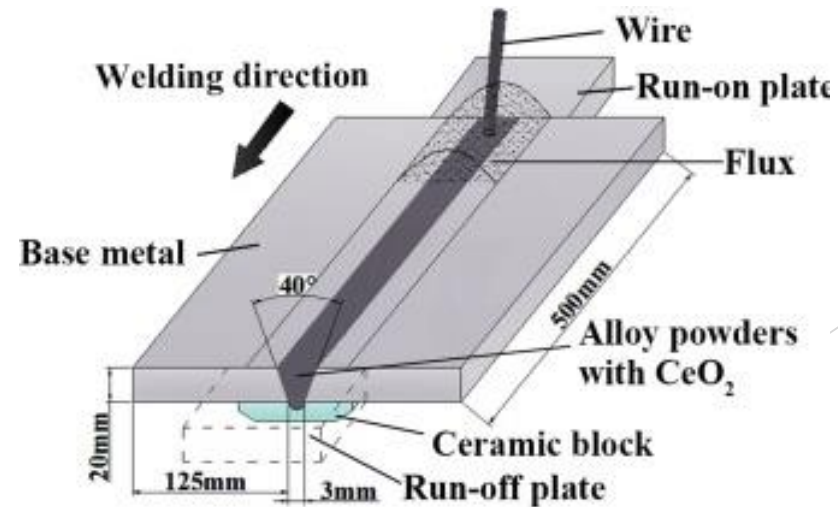




CRATER PIPES

- ✦ Resulting from shrinkage at the end crater of a weld run
- ✦ Causes:
 - + Incorrect manipulative technique or current decay to allow for crater shrinkage

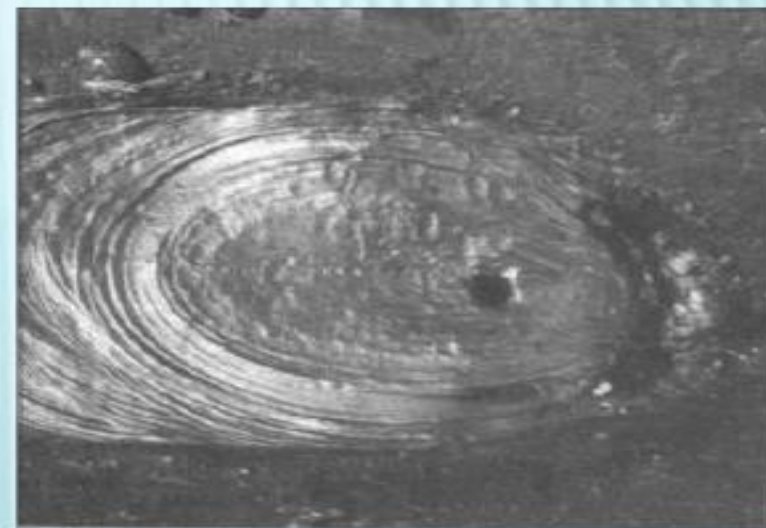




Crater Pipe


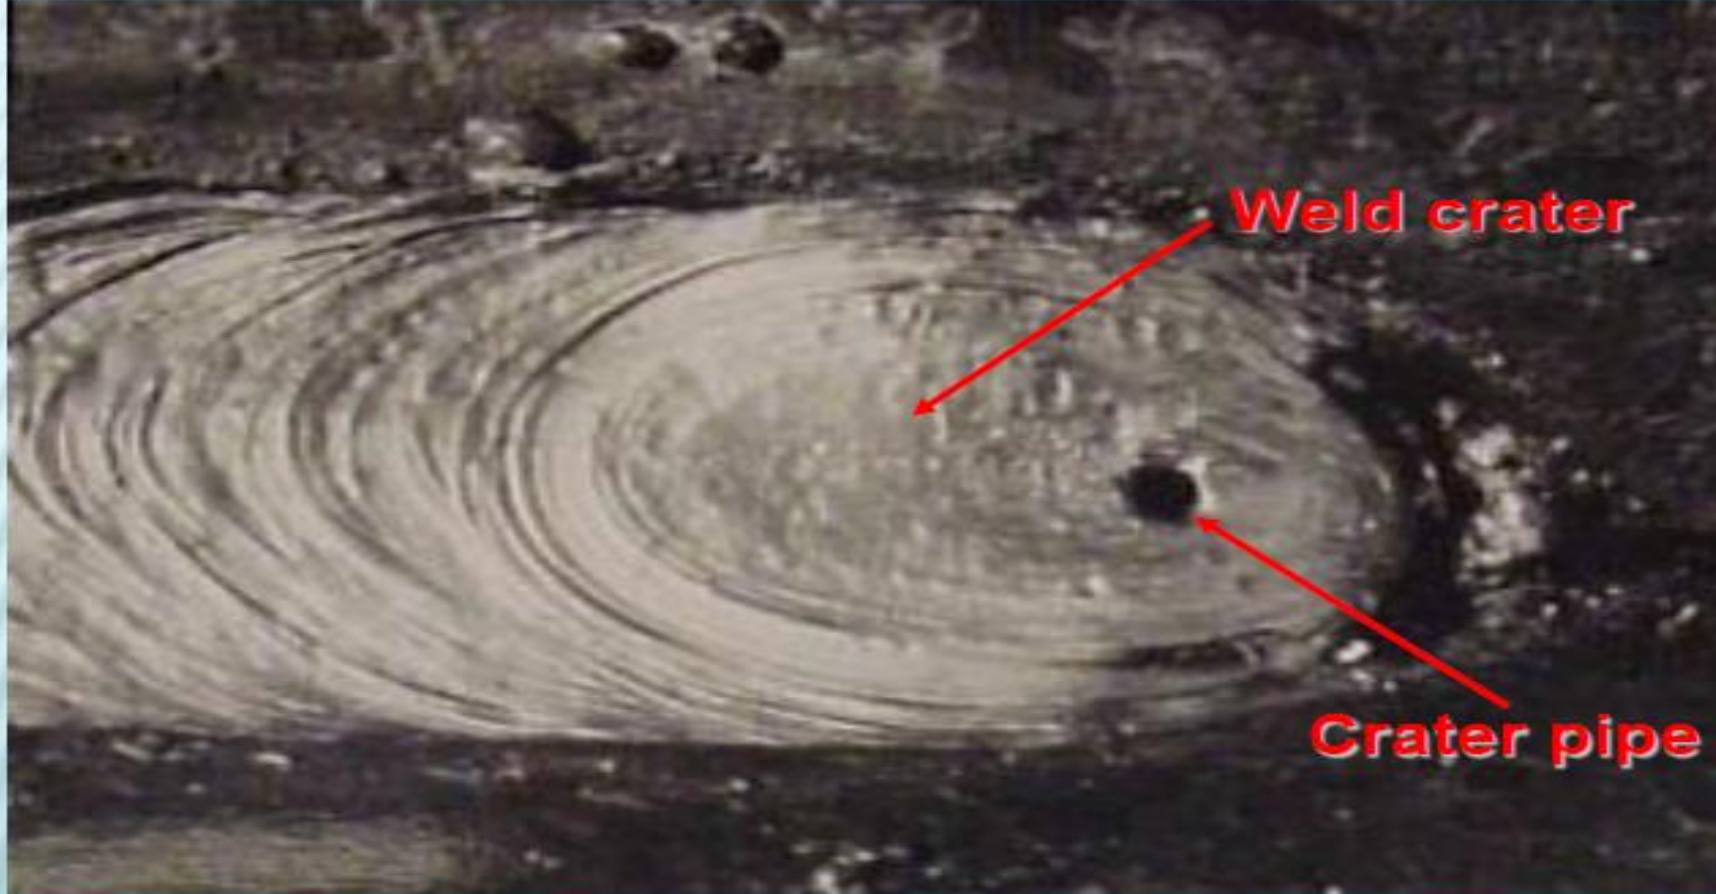




شرکت صنایع پتروشیمی سیلان


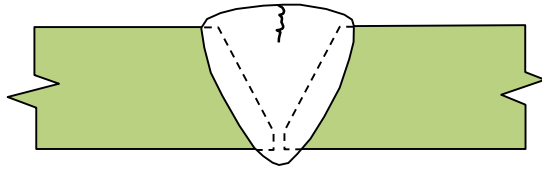


Longitudinal crack

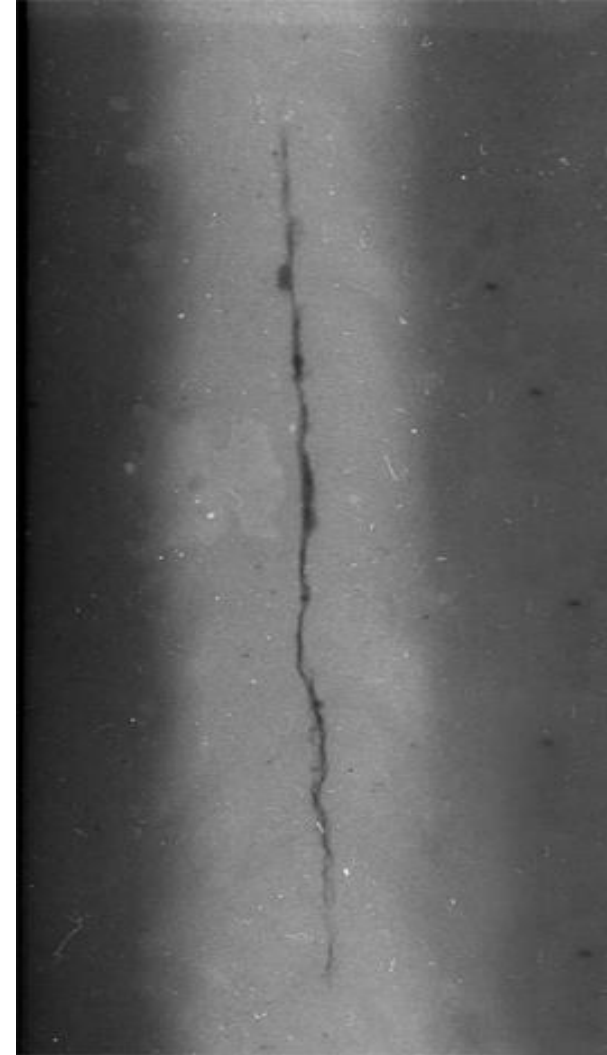
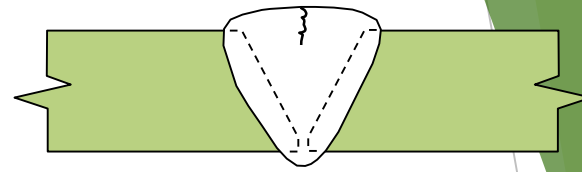


Longitudinal crack



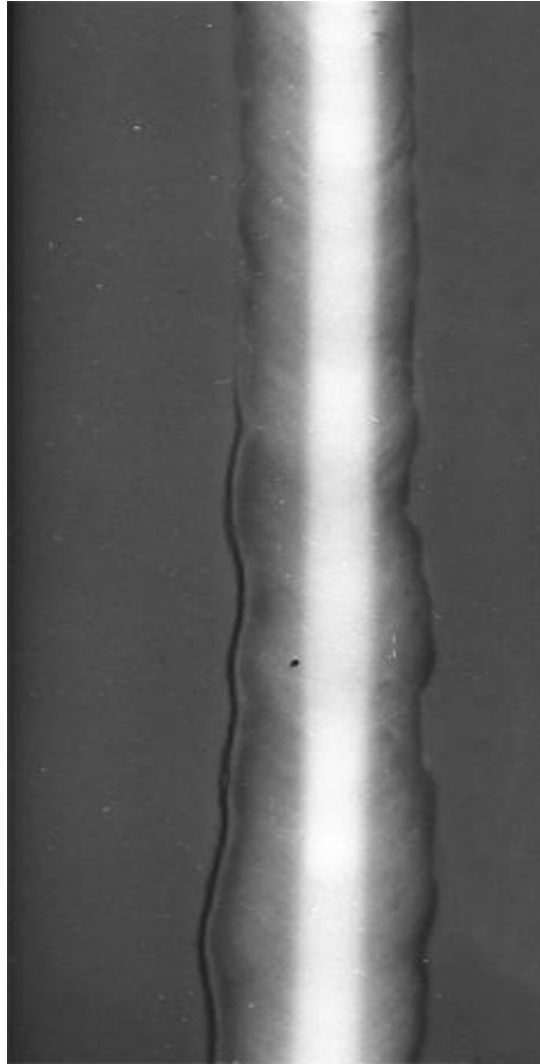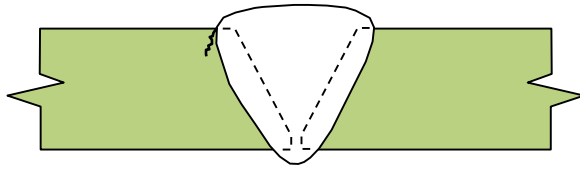


HAZ crack

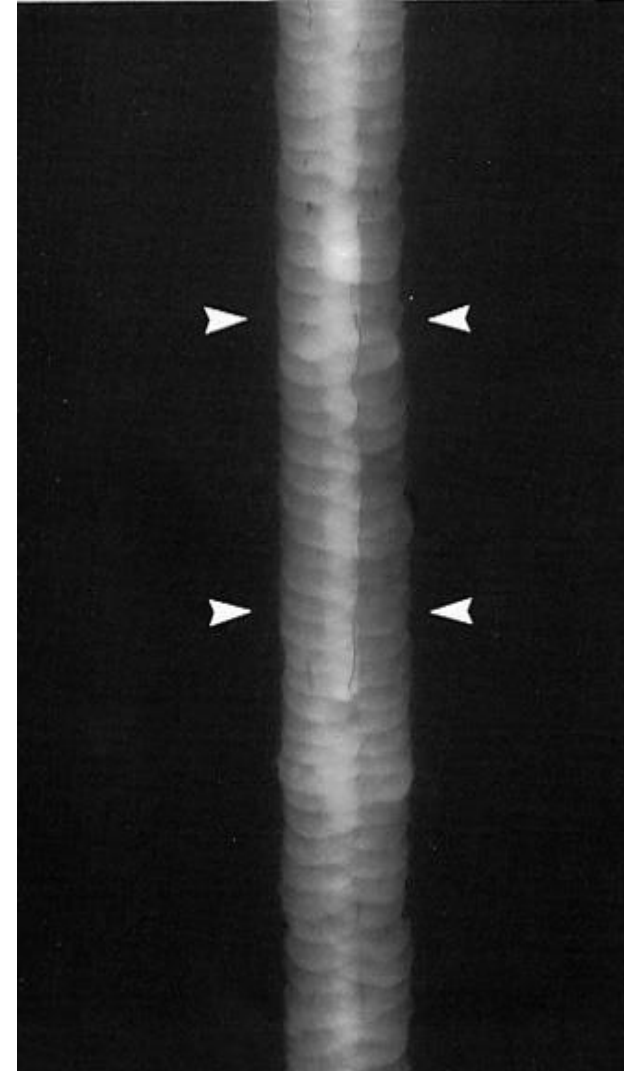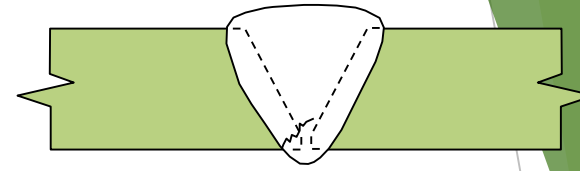


Root crack



LAMINATION DURING WELDING

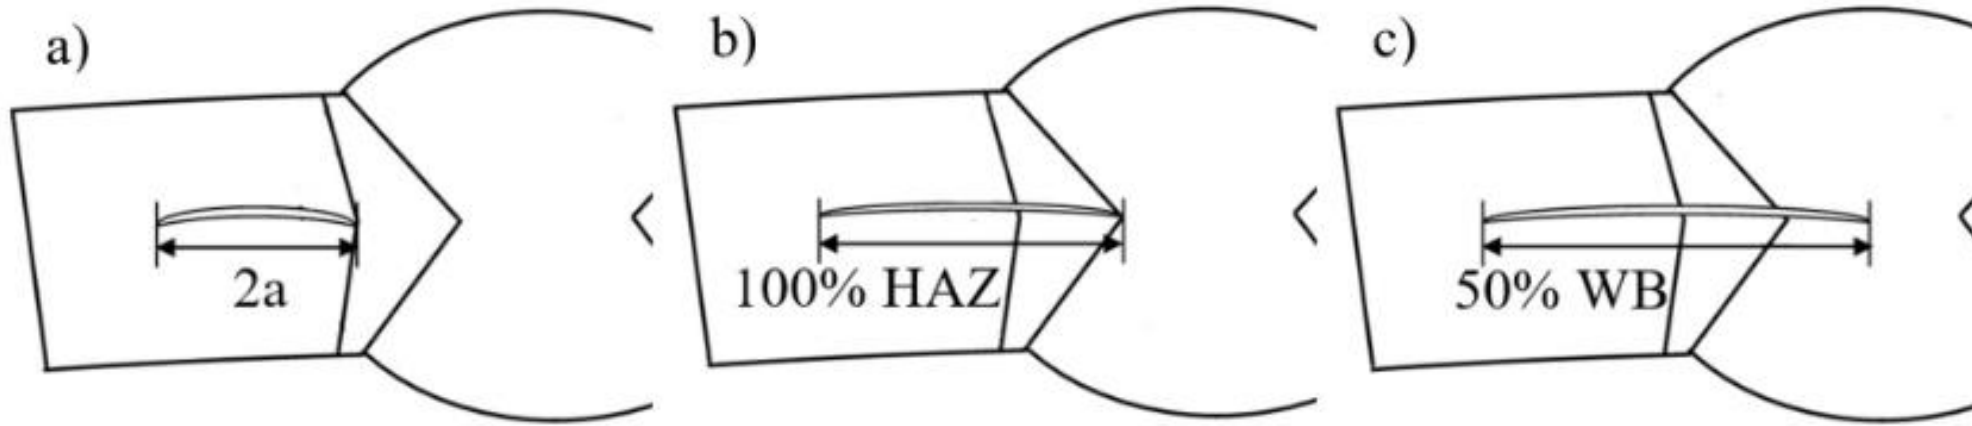

Crack propagation

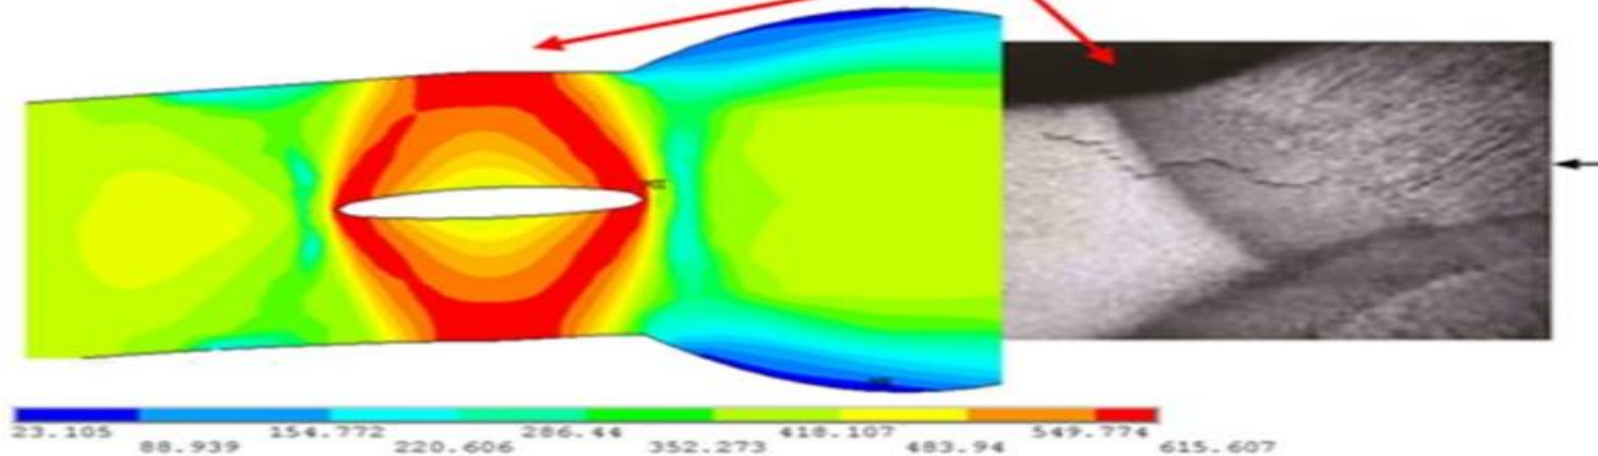


DEVELOP BY ULTRASONIC TESTING

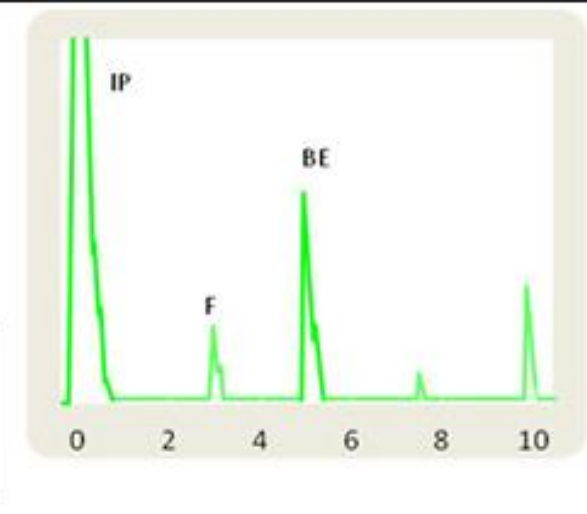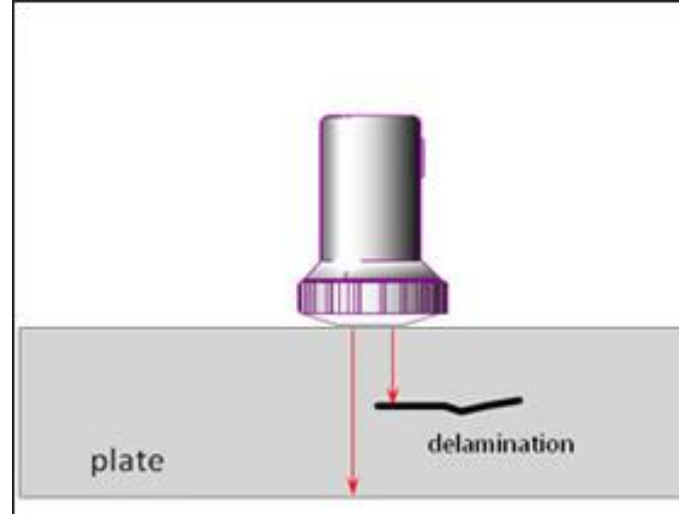




LAMINATIONS

- Base Metal Discontinuity
- May require repair prior to welding
- Formed during the milling process

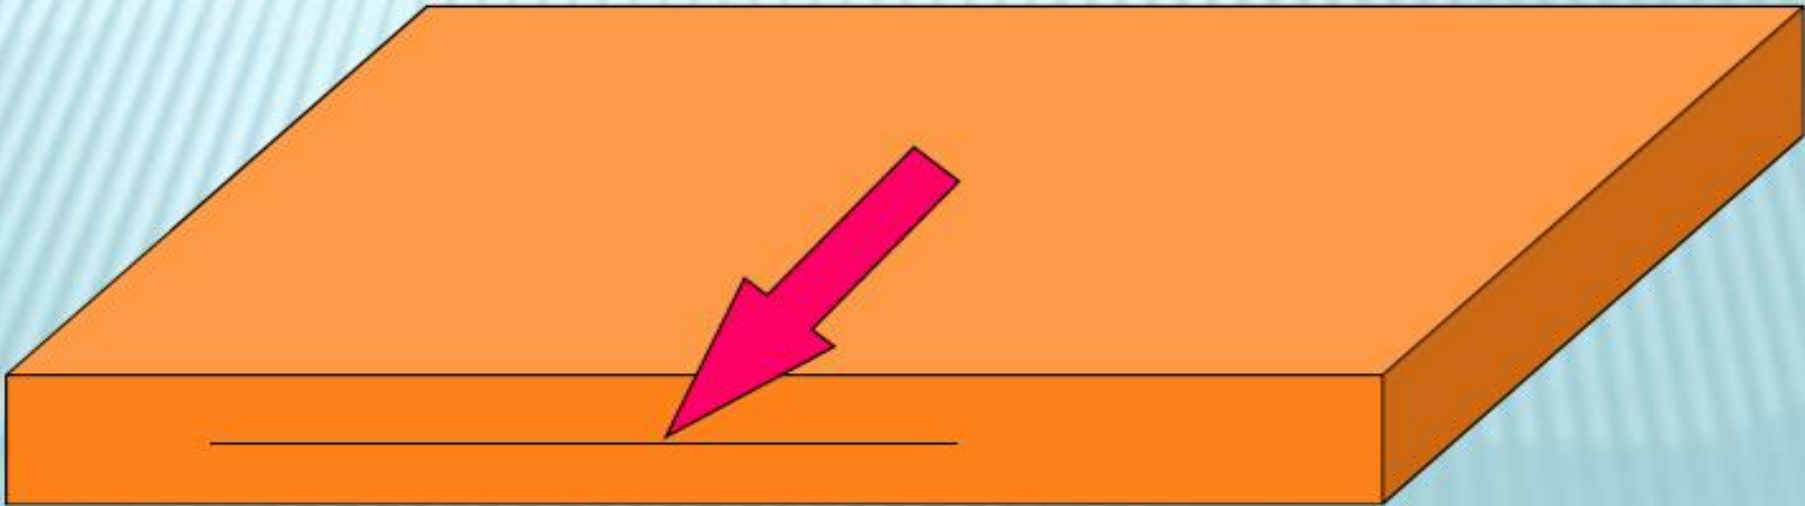

Lamination effects can be reduced by joint design:

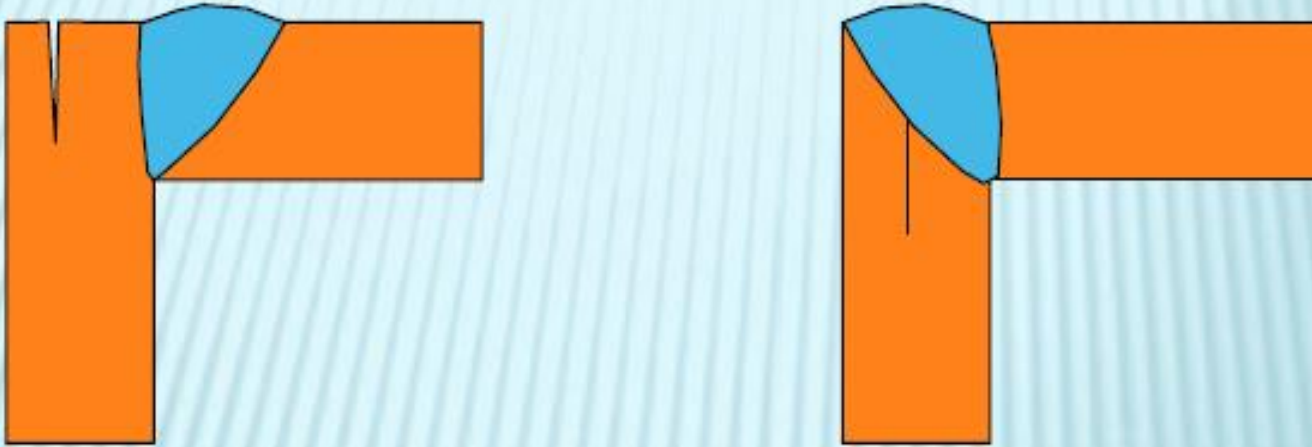

Material Inspection




Plate Lamination



شرکت صنایع پتروشیمی سیلان



Porosity

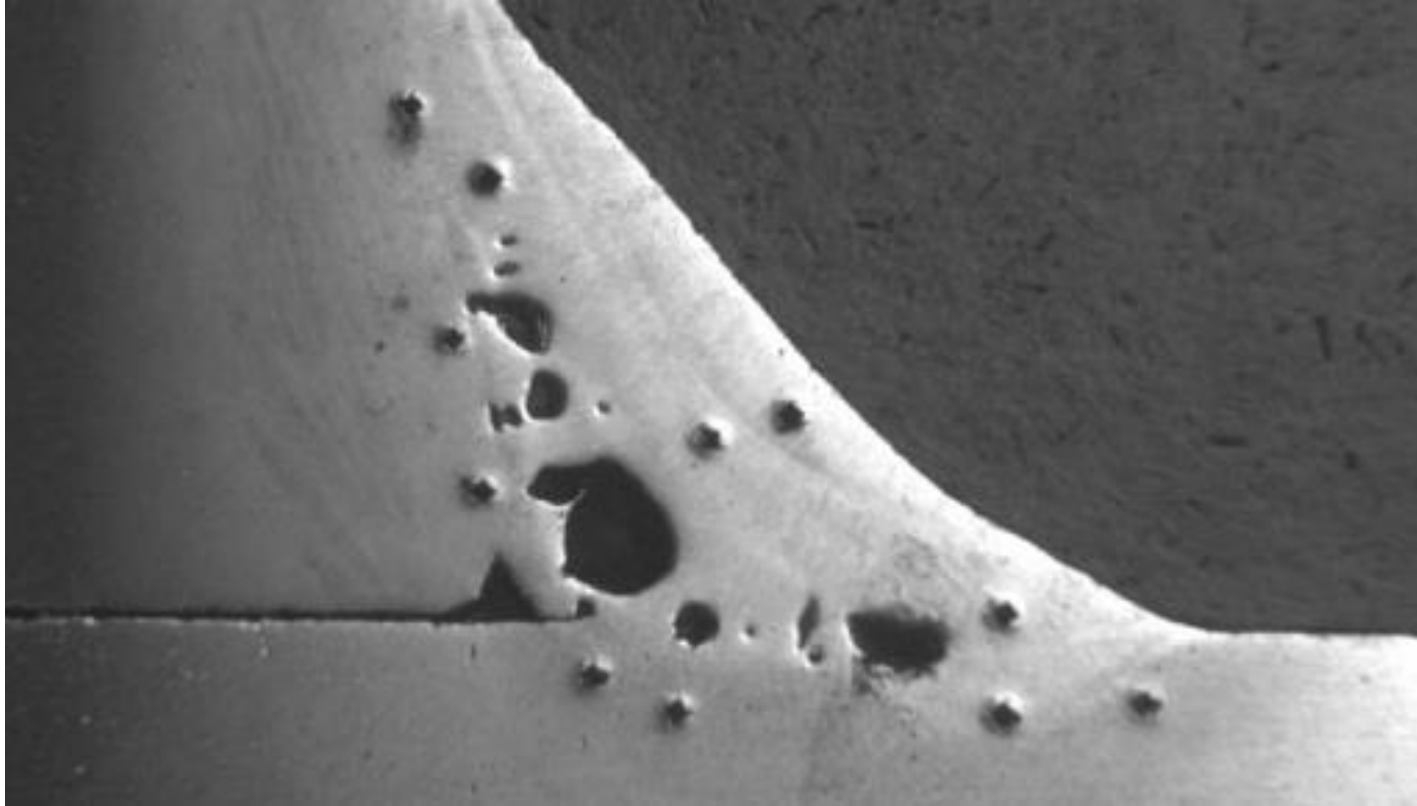




POROSITY

- ▶ تخلخل عبارت است از حبس حفره های ناشی از حضور گاز در زمان انجماد حوضچه مذاب می باشد.
- ▶ با توجه به شکل حفره ای آنها به شکل کروی یا کرمی شکل یا مخروطی می باشند.
- ▶ در محل بروز تخلخل احتمال شکست بسیار زیاد می باشد به دلیل تمرکز تنش.



GEOMETRY OF POROSITY




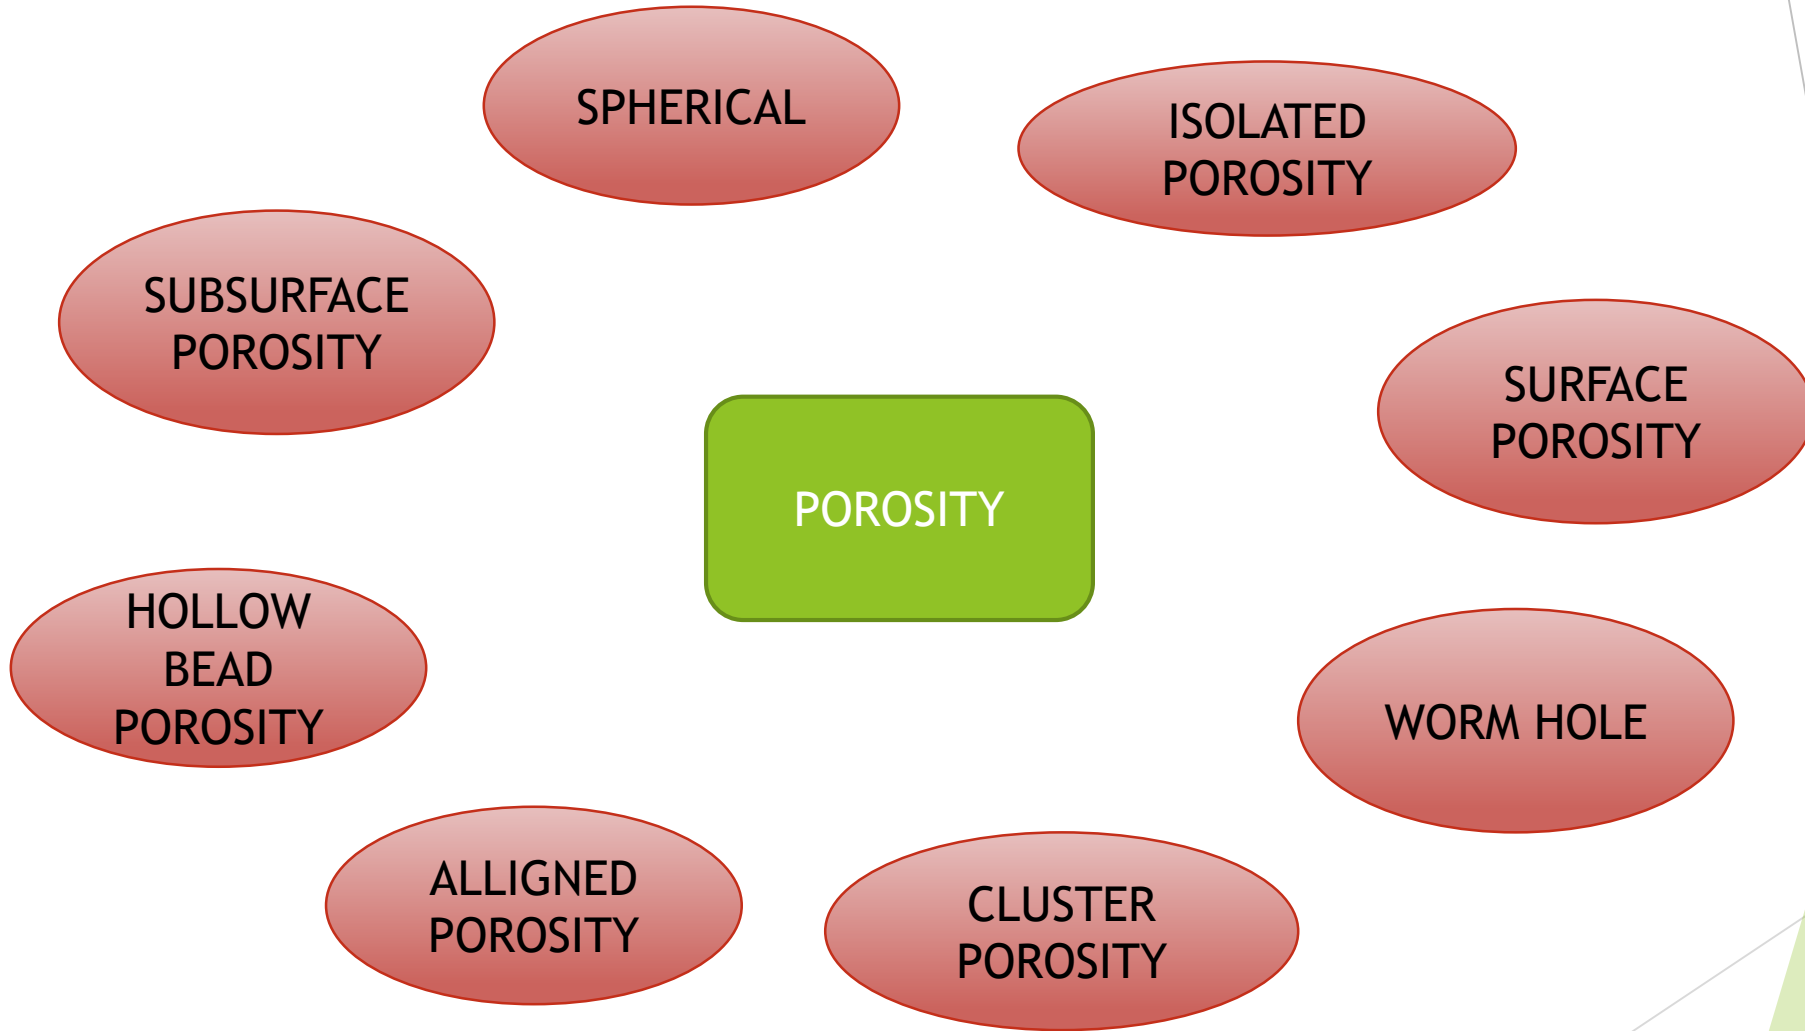


POROSITY RESULTS WHEN:

- ▶ رطوبت ، روغن ، چربی در قطعه کار و الکتروود
- ▶ وزش باد
- ▶ طول قوس بلند
- ▶ عدم حفاظت توسط گاز محافظ یا کثیفی بیش از اندازه کپسول گاز محافظ
- ▶ تاثیر آب خنک یا هواخنک بودن تورچ
- ▶ عدم حفاظت توسط گاز محافظ و ورود اتمسفر هوا در مذاب
- ▶ سریع سرد شدن مذاب و حبس پروسیتی در جوش
- ▶ عدم حفاظت از گاز پشت بند و گاز همراه





HOLLOW BEAD POROSITY

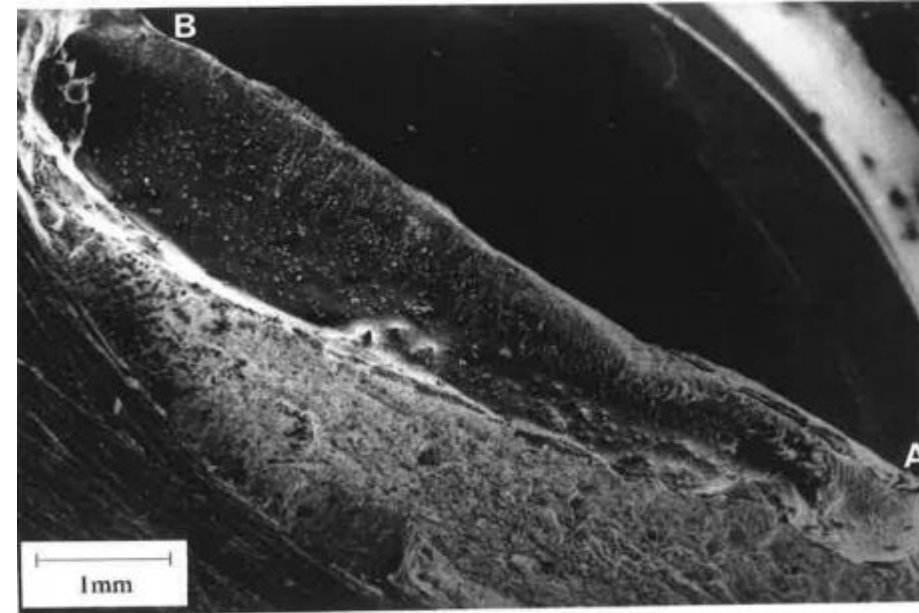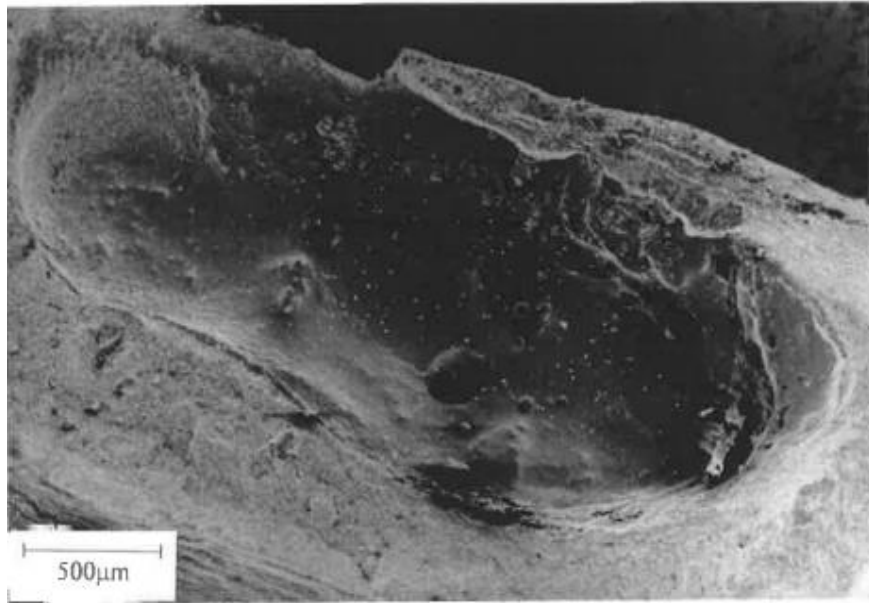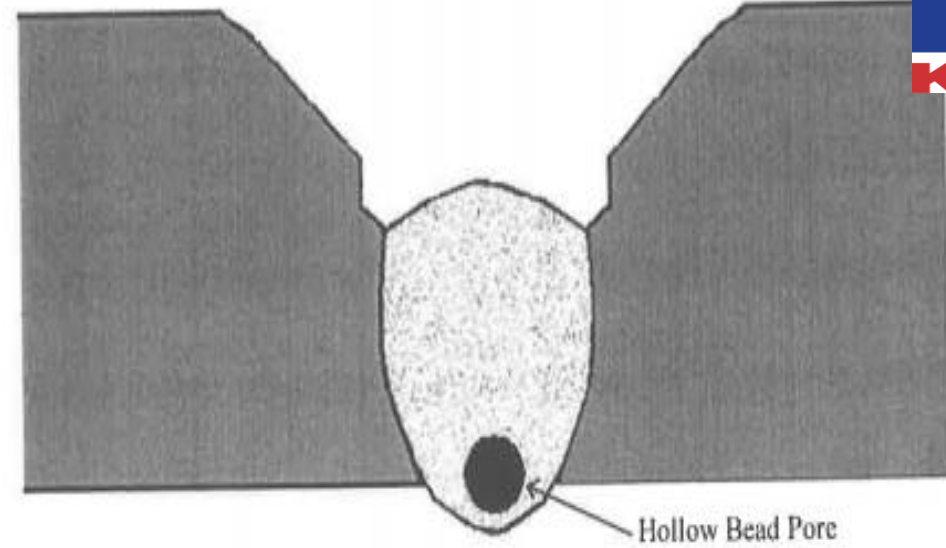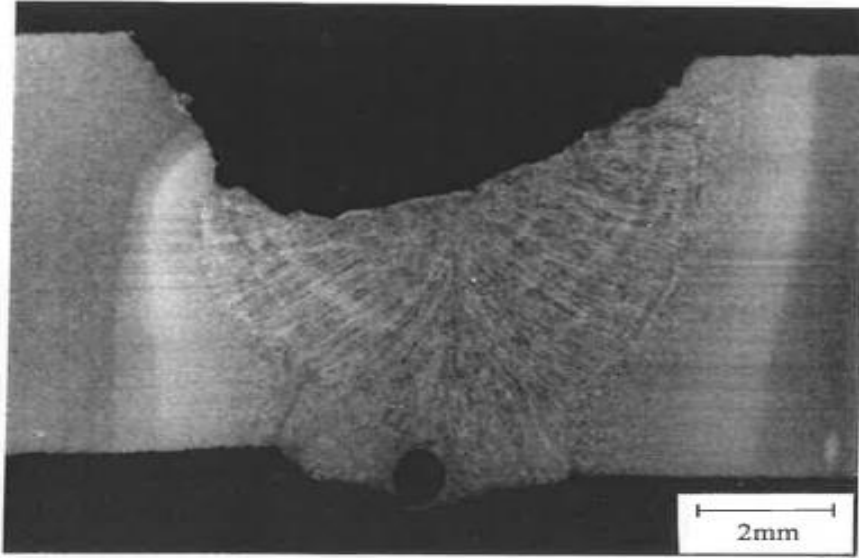




REASONS



- ▶ استفاده از الکترودهای سلولزی به دلیل ایجاد گازهای CO , CO_2 , H_2
- ▶ آمپر زیاد
- ▶ زیاد بودن طول قوس الکتریکی

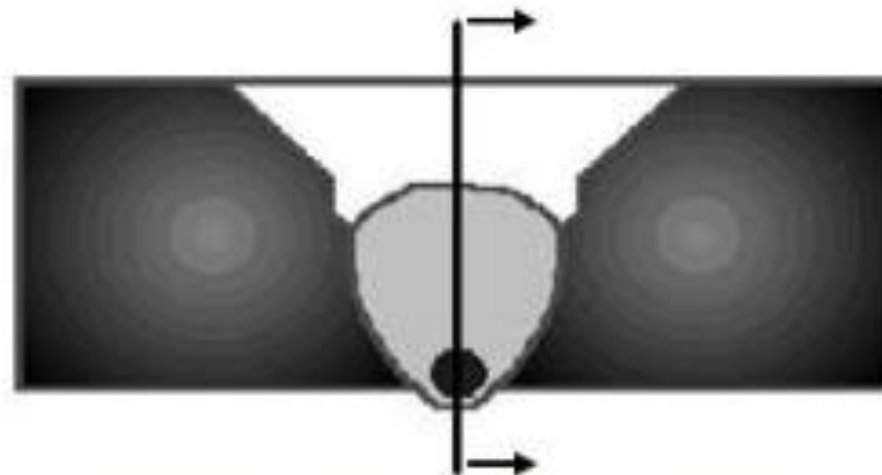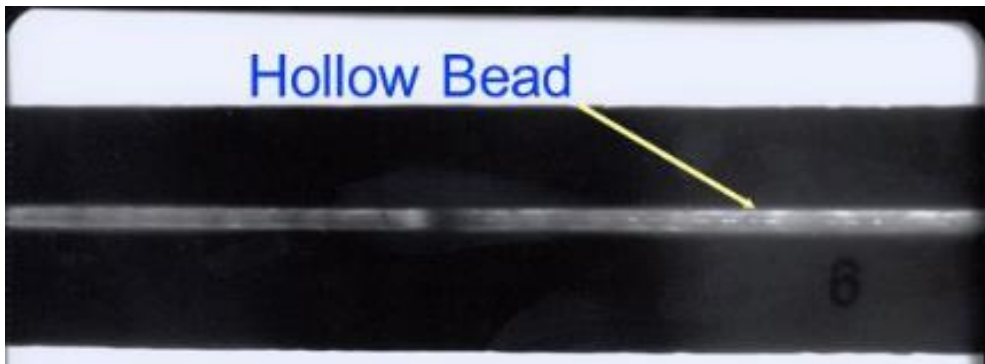



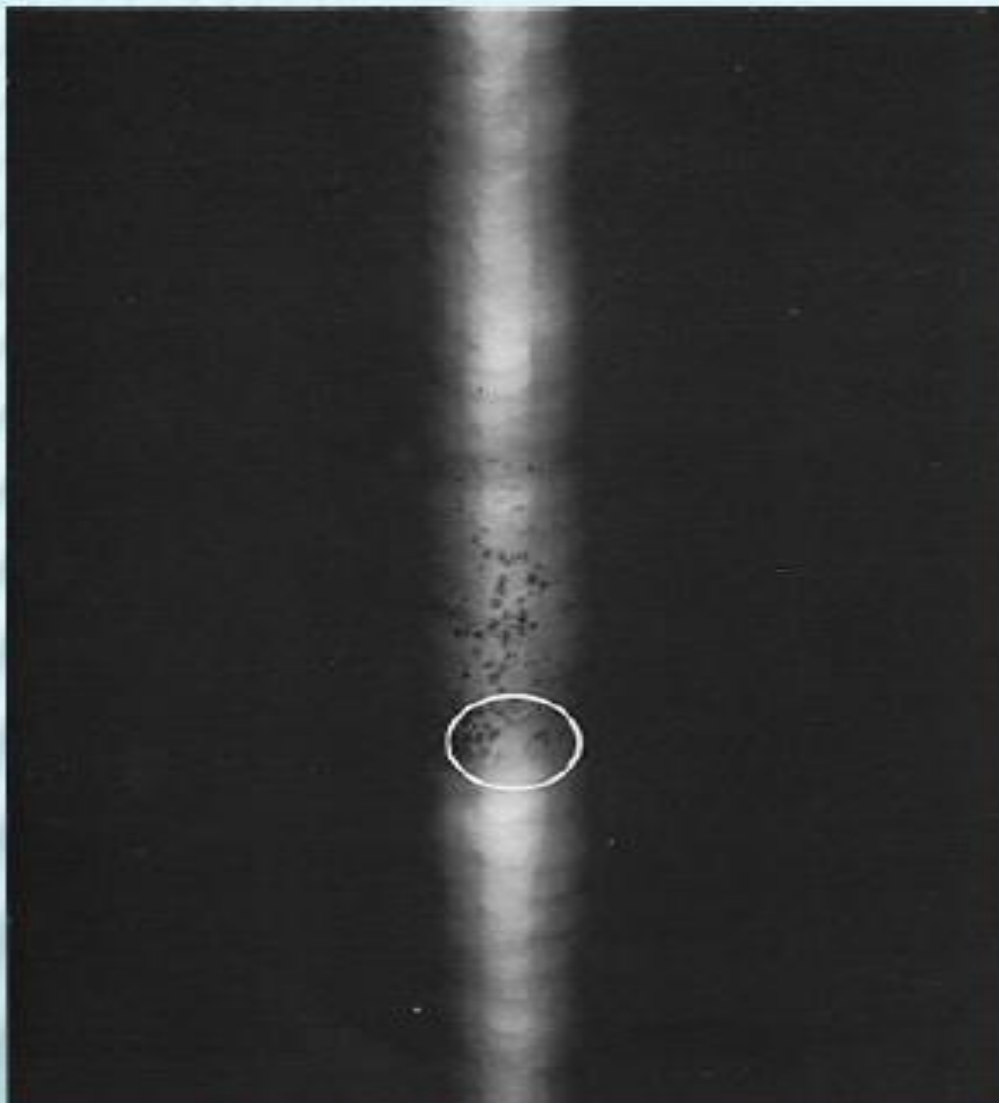


Cluster porosity

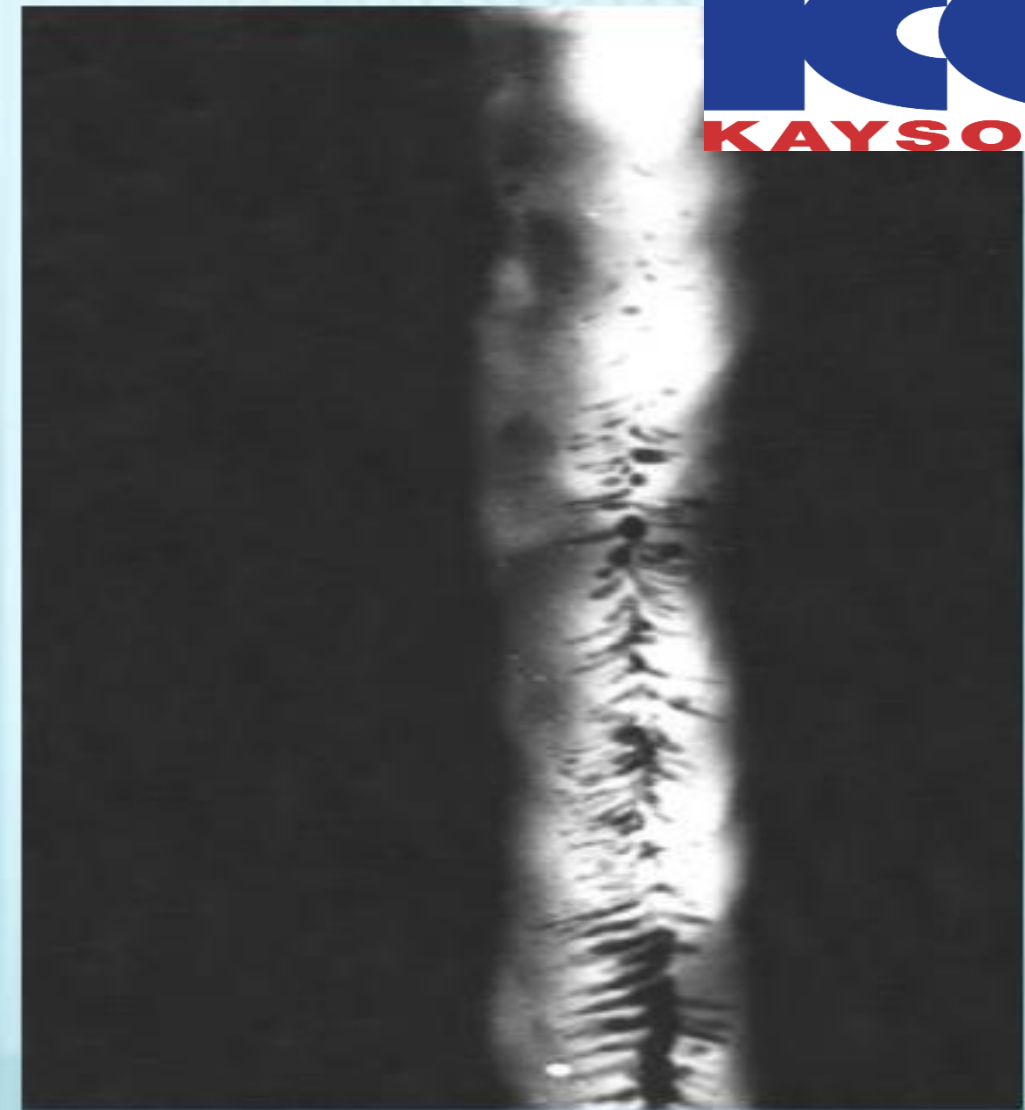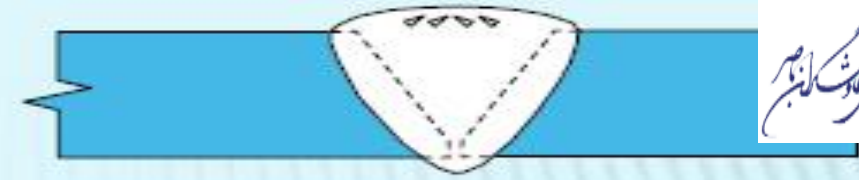

Herringbone porosity



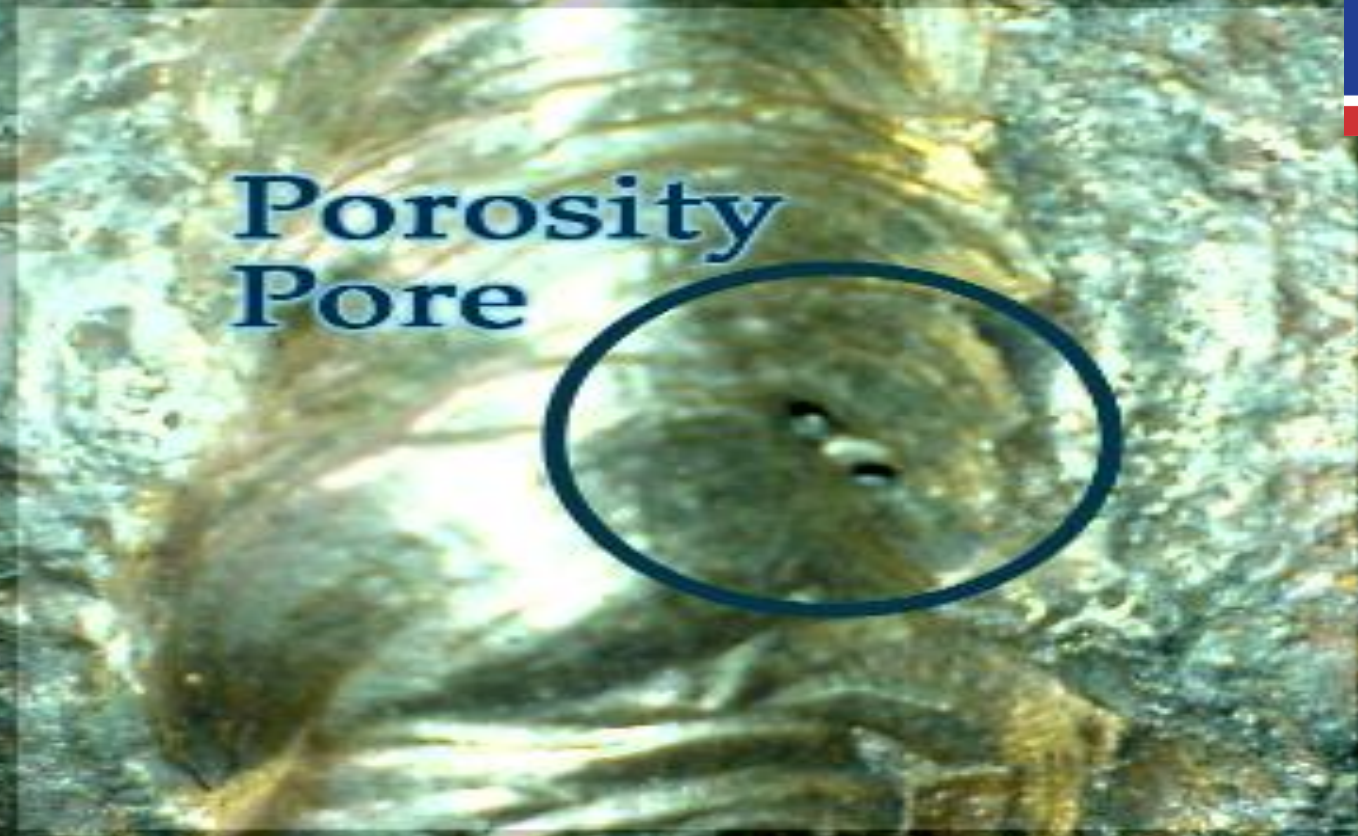

Porosity
Pore



شرکت صنایع پتروشیمی سیلان






شرکت صنایع پتروشیمی سبلان



Weld Root Defects

A shallow groove caused by contraction in the weld metal along each side of the penetration bead

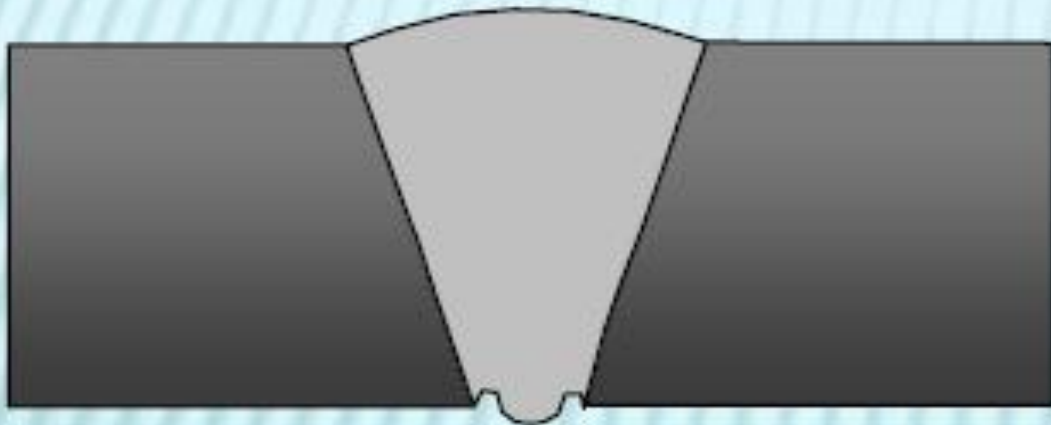

Shrinkage groove

Insufficient weld metal deposited in the root pass

Too fast a cooling rate during the application of the root bead pass

Poor welding technique

A shallow groove, which may occur in the root of a butt weld



Concave root

Root faces too large

Root gap too large

Excessive back purge pressure during TIG welding

Excessive root bead grinding before the application of the second pass



Weld Root Defect

Concave Root



Root penetration bead in excess in accordance with the relevant specification being used



Excessive root penetration


- Root faces too small
- Root gap too large
- Excessive amps/volts
- Slow travel speed





Weld Root Defect



**Excessive root
penetration**

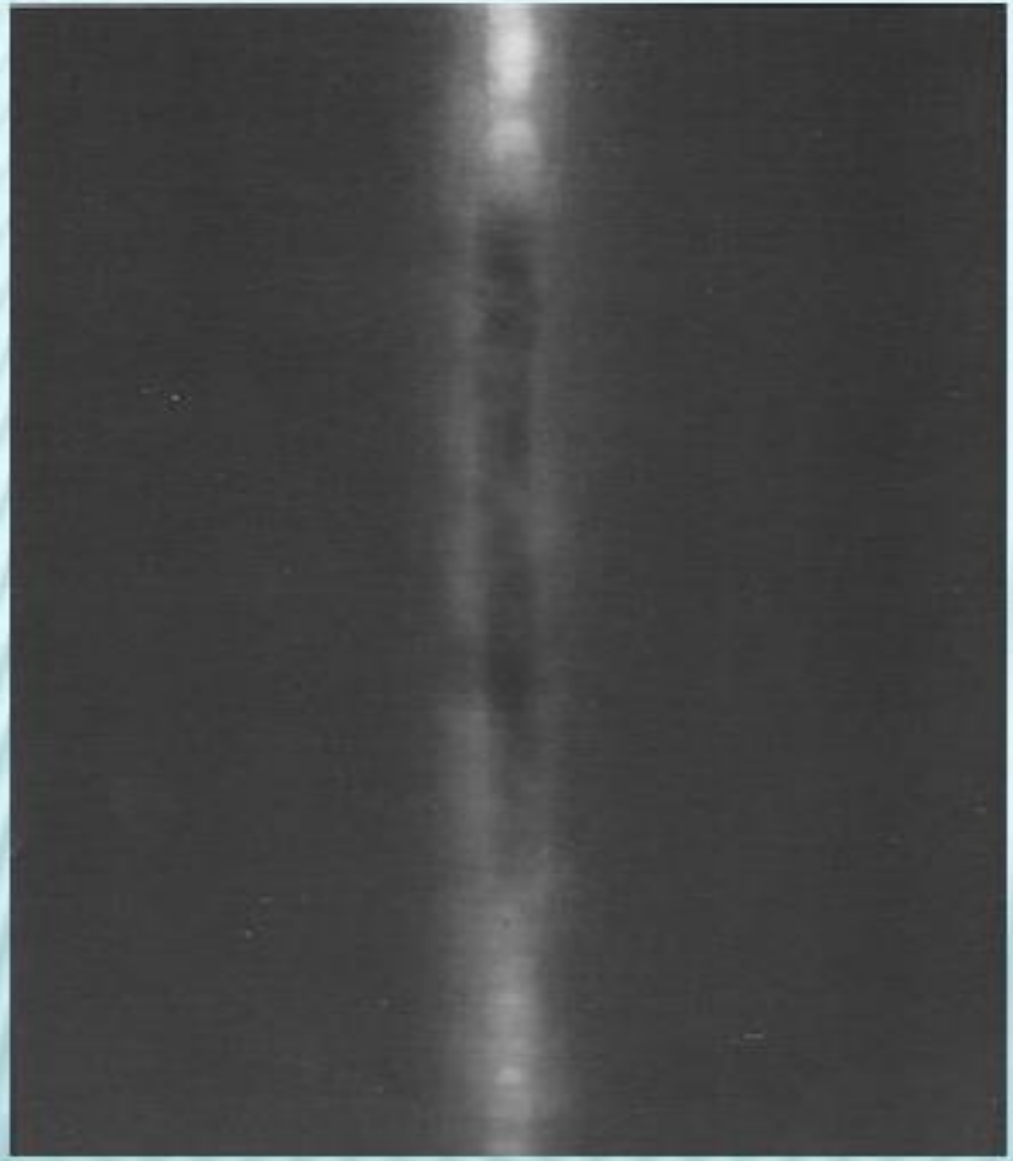

Concave root

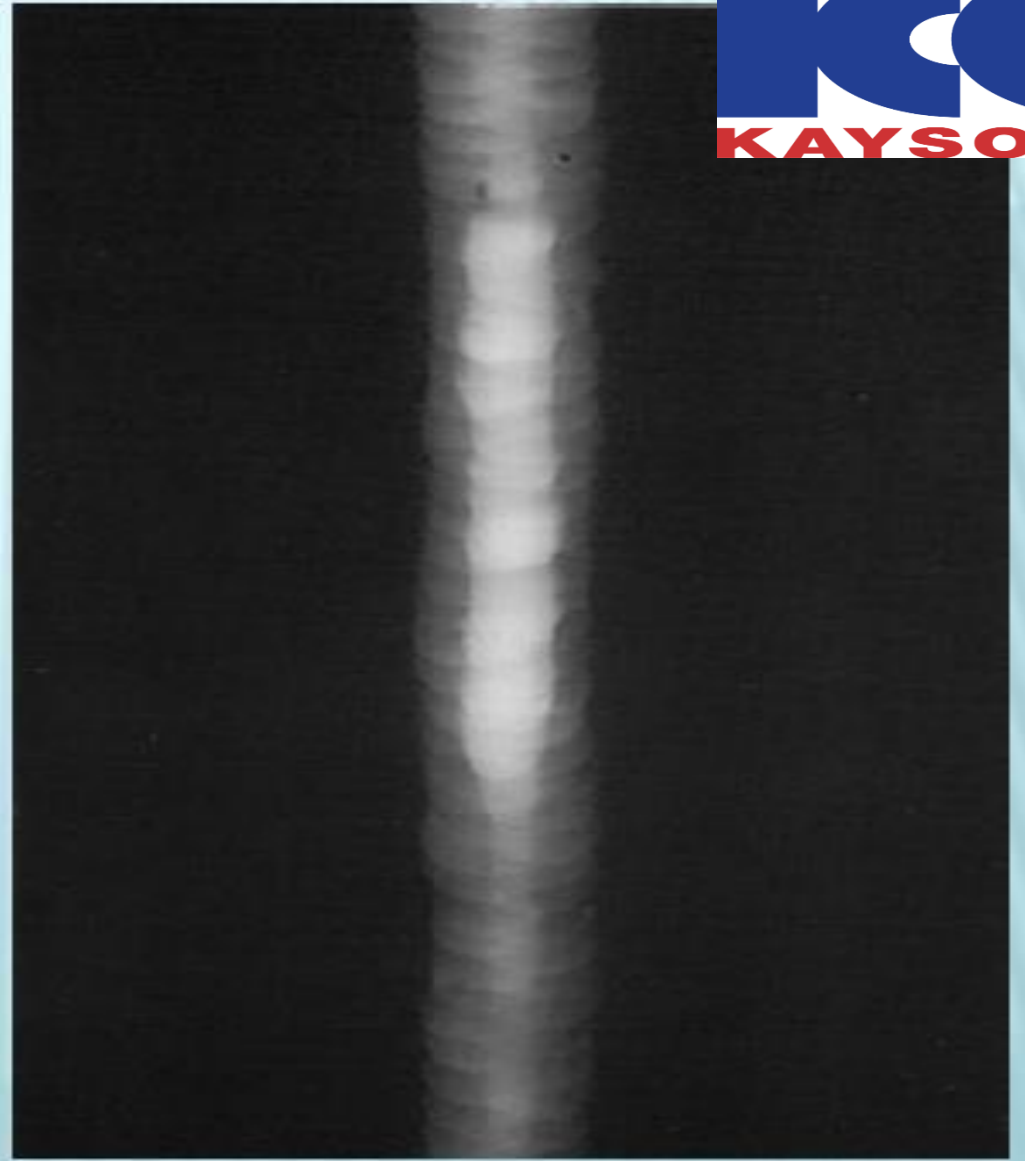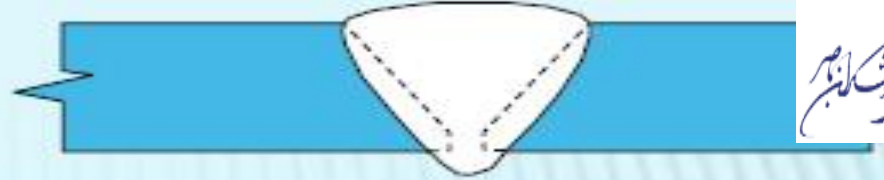

Excess root penetration

BURN-THROUGH (NON-STANDARD)


Definition: When an undesirable open hole has been completely melted through the base metal. The hole may or may not be left open.

Cause: Excessive heat input.

Prevention: Reduce heat input by increasing travel speed, use of a heat sink, or by reducing welding parameters.

Repair: Will be defined by standards. Filling may suffice. Otherwise, removal and rewelding may be required. Some standards may require special filler metal and/or PWHT.

A localized collapse of the weld pool due to excessive penetration resulting in a hole in the root run

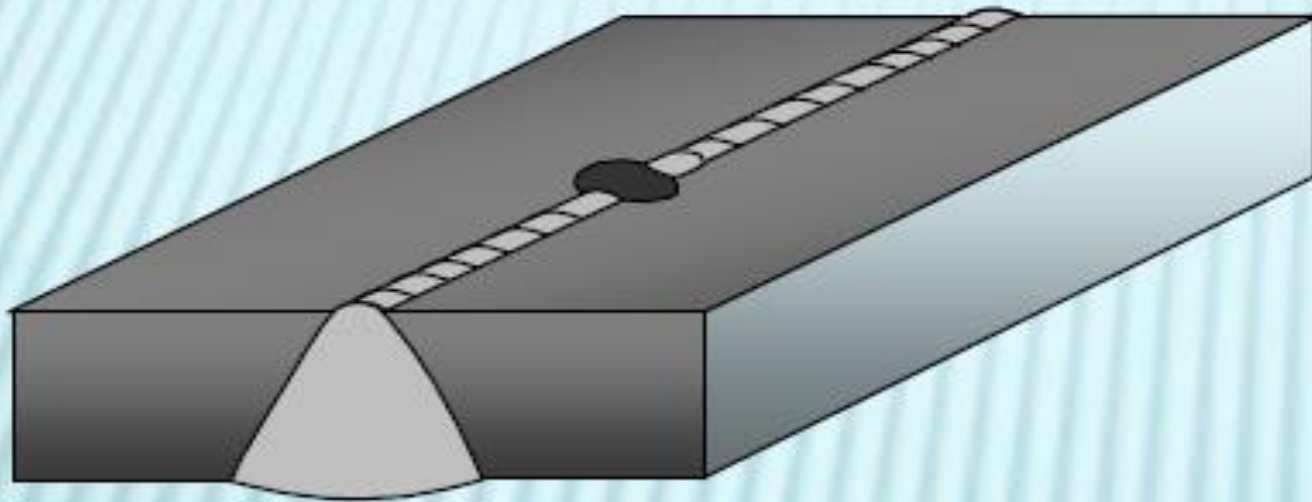

Burn through

High Amps/volts

Small Root face


Large Root Gap

Slow Travel Speed



Weld Root Defect



Burn Through

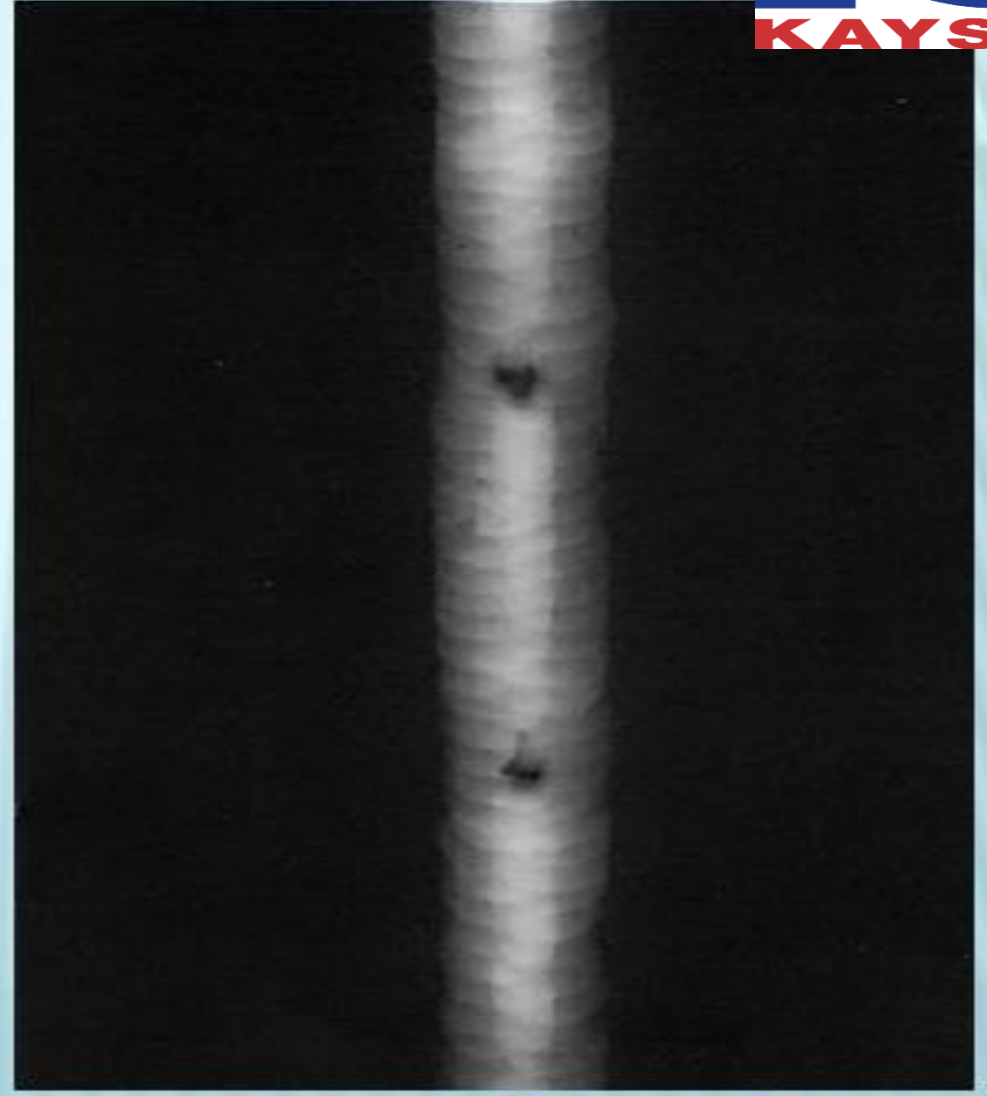

Burn through

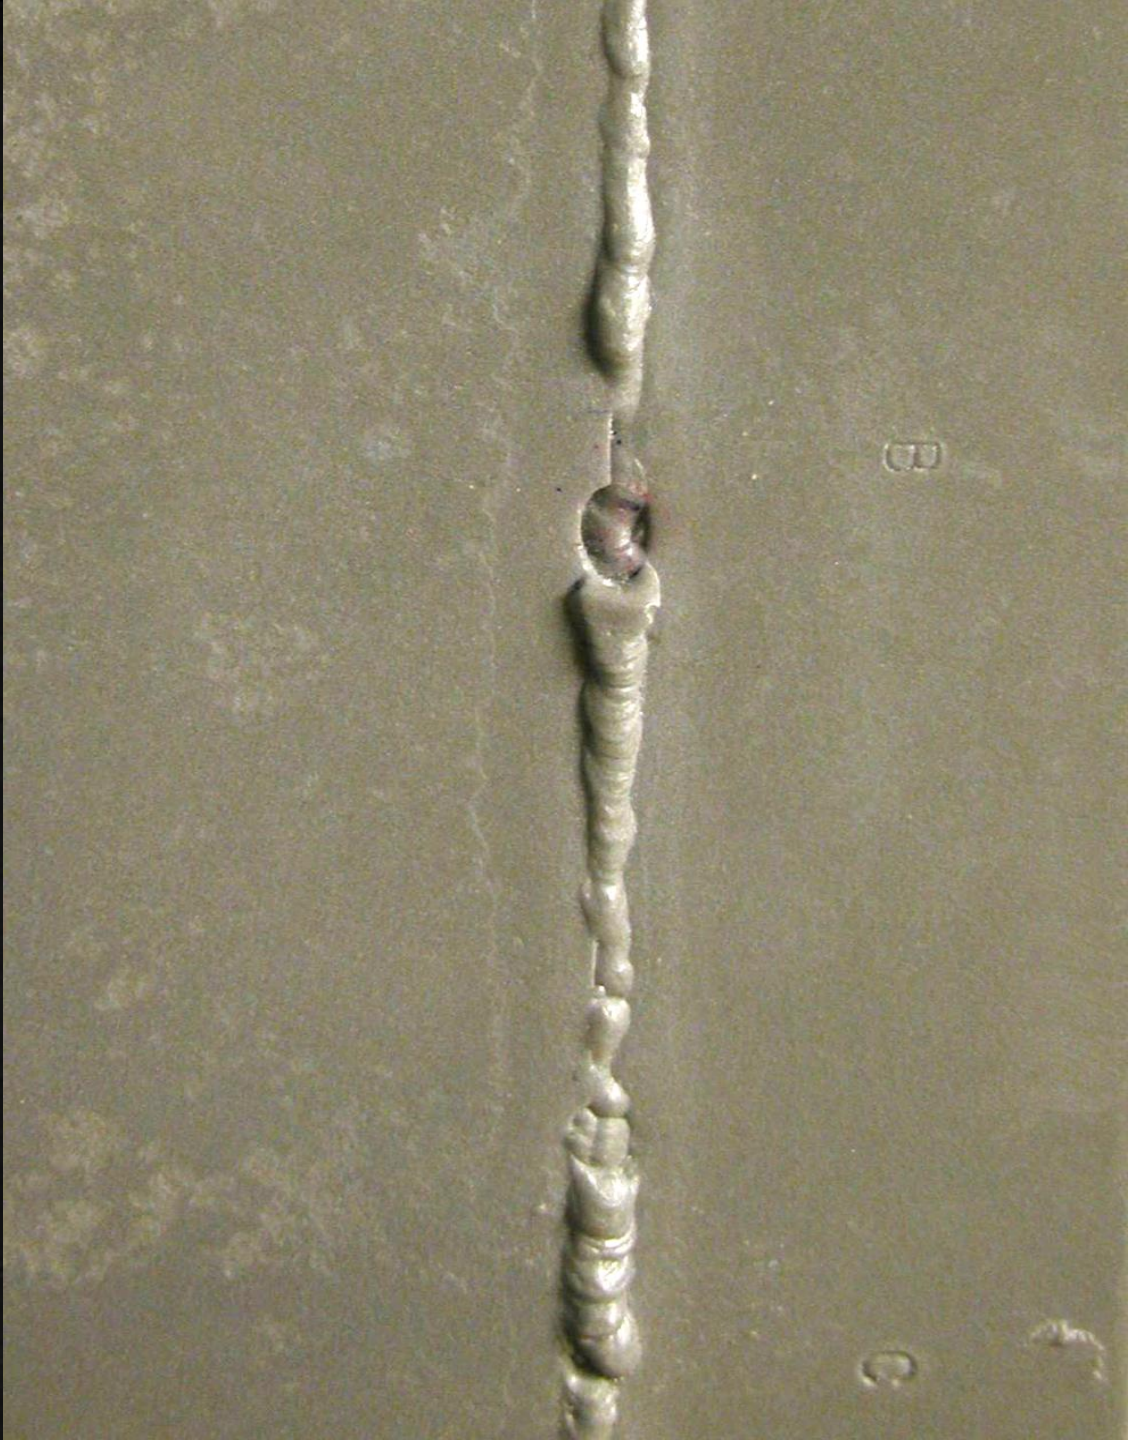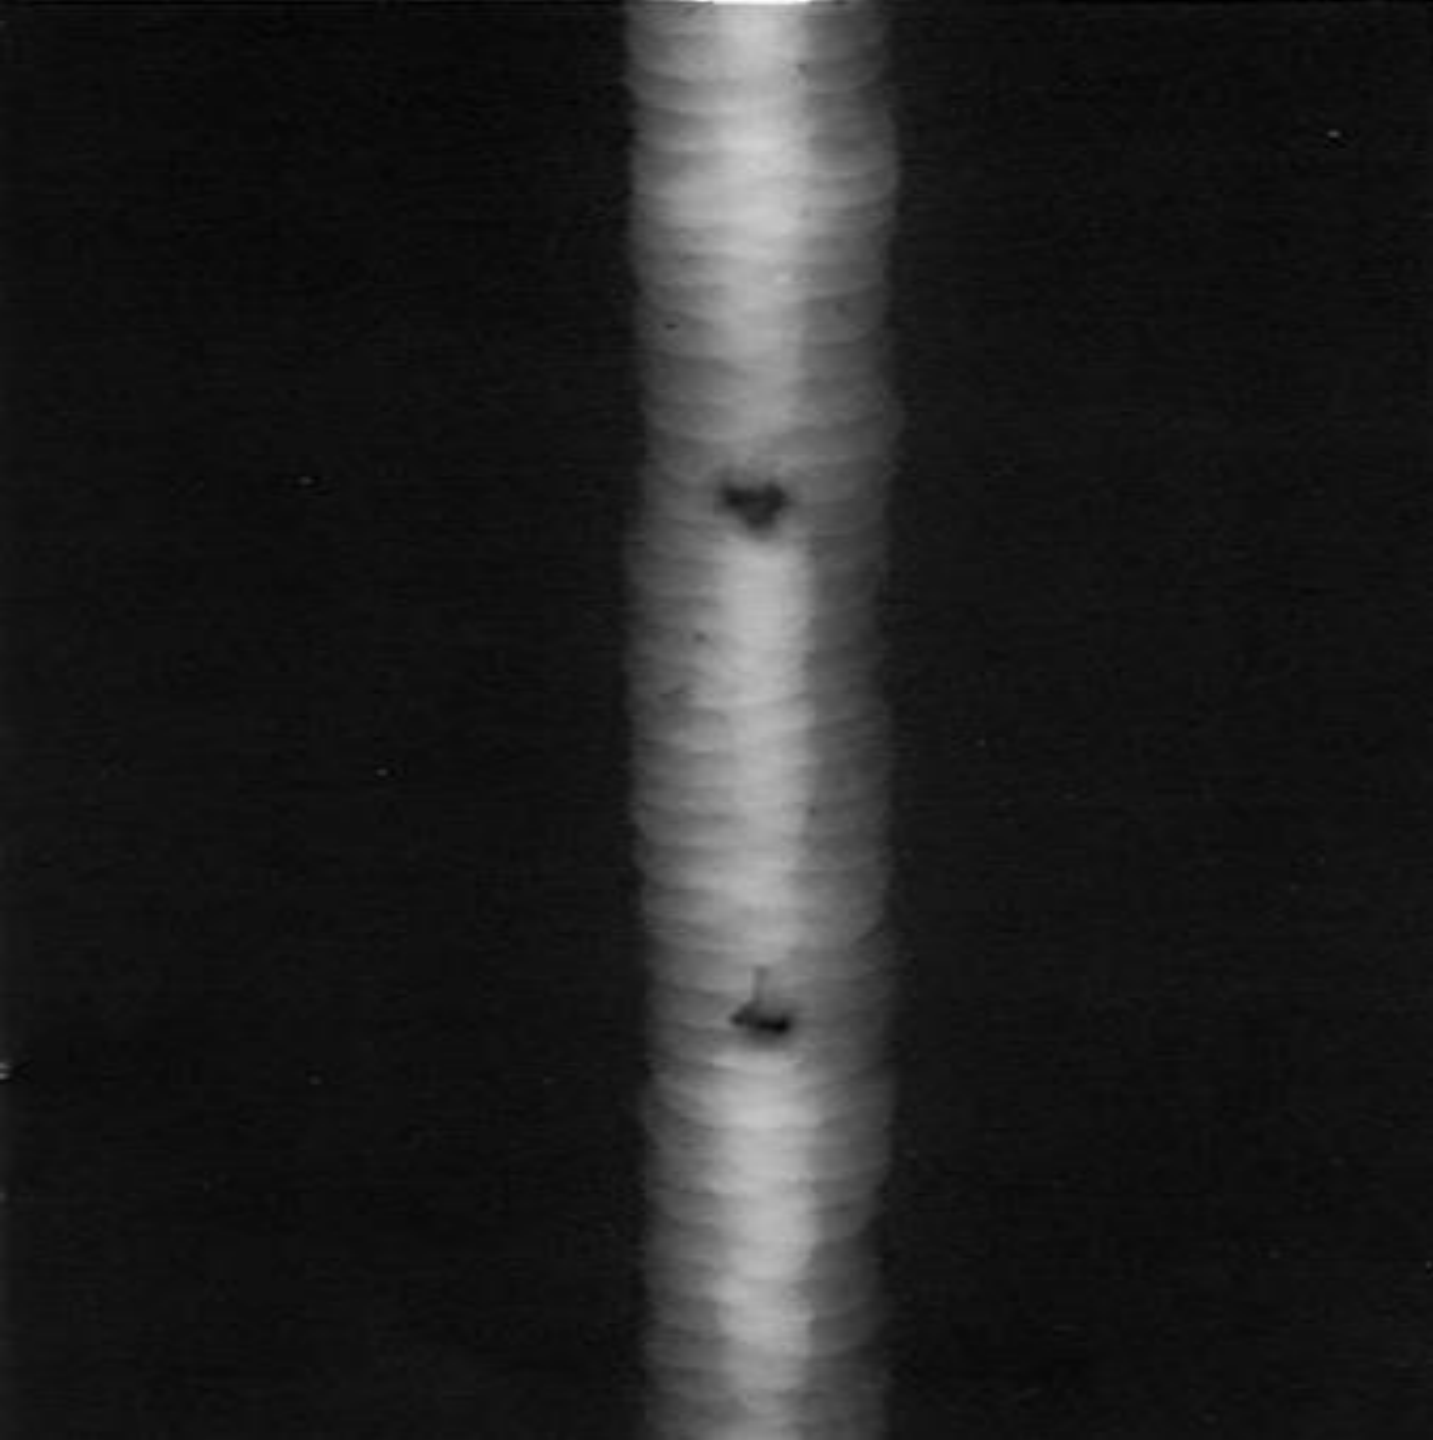



Oxidized Root (Root Coking)





Loss or insufficient back purging gas

Most commonly occurs when welding stainless steels





Purging gases include argon, helium and occasionally nitrogen

SLAG INCLUSION

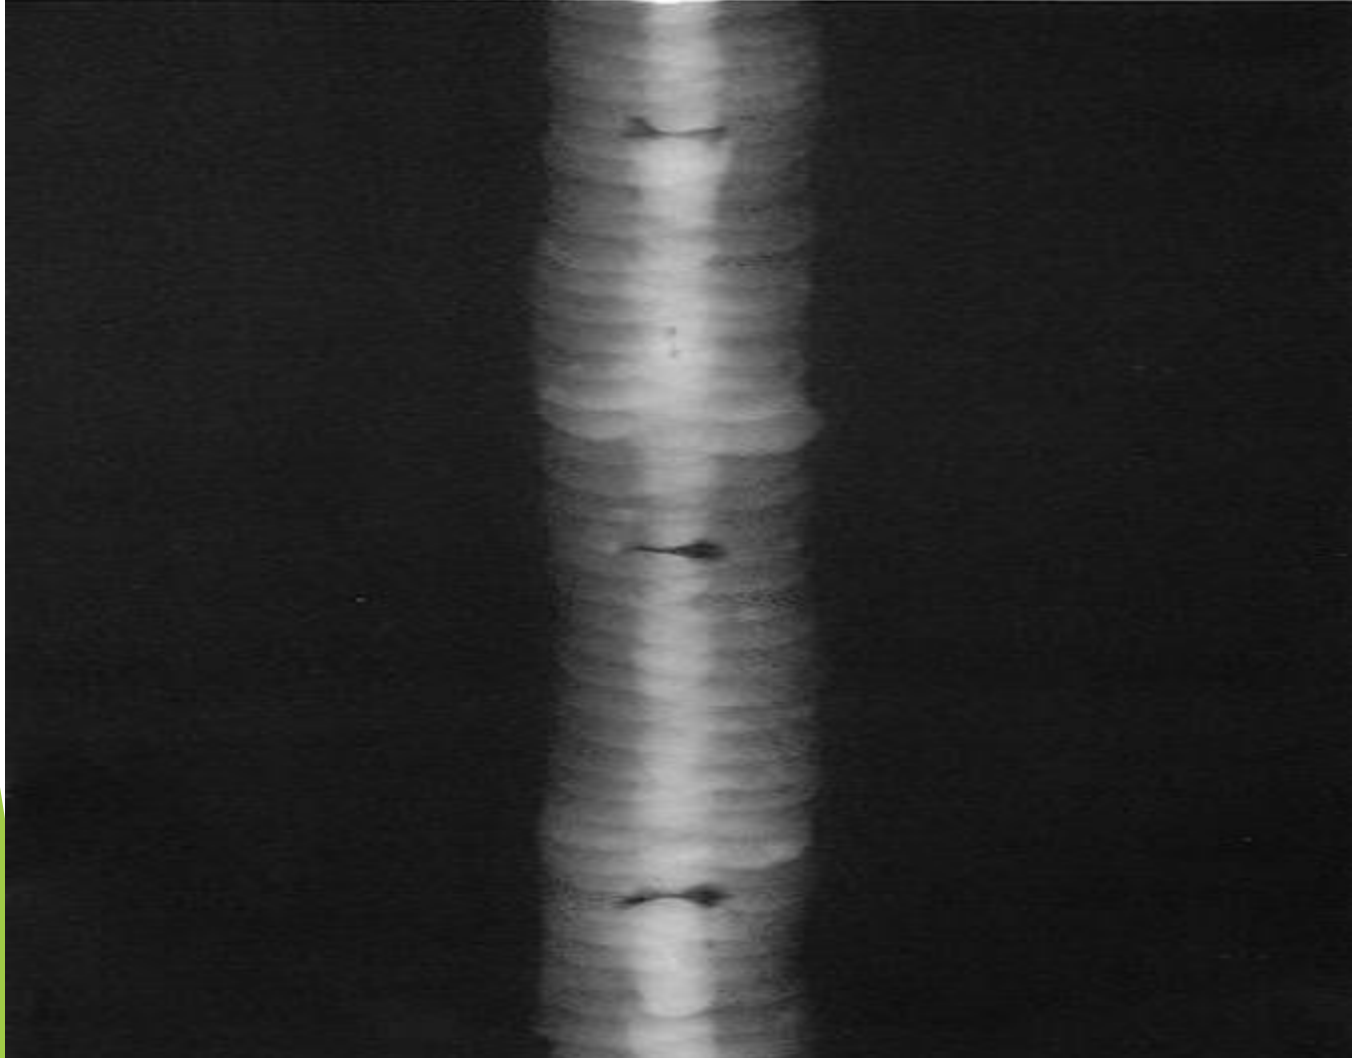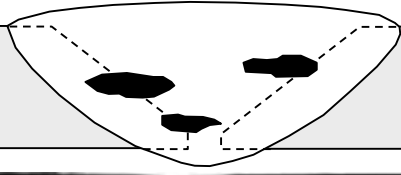

Interpass slag inclusions

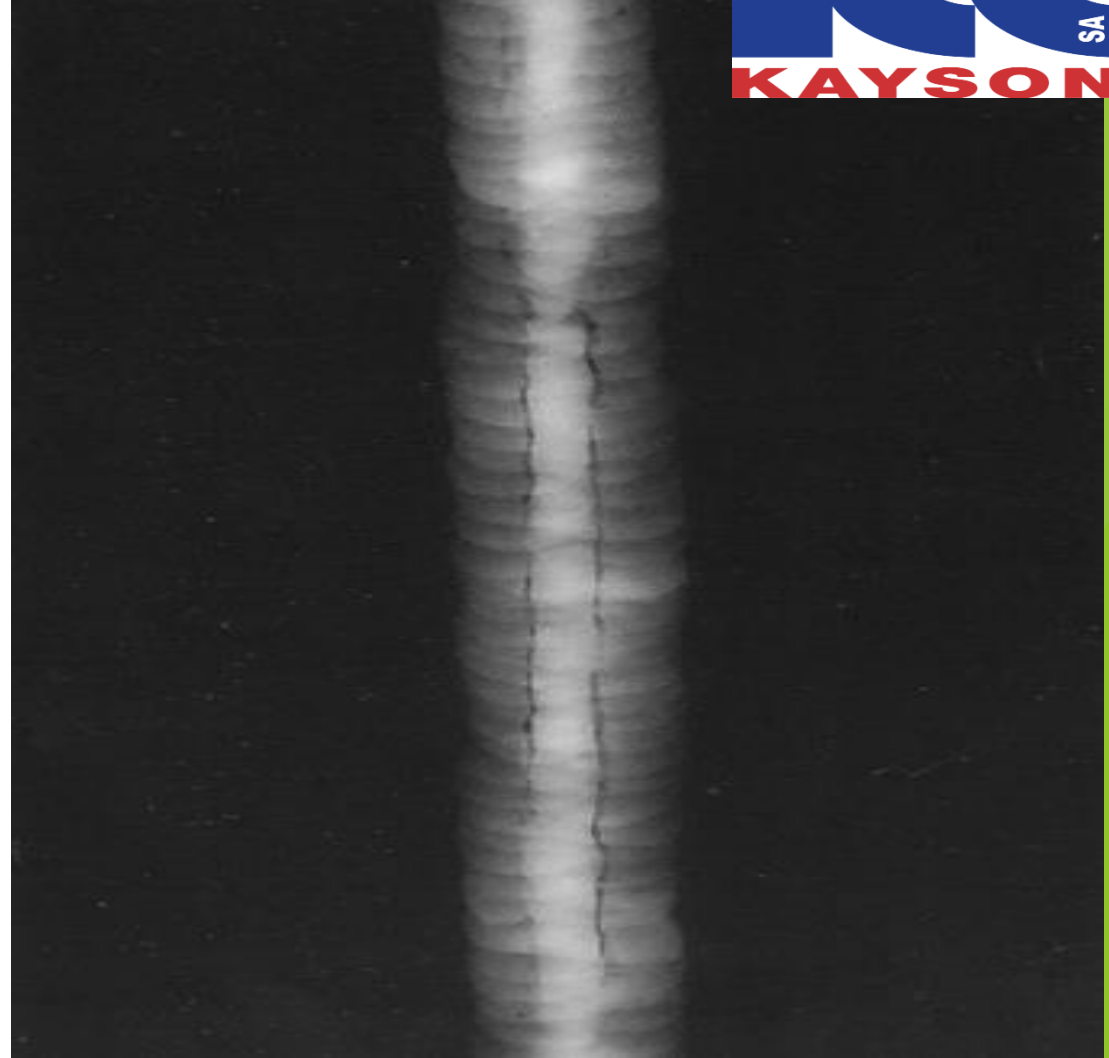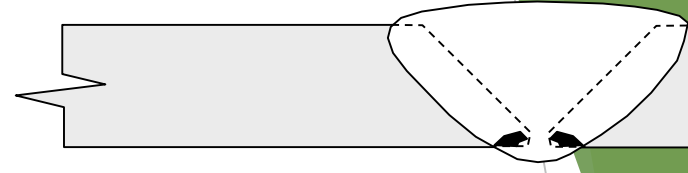


Elongated slag lines


Lack of Penetration

INCOMPLETE OR INSUFFICIENT PENETRATION


- Definition: When the weld metal does not extend to the required depth into the joint root
- Cause: Low amperage, low preheat, tight root opening, fast travel speed, short arc length.
- Prevention: Correct the contributing factor(s).
- Repair: Back gouge and back weld or remove and reweld.

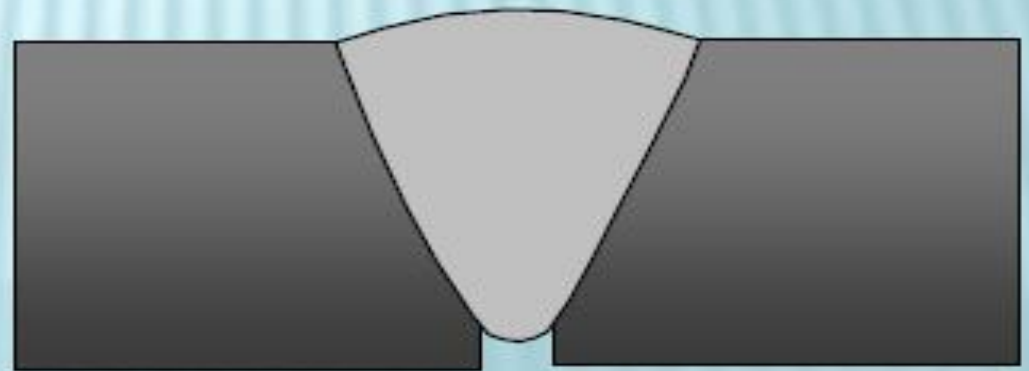

Incomplete root penetration

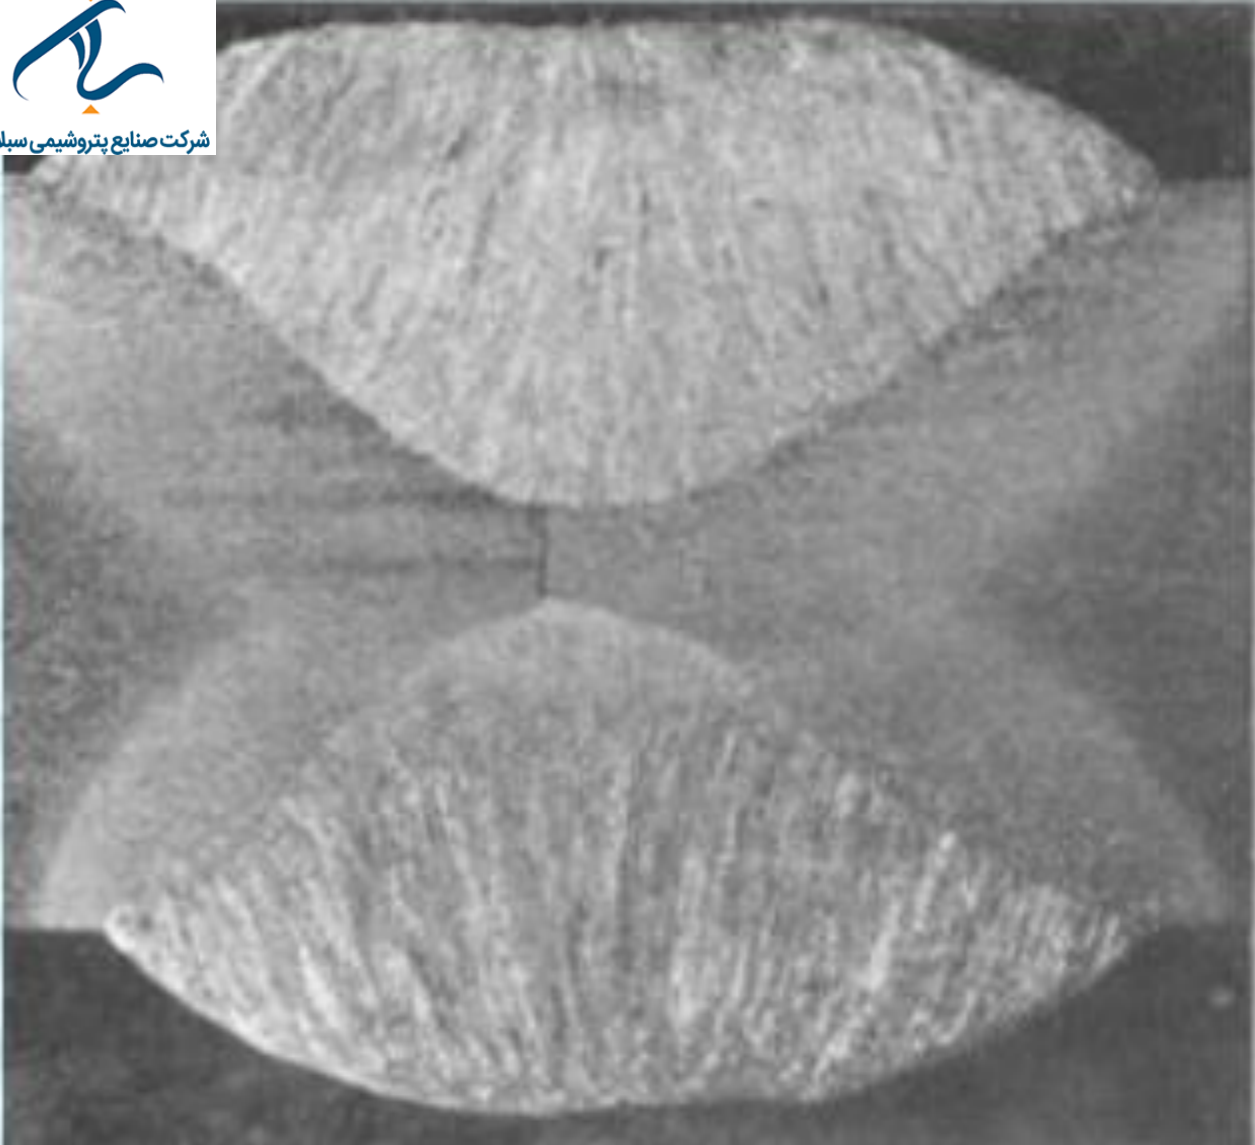

RADIOGRAPH G

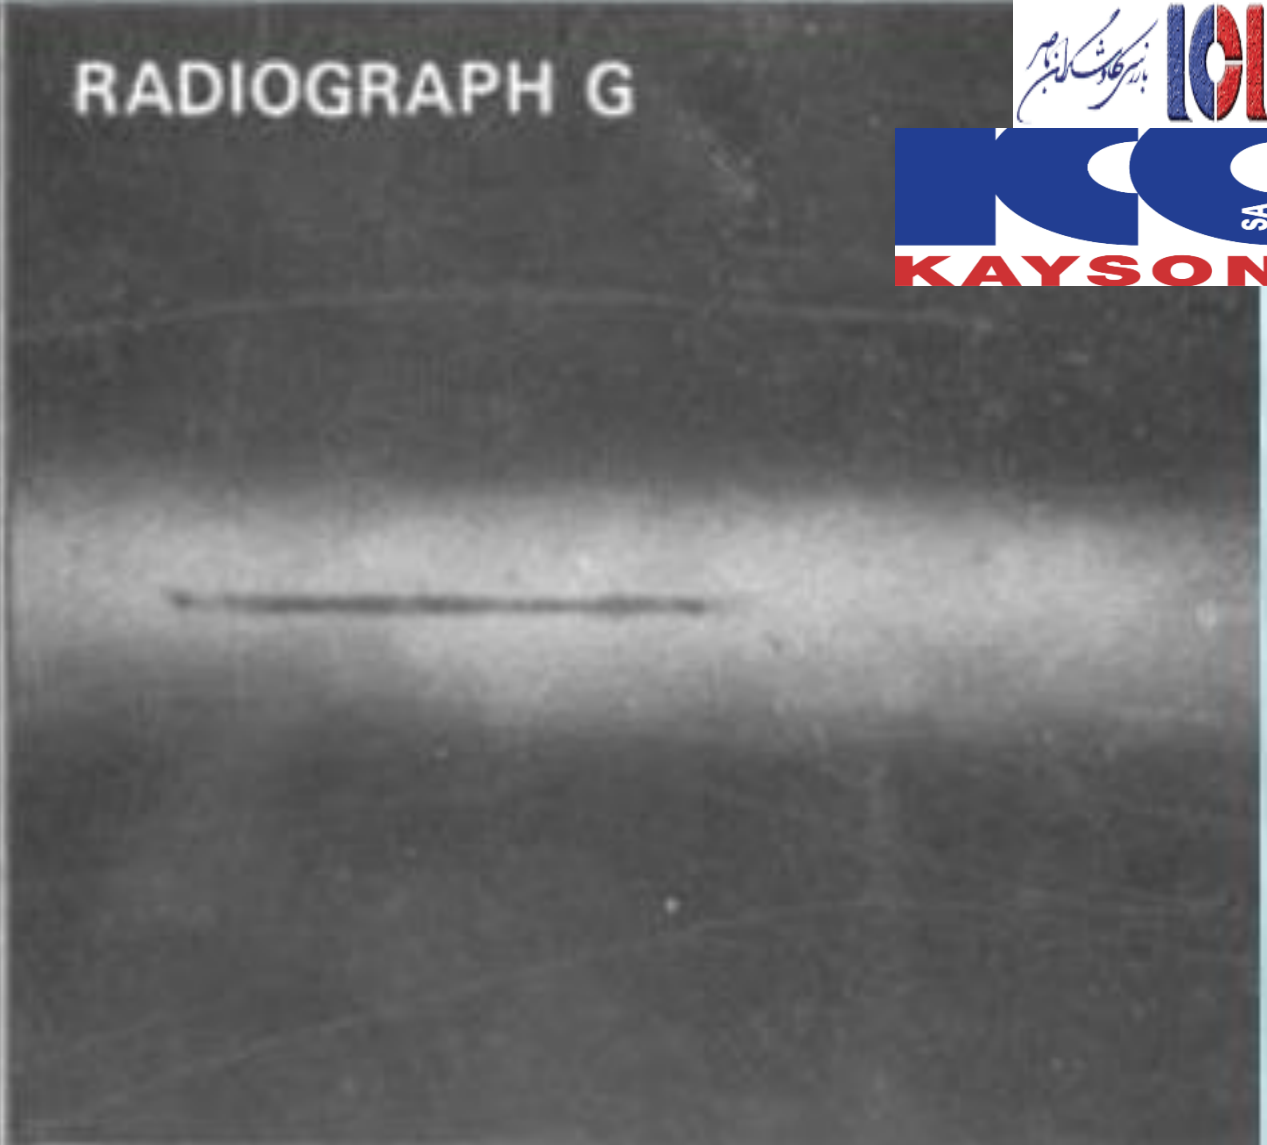

Lack of penetration




Weld Root Defects




Lack of root fusion

Lack of root Penetration

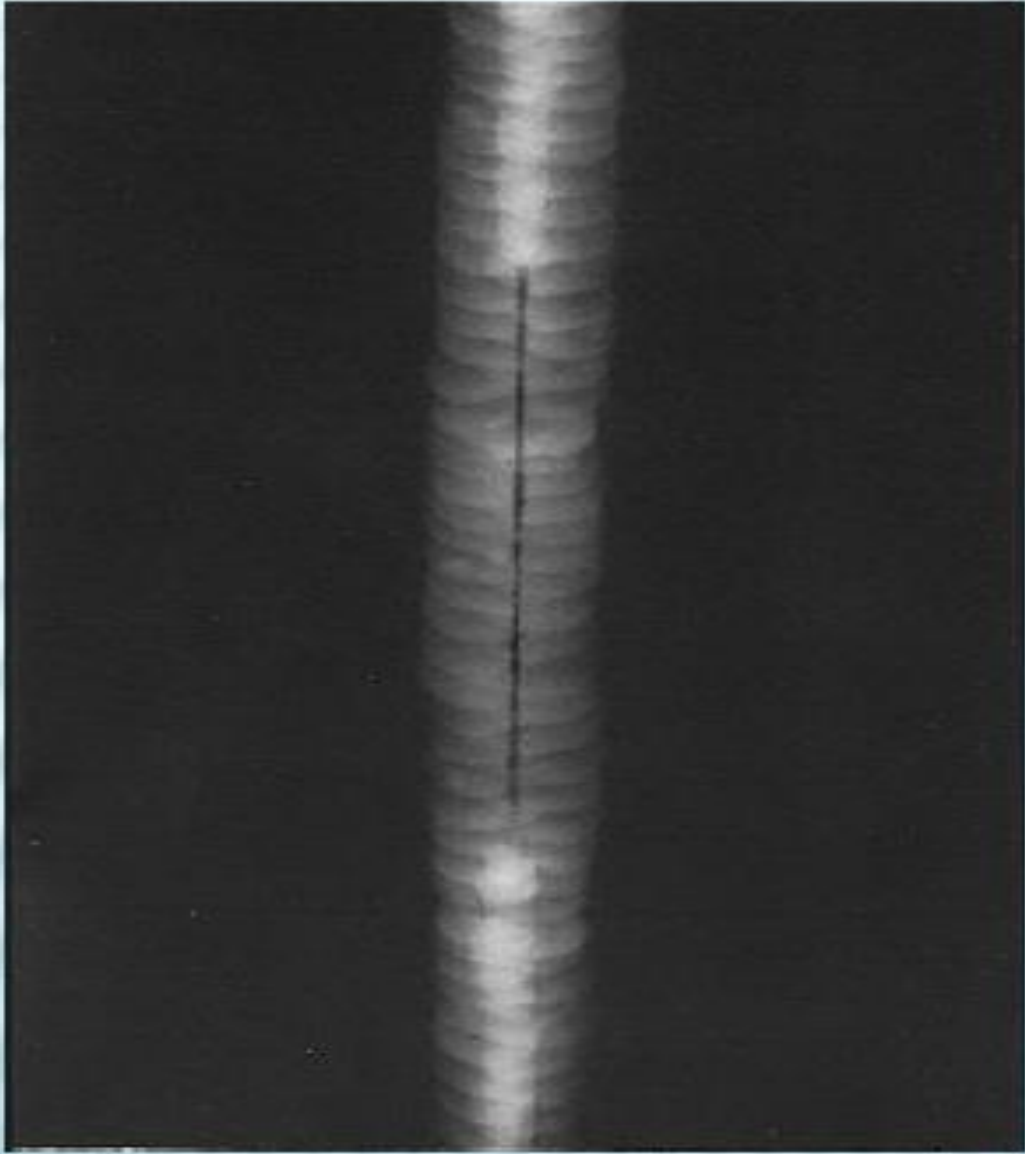


Lack of root penetration

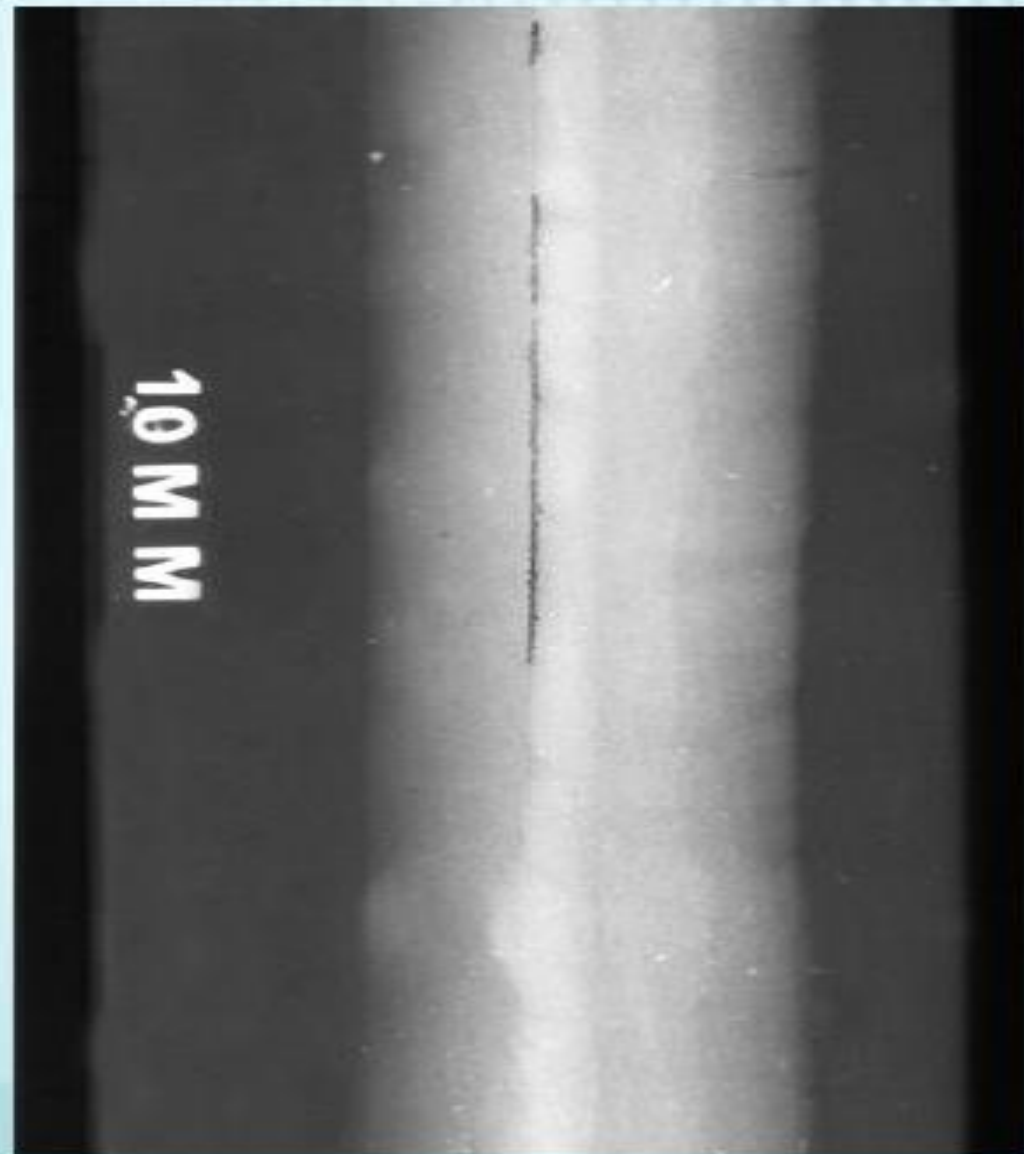


Lack of root fusion



L.O.P

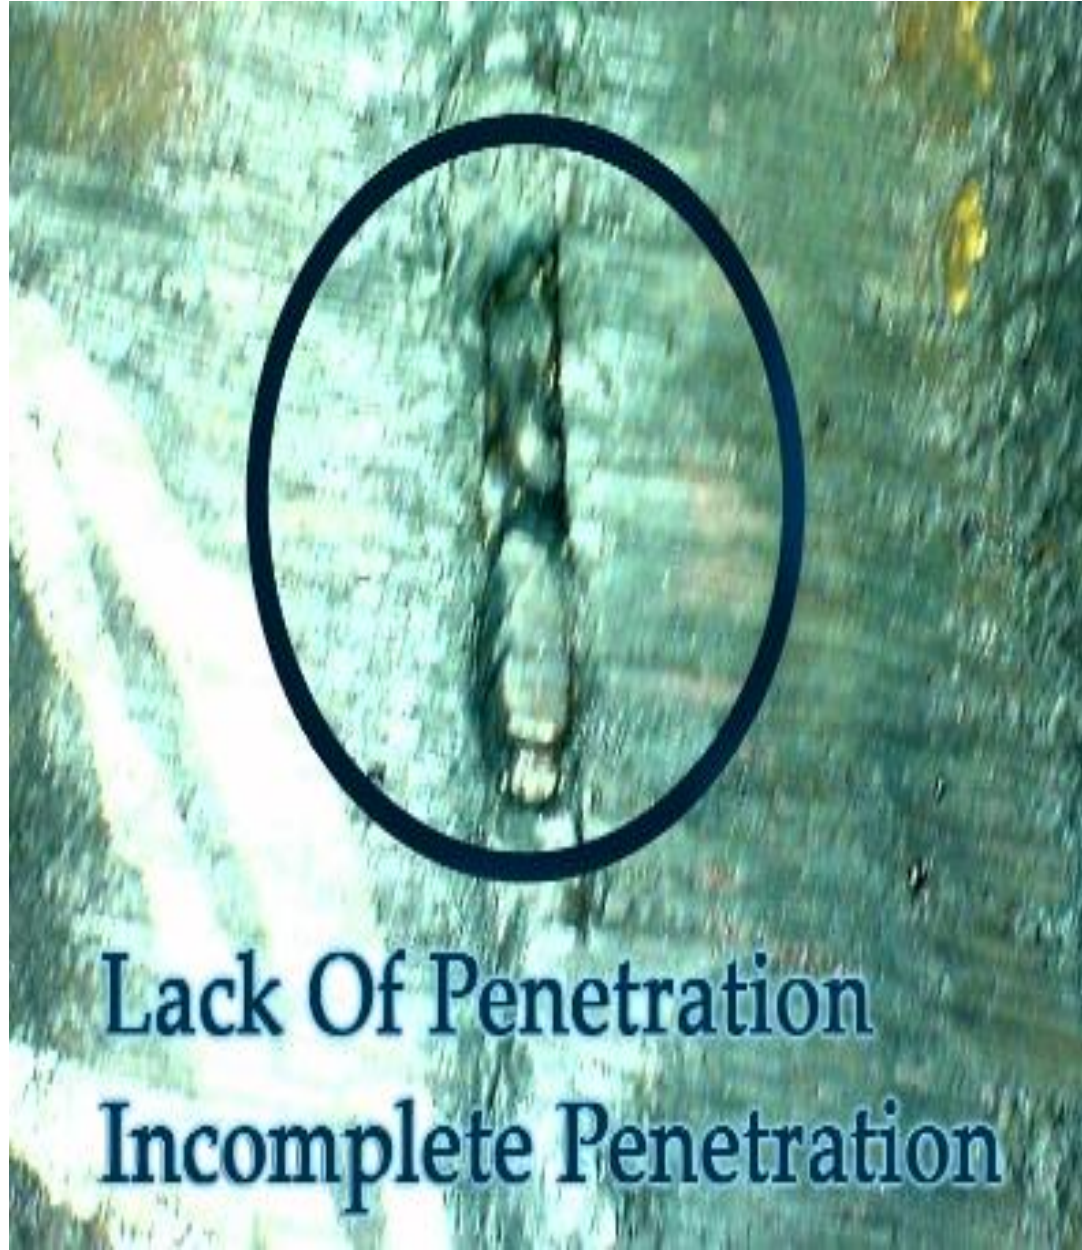

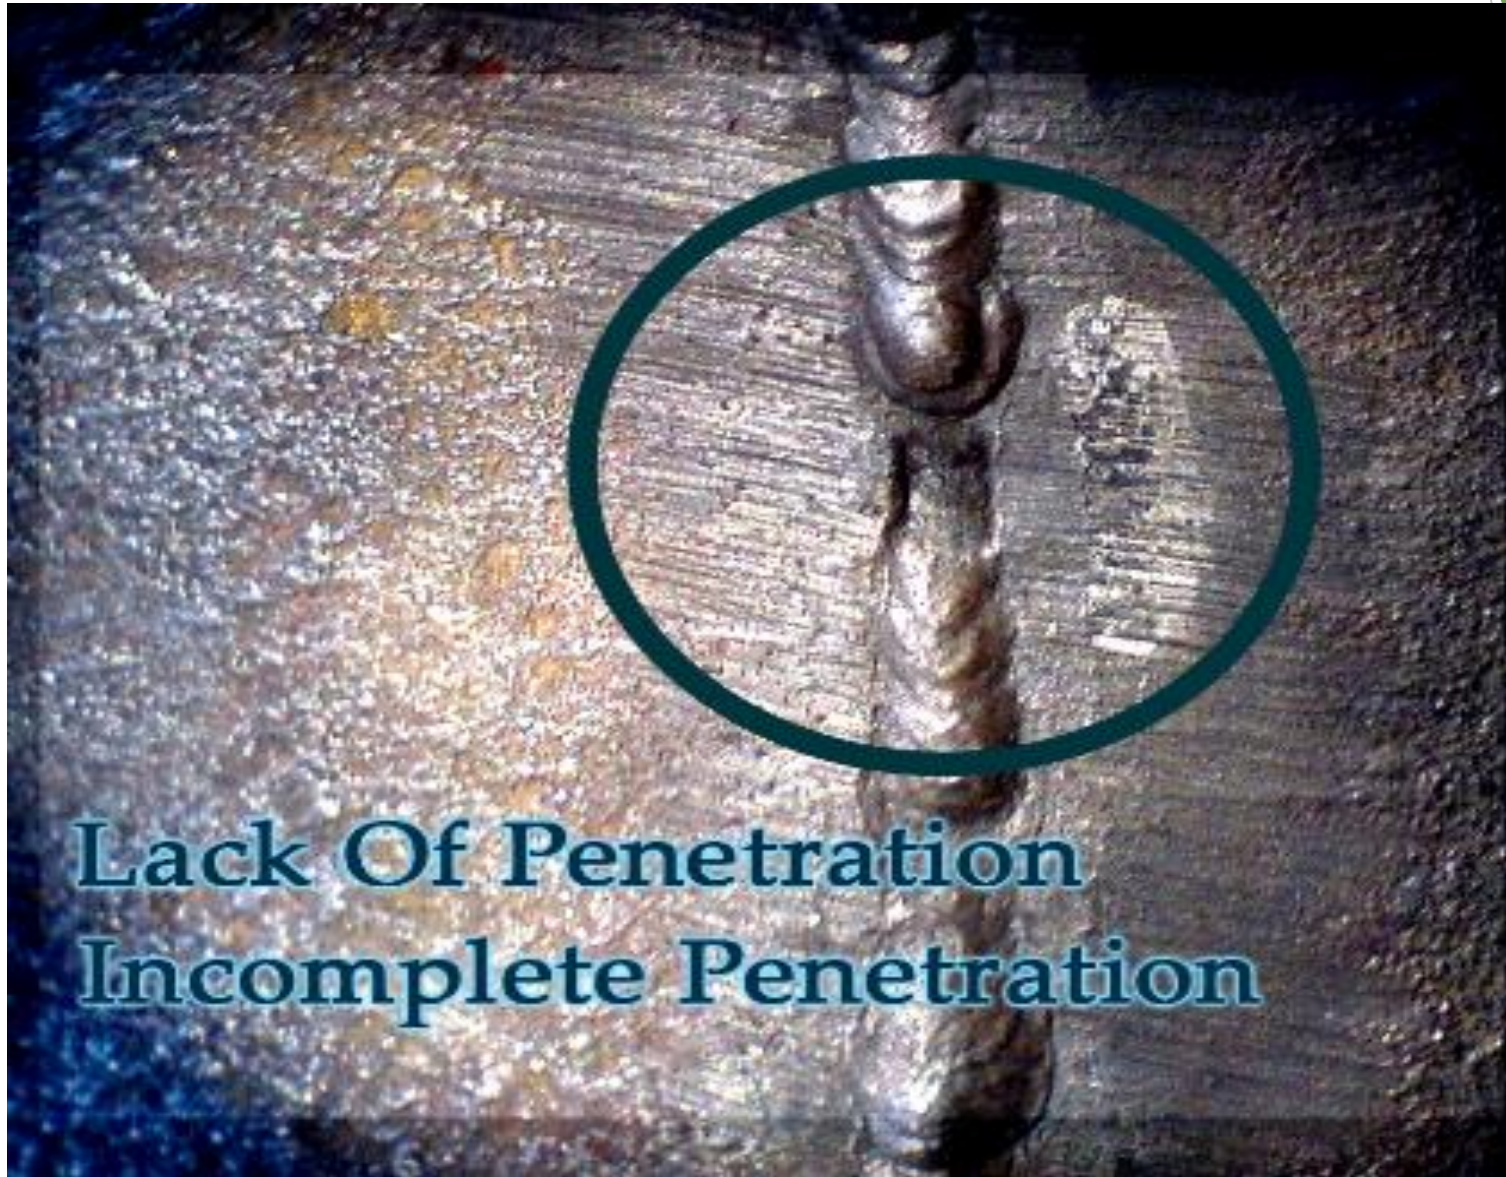

Lack Of Penetration
Incomplete Penetration

Lack of Fusion

Lack of Fusion

Detection

- This type of defect tends to be sub surface and is therefore detectable only by ultrasonics or X-ray methods
- Lack of side wall fusion which penetrates the surface may be detected using magnetic particle, dye or fluorescent penetrant inspection

Cause

- Incorrect weld conditions (eg. low current) and/or incorrect weld preparation (eg. root face too large)
- Both cause the weld pool to freeze too rapidly



**Incomplete filled groove +
Lack of sidewall fusion**



1. Lack of sidewall fusion
2. Lack of inter-run fusion



Incomplete root fusion


Poor welder skill
Incorrect electrode
manipulation

Arc blow


Incorrect welding
current/voltage

Incorrect travel speed

Incorrect inter-run cleaning

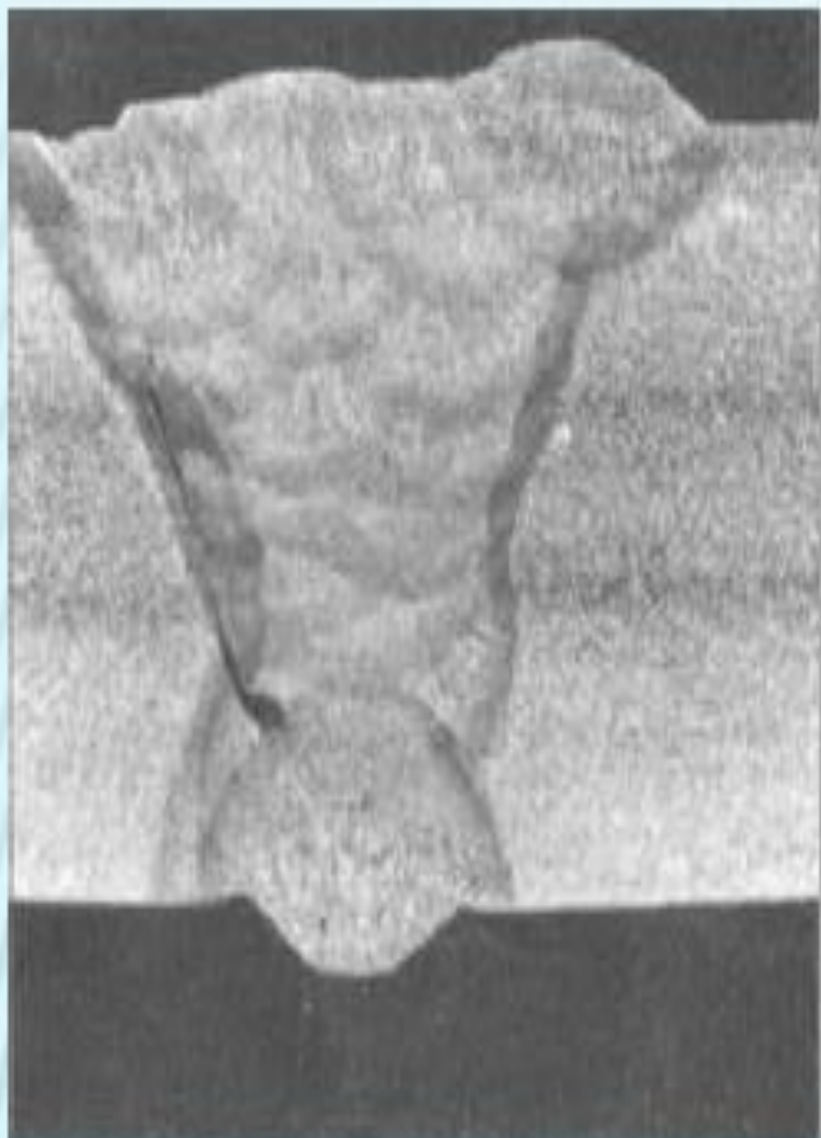





Lack of side-wall fusion

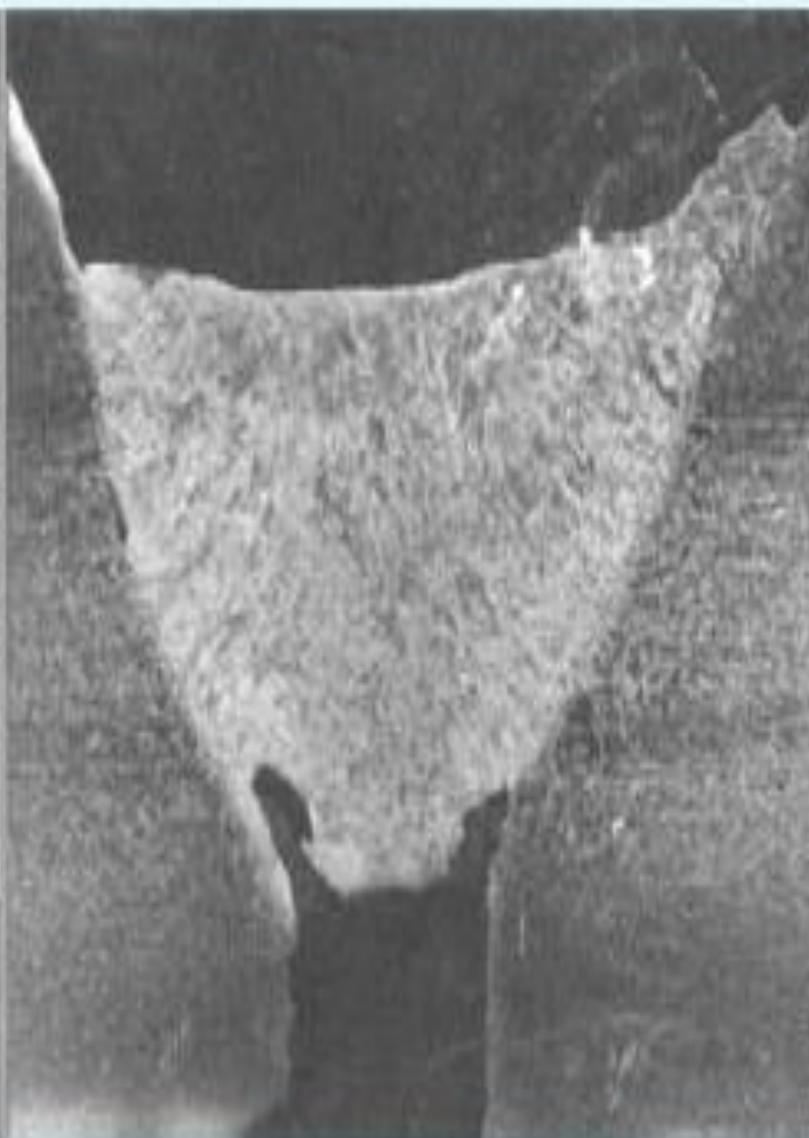

Lack of root fusion




Lack of inter-run fusion

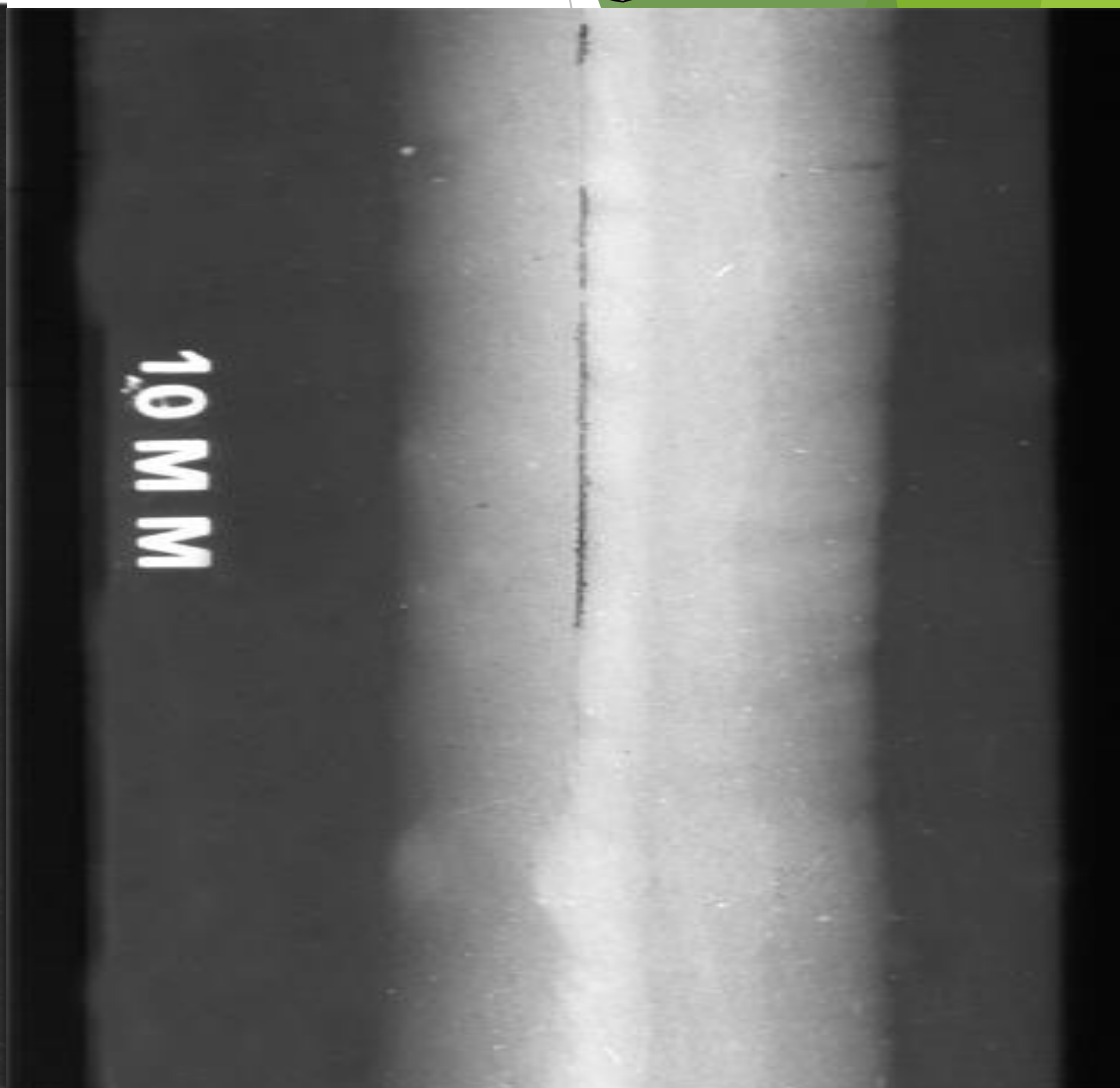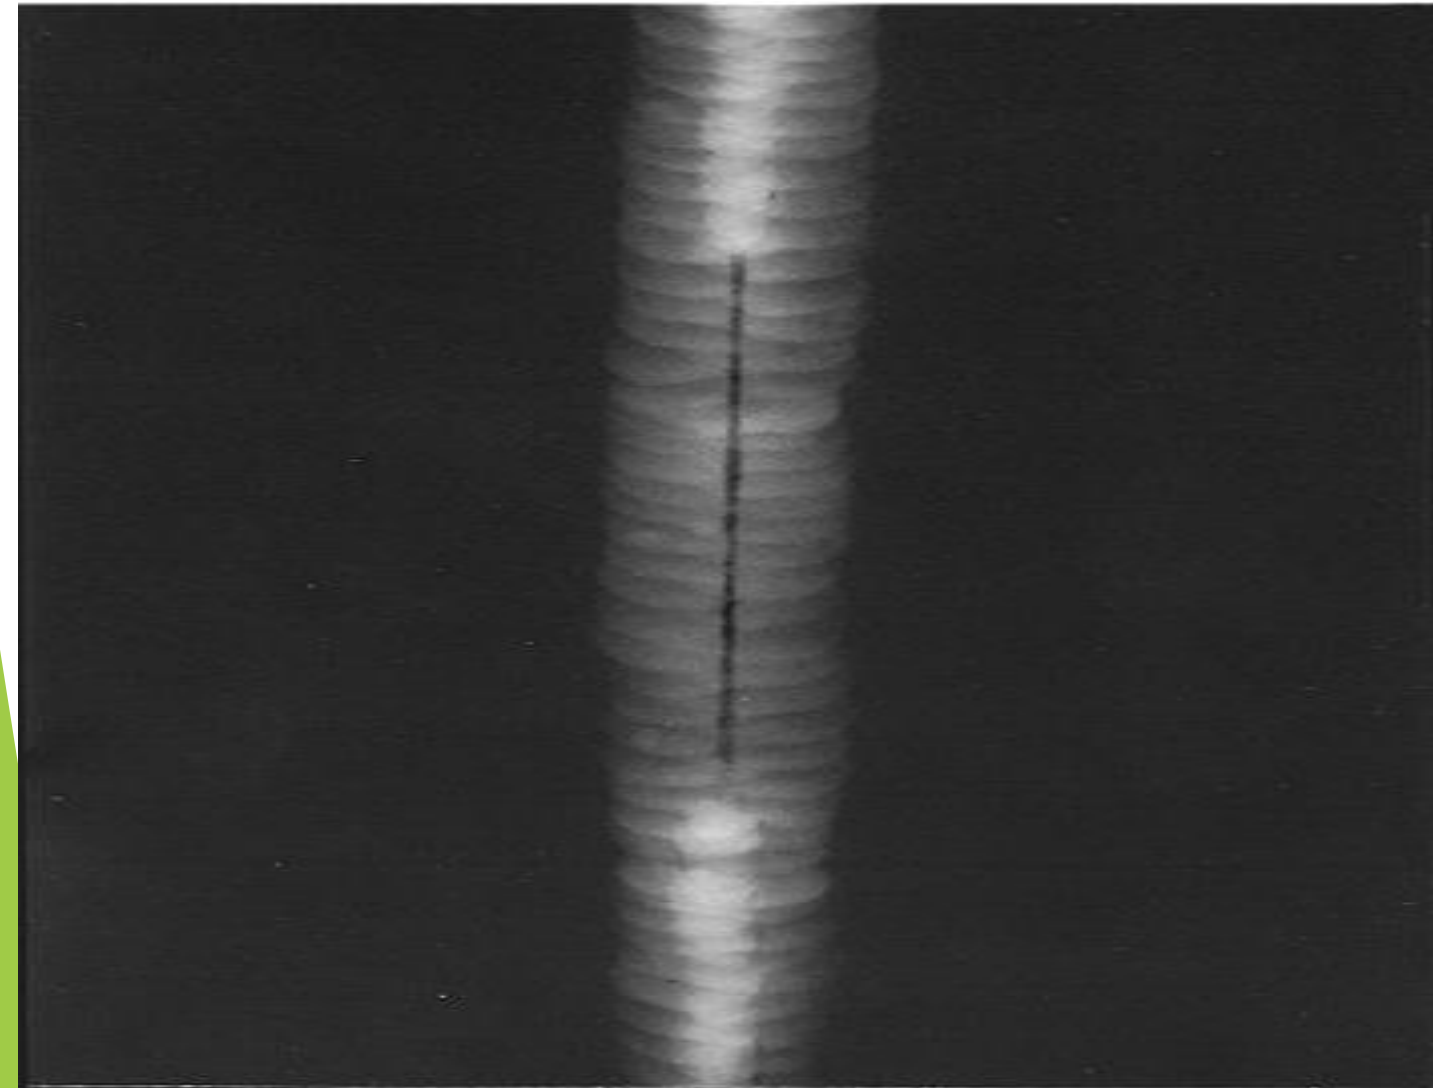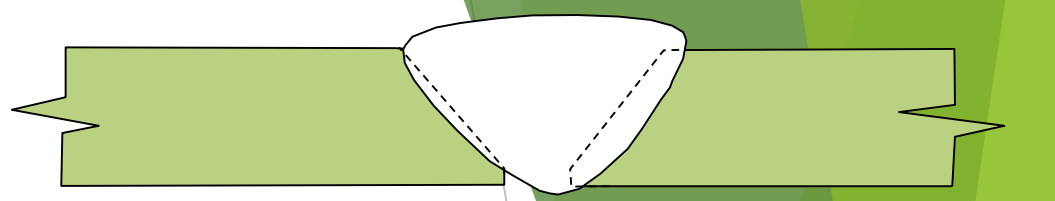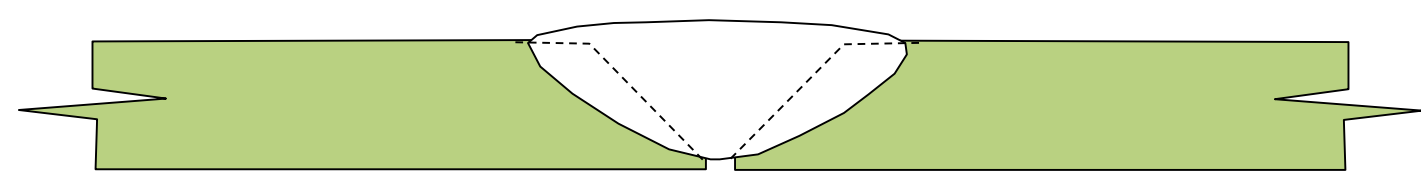

Lack of root penetration

Lack of root fusion

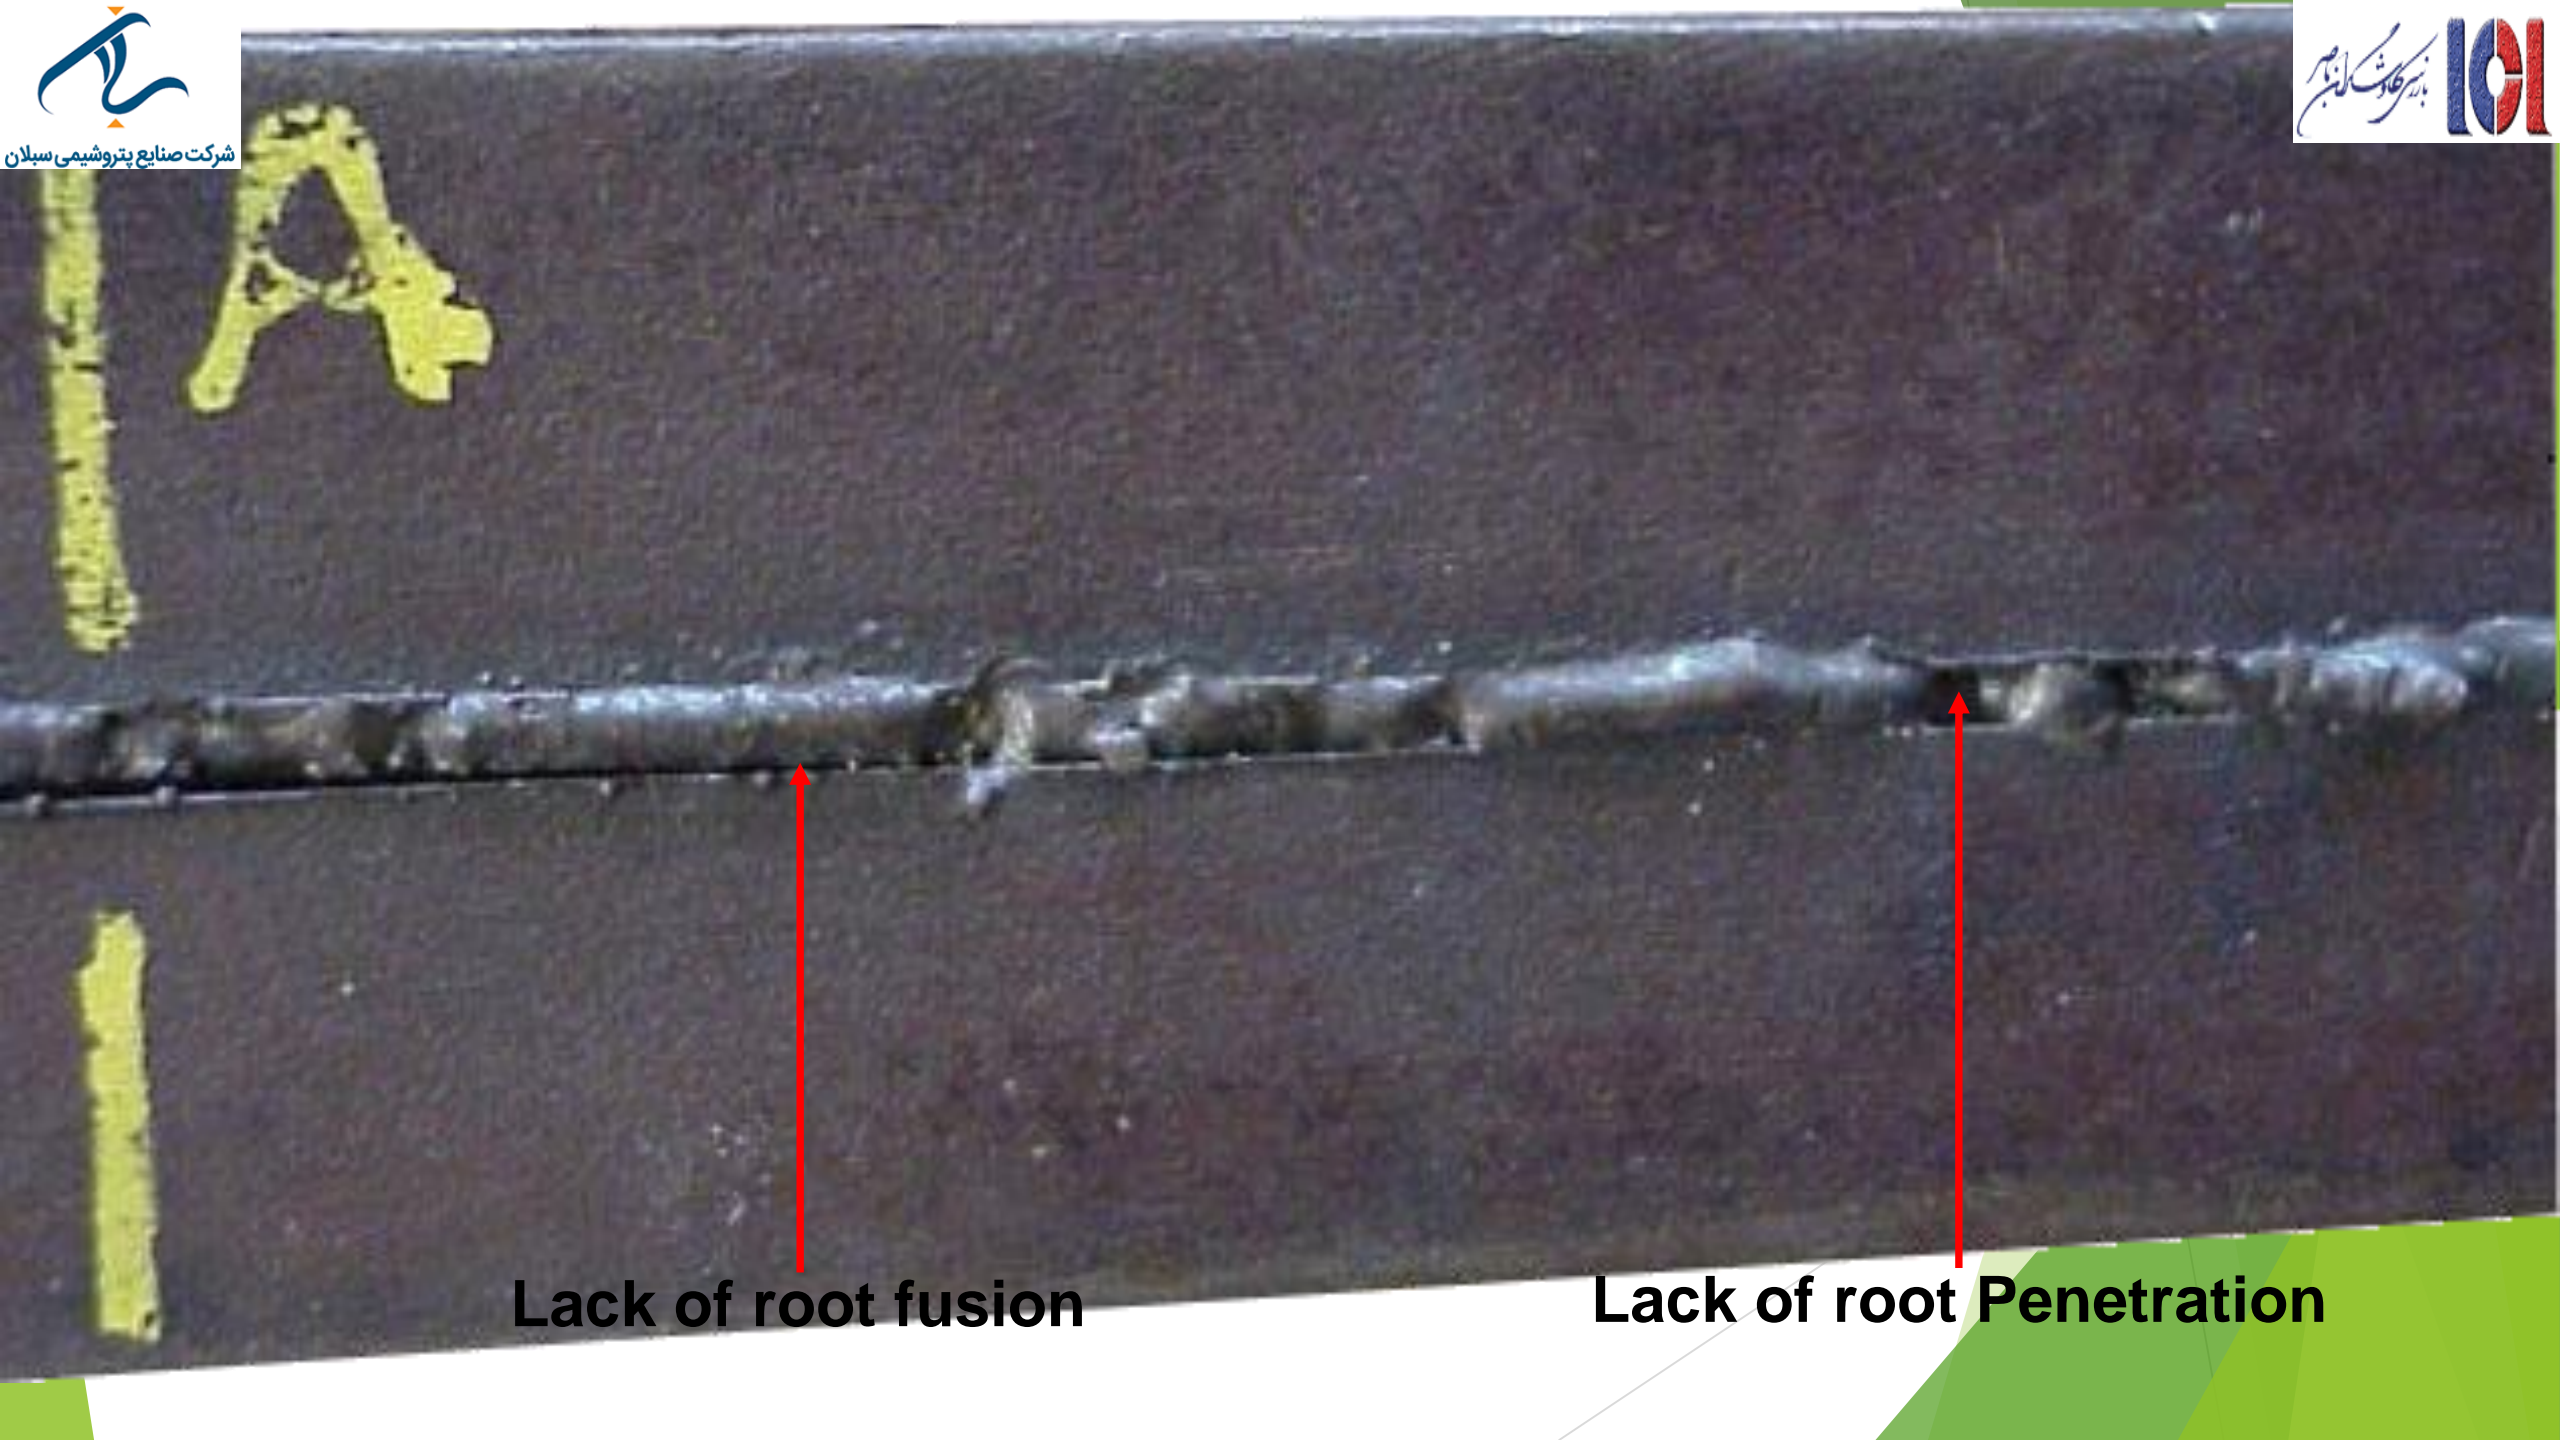

Lack of root fusion

Lack of root Penetration

Lack Of Fusion
Incomplete Fusion



Slag Inclusion



شرکت صنایع پتروشیمی سیلان



بزرگداشت ۱۰۱






Undercut

Cap & Root Undercut


An irregular groove at the toe of a weld run in the parent metal

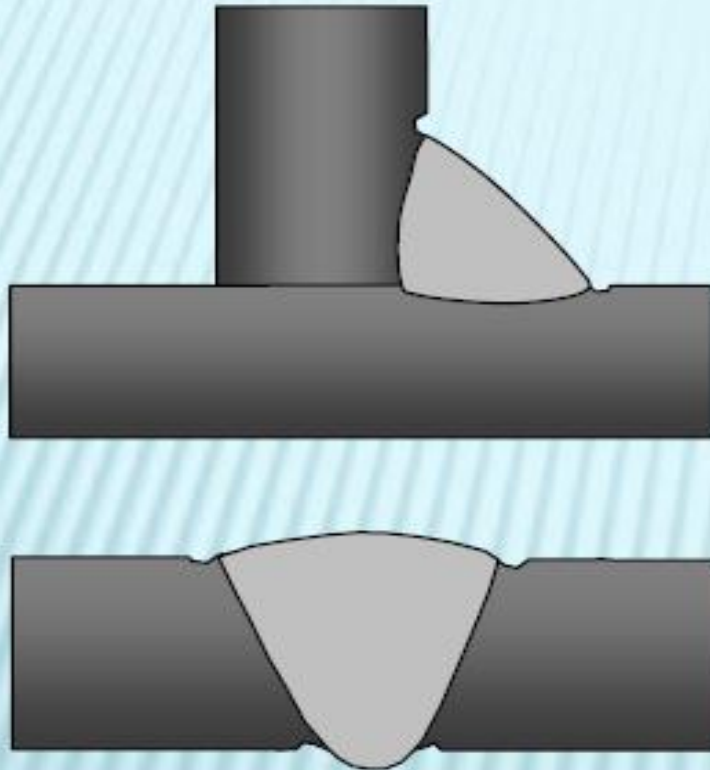


- Excessive amps/volts
- Excessive travel speed
- Incorrect electrode angle
- Excessive weaving
- Incorrect welding technique
- Electrode too large



Intermittent Cap Undercut

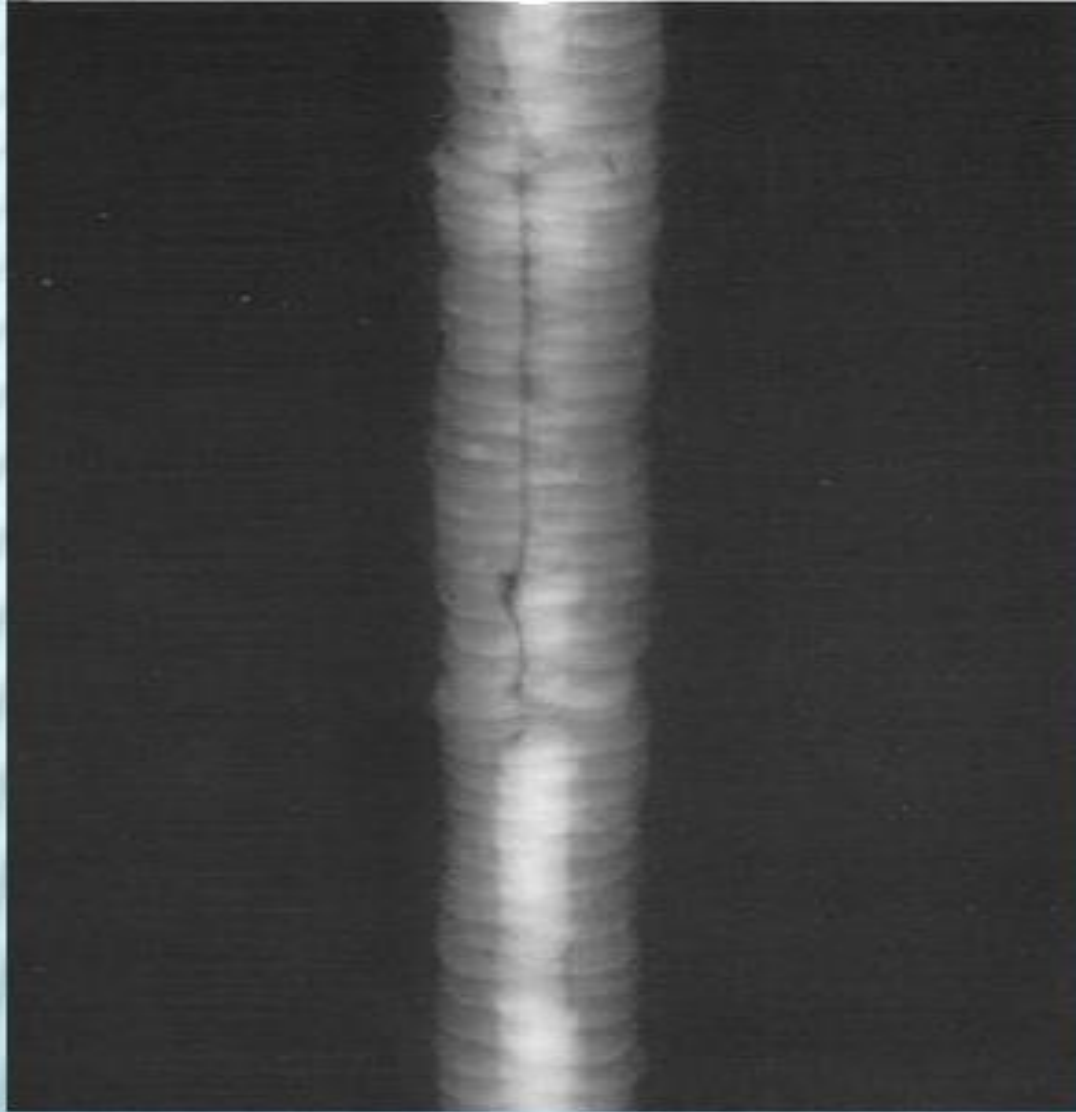



Root undercut

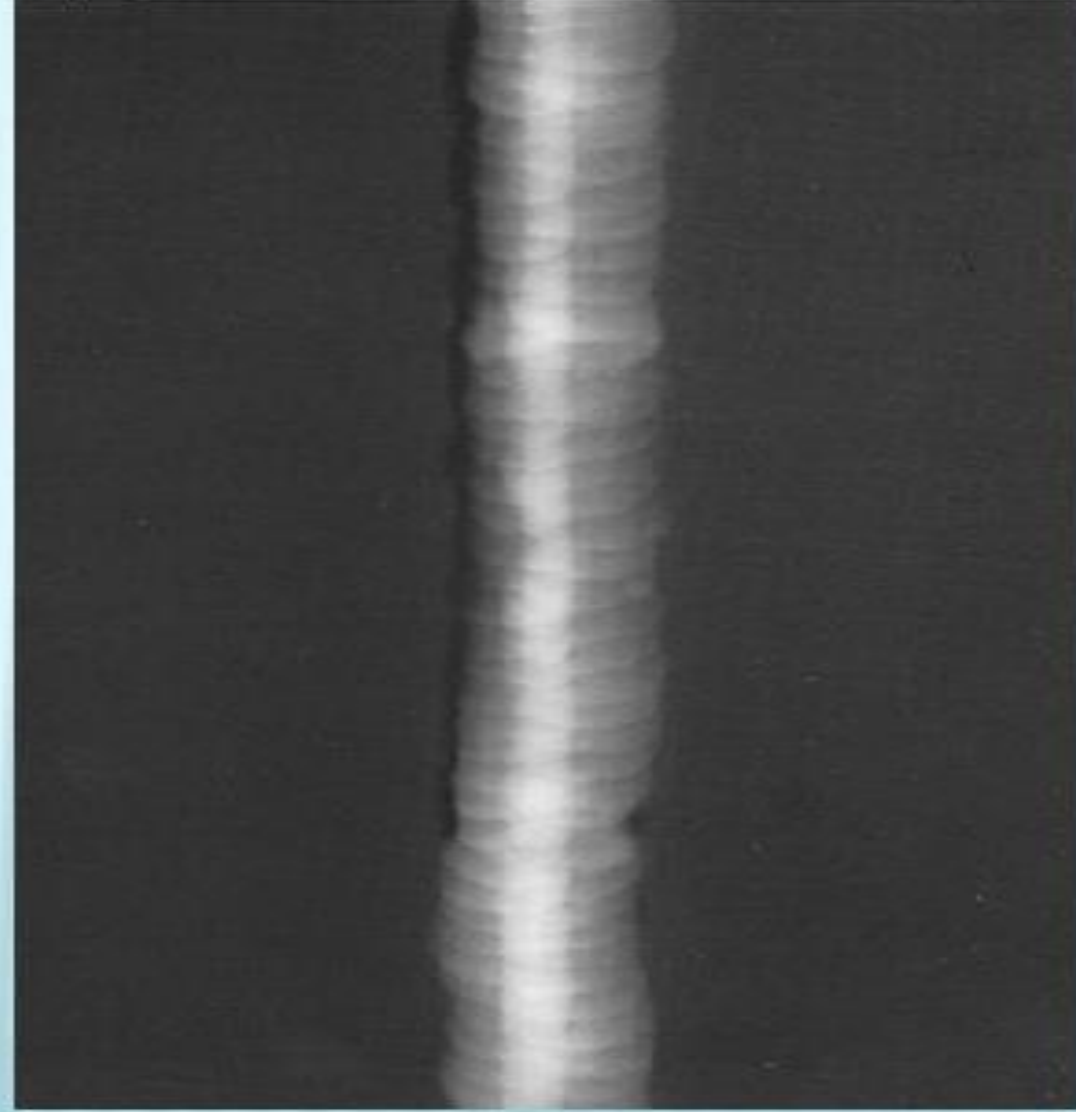

Cap undercut



Continues Cap Undercut

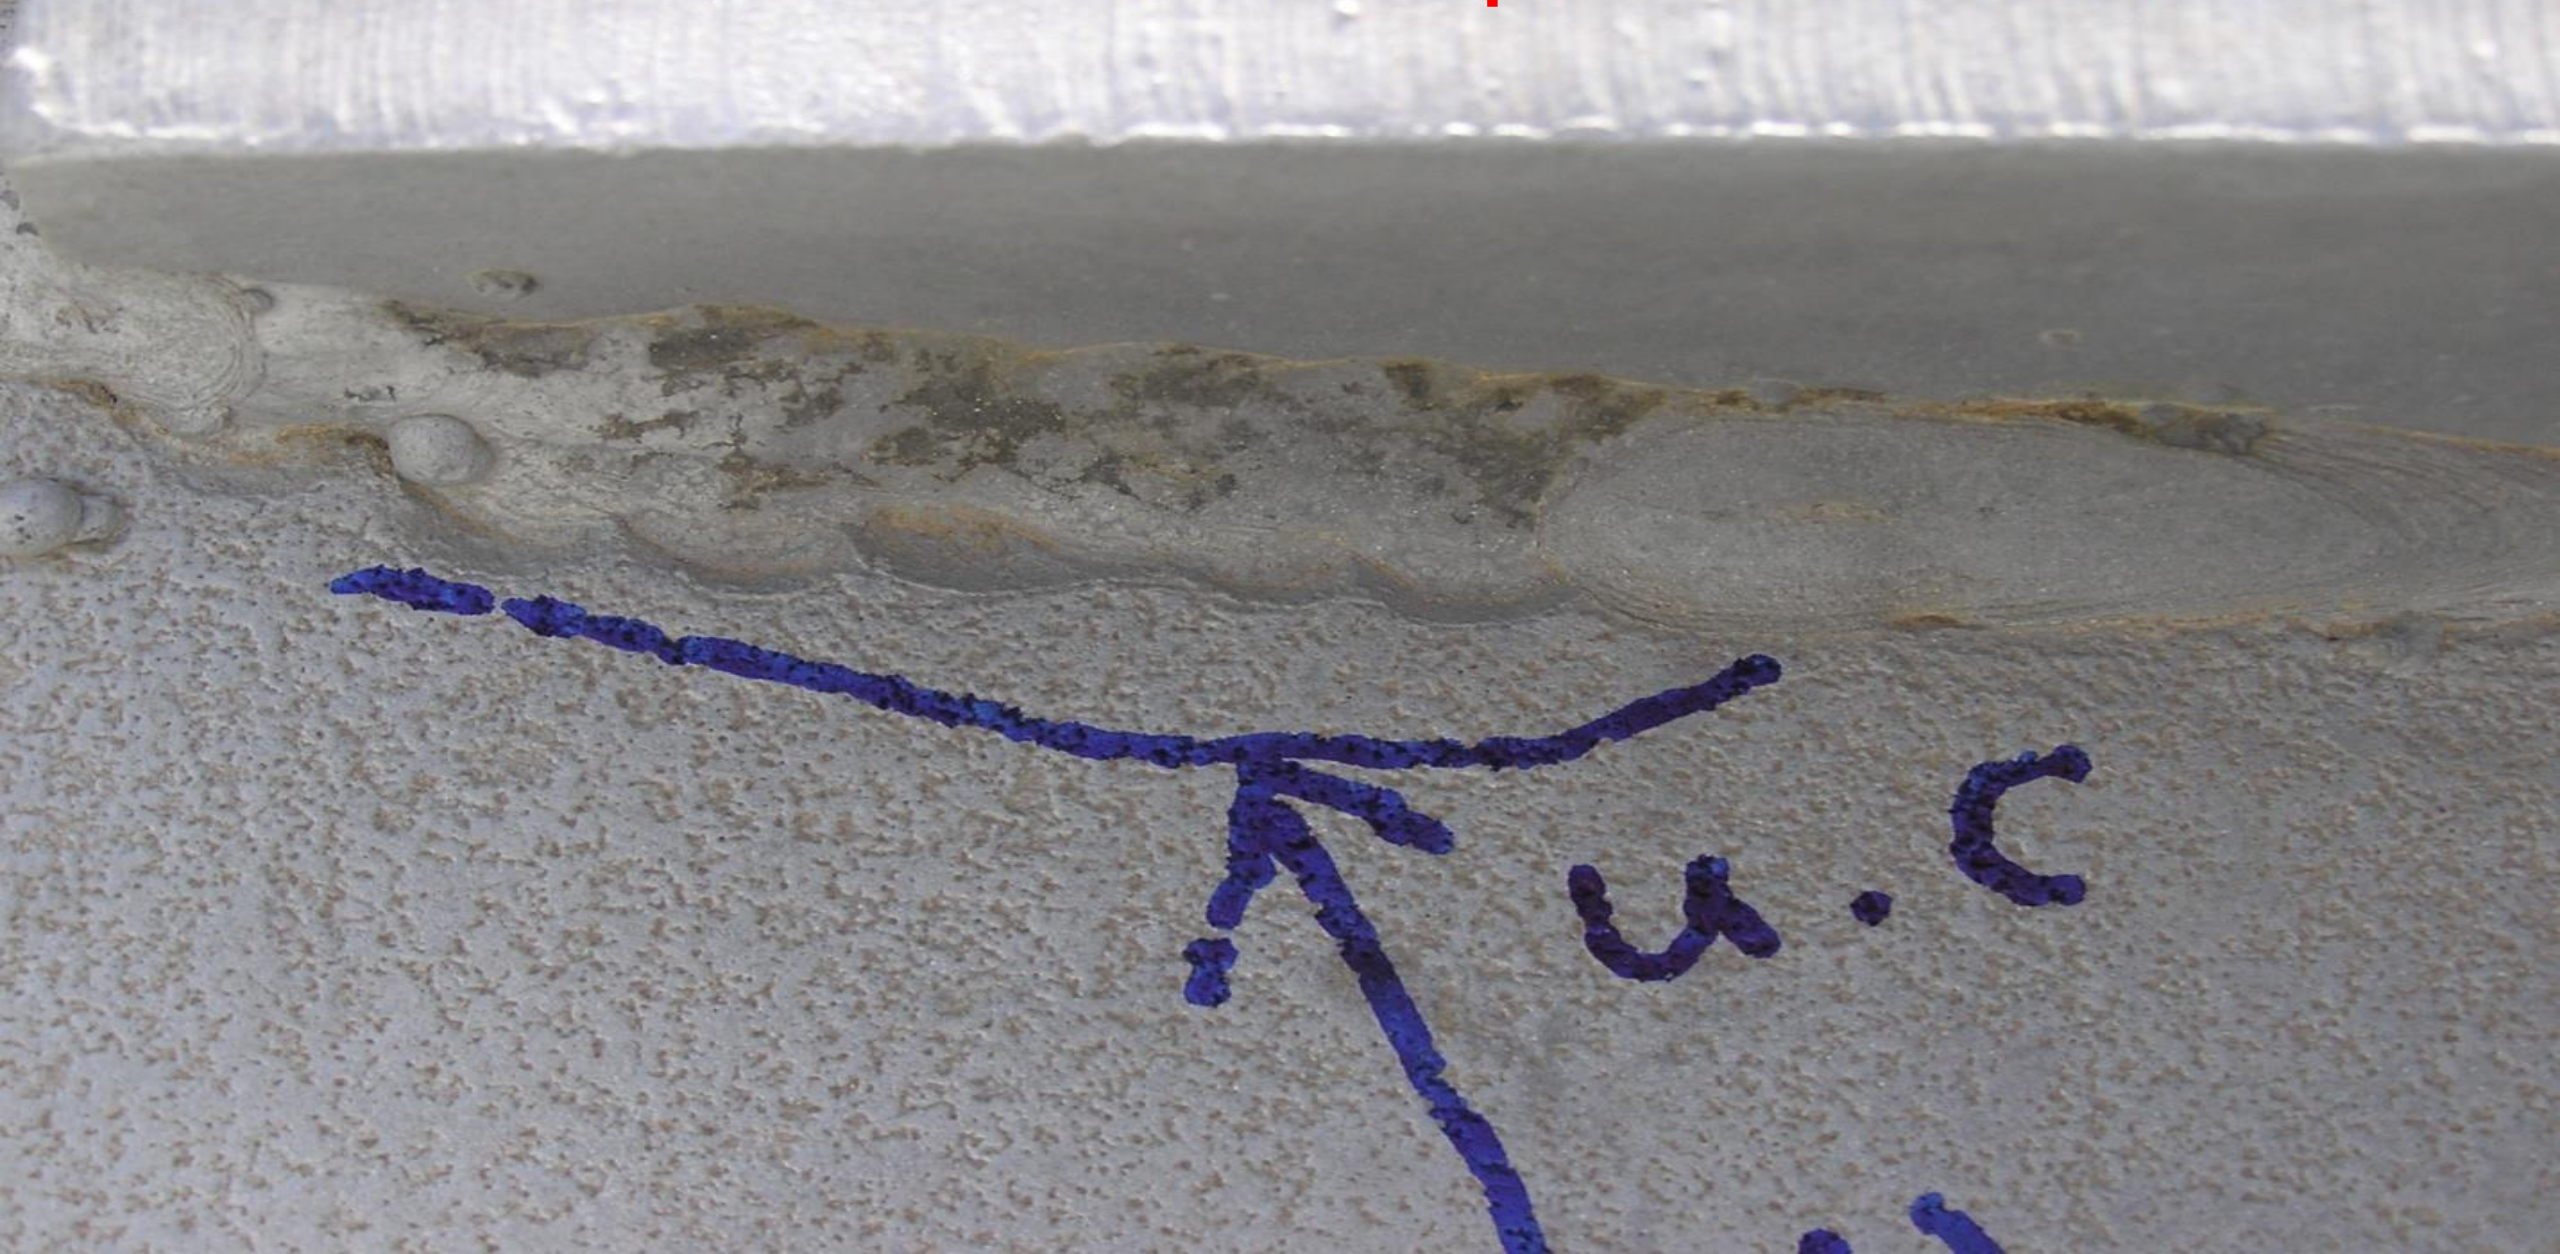


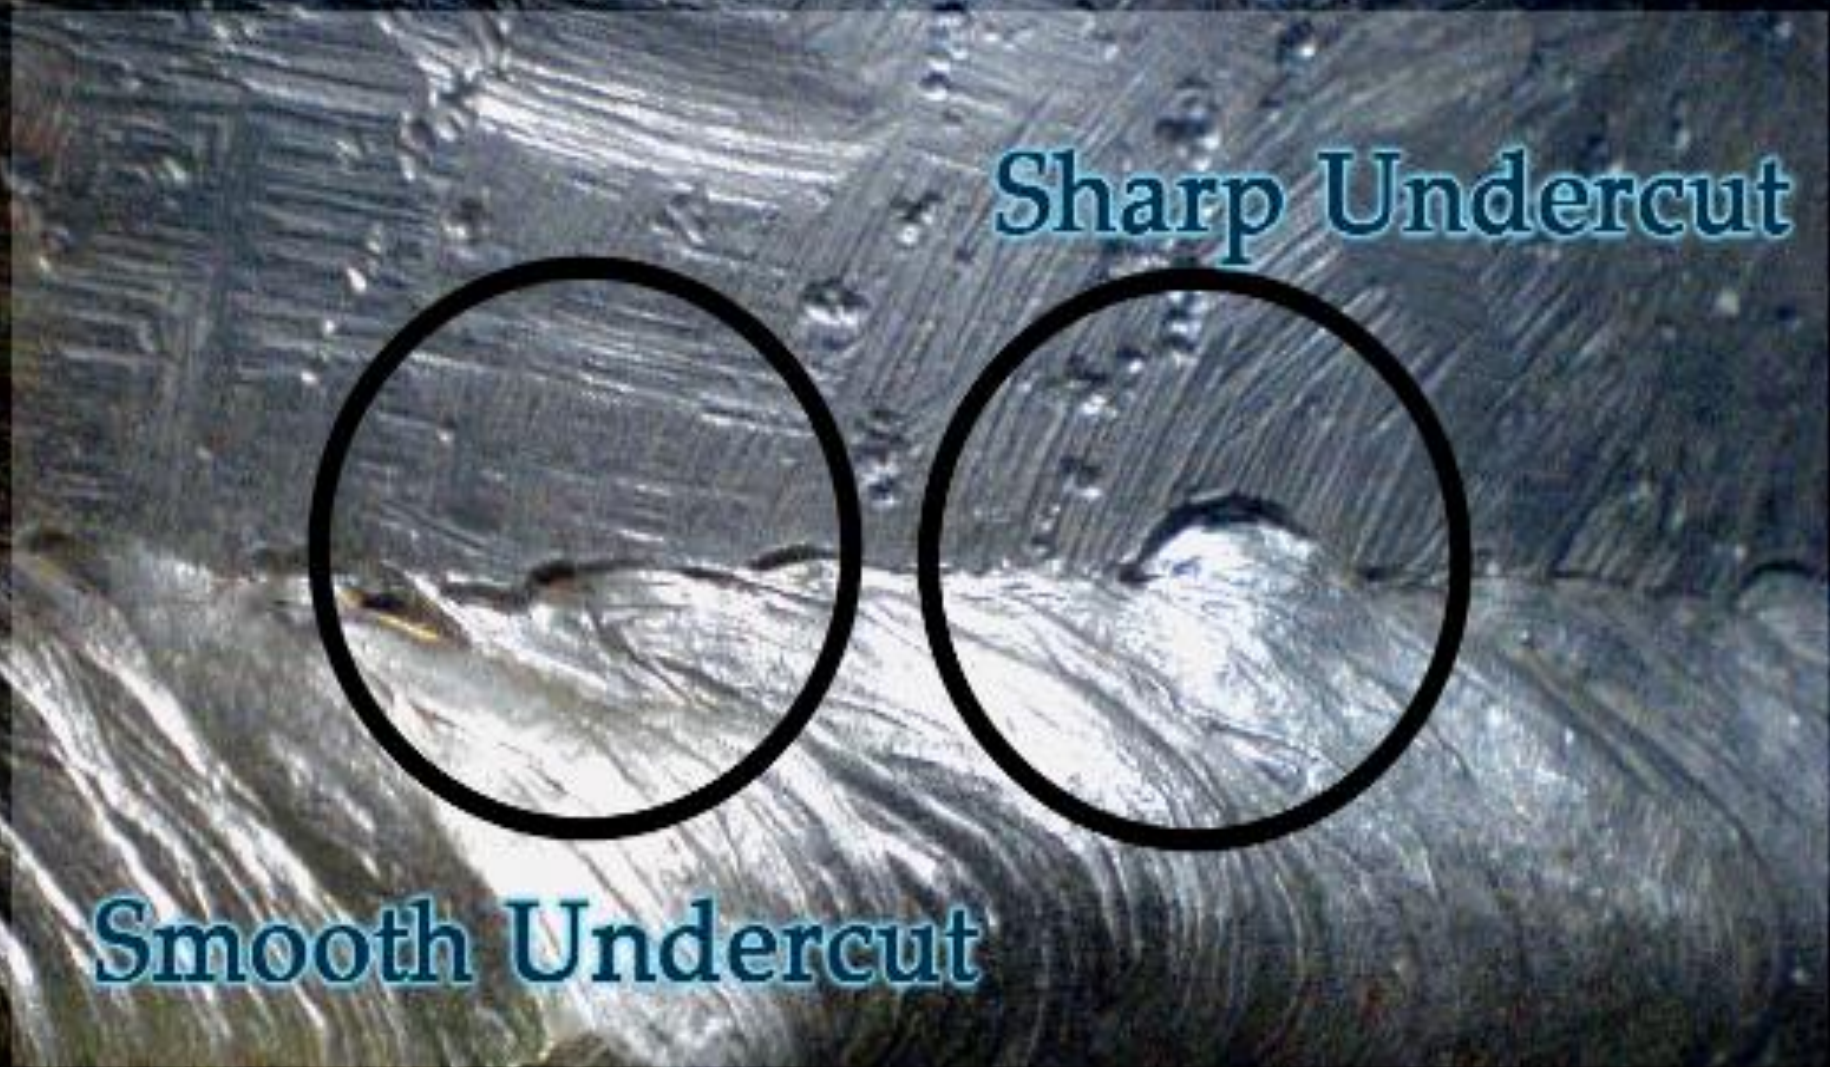


Sharp Undercut

Smooth Undercut

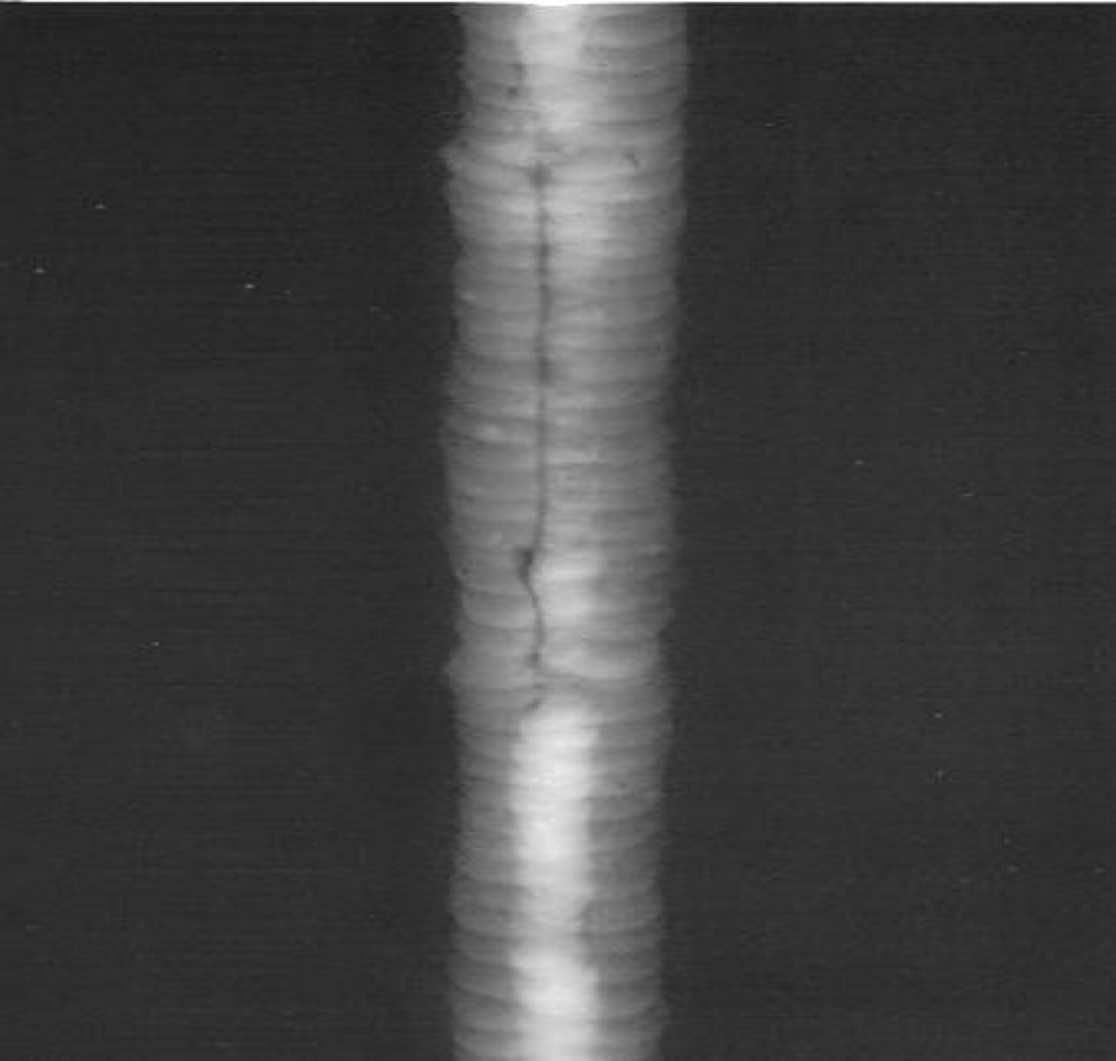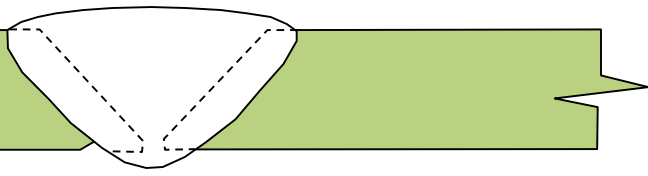


Root undercut

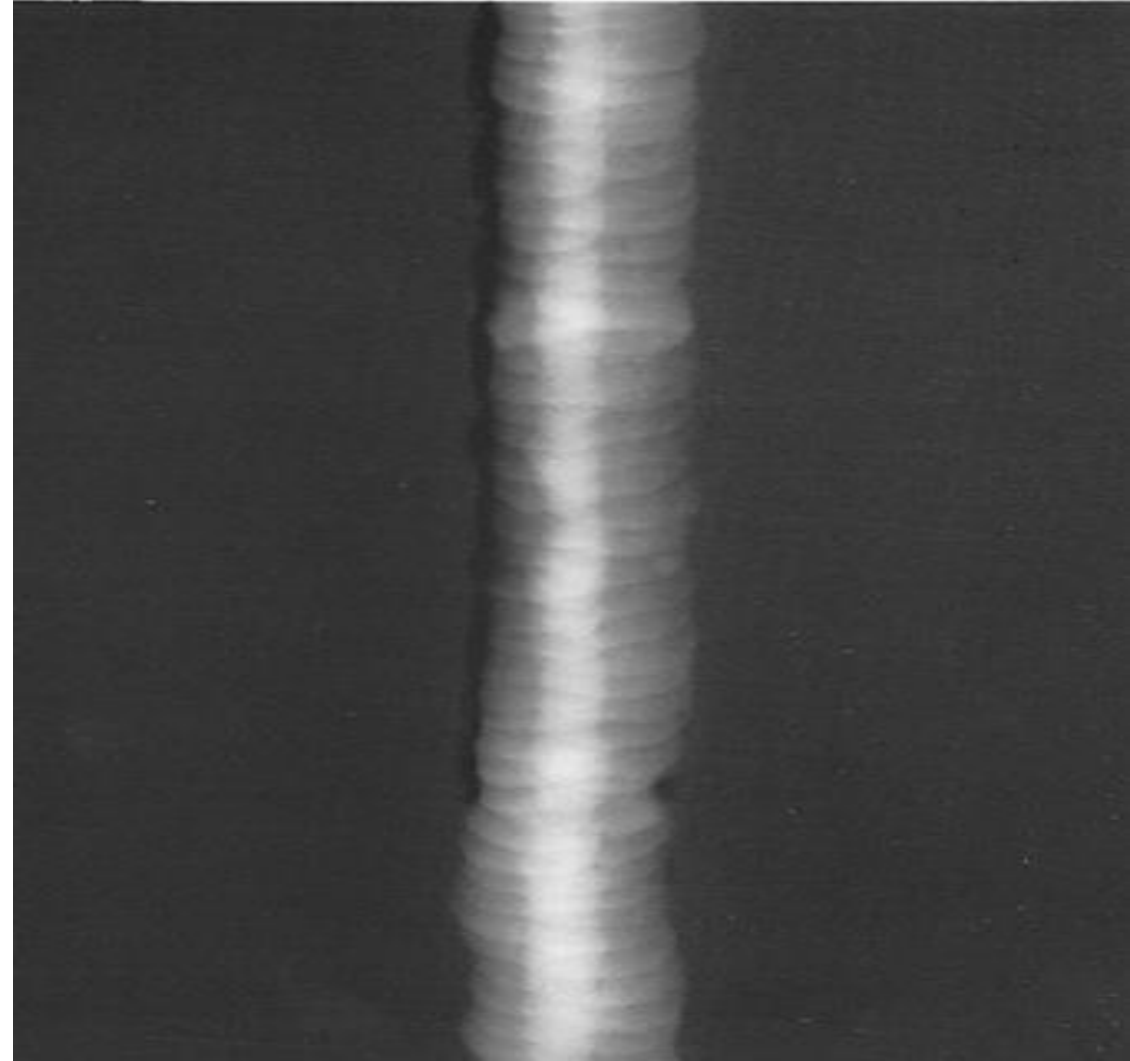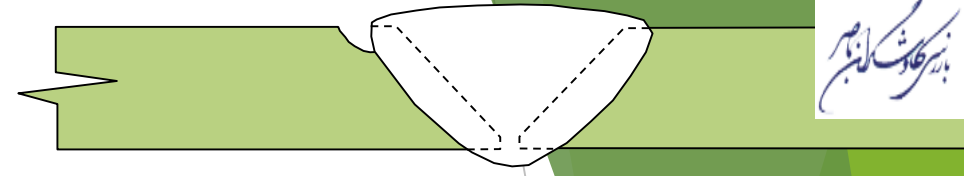

Cap undercut

Overlap

An imperfection at the toe or root of a weld caused by metal flowing on to the surface of the parent metal without fusing to it

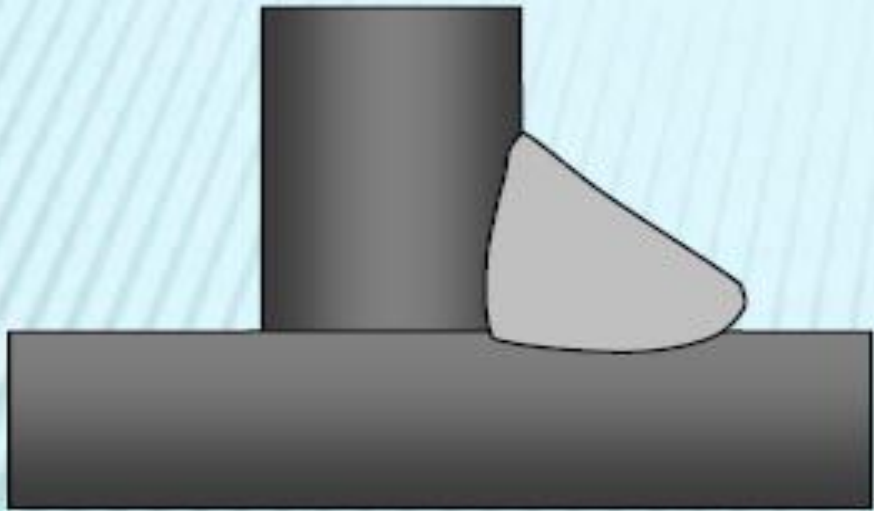

Contamination

Slow travel speed

Incorrect welding technique



Current too low





Overlap



**Toe Overlap
Butt weld**


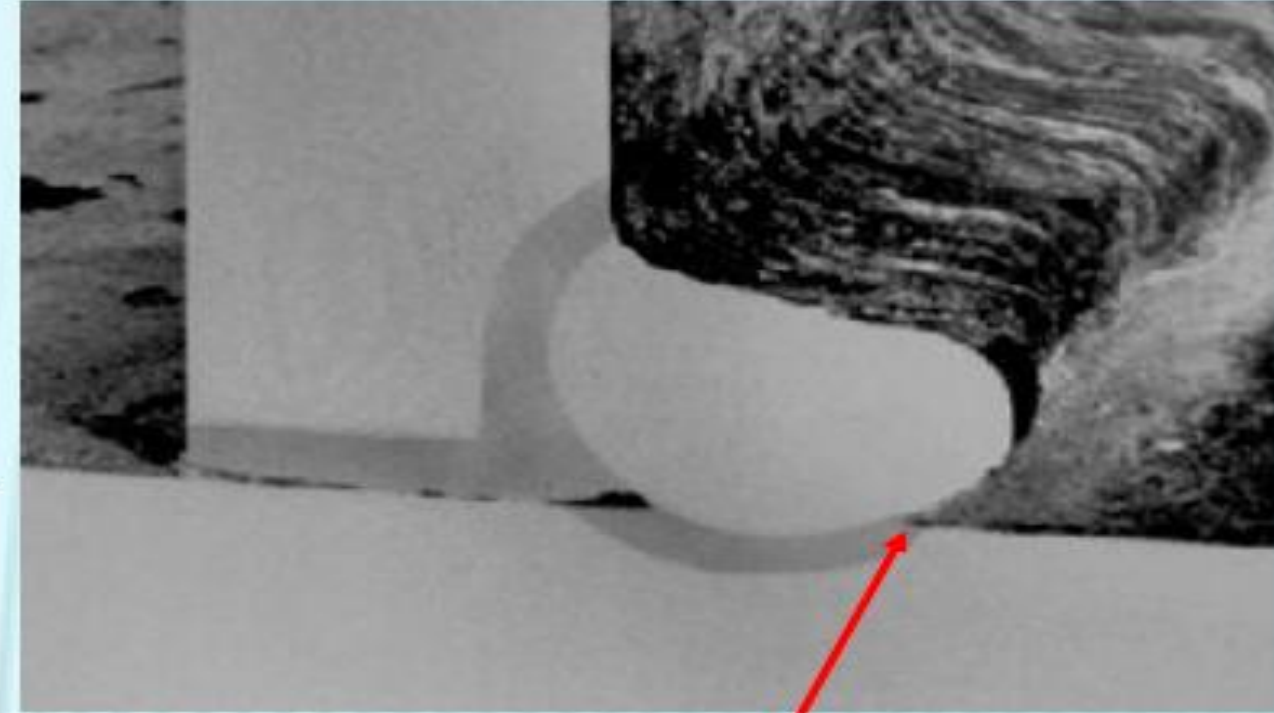
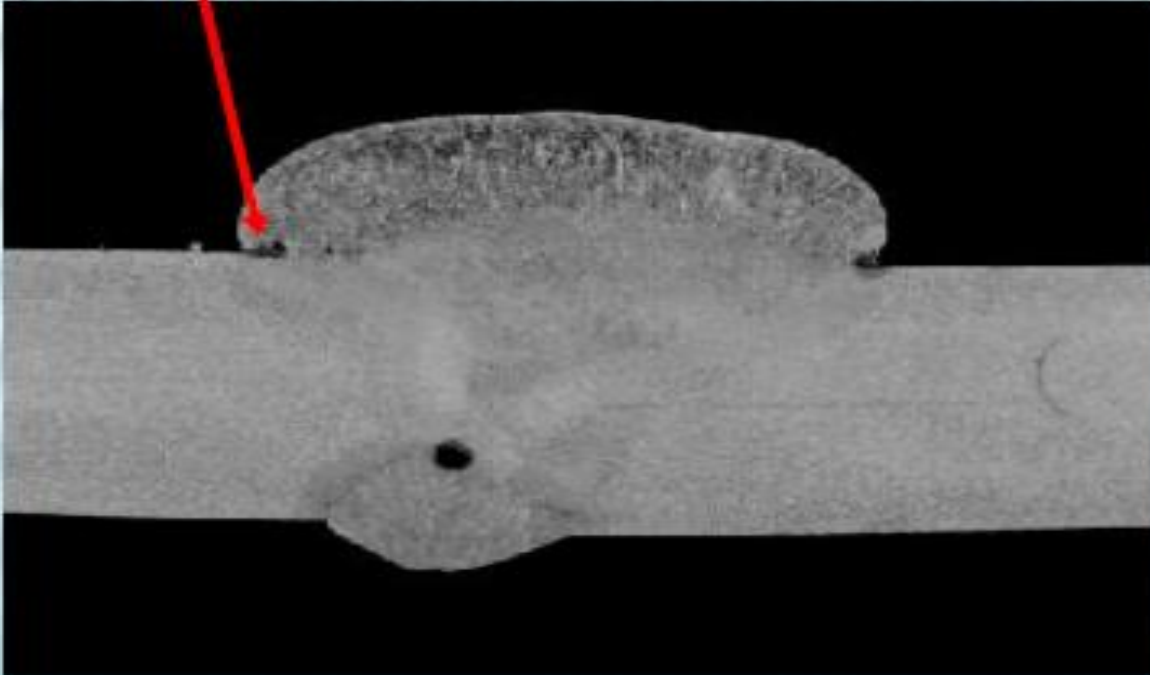


**Toe Overlap
Fillet weld**




TUNGSTAN INCLUSION

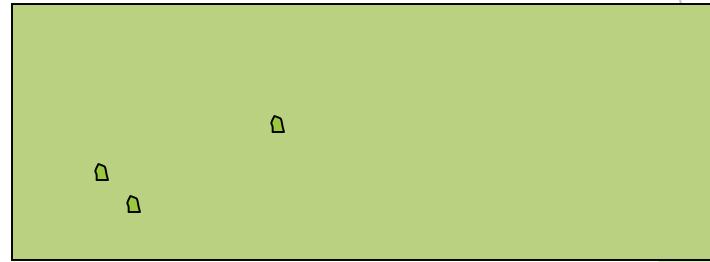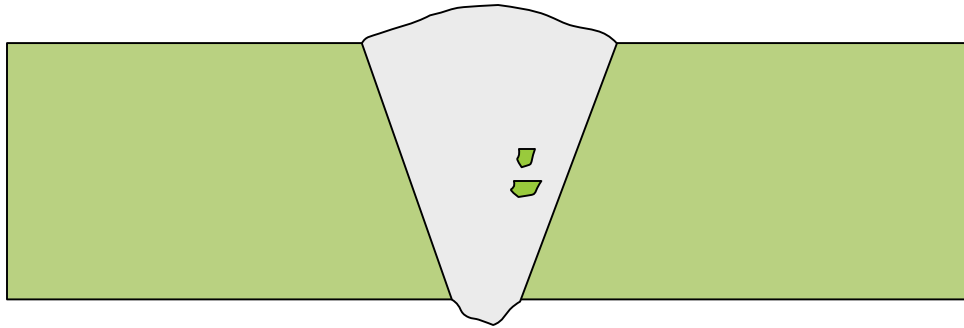

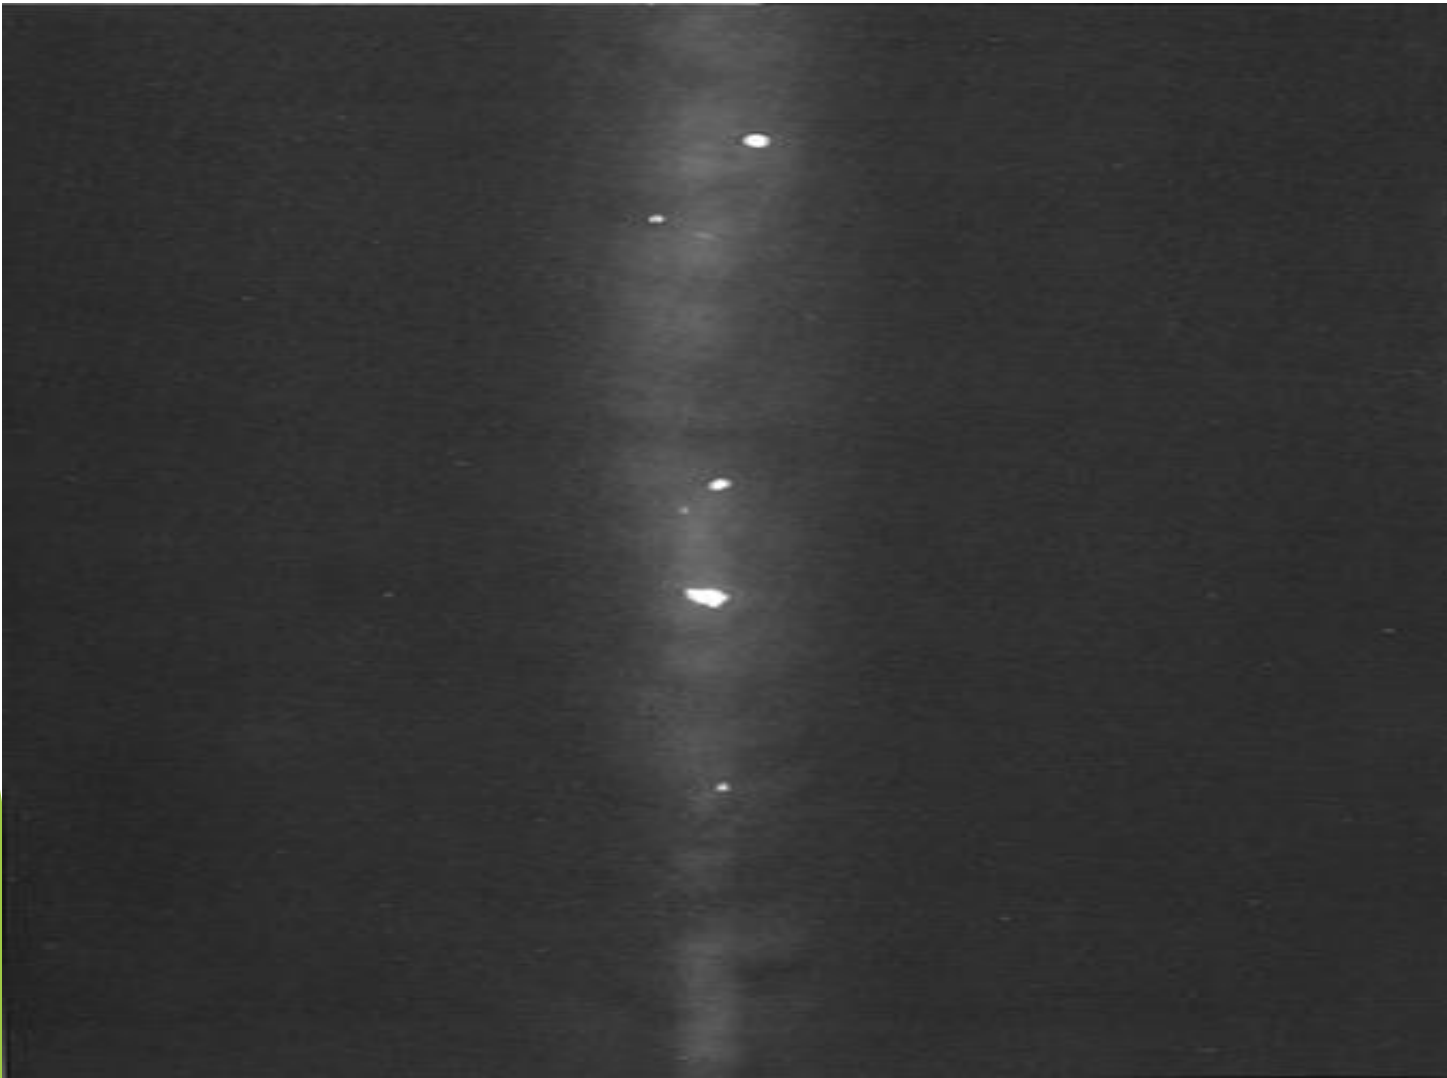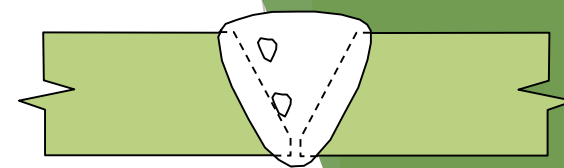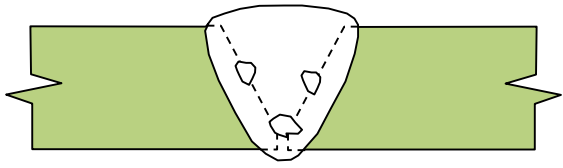

Tungsten inclusions

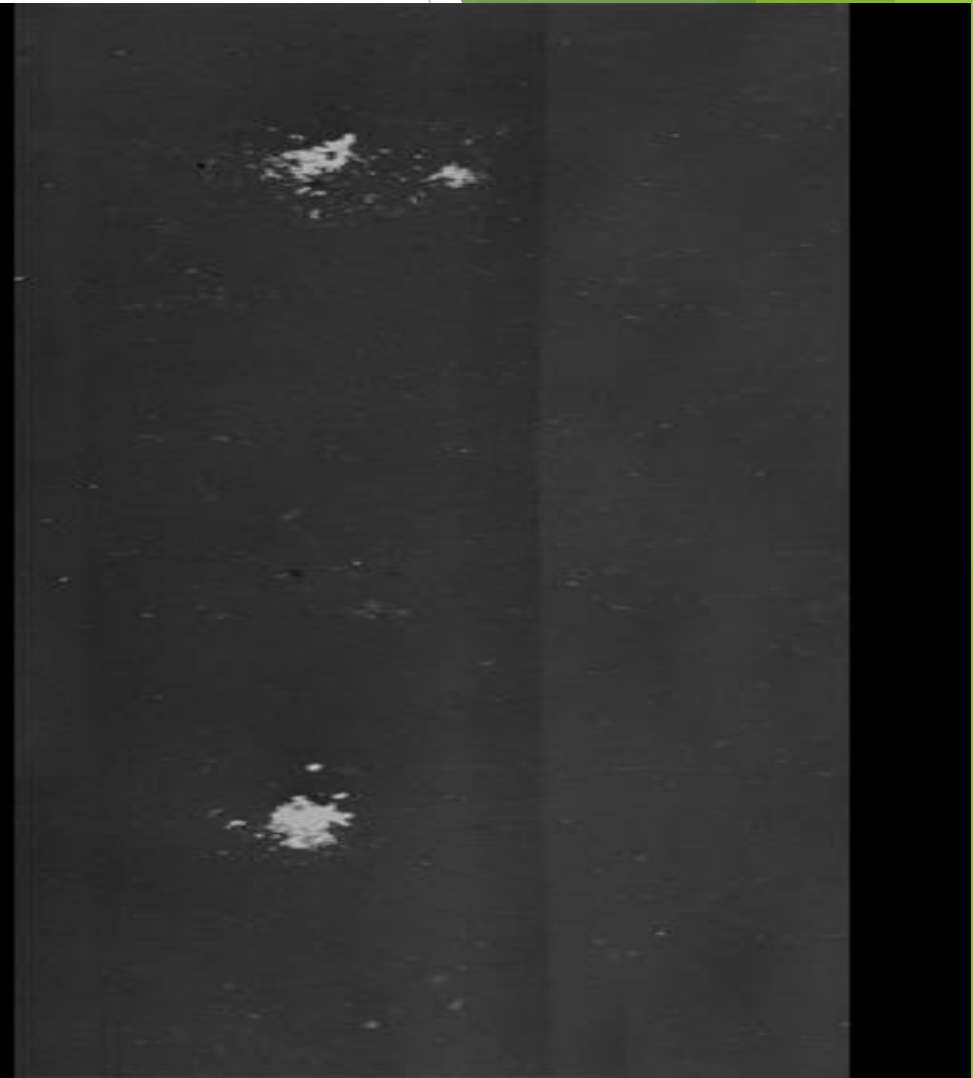

Copper inclusions

Set-up Irregularities


A variation of leg lengths on a fillet weld




Note: Unequal leg lengths on a fillet weld may be specified as part of the design, in which case it will not be considered as a defect.



MISALIGNMENT (HI-LO)

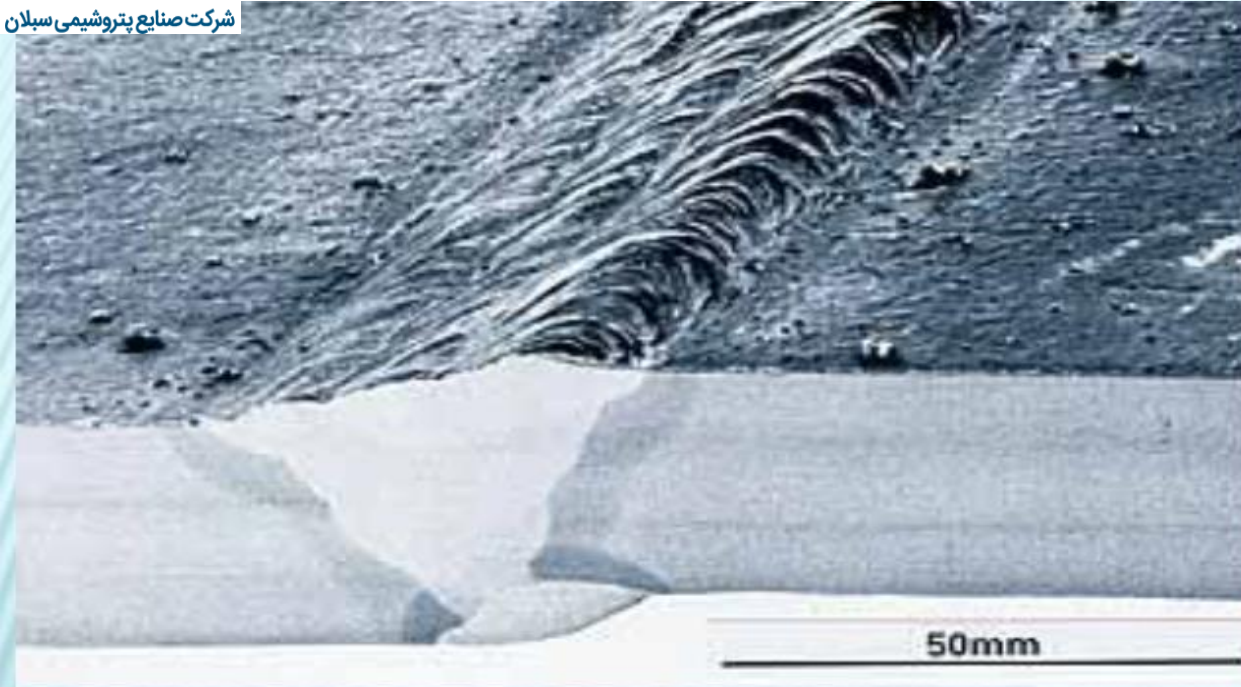



Linear Misalignment

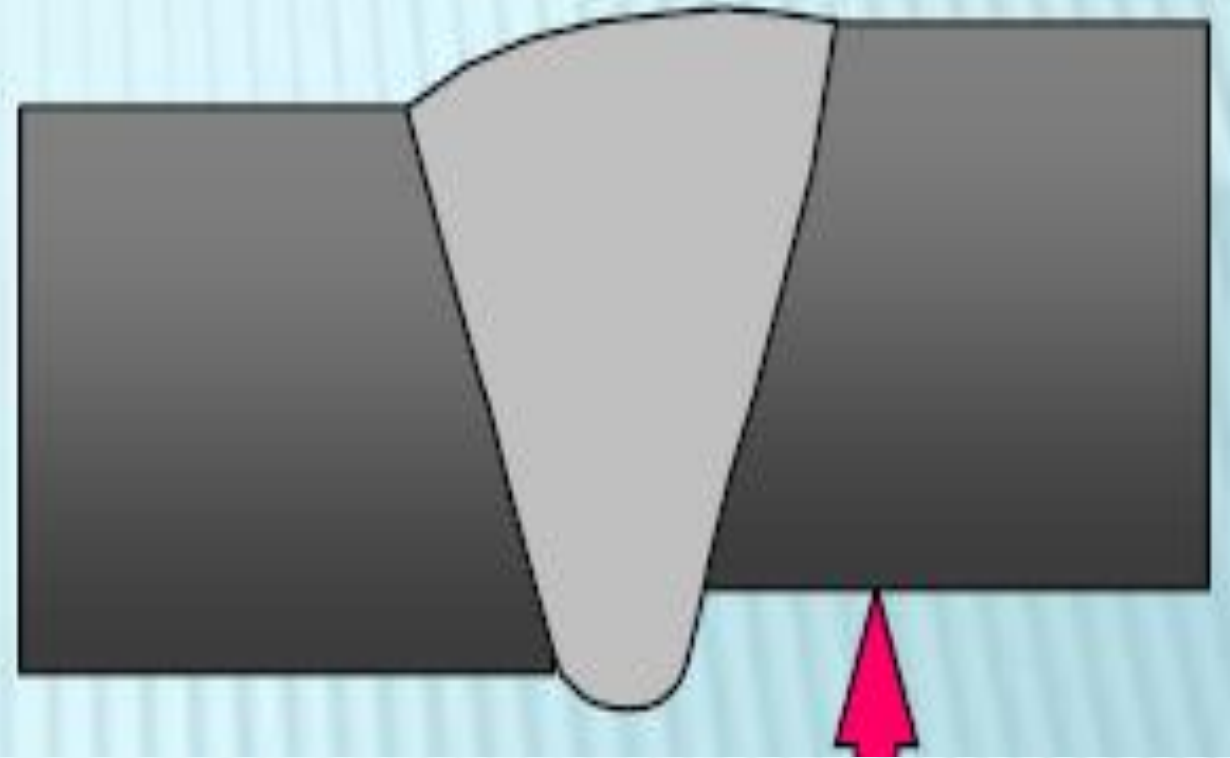

Angular Misalignment

Angular misalignment is measured in degrees

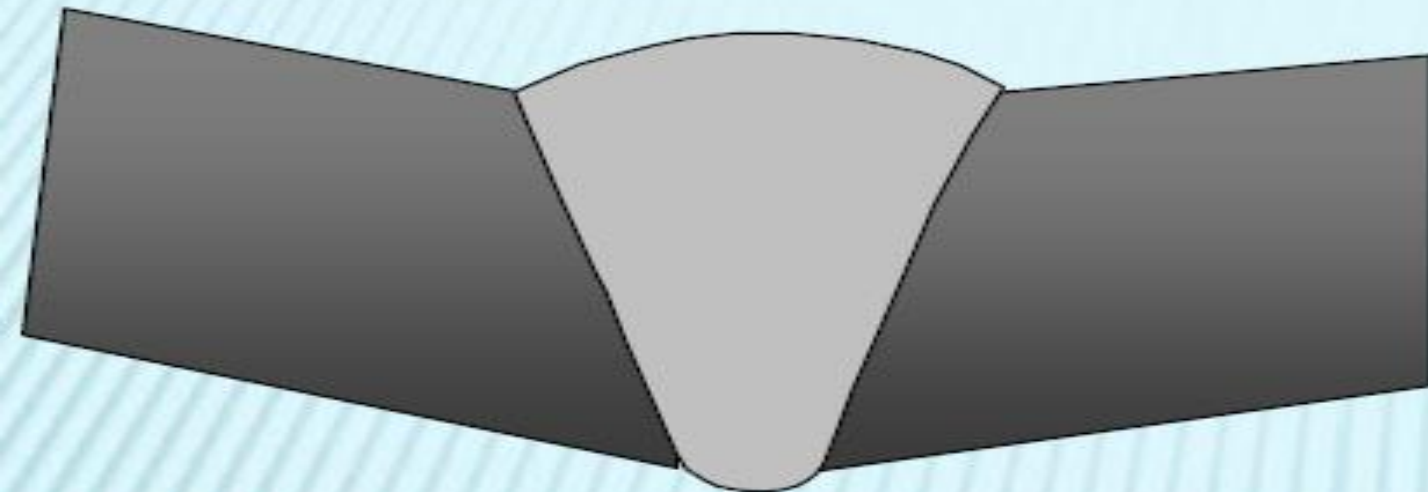

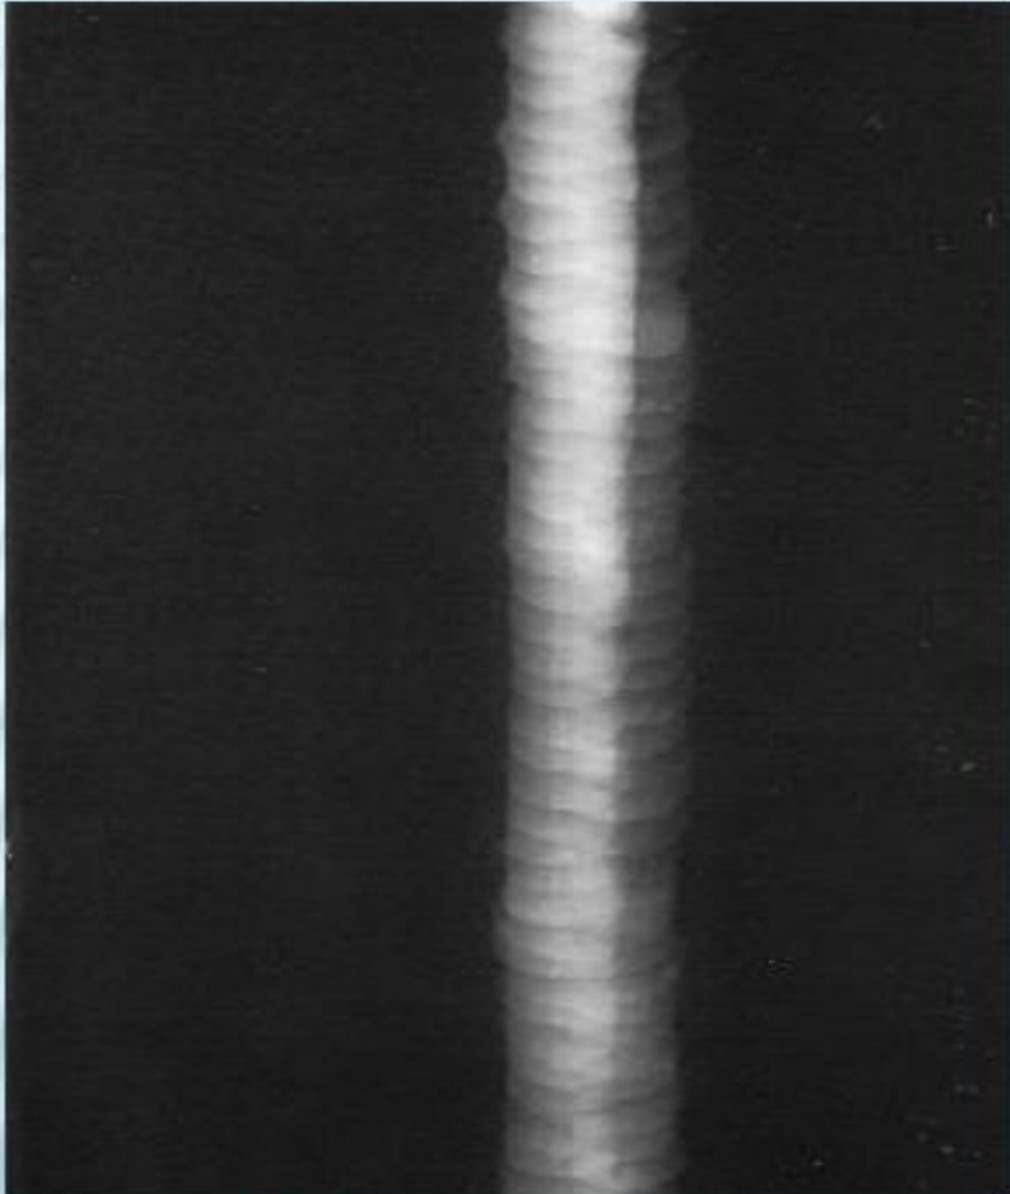


Linear Misalignment

SPATTER

Causes:

- + Incorrect welding conditions and/or contaminated consumables or preparations, giving rise to explosions within the arc and weld pool
- + Globules of molten metal are thrown out, and adhere to the parent metal remote from the weld

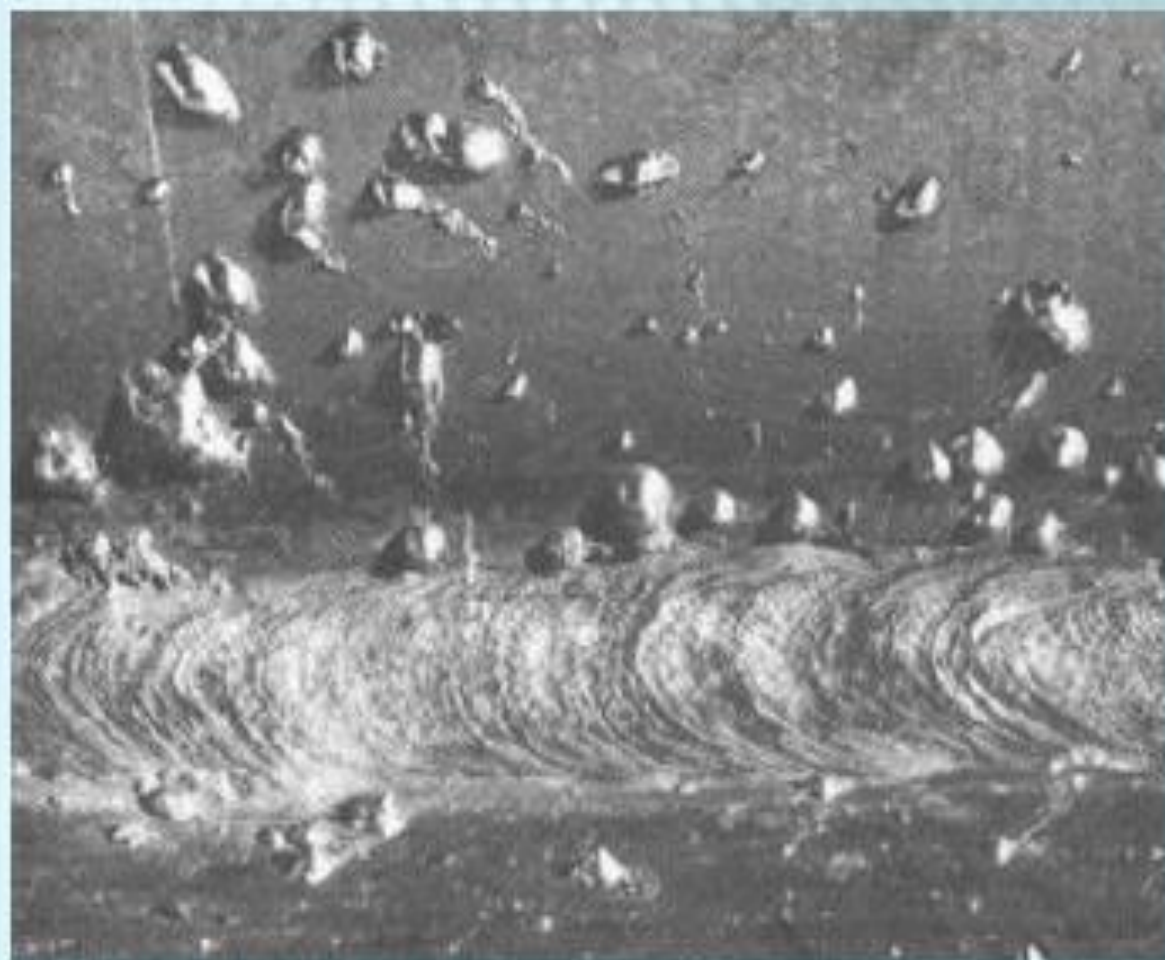

EXCESSIVE CONCAVITY OR CONVEXITY


Definition: Concavity or convexity of a fillet weld which exceeds the specified allowable limits

Cause: Amperage and travel speed

Prevention: Observe proper parameters and techniques.


Repair: Grind off or weld on. Must blend smoothly into the base metal.

Concavity

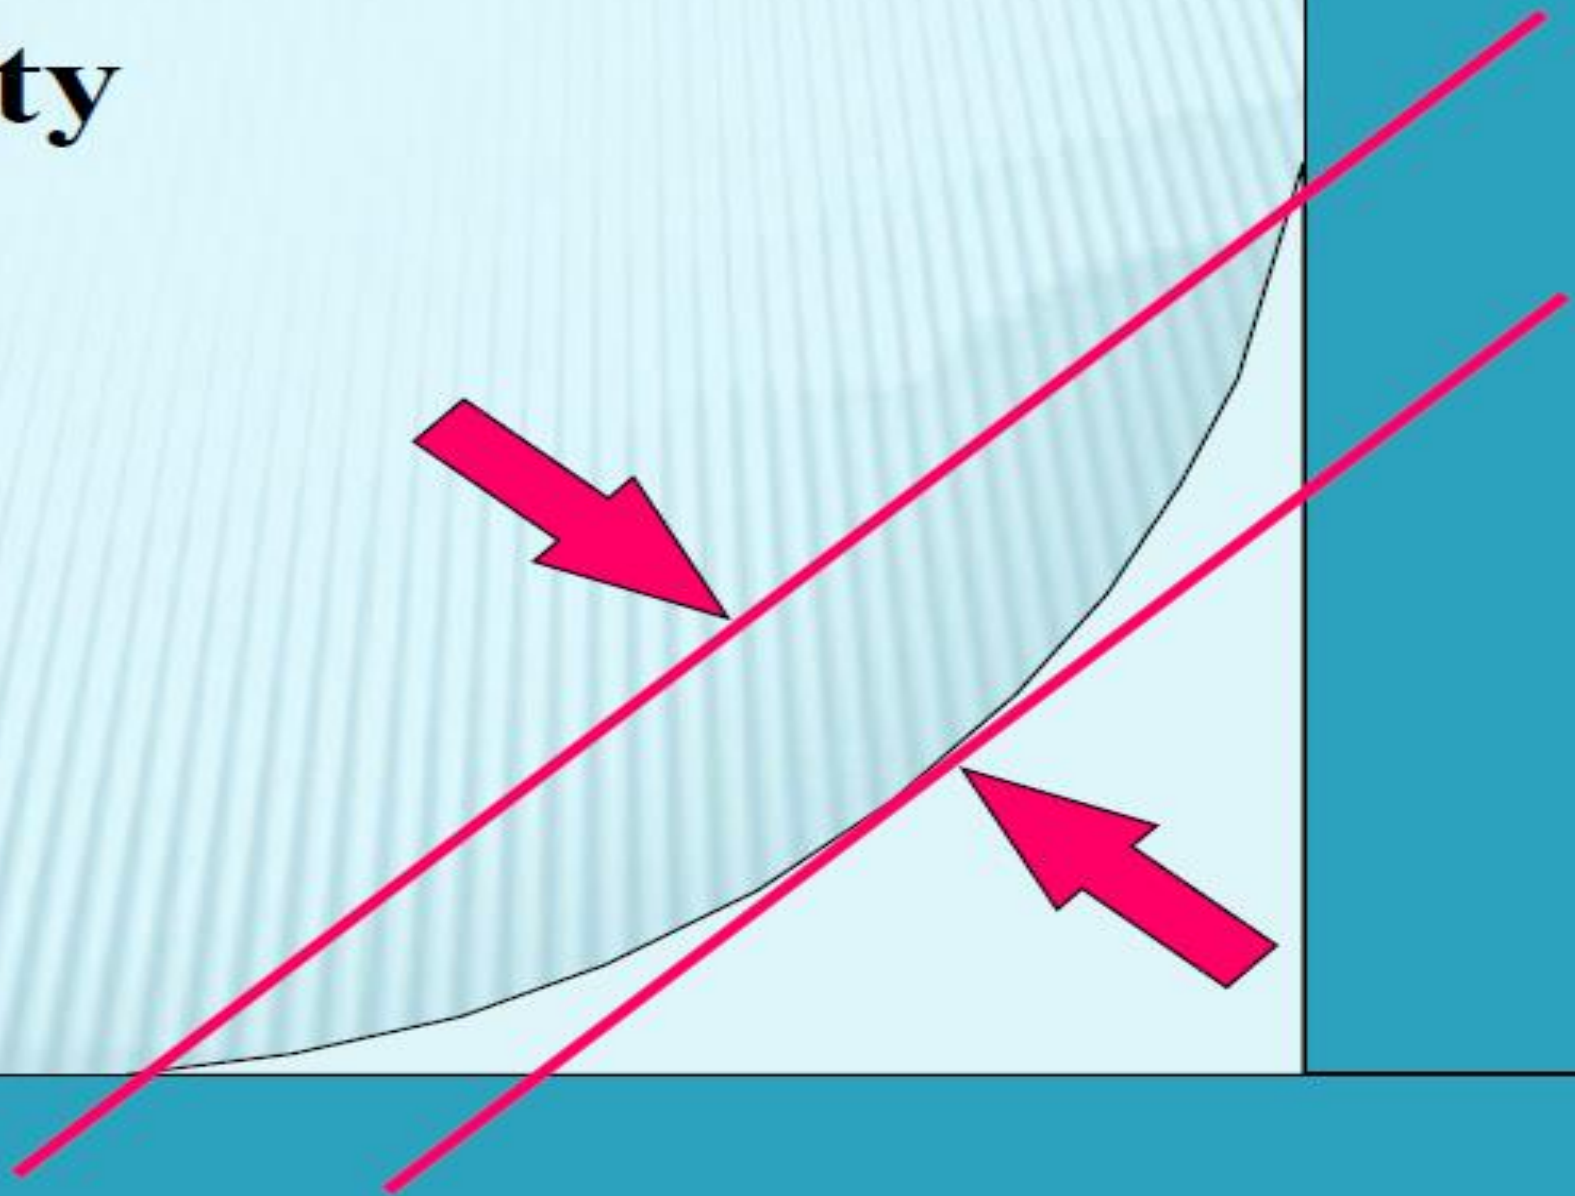



EXCESSIVE CONCAVITY



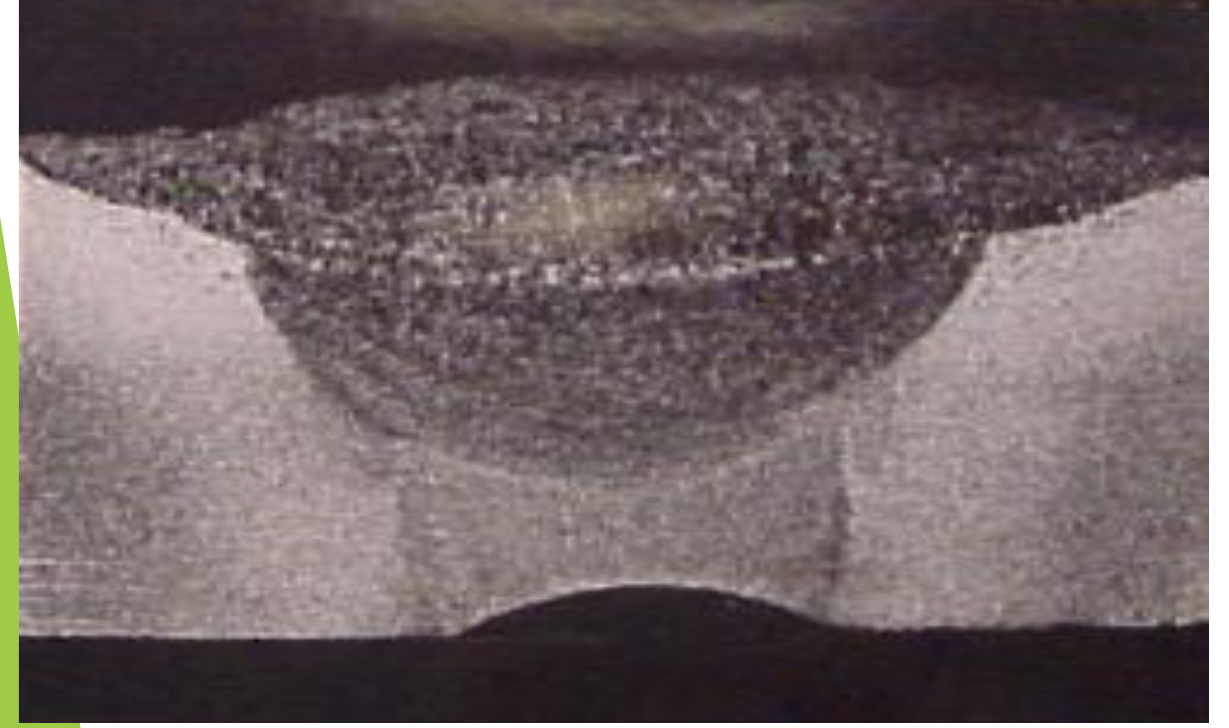


Suck back/concave root

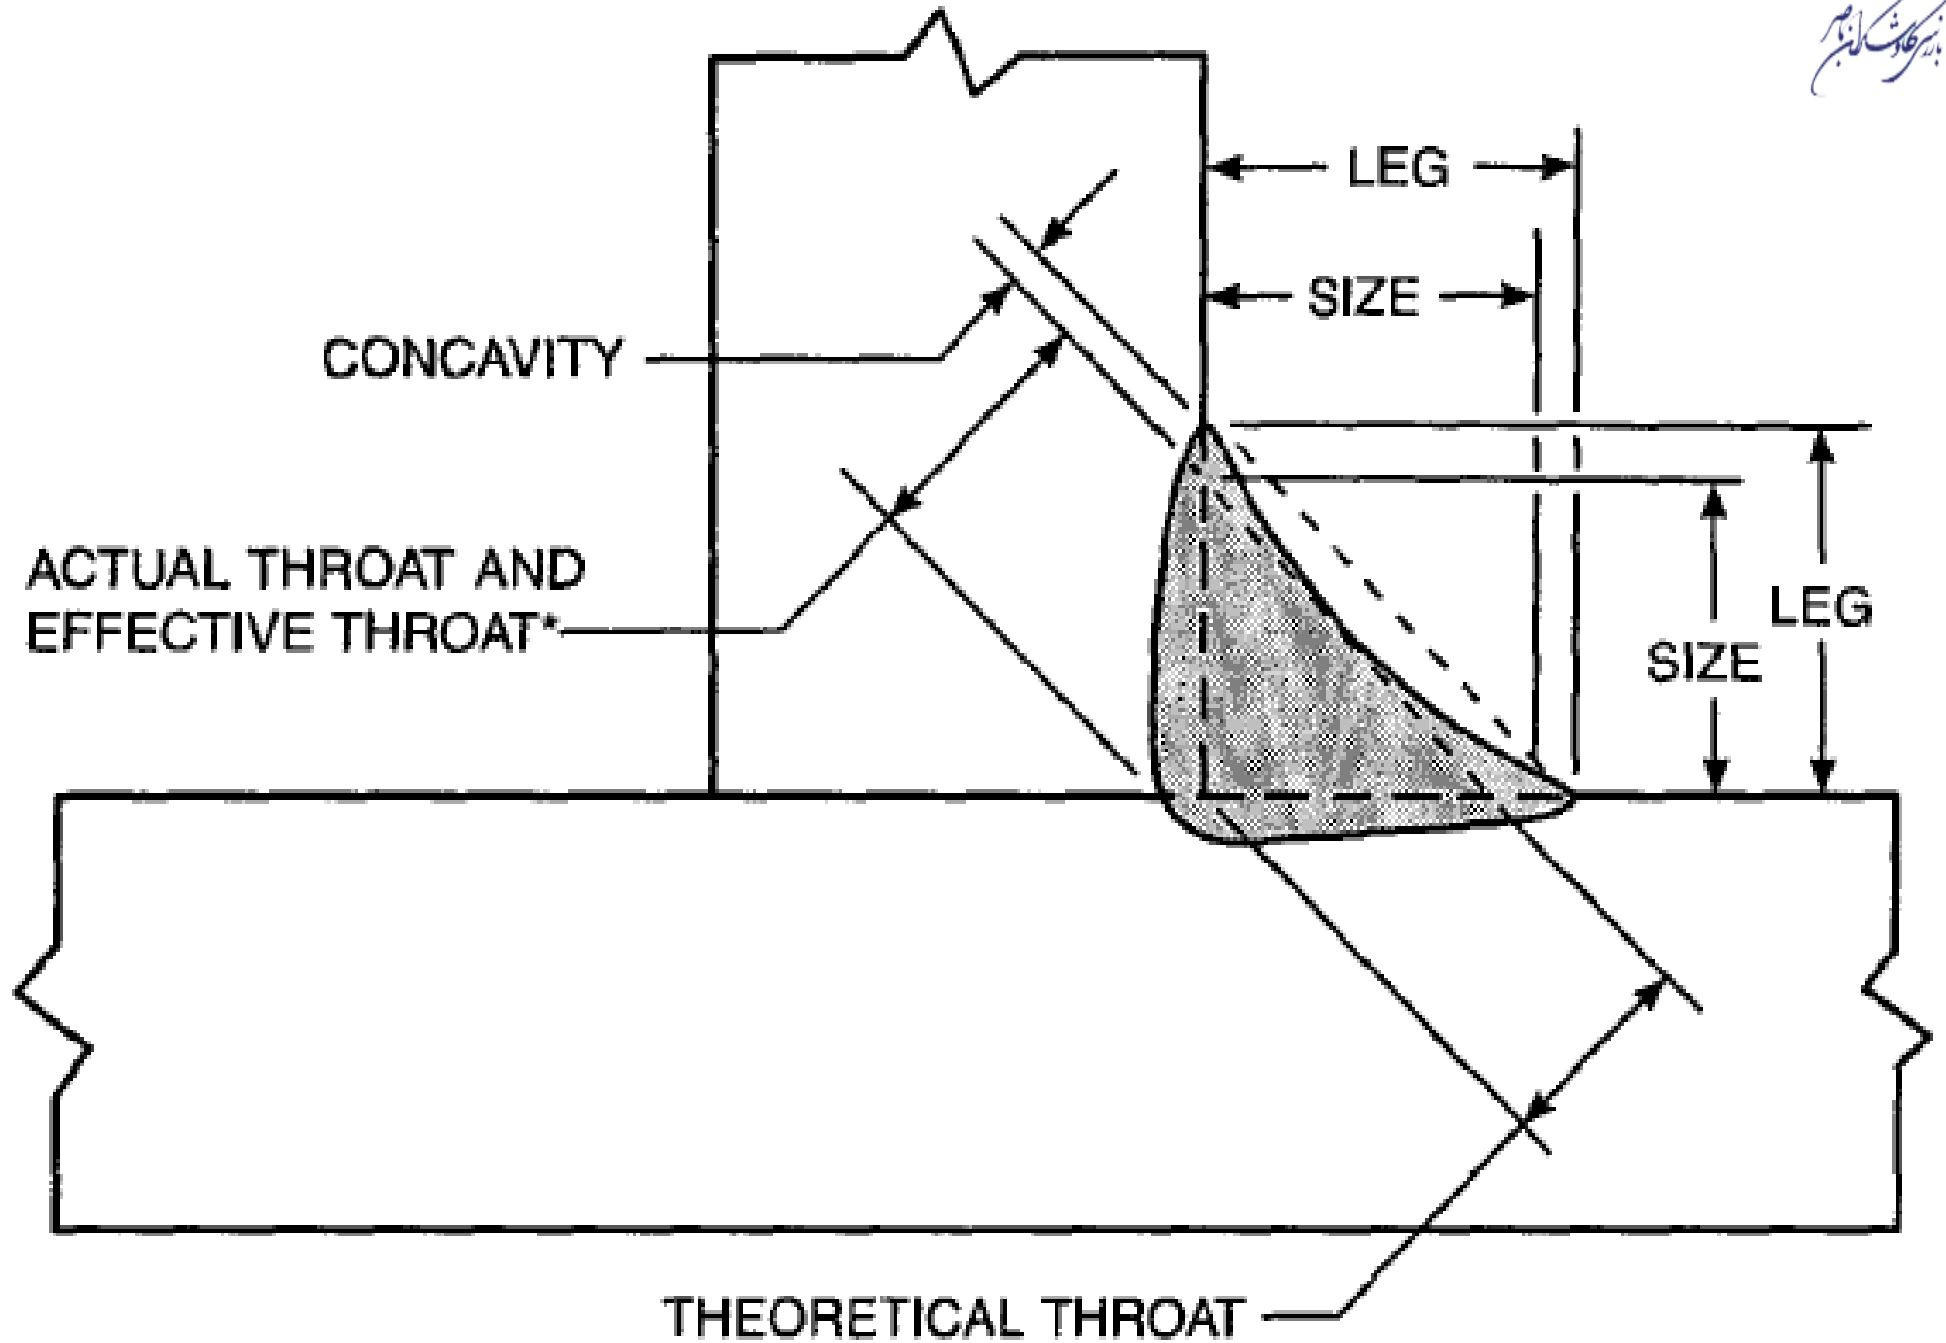

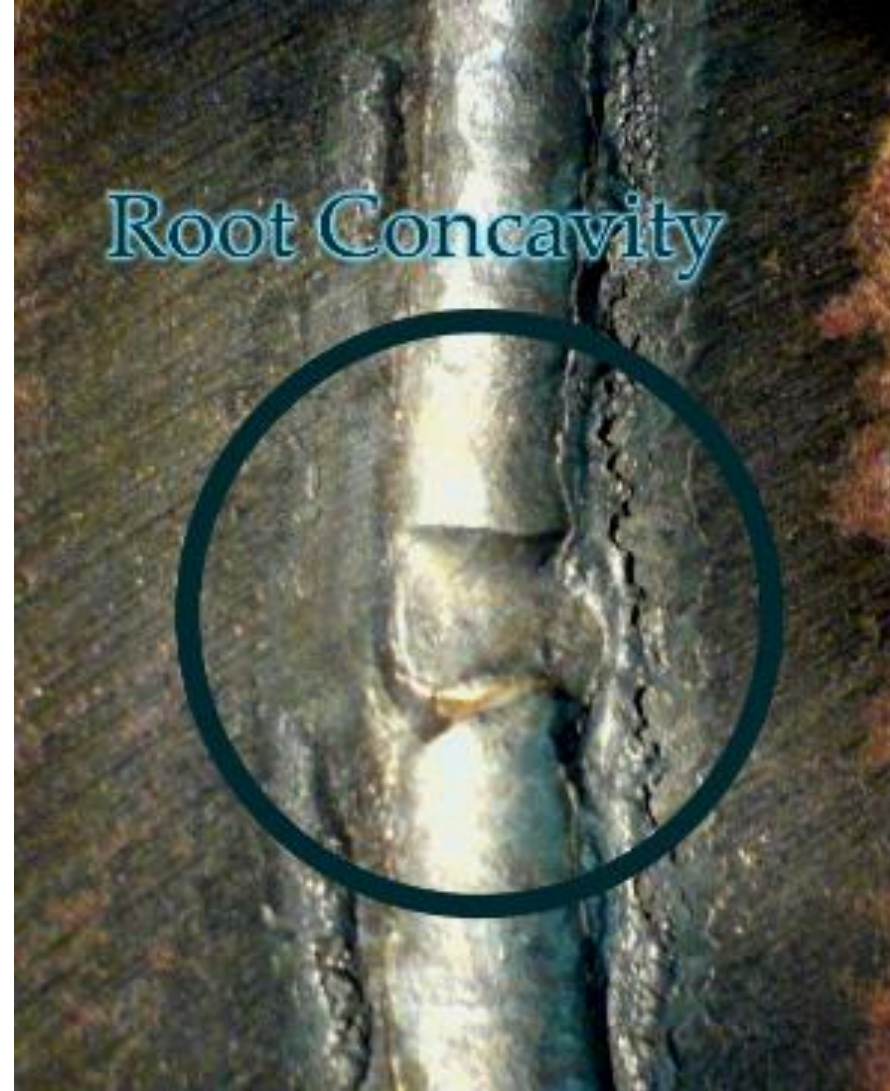


Convexity

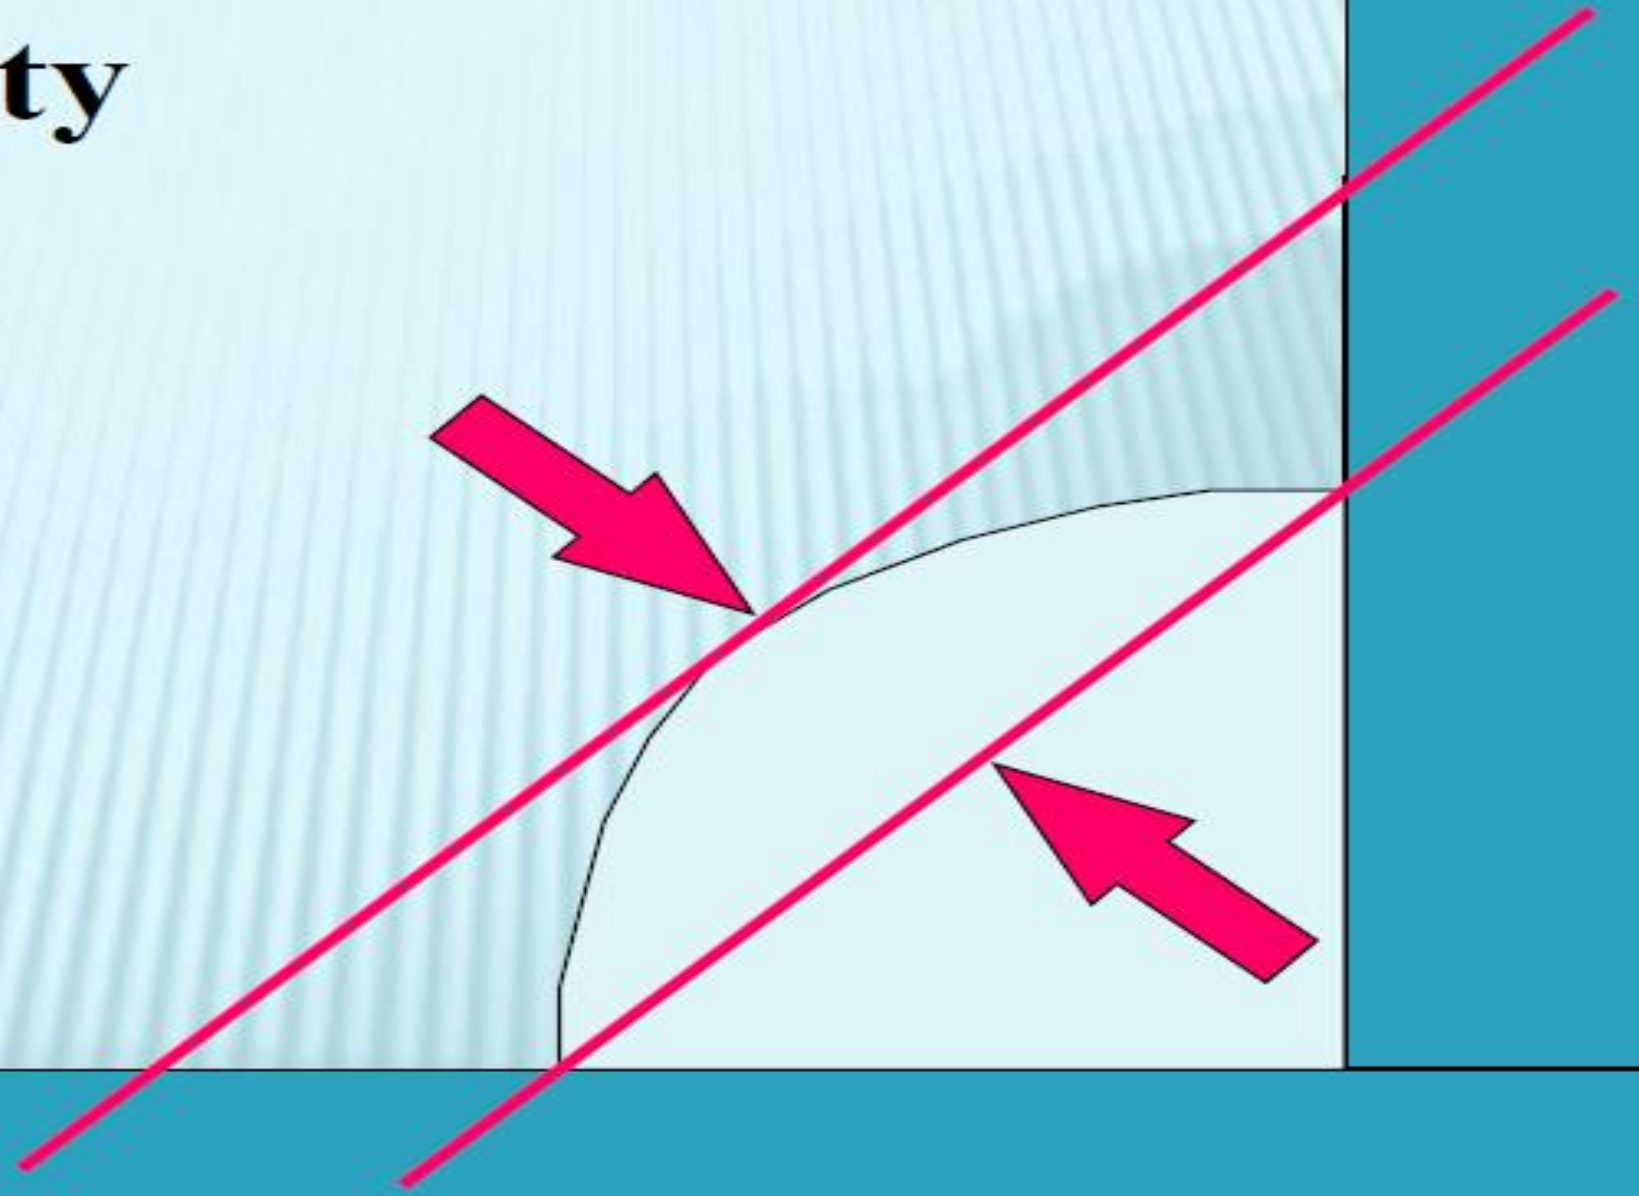


EXCESSIVE CONVEXITY



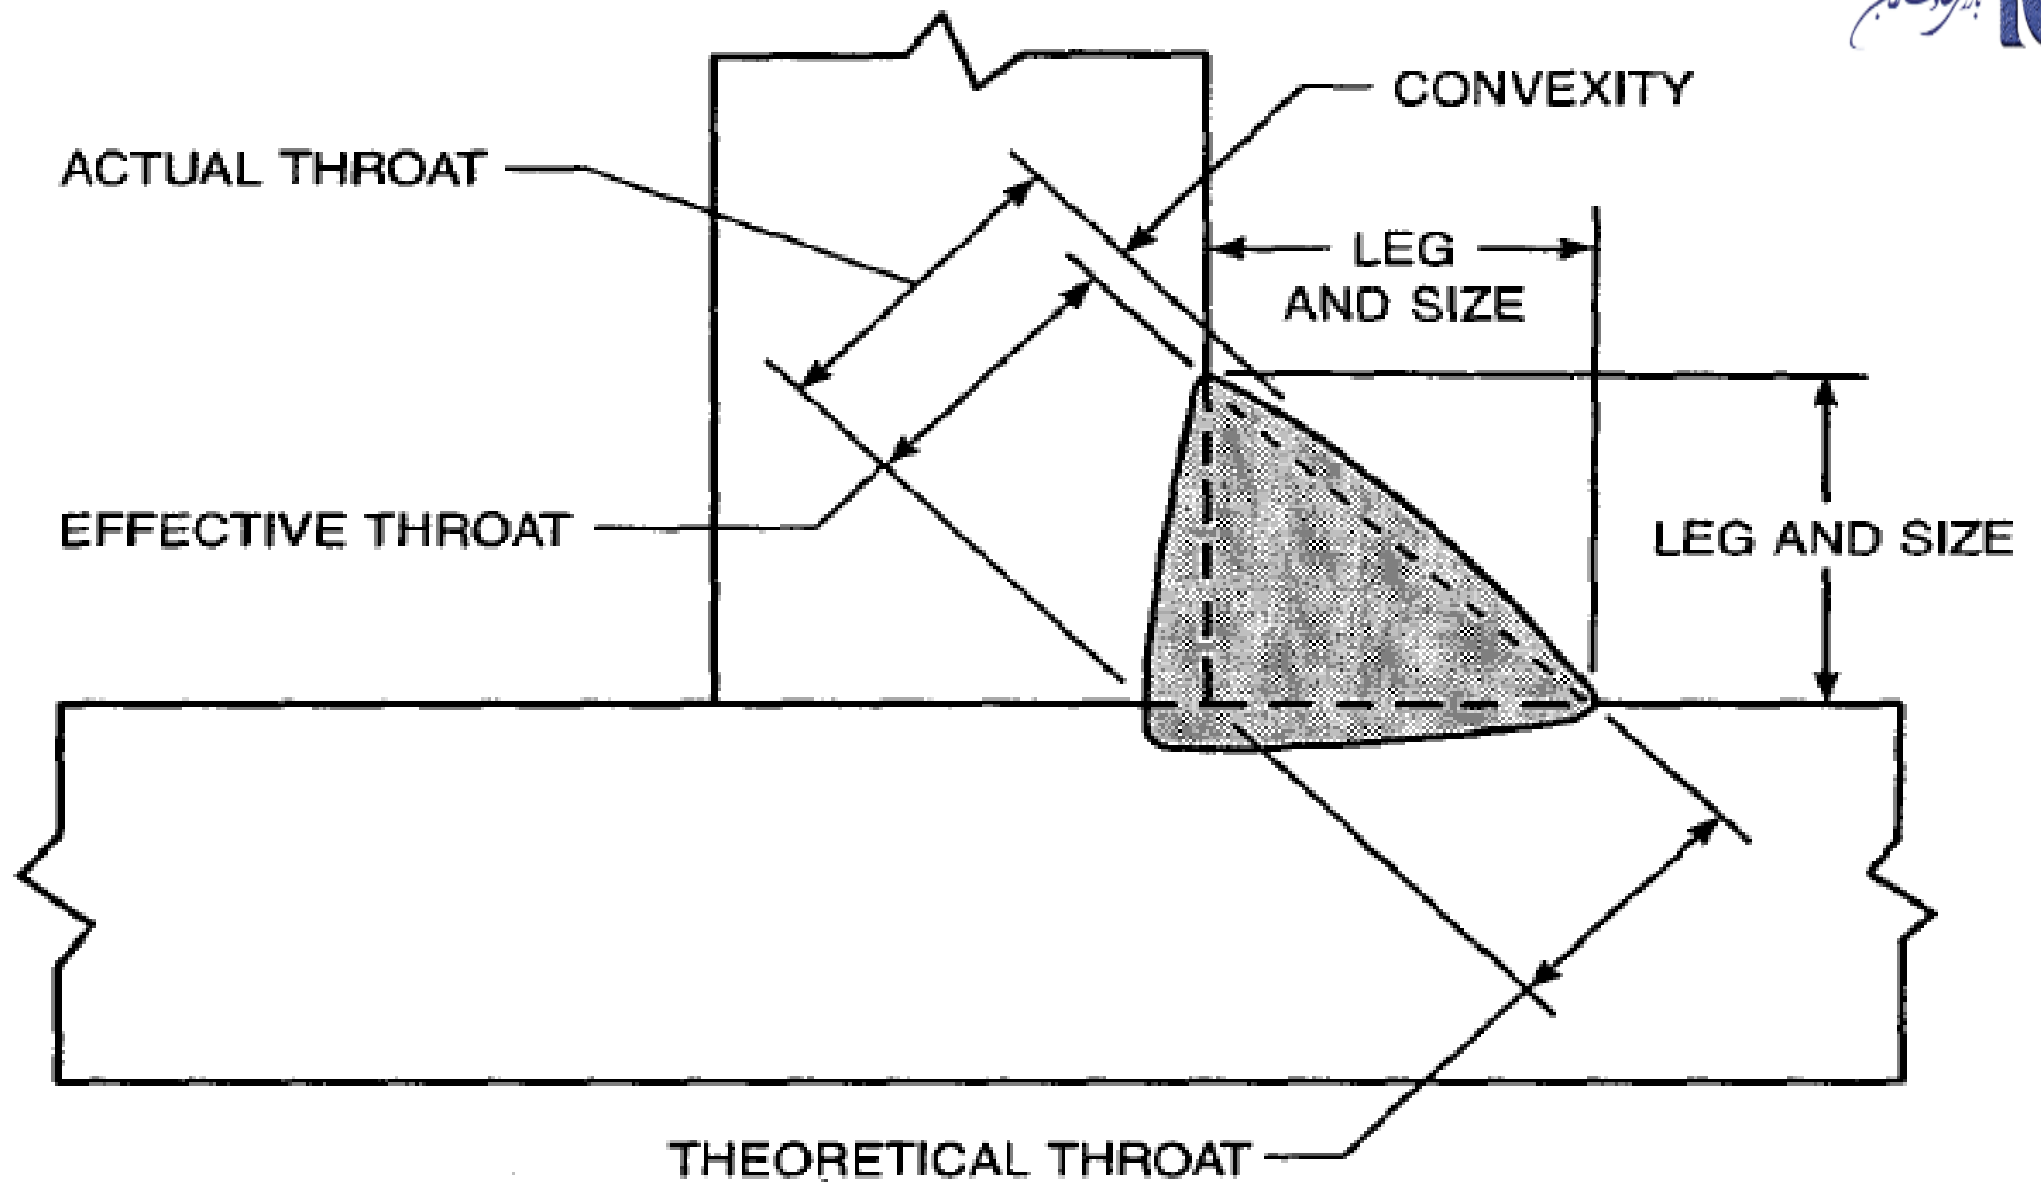

(A) Convex Fillet Weld

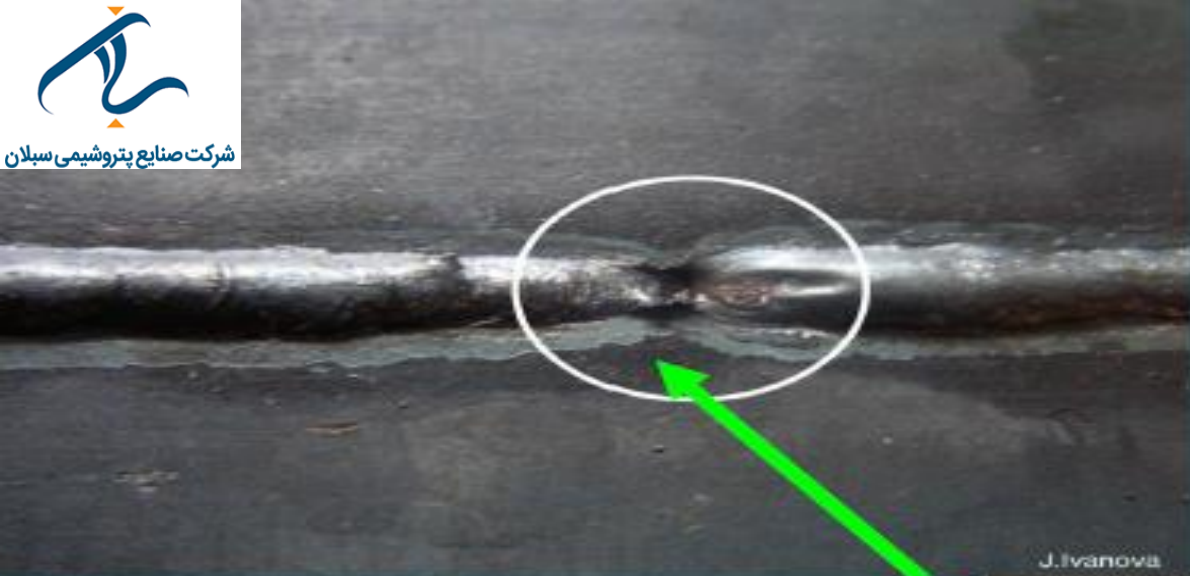

J. Ivanova

Poor stop/starts



Poor Restart






Poor Restart

Surface & Profile


EXCESSIVE REINFORCEMENT

× Causes:

- + Deposition of too much weld metal, often associated with inadequate weld preparation
- + Incorrect welding parameters
- + Too large of an electrode for the joint in question

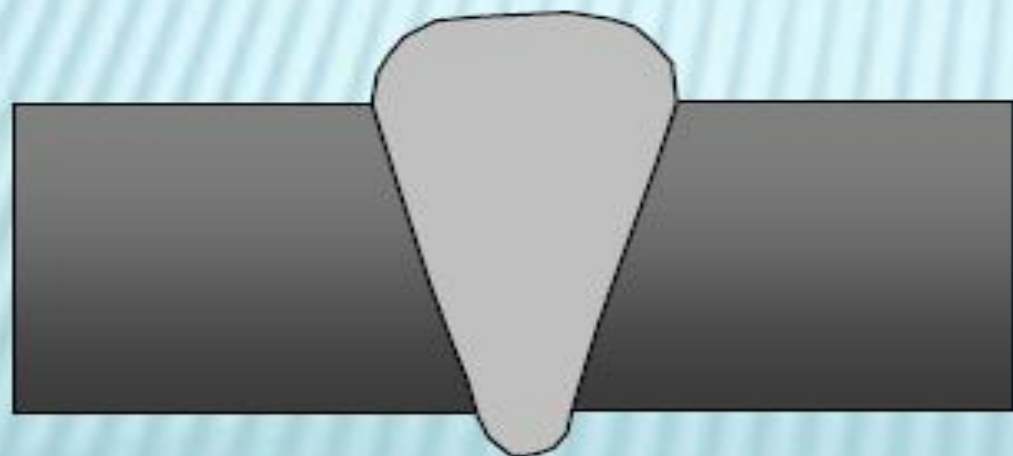

Excessive cap height

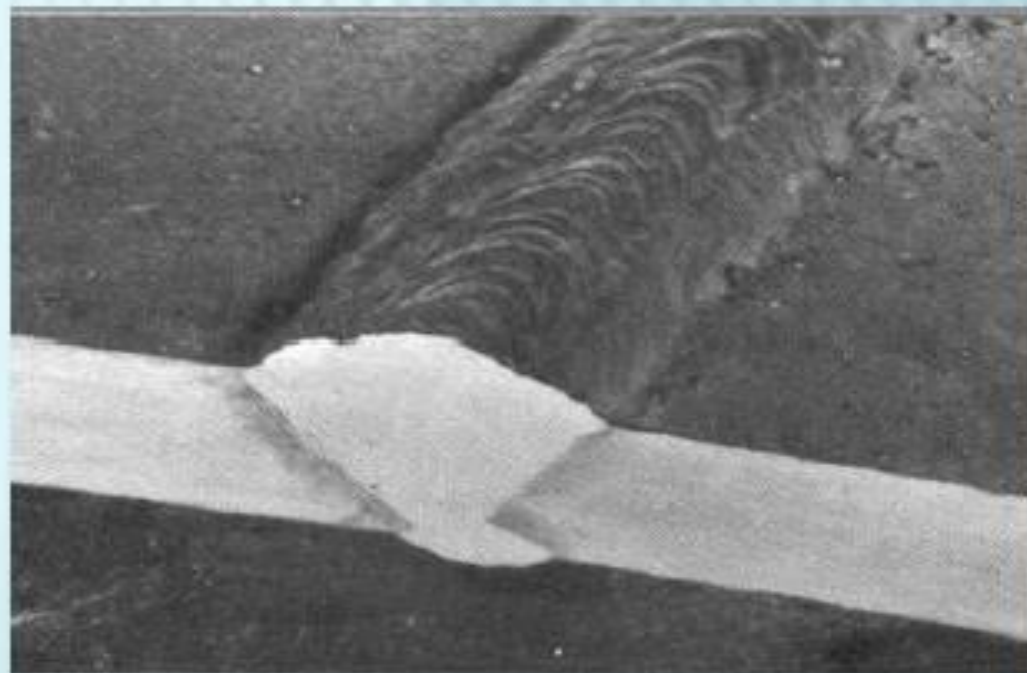


INSUFFICIENT FILL

Definition: The weld surface is below the adjacent surfaces of the base metal ✘

Cause: Improper welding techniques




Prevention: Apply proper welding techniques for the weld type and position. Use stripper beads before the cover pass.

Repair: Simply weld to fill. May require preparation by grinding.

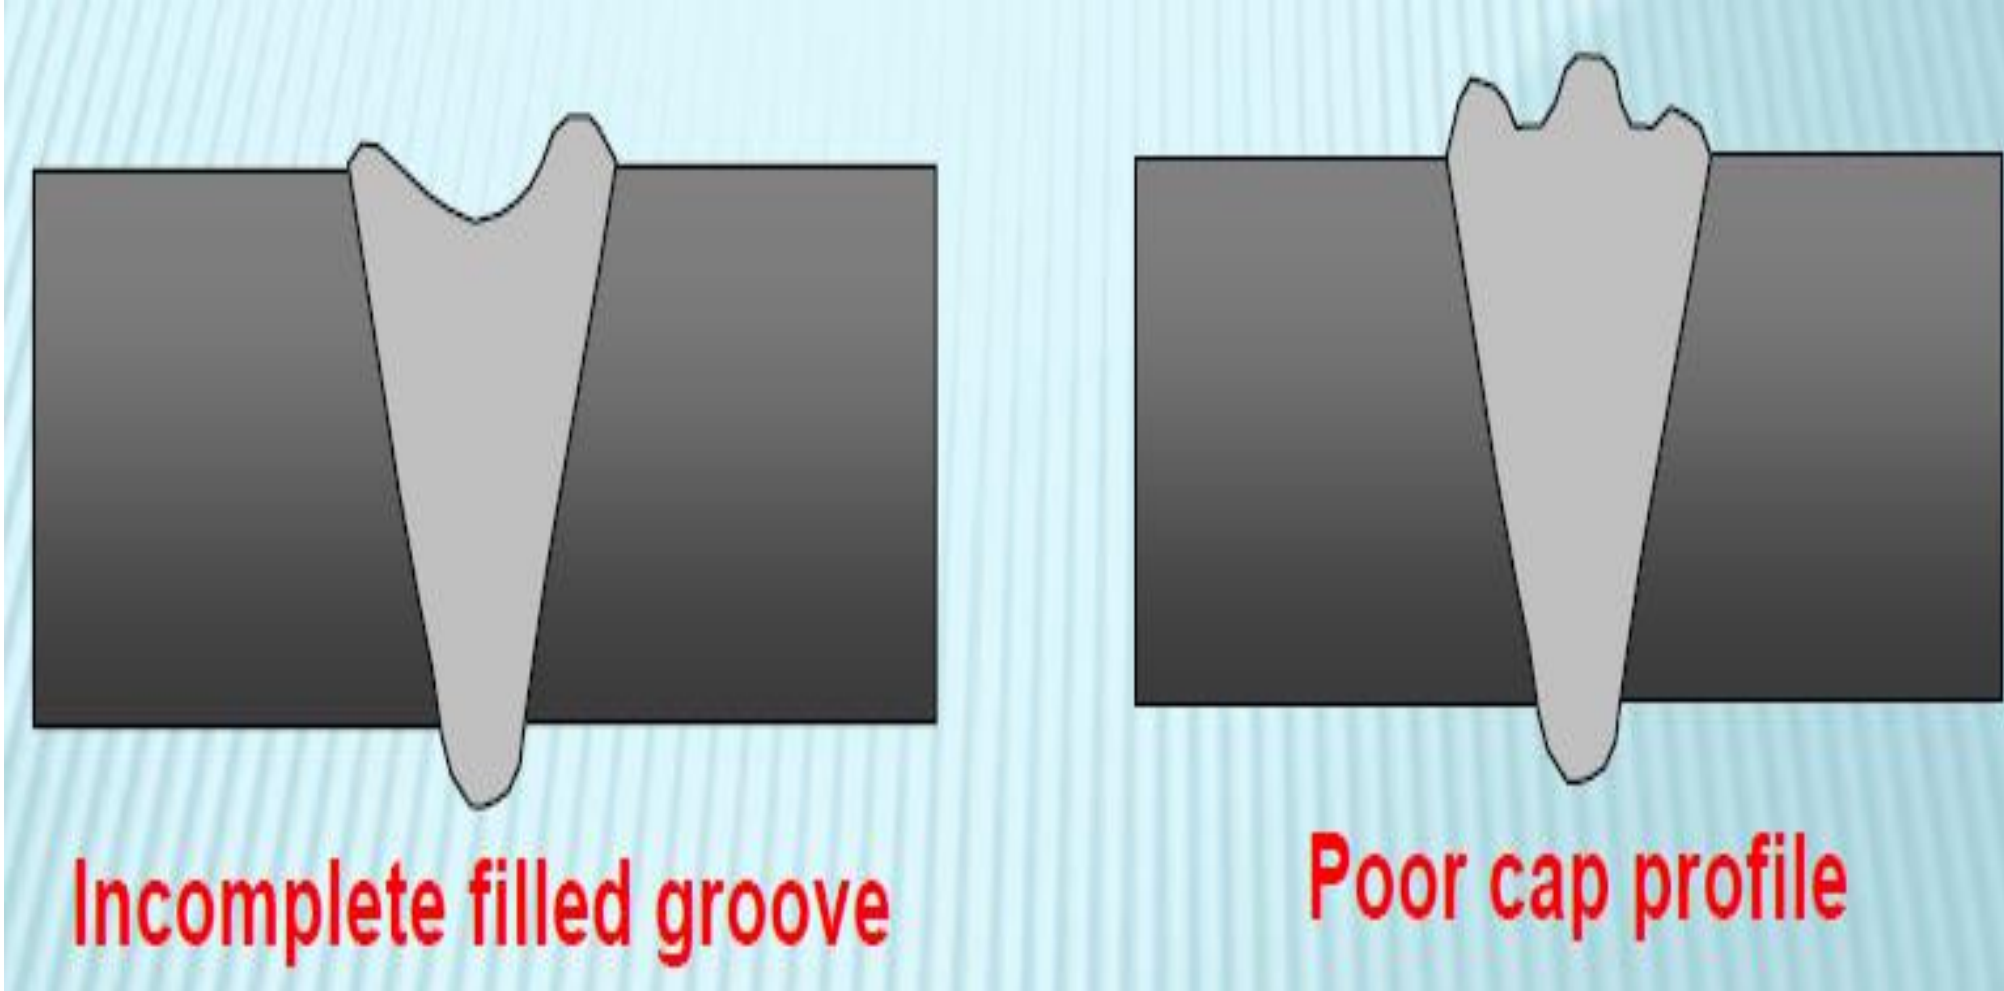



Under Fill

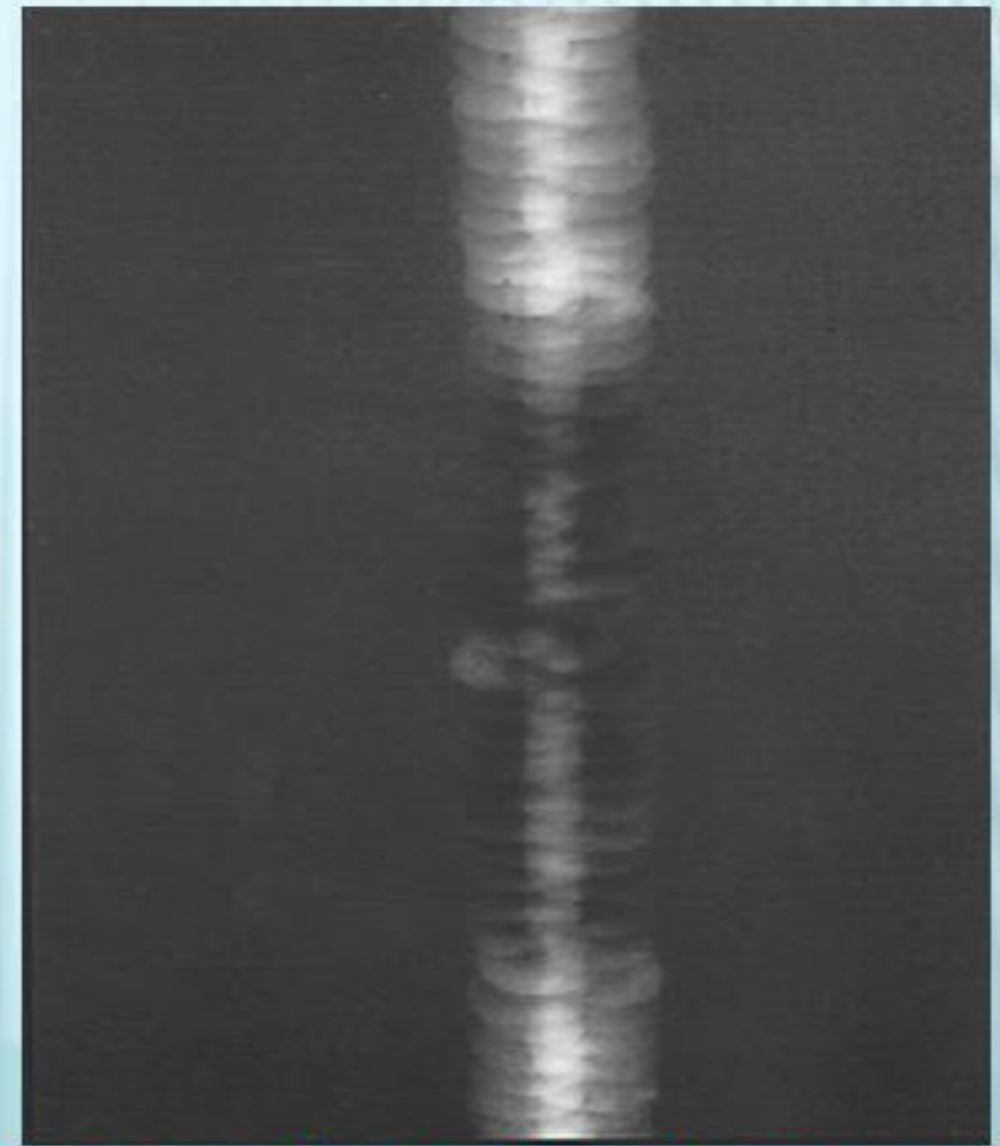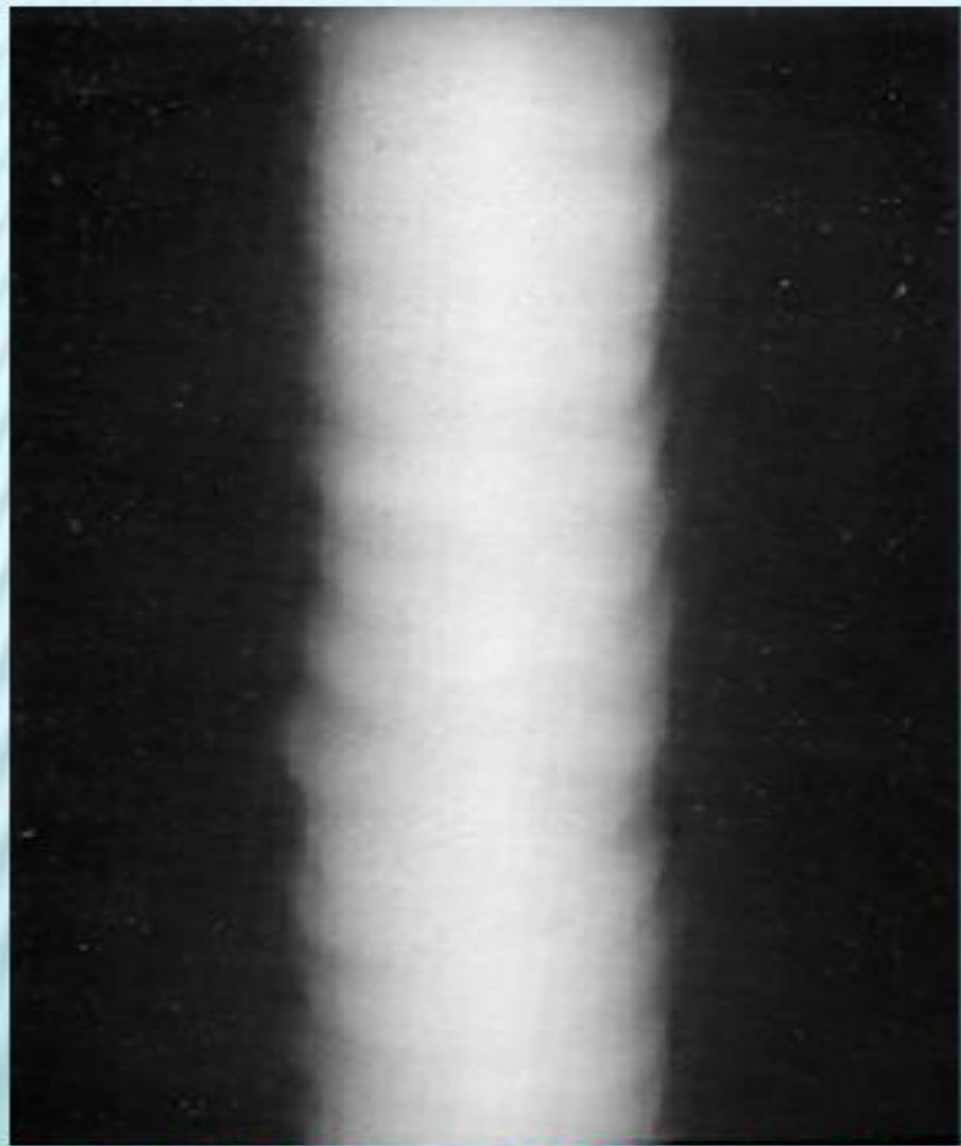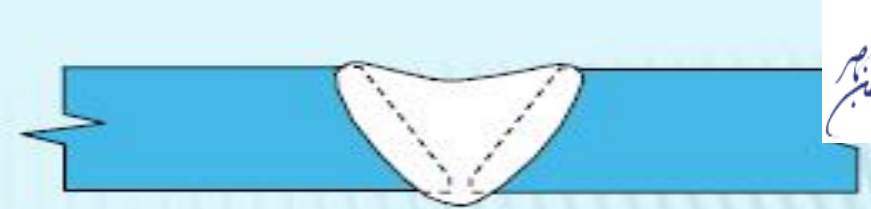


Excess cap reinforcement

Incomplete filled groove

Excessive Penetration



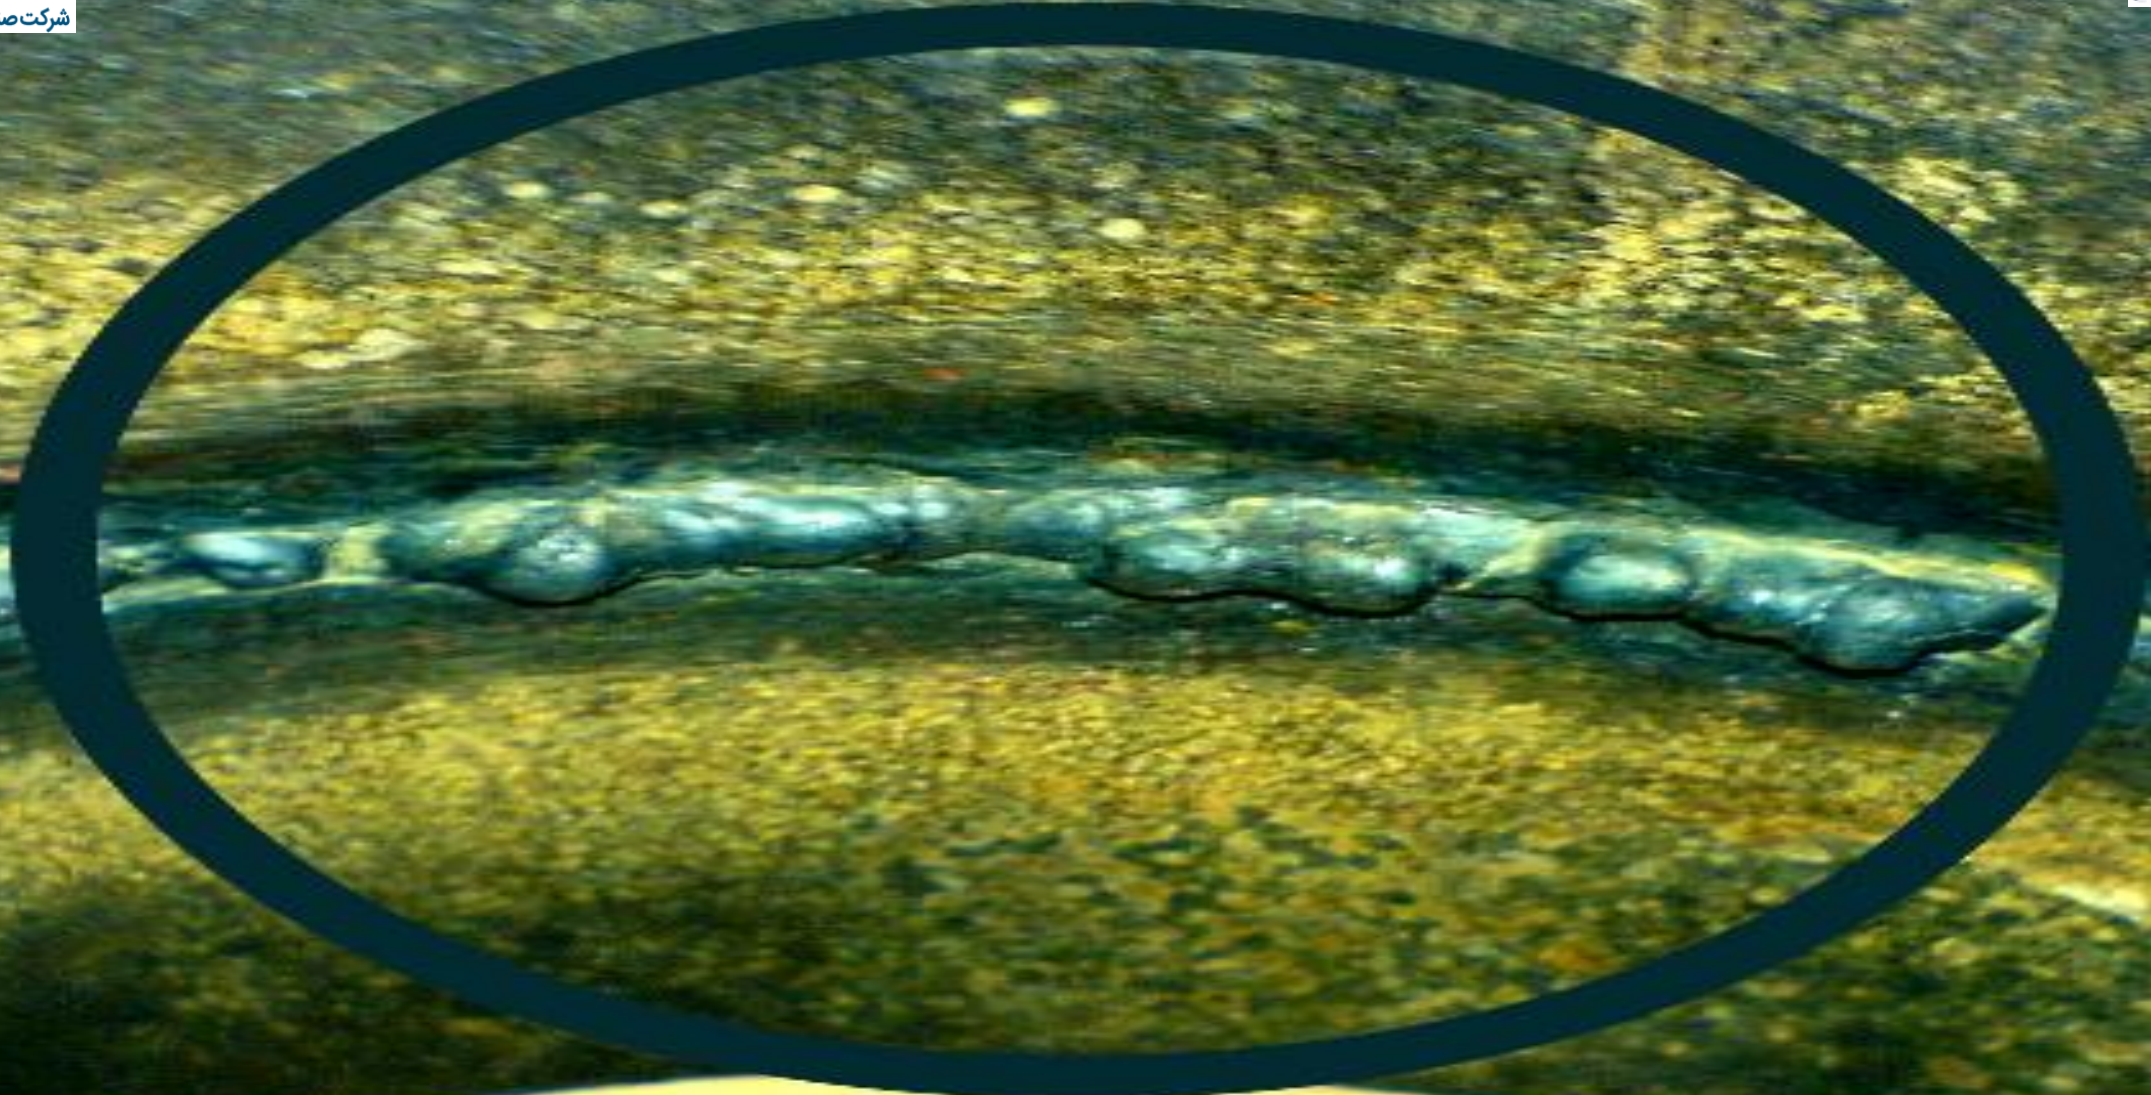


Excessive Root Penetration



Spatter



شرکت صنایع پتروشیمی سیلان

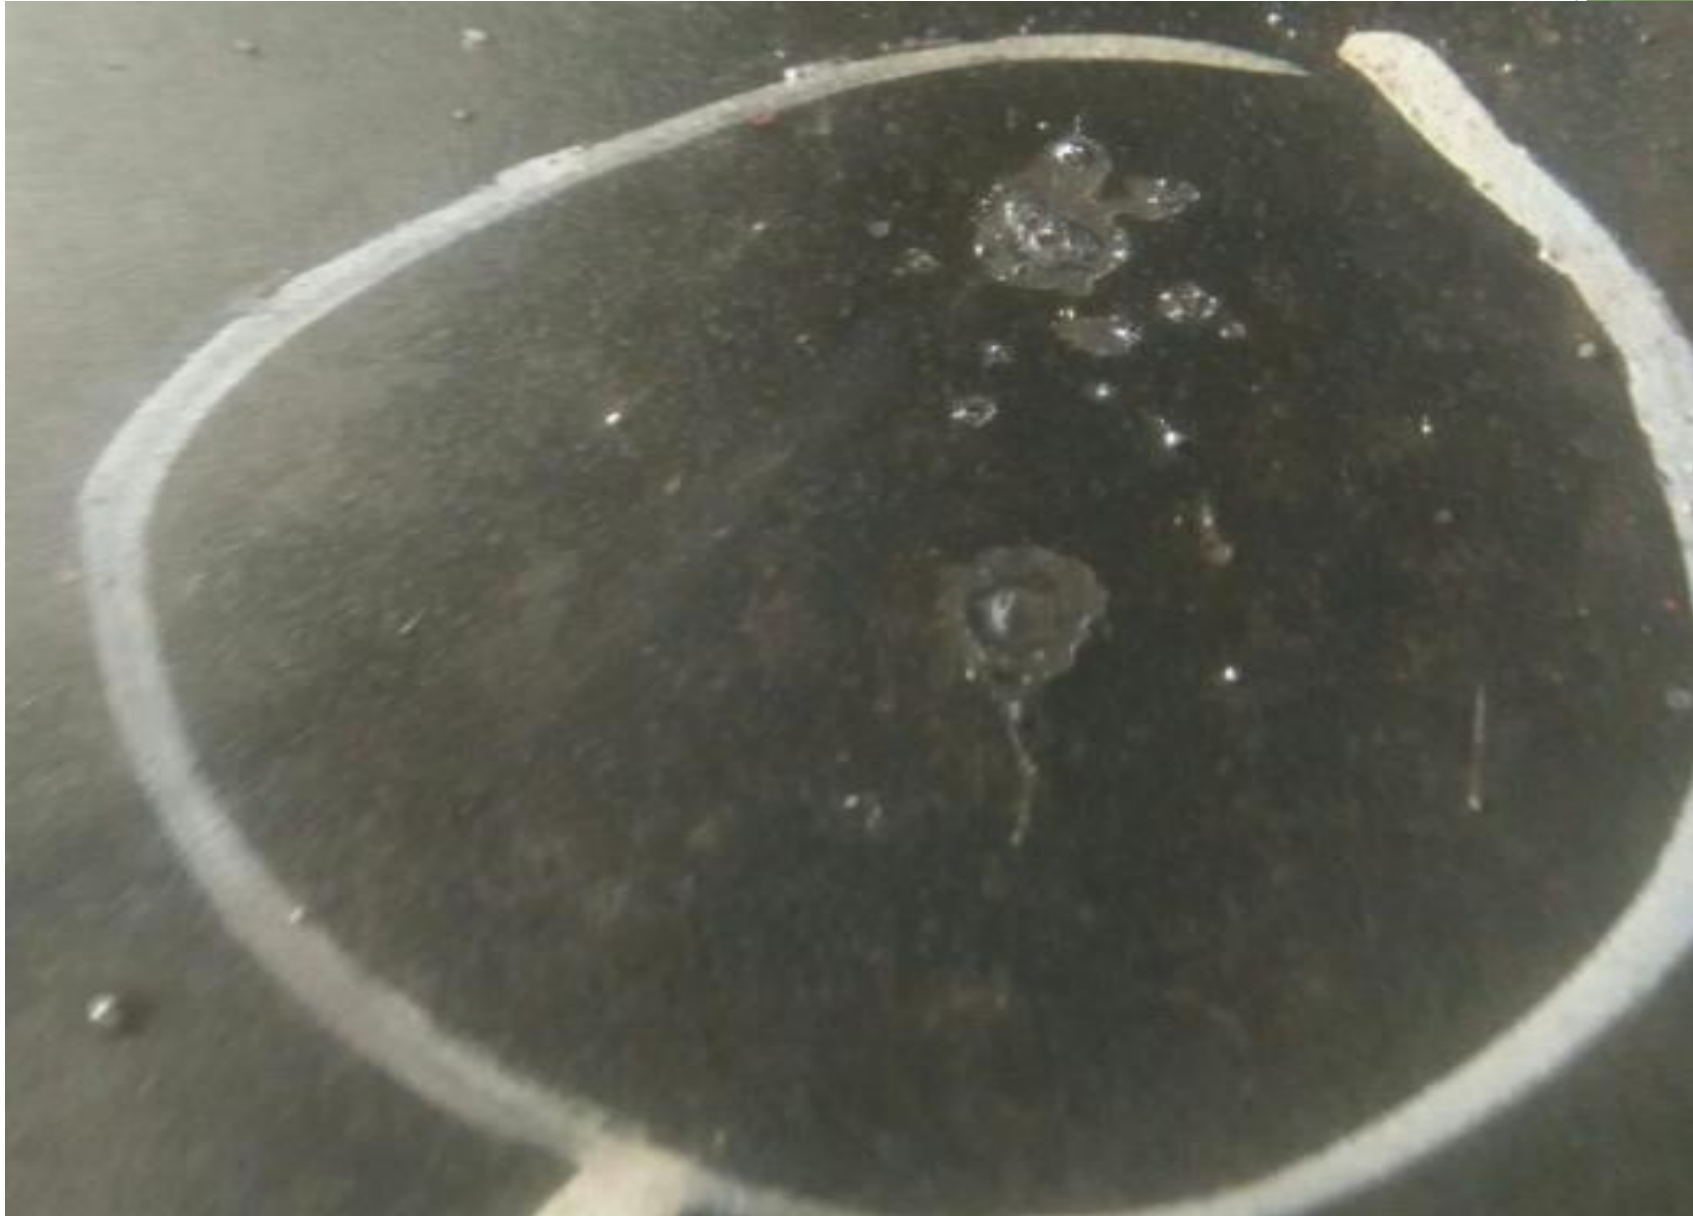





Miscellaneous Defects

Accidental striking of the arc onto the parent material

Faulty electrode holder

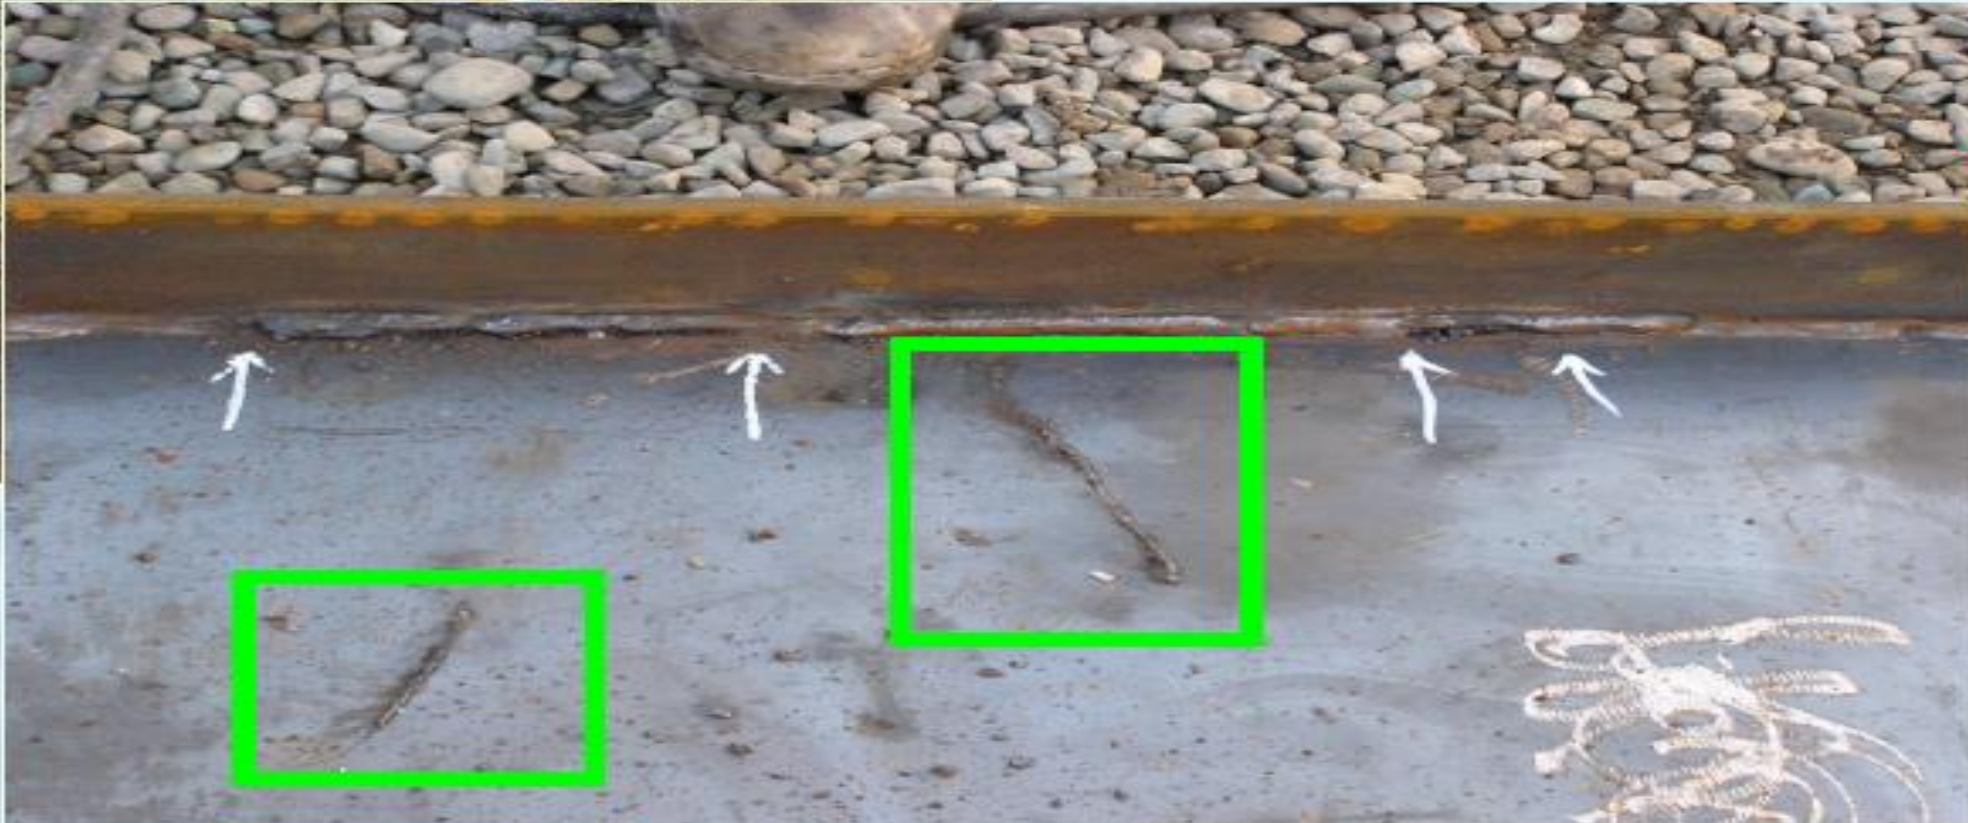

ng

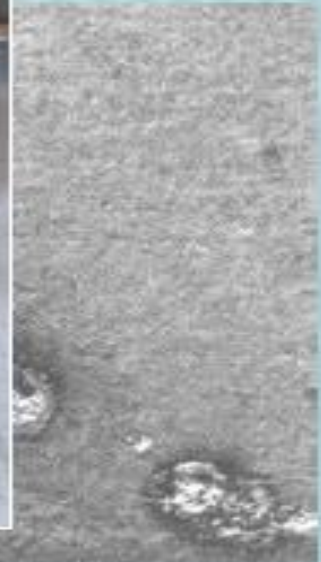



شرکت صنایع پتروشیمی سبلان







نوع عیب	نوع عیب	نوع عیب	نوع عیب	نوع عیب	نوع عیب	نوع عیب	فرایند جوشکاری
روی هم افتادگی	خوردگی کنار جوش	عدم ذوب	عدم نفوذ	ترک	حبس سرباره	خلل و فرج	جوشکاری الکتروود دستی
	خوردگی کنار جوش	عدم ذوب	عدم نفوذ	ترک		خلل و فرج	جوشکاری آرگن
روی هم افتادگی	خوردگی کنار جوش	عدم ذوب	عدم نفوذ	ترک		خلل و فرج	جوشکاری CO2
	خوردگی کنار جوش	عدم ذوب	عدم نفوذ	ترک		خلل و فرج	جوشکاری الکترواسلگ
	خوردگی کنار جوش	عدم ذوب	عدم نفوذ	ترک	حبس سرباره	-	جوشکاری زیرپودری

ACCEPTANCE CRITERIA

استاندارد خطوط لوله مقررات جوشکاری API 1104
استاندارد ساخت مخازن ذخیره اتمسفری API STD 650
ساخت مخازن ذخیره بزرگ API STD 620
مشخصات ساخت لوله API 5L
سیستم های لوله کشی صنعتی ASME B31.3
طراحی و ساخت مخازن تحت فشار 1 ASME SEC VIII DIV
مقررات سازه های ساختمانی AWS D1.1

**Table 6.1
Visual Inspection Acceptance Criteria (see 6.9)**

Discontinuity Category and Inspection Criteria	Statically Loaded Nontubular Connections	Cyclically Loaded Nontubular Connections								
(1) Crack Prohibition Any crack shall be unacceptable, regardless of size or location.	X	X								
(2) Weld/Base Metal Fusion Complete fusion shall exist between adjacent layers of weld metal and between weld metal and base metal.	X	X								
(3) Crater Cross Section All craters shall be filled to provide the specified weld size, except for the ends of intermittent fillet welds outside of their effective length.	X	X								
(4) Weld Profiles Weld profiles shall be in conformance with 5.23.	X	X								
(5) Time of Inspection Visual inspection of welds in all steels may begin immediately after the completed welds have cooled to ambient temperature. Acceptance criteria for ASTM A514, A517, and A709 Grade HPS 100W [HPS 690W] steels shall be based on visual inspection performed not less than 48 hours after completion of the weld.	X	X								
(6) Undersized Welds The size of a fillet weld in any continuous weld may be less than the specified nominal size (L) without correction by the following amounts (U): <table style="margin-left: auto; margin-right: auto; border: none;"> <tr> <td style="text-align: center;">L, specified nominal weld size, in [mm]</td> <td style="text-align: center;">U, allowable decrease from L, in [mm]</td> </tr> <tr> <td style="text-align: center;">$\leq 3/16$ [5]</td> <td style="text-align: center;">$\leq 1/16$ [2]</td> </tr> <tr> <td style="text-align: center;">$1/4$ [6]</td> <td style="text-align: center;">$\leq 3/32$ [2.5]</td> </tr> <tr> <td style="text-align: center;">$\geq 5/16$ [8]</td> <td style="text-align: center;">$\leq 1/8$ [3]</td> </tr> </table> In all cases, the undersize portion of the weld shall not exceed 10% of the weld length. On web-to-flange welds on girders, underrun shall be prohibited at the ends for a length equal to twice the width of the flange.	L, specified nominal weld size, in [mm]	U, allowable decrease from L, in [mm]	$\leq 3/16$ [5]	$\leq 1/16$ [2]	$1/4$ [6]	$\leq 3/32$ [2.5]	$\geq 5/16$ [8]	$\leq 1/8$ [3]	X	X
L, specified nominal weld size, in [mm]	U, allowable decrease from L, in [mm]									
$\leq 3/16$ [5]	$\leq 1/16$ [2]									
$1/4$ [6]	$\leq 3/32$ [2.5]									
$\geq 5/16$ [8]	$\leq 1/8$ [3]									
(7) Undercut (A) For material less than 1 in [25 mm] thick, undercut shall not exceed 1/32 in [1 mm], with the following exception: undercut shall not exceed 1/16 in [2 mm] for any accumulated length up to 2 in [50 mm] in any 12 in [300 mm]. For material equal to or greater than 1 in [25 mm] thick, undercut shall not exceed 1/16 in [2 mm] for any length of weld.	X									

(B) In primary members, undercut shall be no more than 0.01 in [0.25 mm] deep when the weld is transverse to tensile stress under any design loading condition. Undercut shall be no more than 1/32 in [1 mm] deep for all other cases.		X
(8) Porosity (A) CJP groove welds in butt joints transverse to the direction of computed tensile stress shall have no visible piping porosity. For all other groove welds and for fillet welds, the sum of the visible piping porosity 1/32 in [1 mm] or greater in diameter shall not exceed 3/8 in [10 mm] in any linear inch of weld and shall not exceed 3/4 in [20 mm] in any 12 in [300 mm] length of weld.	X	
(B) The frequency of piping porosity in fillet welds shall not exceed one in each 4 in [100 mm] of weld length and the maximum diameter shall not exceed 3/32 in [2.5 mm]. Exception: for fillet welds connecting stiffeners to web, the sum of the diameters of piping porosity shall not exceed 3/8 in [10 mm] in any linear inch of weld and shall not exceed 3/4 in [20 mm] in any 12 in [300 mm] length of weld.		X
(C) CJP groove welds in butt joints transverse to the direction of computed tensile stress shall have no piping porosity. For all other groove welds, the frequency of piping porosity shall not exceed one in 4 in [100 mm] of length and the maximum diameter shall not exceed 3/32 in [2.5 mm].		X

Note: An "X" indicates applicability for the connection type; a shaded area indicates non-applicability.

AWS D1.1

- ▶ ۱- ترک داراي محدودیت مي باشد. هرگونه ترک معاف از اندازه و محل قرارگيري مردود مي باشد.
- ▶ ذوب کامل بايد بين اجزاي جوش و لايه هاي جوش بايد به صورت کامل انجام گيرد.
- ▶ همه عيوب مربوط به انتهاي جوش مردود مي باشد . بايد اصلاح گردد. مگر اينکه ته جوش در خارج از طول موثر جوش باشد.
- ▶ شکل جوش بايد مانند جداول راهنما باشد.
- ▶ مدت زمان بازرسي براي متریال هاي فولادي به محض اتمام جوش و سرد شدن جوش تا درجه حرارت محیط امکان پذیر مي باشد. فقط در مورد جوش هاي فلزات , A514 , A517, A709 GRADE HPS بايد تحت بازرسي چشمي قرار گيرند تا بعد از ۴۸ ساعت بعد از انجام جوشکاري

5.23 Weld Profiles

All welds shall meet the visual acceptance criteria of Tables 6.1 and 9.16, and shall be free from cracks, overlaps, and the unacceptable profile discontinuities exhibited in Figure 5.4, Table 5.8, and Table 5.9, except as otherwise allowed in 5.23.1, 5.23.2, and 5.23.3.

5.23.1 Fillet Welds. The faces of fillet welds may be slightly convex, flat, or slightly concave as shown in Figure 5.4 and as allowed by Tables 5.8, 5.9, 6.1, and 9.16.

5.23.2 Exception for Intermittent Fillet Welds. Except for undercut, as allowed by the code, the profile requirements of Figure 5.4 shall not apply to the ends of intermittent fillet welds outside their effective length.

5.23.3 Groove Welds. Groove weld reinforcement shall comply with Tables 5.8, and 5.9 and with the provisions below. Welds shall have a gradual transition to the plane of the base metal surfaces.

Table 5.8
Weld Profiles^a (see 5.23)

Weld Type	Joint Type					
	Butt	Corner—Inside	Corner—Outside	T-joint	Lap	Butt with Shelf Bar
Groove (CJP or PJP)	Figure 5.4A	Figure 5.4B ^b	Figure 5.4C	Figure 5.4D ^b	N/A	Figure 5.4C
	Schedule A	Schedule B	Schedule A	Schedule B	N/A	See Note c
Fillet	N/A	Figure 5.4E	Figure 5.4F	Figure 5.4E	Figure 5.4E	N/A
	N/A	Schedule C	Schedule C or D ^d	Schedule C	Schedule C	N/A

^aSchedules A through D are given in Table 5.9.

^bFor reinforcing fillet welds required by design, the profile restrictions apply to each groove and fillet, separately.

^cWelds made using shelf bars and welds made in the horizontal position between vertical bars of unequal thickness are exempt from R and C limitations. See Figures 5.4G and 5.4H for typical details.

^dSee Figure 5.4F for a description of where Schedule C and D apply.

Table 5.9
Weld Profile Schedules (see 5.23)

Schedule A	(t = thickness of thicker plate joined for CJP; t = weld size for PJP)			
	t	R min.	R max.	
	≤ 1 in [25 mm]	0	1/8 in [3 mm]	
	> 1 in [25 mm], ≤ 2 in [50 mm]	0	3/16 in [5 mm]	
> 2 in [50 mm]	0	1/4 in [6 mm] ^a		
Schedule B	(t = thickness of thicker plate joined for CJP; t = weld size for PJP; C = allowable convexity or concavity)			
	t	R min.	R max.	C max. ^b
	< 1 in [25 mm]	0	unlimited	1/8 in [3 mm]
	≥ 1 in [25 mm]	0	unlimited	3/16 in [5 mm]
Schedule C	(W = width of weld face or individual surface bead; C = allowable convexity)			
	W	C max. ^b		
	< 5/16 in [8 mm]	1/16 in [2 mm]		
	> 5/16 in [8 mm], < 1 in [25 mm]	1/8 in [3 mm]		
≥ 1 in [25 mm]	3/16 in [5 mm]			
Schedule D	(t = thickness of thinner of the exposed edge dimensions; C = allowable convexity; see Figure 5.4F)			
	t	C max. ^b		
	any value of t	t/2		

^aFor cyclically loaded structures, R max. for materials > 2 in [50 mm] thick is 3/16 in [5 mm].

^bThere is no restriction on concavity as long as minimum weld size (considering both leg and throat) is achieved.

Table 9.16
Visual Inspection Acceptance Criteria (see 9.25)



Discontinuity Category and Inspection Criteria	Tubular Connections (All Loads)										
(1) Crack Prohibition Any crack shall be unacceptable, regardless of size or location.	X										
(2) Weld/Base Metal Fusion Complete fusion shall exist between adjacent layers of weld metal and between weld metal and base metal.	X										
(3) Crater Cross Section All craters shall be filled to provide the specified weld size, except for the ends of intermittent fillet welds outside of their effective length.	X										
(4) Weld Profiles Weld profiles shall be in conformance with 5.23.	X										
(5) Time of Inspection Visual inspection of welds in all steels may begin immediately after the completed welds have cooled to ambient temperature. Acceptance criteria for ASTM A514, A517, and A709 Grade HPS 100W [HPS 690W] steels shall be based on visual inspection performed not less than 48 hours after completion of the weld.	X										
(6) Undersized Welds The size of a fillet weld in any continuous weld may be less than the specified nominal size (L) without correction by the following amounts (U): <table border="0" style="margin-left: auto; margin-right: auto;"> <tr> <td style="text-align: center;">L_n</td> <td style="text-align: center;">U_n</td> </tr> <tr> <td style="text-align: center;">specified nominal weld size, in [mm]</td> <td style="text-align: center;">allowable decrease from L, in [mm]</td> </tr> <tr> <td style="text-align: center;">$\leq 3/16$ [5]</td> <td style="text-align: center;">$\leq 1/16$ [2]</td> </tr> <tr> <td style="text-align: center;">$1/4$ [6]</td> <td style="text-align: center;">$\leq 3/32$ [2.5]</td> </tr> <tr> <td style="text-align: center;">$\geq 5/16$ [8]</td> <td style="text-align: center;">$\leq 1/8$ [3]</td> </tr> </table> In all cases, the undersize portion of the weld shall not exceed 10% of the weld length. On web-to-flange welds on girders, undercut shall be prohibited at the ends for a length equal to twice the width of the flange.	L_n	U_n	specified nominal weld size, in [mm]	allowable decrease from L, in [mm]	$\leq 3/16$ [5]	$\leq 1/16$ [2]	$1/4$ [6]	$\leq 3/32$ [2.5]	$\geq 5/16$ [8]	$\leq 1/8$ [3]	X
L_n	U_n										
specified nominal weld size, in [mm]	allowable decrease from L, in [mm]										
$\leq 3/16$ [5]	$\leq 1/16$ [2]										
$1/4$ [6]	$\leq 3/32$ [2.5]										
$\geq 5/16$ [8]	$\leq 1/8$ [3]										
(7) Undercut (A) For material less than 1 in [25 mm] thick, undercut shall not exceed 1/32 in [1 mm], with the following exception: undercut shall not exceed 1/16 in [2 mm] for any accumulated length up to 2 in [50 mm] in any 12 in [300 mm]. For material equal to or greater than 1 in [25 mm] thick, undercut shall not exceed 1/16 in [2 mm] for any length of weld. (B) In primary members, undercut shall be no more than 0.01 in [0.25 mm] deep when the weld is transverse to tensile stress under any design loading condition. Undercut shall be no more than 1/32 in [1 mm] deep for all other cases.	X										
(8) Porosity (A) CJP groove welds in butt joints transverse to the direction of computed tensile stress shall have no visible piping porosity. For all other groove welds and for fillet welds, the sum of the visible piping porosity 1/32 in [1 mm] or greater in diameter shall not exceed 3/8 in [10 mm] in any linear inch of weld and shall not exceed 3/4 in [20 mm] in any 12 in [300 mm] length of weld. (B) The frequency of piping porosity in fillet welds shall not exceed one in each 4 in [100 mm] of weld length and the maximum diameter shall not exceed 3/32 in [2.5 mm]. Exception: for fillet welds connecting stiffeners to web, the sum of the diameters of piping porosity shall not exceed 3/8 in [10 mm] in any linear inch of weld and shall not exceed 3/4 in [20 mm] in any 12 in [300 mm] length of weld. (C) CJP groove welds in butt joints transverse to the direction of computed tensile stress shall have no piping porosity. For all other groove welds, the frequency of piping porosity shall not exceed one in 4 in [100 mm] of length and the maximum diameter shall not exceed 3/32 in [2.5 mm].	X										

Note: An "X" indicates applicability for the connection type; a shaded area indicates non-applicability.

AWS D1.1

- ▶ در همه جوش ها مقدار کاهش در اندازه جوش نباید بیشتر از ۱۰ درصد طول جوش باشد.
- ▶ در اتصالات جان به بال در تیر آهن ها ، هیچ کاهش سائیزی در دو انتهای تیر آهن در فاصله معادل دو برابر پهناي بال مجاز نمی باشد.
- ▶ خوردگی کناره جوش ها : برای قطعات با ضخامت کمتر از ۲۵ میلیمتر عمق خوردگی کناره جوش نباید از ۱ میل تجاوز نماید. البته مجموع طول عیب نباید از ۵۰ میل در هر ۳۰۰ میل تجاوز کند. البته عمق نباید از ۲ میل بیشتر باشد.
- ▶ در ضخامت های بیشتر از ۲۵ میلیمتر، عمق نباید از ۲ میل بیشتر باشد.
- ▶ در حالت که جهت تنش کششی عمود بر راستای جوش باشد نباید از ۰/۲۵ میلیمتر بیشتر باشد. برای تمامی حالتهاي دیگر این عیب نباید از ۱ میلیمتر تجاوز نماید.

SIDE VIEW

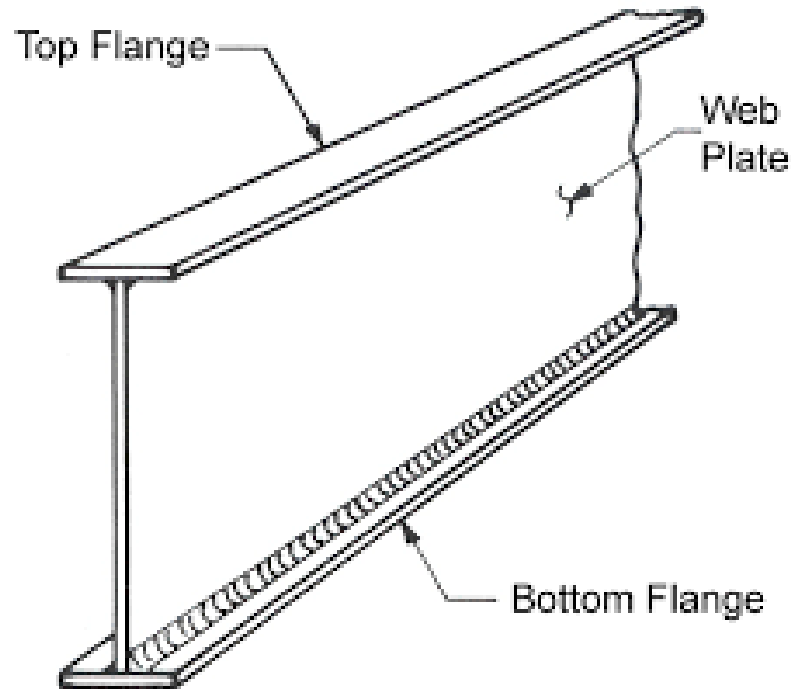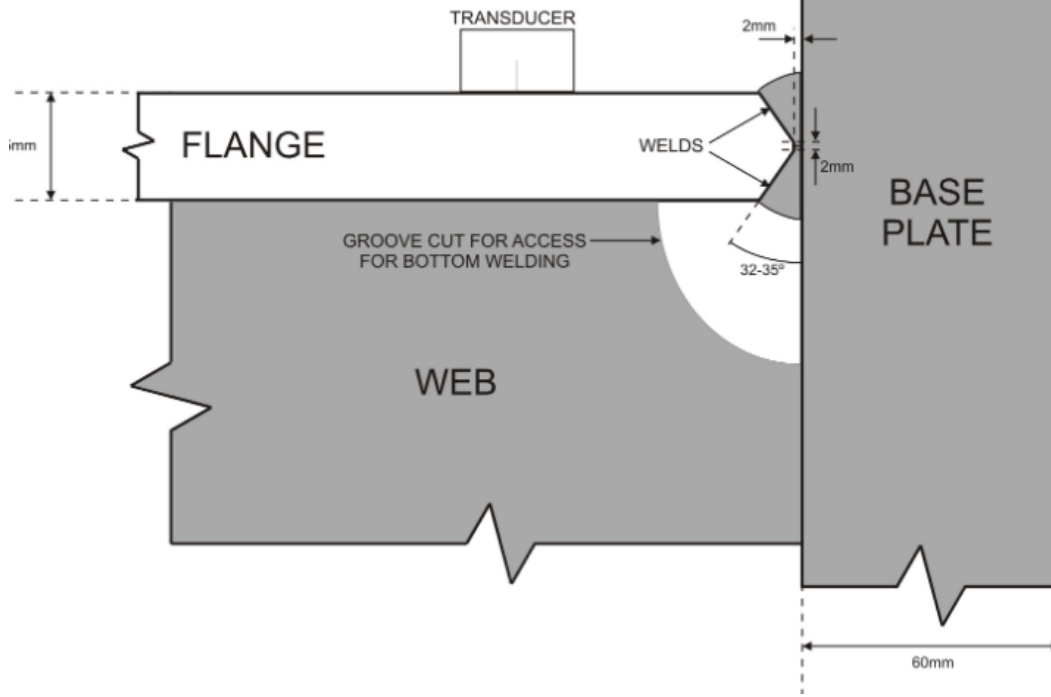

AWS D1.1

- ▶ **A:** در جوش های سر به سر با جوشهای نفوذ کامل در صورتیکه راستای جوش عمود بر جهت تنش کششی باشد هیچ حفره گازی لوله ای **PIPING POROSITY** مجاز نمی باشد.
- ▶ برای سایر جوش های شیاری و جوشهای نبشی مجموع قطر حفرات لوله ای قابل رویت با قطر ۱ میل یا بیشتر نباید از ۱۰ میل در هر ۲۵ میل طول جوش بیشتر باشد.
- ▶ همچنین نباید از ۲۰ میل در ۳۰۰ میل بیشتر نباشد.

- ▶ **B:** در جوش های نبشی تعداد خلل و فرج در هر ۱۰۰ میلیمتر یک عدد مجاز می باشد. البته حداکثر قطر نباید از ۲/۵ میل نباید تجاوز نماید.
- ▶ استثنائاً برای جوش های نبشی اجرا شده بین تقویت کننده **STIFFNER** و جان تیر آهن مجموع قطر حفرات لوله ای نباید از ۱۰ میل در ۲۵ میل تجاوز نماید و در هر ۳۰۰ میل از ۲۰ میل تجاوز نماید.

- ▶ **C:** در اتصالات سر به سر با جوش های شیاری نفوذ کامل در صورتیکه راستای جوش عمود بر جهت تنش کششی باشد، هیچ حفره گازی لوله ای مجاز نمی باشد. برای سایر جوش های شیاری، تعداد حفرات گازی لوله ای نباید بیشتر از یک عدد در هر ۱۰۰ میل باشد و حداکثر قطر نباید از ۲,۵ میل تجاوز نماید.

D RATING IN AWS D1.1

Table 6.2
UT Acceptance-Rejection Criteria (Statically Loaded Nontubular Connections and Cyclically Loaded Nontubular Connections in Compression) (see 6.13.1, 6.13.2(2), and C-6.25.6)

Discontinuity Severity Class	Weld Size ^a in inches [mm] and Search Unit Angle										
	5/16 through 3/4 [8–20]	> 3/4 through 1-1/2 [20–38]	> 1-1/2 through 2-1/2 [38–65]			> 2-1/2 through 4 [65–100]			> 4 through 8 [100–200]		
	70°	70°	70°	60°	45°	70°	60°	45°	70°	60°	45°
Class A	+5 & lower	+2 & lower	-2 & lower	+1 & lower	+3 & lower	-5 & lower	-2 & lower	0 & lower	-7 & lower	-4 & lower	-1 & lower
Class B	+6	+3	-1 0	+2 +3	+4 +5	-4 -3	-1 0	+1 +2	-6 -5	-3 -2	0 +1
Class C	+7	+4	+1 +2	+4 +5	+6 +7	-2 to +2	+1 +2	+3 +4	-4 to +2	-1 to +2	+2 +3
Class D	+8 & up	+5 & up	+3 & up	+6 & up	+8 & up	+3 & up	+3 & up	+5 & up	+3 & up	+3 & up	+4 & up

Class A (large discontinuities)
Any indication in this category shall be rejected (regardless of length).

Class B (medium discontinuities)
Any indication in this category having a length greater than 3/4 in [20 mm] shall be rejected.

Class C (small discontinuities)
Any indication in this category having a length greater than 2 in [50 mm] shall be rejected.

Class D (minor discontinuities)
Any indication in this category shall be accepted regardless of length or location in the weld.

Scanning Levels	
Sound path ^b in inches [mm]	Above Zero Reference, dB
through 2-1/2 [65 mm]	14
> 2-1/2 through 5 [65–125 mm]	19
> 5 through 10 [125–250 mm]	29
> 10 through 15 [250–380 mm]	39

^b This column refers to sound path distance; NOT material thickness.

Table 6.3
UT Acceptance-Rejection Criteria (Cyclically Loaded Nontubular Connections in Tension)
(see 6.13.2 and C-6.25.6)

Discontinuity Severity Class	Weld Size ^a in inches [mm] and Search Unit Angle										
	5/16 through 3/4 [8–20]	> 3/4 through 1-1/2 [20–38]	> 1-1/2 through 2-1/2 [38–65]			> 2-1/2 through 4 [65–100]			> 4 through 8 [100–200]		
	70°	70°	70°	60°	45°	70°	60°	45°	70°	60°	45°
Class A	+10 & lower	+8 & lower	+4 & lower	+7 & lower	+9 & lower	+1 & lower	+4 & lower	+6 & lower	-2 & lower	+1 & lower	+3 & lower
Class B	+11	+9	+5 +6	+8 +9	+10 +11	+2 +3	+5 +6	+7 +8	-1 0	+2 +3	+4 +5
Class C	+12	+10	+7 +8	+10 +11	+12 +13	+4 +5	+7 +8	+9 +10	+1 +2	+4 +5	+6 +7
Class D	+13 & up	+11 & up	+9 & up	+12 & up	+14 & up	+6 & up	+9 & up	+11 & up	+3 & up	+6 & up	+8 & up

Class A (large discontinuities)
Any indication in this category shall be rejected (regardless of length).

Class B (medium discontinuities)
Any indication in this category having a length greater than 3/4 in [20 mm] shall be rejected.

Class C (small discontinuities)
Any indication in this category having a length greater than 2 in [50 mm] in the middle half or 3/4 in [20 mm] length in the top or bottom quarter of weld thickness shall be rejected.

Class D (minor discontinuities)
Any indication in this category shall be accepted regardless of length or location in the weld.

Scanning Levels	
Sound path ^b in [mm]	Above Zero Reference, dB
through 2-1/2 [65 mm]	20
> 2-1/2 through 5 [65–125 mm]	25
> 5 through 10 [125–250 mm]	35
> 10 through 15 [250–380 mm]	45

^b This column refers to sound path distance; NOT material thickness.

UNDER CUT



UNDER CUT IN ASME

► ASME B31.3 2016

(16)

Table 341.3.2 Acceptance Criteria for Welds – Visual and Radiographic Examination

Criteria (A to M) for Types of Welds and for Service Conditions [Note (1)]										Examination Methods		
Normal and Category M Fluid Service			Severe Cyclic Conditions			Category D Fluid Service				Weld Imperfection	Visual	Radiography
Type of Weld			Type of Weld			Type of Weld						
Girth, Miter Groove & Branch Connection [Note (2)]	Longitudinal Groove [Note (3)]	Fillet [Note (4)]	Girth, Miter Groove & Branch Connection [Note (2)]	Longitudinal Groove [Note (3)]	Fillet [Note (4)]	Girth and Miter Groove	Longitudinal Groove [Note (3)]	Fillet [Note (4)]	Branch Connection [Note (2)]			
A	A	A	A	A	A	A	A	A	A	Crack	✓	✓
A	A	A	A	A	A	C	A	N/A	A	Lack of fusion	✓	✓
B	A	N/A	A	A	N/A	C	A	N/A	B	Incomplete penetration	✓	✓
E	E	N/A	D	D	N/A	N/A	N/A	N/A	N/A	Rounded Indications	...	✓
G	G	N/A	F	F	N/A	N/A	N/A	N/A	N/A	Elongated indications	...	✓
H	A	H	A	A	A	I	A	H	H	Undercutting	✓	✓
A	A	A	A	A	A	A	A	A	A	Surface porosity or exposed slag inclusion [Note (5)]	✓	...
N/A	N/A	N/A	J	J	J	N/A	N/A	N/A	N/A	Surface finish	✓	...
K	K	N/A	K	K	N/A	K	K	N/A	K	Concave surface, concave root, or burn-through	✓	✓
L	L	L	L	L	L	M	M	M	M	Weld reinforcement or internal protrusion	✓	...

ASME B31.3-2016

UNDER CUT IN ASME

► ASME B31.3 2016

(16)

Criterion Value Notes for Table 341.3.2

Symbol	Criterion Measure	Acceptable Value Limits [Note (6)]										
A	Extent of imperfection	Zero (no evident imperfection)										
B	Cumulative length of incomplete penetration	≤ 38 mm (1.5 in.) in any 150 mm (6 in.) weld length or 25% of total weld length, whichever is less										
C	Cumulative length of lack of fusion and incomplete penetration	≤ 38 mm (1.5 in.) in any 150 mm (6 in.) weld length or 25% of total weld length, whichever is less										
D	Size and distribution of rounded indications	See BPV Code, Section VIII, Division 1, Appendix 4 [Note (10)]										
E	Size and distribution of rounded indications	For $\bar{T}_w \leq 6$ mm ($1/4$ in.), limit is same as D [Note (10)] For $\bar{T}_w > 6$ mm ($1/4$ in.), limit is $1.5 \times D$ [Note (10)]										
F	Elongated indications Individual length Individual width Cumulative length	$\leq \bar{T}_w / 3$ ≤ 2.5 mm ($3/32$ in.) and $\leq \bar{T}_w / 3$ $\leq \bar{T}_w$ in any $12\bar{T}_w$ weld length [Note (10)]										
G	Elongated indications Individual length Individual width Cumulative length	$\leq 2\bar{T}_w$ ≤ 3 mm ($1/8$ in.) and $\leq \bar{T}_w / 2$ $\leq 4\bar{T}_w$ in any 150 mm (6 in.) weld length [Note (10)]										
H	Depth of undercut Cumulative length of internal and external undercut	≤ 1 mm ($1/32$ in.) and $\leq \bar{T}_w / 4$ ≤ 38 mm (1.5 in.) in any 150 mm (6 in.) weld length or 25% of total weld length, whichever is less										
I	Depth of undercut Cumulative length of internal and external undercut	≤ 1.5 mm ($1/16$ in.) and $\leq [\bar{T}_w / 4$ or 1 mm ($1/32$ in.)] ≤ 38 mm (1.5 in.) in any 150 mm (6 in.) weld length or 25% of total weld length, whichever is less										
J	Surface roughness	≤ 12.5 μ m (500 μ in.) R_a in accordance with ASME B46.1										
K	Depth of surface concavity, root concavity, or bum-through	Total joint thickness, incl. weld reinf., $\geq \bar{T}_w$ [Notes (7) and (11)]										
L	Height of reinforcement or internal protrusion [Note (8)] in any plane through the weld shall be within limits of the applicable height value in the tabulation at right, except as provided in Note (9). Weld metal shall merge smoothly into the component surfaces.	<table border="0"> <tr> <td>For \bar{T}_w, mm (in.)</td> <td>Height, mm (in.)</td> </tr> <tr> <td>≤ 6 ($1/4$)</td> <td>≤ 1.5 ($1/16$)</td> </tr> <tr> <td>> 6 ($1/4$), ≤ 13 ($1/2$)</td> <td>≤ 3 ($1/8$)</td> </tr> <tr> <td>> 13 ($1/2$), ≤ 25 (1)</td> <td>≤ 4 ($3/32$)</td> </tr> <tr> <td>> 25 (1)</td> <td>≤ 5 ($1/16$)</td> </tr> </table>	For \bar{T}_w , mm (in.)	Height, mm (in.)	≤ 6 ($1/4$)	≤ 1.5 ($1/16$)	> 6 ($1/4$), ≤ 13 ($1/2$)	≤ 3 ($1/8$)	> 13 ($1/2$), ≤ 25 (1)	≤ 4 ($3/32$)	> 25 (1)	≤ 5 ($1/16$)
For \bar{T}_w , mm (in.)	Height, mm (in.)											
≤ 6 ($1/4$)	≤ 1.5 ($1/16$)											
> 6 ($1/4$), ≤ 13 ($1/2$)	≤ 3 ($1/8$)											
> 13 ($1/2$), ≤ 25 (1)	≤ 4 ($3/32$)											
> 25 (1)	≤ 5 ($1/16$)											
M	Height of reinforcement or internal protrusion [Note (8)] as described in L. Note (9) does not apply.	Limit is twice the value applicable for L above										

Notes follow on next page

CATEGORY D

(a) Category D Fluid Service: a fluid service in which all of the following apply:

(1) the fluid handled is nonflammable, nontoxic, and not damaging to human tissues as defined in para. 300.2

(2) the design gage pressure does not exceed 1 035 kPa (150 psi)

(3) the design temperature is not greater than 186°C (366°F)

(4) the fluid temperature caused by anything other than atmospheric conditions is not less than -29°C (-20°F)

► ۱- سیال مورد نظر غیر قابل اشتعال و غیر سمی و برای انسان مضر نباشد.

۲- فشار طراحی بیش از 150PSI نباشد.
10.35 BAR

۳- دمای طراحی بیش از ۱۸۶ درجه سانتیگراد نباشد.

۴- دمای سیال با هر علتی غیر از شرایط اتمسفر کمتر از 29- درجه سانتیگراد نرسد.

CATEGORY M

(b) Category M Fluid Service: a fluid service in which both of the following apply:

(1) the fluid is so highly toxic that a single exposure to a very small quantity of the fluid, caused by leakage, can produce serious irreversible harm to persons on breathing or bodily contact, even when prompt restorative measures are taken

(2) after consideration of piping design, experience, service conditions, and location, the owner determines that the requirements for Normal Fluid Service do not sufficiently provide the leak tightness required to protect personnel from exposure

و موقعیت بهره برداری ، کارفرما متوجه بشود که شرایط نرمال تامین نگردیده است برای حفاظت نفرات.

► ۱- سیال بسیار سمی باشد و

به نحوی که کوچکترین نشستی از سیال

تولید لطمات جبران ناپذیر سنگین

برای اشخاصی که نفس میکشند

یا تماس بدنی دارند حتی زمانیکه

سیستم ترمیمی سریع

نیز وجود داشته باشد

۲- با توجه به طراحی های لازم و

تجربه کاری و شرایط بهره برداری

و موقعیت بهره برداری ، کارفرما متوجه بشود که شرایط نرمال تامین نگردیده است برای حفاظت نفرات.

H, A , I IN TABLE 341.3.2

A = هیچ محدوده پذیرشی ندارد

H = ۱- عمق ۱ میلیمتر یا $\frac{1}{4}$ ضخامت هر کدام که کوچکتر باشد.

۲- طول آن در هر ۱۵۰ میلیمتر ۳۸ میلیمتر یا ۲۵ درصد کل جوش هر کدام که کوچکتر باشد

I = ۱- عمق $\frac{1}{5}$ میلیمتر یا ۱ میلیمتر یا $\frac{1}{4}$ ضخامت هر کدام کوچکتر است.

۲- طول آن در هر ۱۵۰ میلیمتر ۳۸ میلیمتر یا ۲۵ درصد کل جوش هر کدام که کوچکتر باشد

UNDER CUT IN ASME SEC VIII DIV 1 2017

UW-35 FINISHED LONGITUDINAL AND CIRCUMFERENTIAL JOINTS

(b) A reduction in thickness due to the welding process is acceptable provided all of the following conditions are met:

(1) The reduction in thickness shall not reduce the material of the adjoining surfaces below the minimum required thickness at any point.

(2) The reduction in thickness shall not exceed $\frac{1}{32}$ in. (1 mm) or 10% of the nominal thickness of the adjoining surface, whichever is less.⁷²



- ▶ کاهش ضخامت به دلیل وجود پروسه جوشکاری با توجه به شرایط زیر قابل قبول است:
- ▶ ۱- کاهش در ضخامت به نحوی نباشد که ضخامت فلز مبنا کمتر از ضخامت طراحی گردد.
- ▶ ۲- اگر وجود داشته باشد این کاهش ضخامت نباید از ۱۰ درصد ضخامت محل اتصال یا ۱ میلیمتر هر کدام که کوچکتر است تجاوز کند.

UNDER CUT IN API 650- 2016 ATMOSPHERIC TANK

8.5.2 A weld shall be acceptable by visual examination if the inspection shows the following.

- b) Maximum permissible undercut is 0.4 mm ($1/64$ in.) in depth for vertical butt joints, vertically oriented permanent attachments, attachment welds for nozzles, manholes, flush-type openings, and the inside shell-to-bottom welds. For horizontal butt joints, horizontally oriented permanent attachments, and annular-ring butt joints, the maximum permissible undercut is 0.8 mm ($1/32$ in.) in depth.

حداکثر عمق U/C در جوش های لب به لب سربالا و جوشهای منهول ها و نازل ها و جوشهای بدنه به کف مخزن $0/4$ میلیمتر می باشد و در جوش های افقی $0/8$ میلیمتر است.

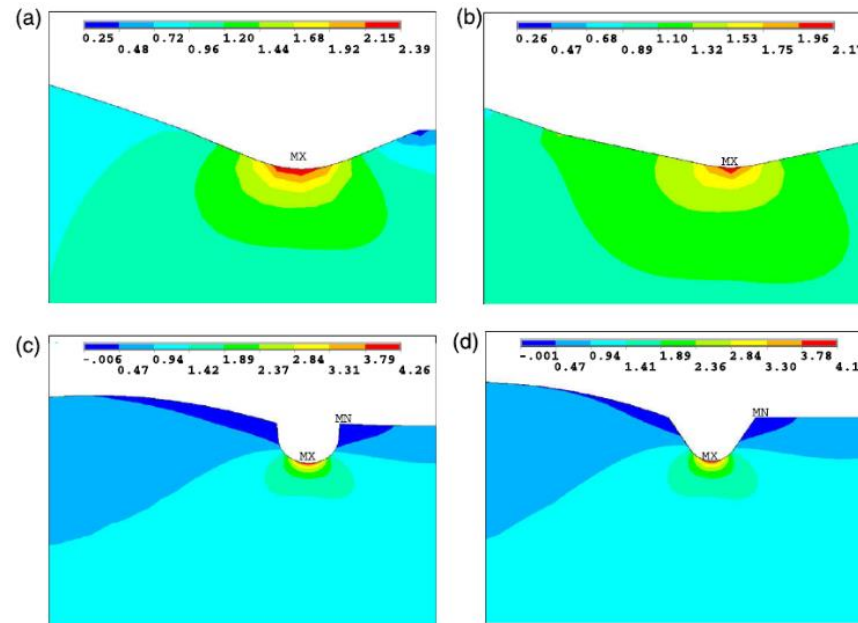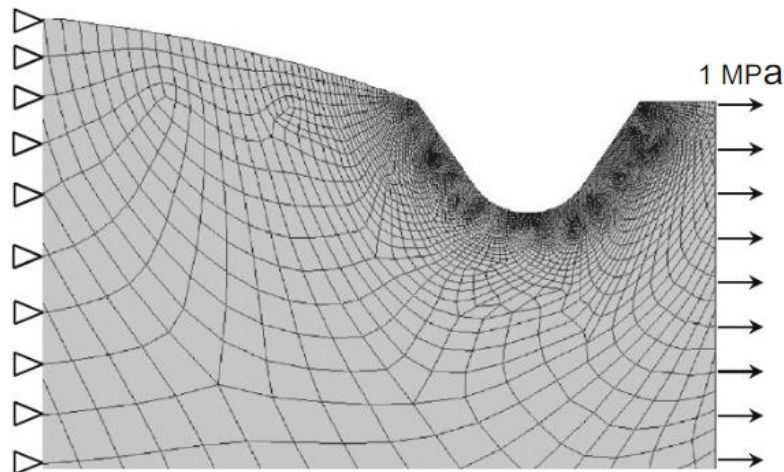

UNDER CUT IN API 620- 2014 LARGE WELDED LOW PRESSURE STORAGE TANK

6.13 Merging Weld With Plate Surface

The edges of the weld shall merge smoothly with the surface of the plate without a sharp angle. Maximum permissible weld undercut is $1/64$ in. for longitudinal or meridional butt joints, similarly oriented permanent attachments, attachment welds for nozzles, manholds, flush-type openings, and the inside shell-to-flat bottom welds. For circumferential and latitudinal butt joints, similarly oriented permanent attachments, and annular ring butt joints, the maximum permissible undercutting is $1/32$ in.

حداکثر عمق U/C در جوش های لب به لب سربالا و جوشهای منهول ها و نازل ها و جوشهای بدنه به کف مخزن $0/4$ میلیمتر می باشد و در جوش های افقی $0/8$ میلیمتر است.

UNDER CUT IN API 1104- 2016 PIPE LINE

9.3.11 Undercutting

Undercutting is defined as a groove melted into the parent material adjacent to the toe or root of the weld and left unfilled by weld metal. Undercutting adjacent to the cover pass (EU) or undercutting adjacent to root pass (IU) shall be considered a defect should any of the following conditions exists:

- a) the aggregate length of indications of EU and IU, in any combination, in any continuous 12 in. (300 mm) length of weld exceeds 2 in. (50 mm);
- b) the aggregate length of indications of EU and IU, in any combination, exceeds one-sixth of the weld length.

سوخستگی کناره جوش عبارت است از شیاری که در اثر ذوب فلز پایه در کنار پاس پرکن رویی EU یا پاس ریشه IU رخ می دهد.

مجموع EU , IU در هر ۳۰۰ میلیمتر ۵۰ میلیمتر می باشد.

البته نباید از ۱/۶ طول جوش تجاوز نماید.

وقتی برای پذیرش سوخستگی لبه جوش از ابزار مکانیکی یا چشمی استفاده گردد از ۹/۷ استفاده می گردد.

UNDER CUT IN API 1104- 2016 PIPE LINE

9.7 Visual Acceptance Standards for Undercutting

9.7.1 General

Undercutting is defined in 9.3.11. The acceptance standards in 9.7.2 supplement but do not replace visual inspection requirements found elsewhere in this standard.

9.7.2 Acceptance Standards

When visual and mechanical means are used to determine depth, undercutting adjacent to the cover or root bead shall not exceed the dimensions given in Table 4. When both mechanical and radiographic measurements are available, the mechanical measurements shall govern.

Table 4—Maximum Dimensions of Undercutting

Depth	Length
$>1/32$ in. (0.8 mm) or >12.5 % of pipe wall thickness, whichever is smaller	Not acceptable
$>1/64$ in. (0.4 mm) but $\leq 1/32$ in. (0.8 mm) or >6 % but ≤ 12.5 % of pipe wall thickness, whichever is smaller	2 in. (50 mm) in a continuous 12 in. (300 mm) weld length or one-sixth the weld length, whichever is smaller
$\leq 1/64$ in. (0.4 mm) or ≤ 6 % of pipe wall thickness, whichever is smaller	Acceptable, regardless of length

UNDER CUT IN API 1104- 2016 PIPE LINE

حداکثر ابعاد UNDER CUT

عمق	طول
عمق آن بیشتر از ۰,۸ میلیمتر یا بیشتر از ۱۲,۵ درصد ضخامت هر کدام که کمتر است.	غیر قابل قبول
عمق بیشتر از ۰,۴ میلیمتر و کمتر از ۰,۸ میلیمتر یا بزرگتر از ۶ درصد ضخامت و کمتر از ۱۲,۵ درصد ضخامت لوله هر کدام کوچکتر است.	در هر ۳۰۰ میلیمتر جوش، ۵۰ میلیمتر یا ۱/۶ طول جوش هر کدام کمتر باشد
عمق کمتر یا مساوی ۰,۴ میلیمتر لوله یا ۶ درصد ضخامت لوله هر کدام کوچکتر باشد.	طول هر چه قدر باشد قابل قبول است

مشخصات ساخت لوله API 5L UNDER CUT IN

9.10.2 Undercuts

Undercuts in SAW and COW pipe shall be investigated, classified, and treated as follows.

- a) Undercuts that have a depth ≤ 0.4 mm (0.016 in.) are acceptable, regardless of length, and shall be treated in accordance with C.1.
- b) Undercuts that have a depth > 0.4 mm (0.016 in.) but ≤ 0.8 mm (0.031 in.) are acceptable provided they are treated in accordance with C.2 and provided that:
 - 1) their individual lengths are $\leq 0.5t$,
 - 2) their individual depths are $\leq 0.1t$, and
 - 3) there are no more than two such undercuts in any 300 mm (12.0 in.) length of weld.
- c) Undercuts that exceed the limits specified in item b) shall be classified as defects and shall be treated in accordance with C.3.

NOTE Undercuts can best be located visually.

مشخصات ساخت لوله UNDER CUT IN API 5L

- ▶ مشخصات سوختگی کناره جوش در لوله های درز دار با جوش SAW, COW به وسیله بازرسی چشمی دیده می شوند و مطابق زیر دسته بندی می گردد:
- ▶ SAW PIPE: SUBMERGED ARC WELDING
- ▶ COW: COMBINATION WELDING PROCESS FOR PIPE DURING WELDING
- ▶ UNDER CUT اگر دارای عمق عیبی کمتر یا برابر از 0.4 میلیمتر باشد صرفنظر از طول آن قابل قبول هستند.
- ▶ UNDER CUT اگر دارای عمق بیشتر از 0.4 میلیمتر و کمتر از 0.8 میلیمتر باشد باید موارد زیر را در مورد طول در بر گرفته باشد:
 - ▶ الف: طول تکی آنها کمتر یا برابر 0.5 ضخامت باشد.
 - ▶ ب: عمق تکی آنها کمتر یا برابر 0.1 ضخامت باشد.
 - ▶ ج: در هر 200 میلیمتر دو عیب UNDERCUT با مشخصات فوق وجود نداشته باشد.
- ▶ UNDER CUT هایی که حدود پذیرش بند فوق را نداشته باشند مردود هستند.

HIGH LOW



HIGH-LOW

► ASME SEC VIII DIV1-2017

Table UW-33		
Customary Units		
Section Thickness, in.	Joint Categories	
	A	B, C, and D
Up to $\frac{1}{2}$, incl.	$\frac{1}{4}t$	$\frac{1}{4}t$
Over $\frac{1}{2}$ to $\frac{3}{4}$, incl.	$\frac{1}{8}$ in.	$\frac{1}{4}t$
Over $\frac{3}{4}$ to $1\frac{1}{2}$, incl.	$\frac{1}{8}$ in.	$\frac{3}{16}$ in.
Over $1\frac{1}{2}$ to 2, incl.	$\frac{1}{8}$ in.	$\frac{1}{8}t$
Over 2	Lesser of $\frac{1}{16}t$ or $\frac{3}{8}$ in.	Lesser of $\frac{1}{8}t$ or $\frac{3}{4}$ in.


SI Units		
Section Thickness, mm	Joint Categories	
	A	B, C, and D
Up to 13, incl.	$\frac{1}{4}t$	$\frac{1}{4}t$
Over 13 to 19, incl.	3 mm	$\frac{1}{4}t$
Over 19 to 38, incl.	3 mm	5 mm
Over 38 to 51, incl.	3 mm	$\frac{1}{8}t$
Over 51	Lesser of $\frac{1}{16}t$ or 10 mm	Lesser of $\frac{1}{8}t$ or 19 mm

UW-33 ALIGNMENT TOLERANCE

(a) Alignment of sections at edges to be butt welded shall be such that the maximum offset is not greater than the applicable amount for the welded joint category (see [UW-3](#)) under consideration, as listed in [Table UW-33](#). The section thickness t is the nominal thickness of the thinner section at the joint.

(b) Any offset within the allowable tolerance provided above shall be faired at a three to one taper over the width of the finished weld, or if necessary, by adding additional weld metal beyond what would otherwise be the edge of the weld. Such additional weld metal buildup shall be subject to the requirements of [UW-42](#).


Figure UW-9-1
Butt Welding of Plates of Unequal Thickness

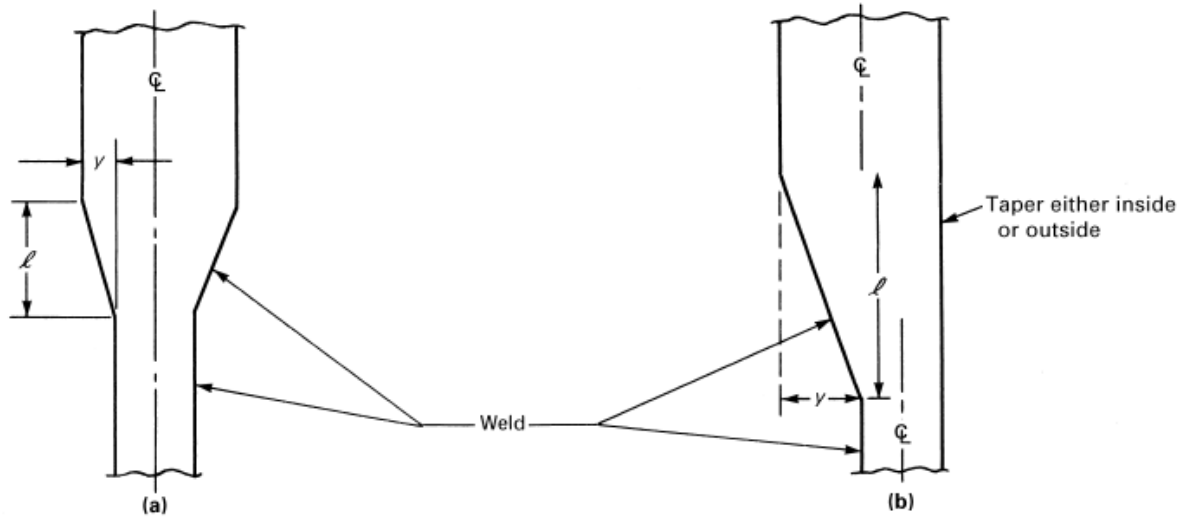

GENERAL NOTES:

- (a) $\ell \geq 3y$, where ℓ is the required length of taper and y is the offset between the adjacent surfaces of abutting sections.
- (b) Length of required taper, ℓ , may include the width of the weld.
- (c) In all cases, ℓ shall be not less than $3y$.

Figure ULW-17.1
Transitions of Layered Shell Sections

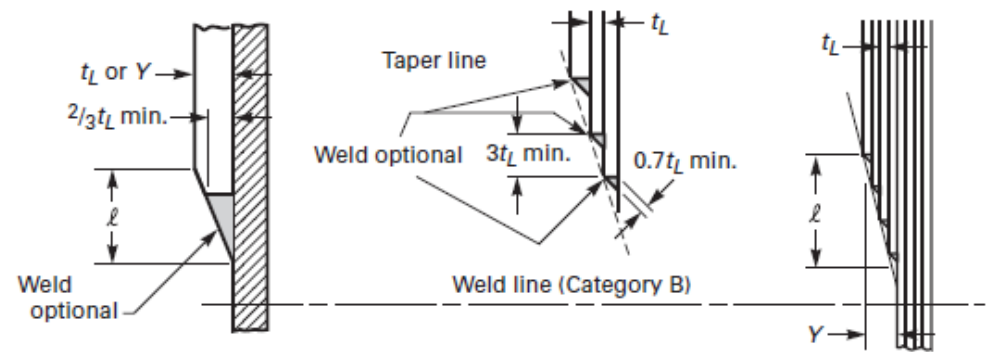

(a) For Layers Over $\frac{5}{8}$ in.
(16 mm) Thickness

(b) Details of Taper for
Layers $\frac{5}{8}$ in. (16 mm)
or Less in Thickness

HIGH-LOW

► ASME SEC VIII DIV1-2017

UW-3 WELDED JOINT CATEGORY

The term “Category” as used herein defines the location of a joint in a vessel, but not the type of joint. The “Categories” established by this paragraph are for use elsewhere in this Division in specifying special requirements regarding joint type and degree of inspection for certain welded pressure joints. Since these special requirements, which are based on service, material, and thickness, do not apply to every welded joint, only those joints to which special requirements apply are included in the categories. The special requirements will apply to joints of a given category only when specifically so stated. The joints included in each category are designated as joints of Categories A, B, C, and D below. [Figure UW-3](#) illustrates typical joint locations included in each category. Welded joints not defined by the category designations include but are not limited to [Figure 5-1](#), illustrations (a), (c), and (d) corner joints; [Figure 9-5](#) jacket-closure-to-shell welds; and [Figure 26-13](#) fillet welds. Unless


(a) *Category A.* Longitudinal and spiral welded joints within the main shell, communicating chambers,⁶⁶ transitions in diameter, or nozzles; any welded joint within a sphere, within a formed or flat head, or within the side plates⁶⁷ of a flat-sided vessel; any butt-welded joint within a flat tubesheet; circumferential welded joints connecting hemispherical heads to main shells, to transitions in diameters, to nozzles, or to communicating chambers.⁶⁶

(b) *Category B.* Circumferential welded joints within the main shell, communicating chambers,⁶⁶ nozzles, or transitions in diameter including joints between the transition and a cylinder at either the large or small end; circumferential welded joints connecting formed heads other than hemispherical to main shells, to transitions in diameter, to nozzles, or to communicating chambers.⁶⁶ Circumferential welded joints are butt joints if the half-apex angle, α , is equal to or less than 30 deg and angle joints when α is greater than 30 deg. (See [Figure UW-3](#).)

HIGH-LOW

► ASME SEC VIII DIV1-2017

Figure UW-3
Illustration of Welded Joint Locations Typical of Categories A, B, C, and D

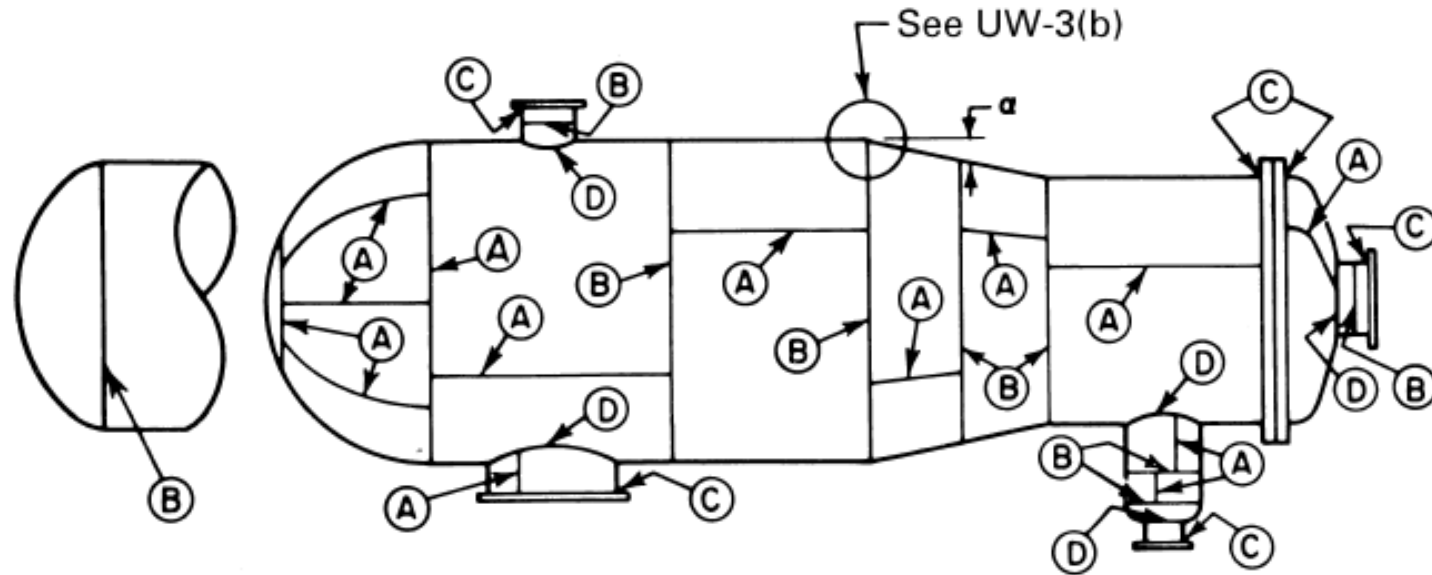

HIGH-LOW

▶ ASME SEC VIII DIV1-2017

▶ Category A : تمام جوش های طولی و جوش عدسی ها به پوسته و جوشهای روی عدسی

▶ Category B : تمام جوش های محیطی در طول مخزن و جوش های محیطی در نازل ها

▶ Category C : اتصالات تیوب شیتها و بوشن ها

▶ Category D : اتصالات متعلقات

HIGH-LOW

▶ API 650-2016

7.2.3 Shells

7.2.3.1 Plates to be joined by butt welding shall be matched accurately and retained in position during the welding operation. Misalignment in completed vertical joints for plates greater than 16 mm ($\frac{5}{8}$ in.) thick shall not exceed 10 % of the plate thickness or 3 mm ($\frac{1}{8}$ in.), whichever is less; misalignment for plates less than or equal to 16 mm ($\frac{5}{8}$ in.) thick shall not exceed 1.5 mm ($\frac{1}{16}$ in.).

7.2.3.2 In completed horizontal butt joints, the upper plate shall not project beyond the face of the lower plate at any point by more than 20 % of the thickness of the upper plate, with a maximum projection of 3 mm ($\frac{1}{8}$ in.); however, for upper plates less than 8 mm ($\frac{5}{16}$ in.) thick, the maximum projection shall be limited to 1.5 mm ($\frac{1}{16}$ in.).

7.2.3.3 The upper plate at a horizontal butt joint shall have a 4:1 taper when its thickness is more than 3 mm ($\frac{1}{8}$ in.) greater than the lower plate.

HIGH-LOW

▶ API 650-2016

▶ 7.2.3.1 برای جوش های عمودی در مخازن اتمسفریک

FOR THICKNESS ≤ 16 MM HIGH LOW < 1.5


FOR THICKNESS > 16 MM HIGH LOW < 3 MM OR 10 % THICKNESS

▶ 7.2.3.2 در جوش های لب به لب افقی مخازن اتمسفریک نباید مقدار HIGH LOW

بیشتر از ۲۰ درصد ضخامت نسبت به ورق پایینی باشد ولی در هر حال نباید بیش از ۳ میلیمتر باشد

▶ ۷/۲/۳/۳ زمانیکه اختلاف بین ورق بالایی بیش از ۳ میلیمتر است در وضعیت افقی نسبت به ورق پایینی باید ورق بالایی با نسبت ۱:۴ نسبت به ورق پایینی تراشیده گردد. TAPER.

30 deg. max. / 14 deg. min.
(1:4) Note (1)

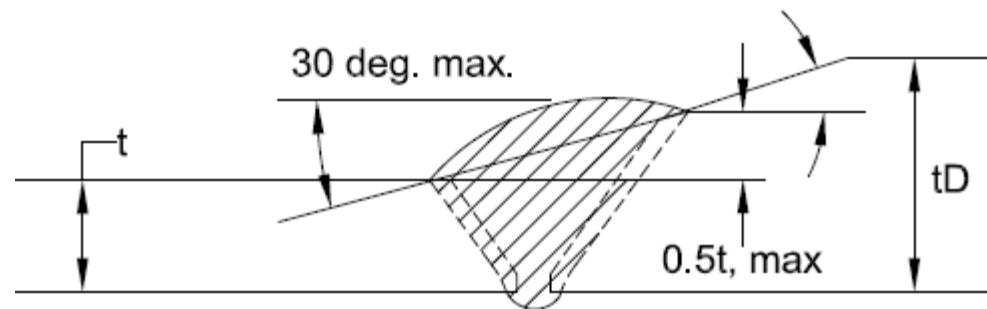

HIGH-LOW

▶ API 620-2014

6.14 Aligning of Main Joints

Particular care shall be taken in matching up the edges of all plates within the tolerances of offset as follows:

a) for plates $\frac{1}{4}$ inch in thickness and less, $\frac{1}{16}$ in.;

b) for plates over $\frac{1}{4}$ inch in thickness, 25 % of the plate thickness or $\frac{1}{8}$ in., whichever is smaller.

▶ *FOR THICKNESS ≤ 6 MM ALLOWABLE HIGH LOW IS 1.6 MM*

▶ *FOR THICKNESS > 6 MM ALLOWABLE HIGH LOW IS 3 MM OR 25 % THICKNESS*

HIGH-LOW

► ASME B31.3-2016 PIPING

► در جوش های محیطی و خطی:

مطابق پاراگراف A,B,C میزان مجاز HIGH-LOW داخلی لوله در جوش های محیطی می بایستی در مدارک فنی مهندسی یا در WPS قید گردد. همچنین HIGH-LOW مجاز بیرون لوله نیز بایستی تراش گردد یا TAPER گردد.

در جوش های خطی نیز بایستی مانند جوش های محیطی عمل نمود.

328.4.3 Alignment


(a) Circumferential Welds

(1) Inside surfaces of components at ends to be joined in girth or miter groove welds shall be aligned within the dimensional limits in the WPS and the engineering design.


(2) If the external surfaces of the components are not aligned, the weld shall be tapered between them.

(b) *Longitudinal Welds.* Alignment of longitudinal groove welds (not made in accordance with a standard listed in Table A-1 or Table 326.1) shall conform to the requirements of para. 328.4.3(a).

Fig. 328.4.3 Trimming and Permitted Misalignment

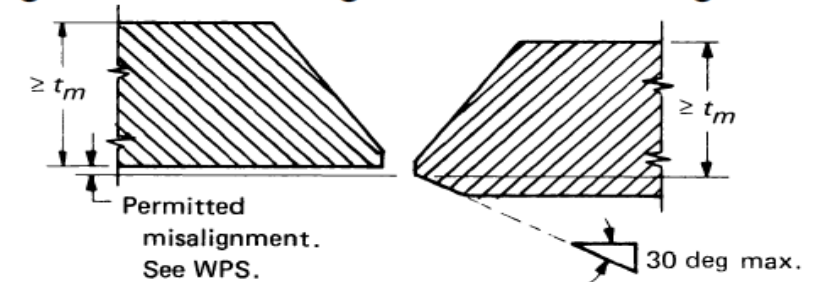


(a) Thicker Pipe Taper-Bored to Align


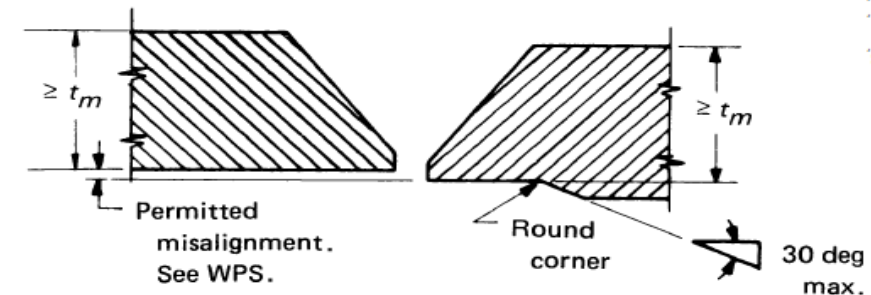


(b) Thicker Pipe Bored for Alignment

Longitudinal Joint

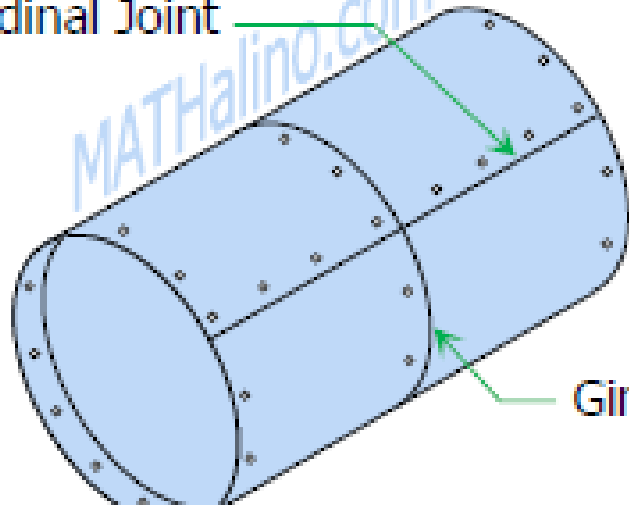

Girth Joint

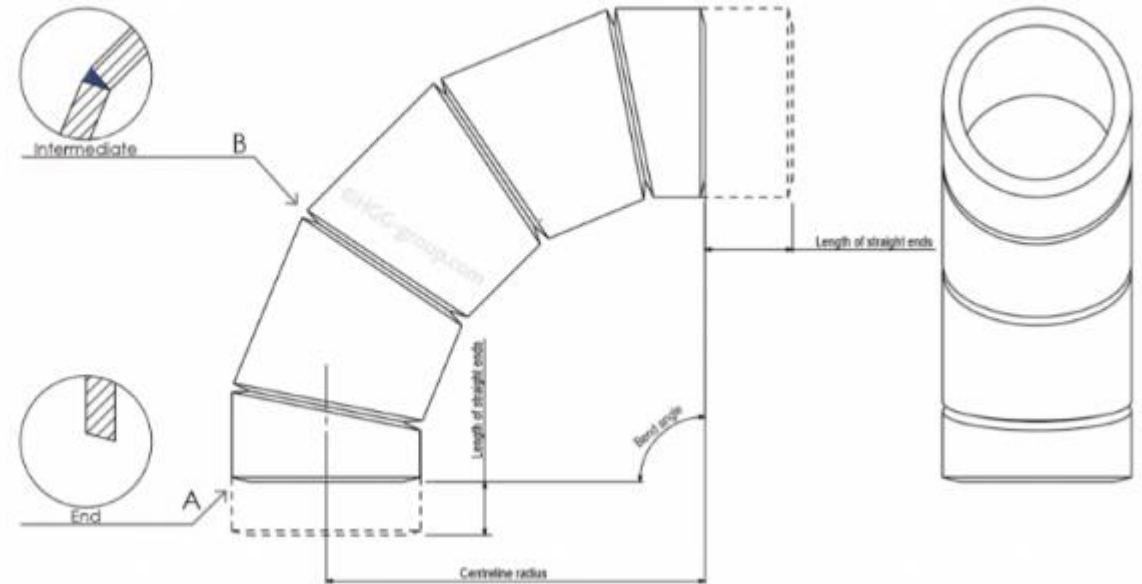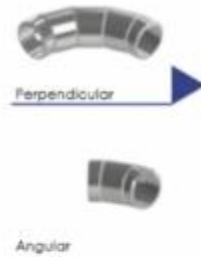

HIGH-LOW

► ASME B31.3-2016 PIPING

► HIGH LOW در انشعابات (BRANCHES):

انشعابات در همه سرویس ها به جز سرویس HIGH – PRESSURE مطابق تصویر می باشد. وقتی لوله انشعاب روی لوله اصلی یا هدر نصب می شود ممکن است قطر سوراخکاری روی لوله نسبت به قطر انشعاب کوچکتر یا بزرگتر باشد.

در هر دو حالت میزان مجاز HIGH-LOW برابر است با m که مقدار آن 3.2mm یا $0/5 T_b$ ضخامت لوله انشعاب هر کدام که کم تر باشد.


(c) Branch Connection Welds

(1) Branch connections that abut the outside surface of the run pipe shall be contoured for groove welds that meet the WPS requirements [see Fig. 328.4.4, illustrations (a) and (b)].


(2) Branch connections that are inserted through a run opening shall be inserted at least as far as the inside surface of the run pipe at all points [see Fig. 328.4.4, illustration (c)] and shall otherwise conform to para. 328.4.3(c)(1).

(3) Run openings for branch connections shall not deviate from the required contour more than the dimension m in Fig. 328.4.4. In no case shall deviations of the shape of the opening cause the root spacing tolerance limits in the WPS to be exceeded. Weld metal may be added and refinished if necessary for compliance.

(d) Spacing. The root opening of the joint shall be within the tolerance limits in the WPS.

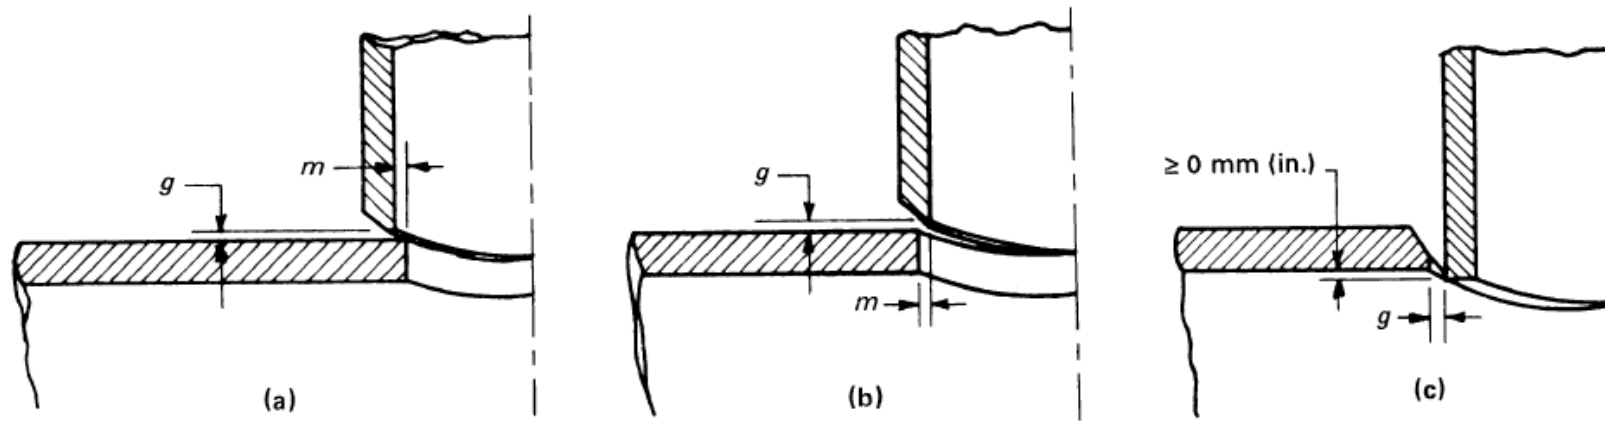

g = root gap per welding specification
 m = the lesser of 3.2 mm ($1/8$ in.) or $0.5 \bar{T}_b$

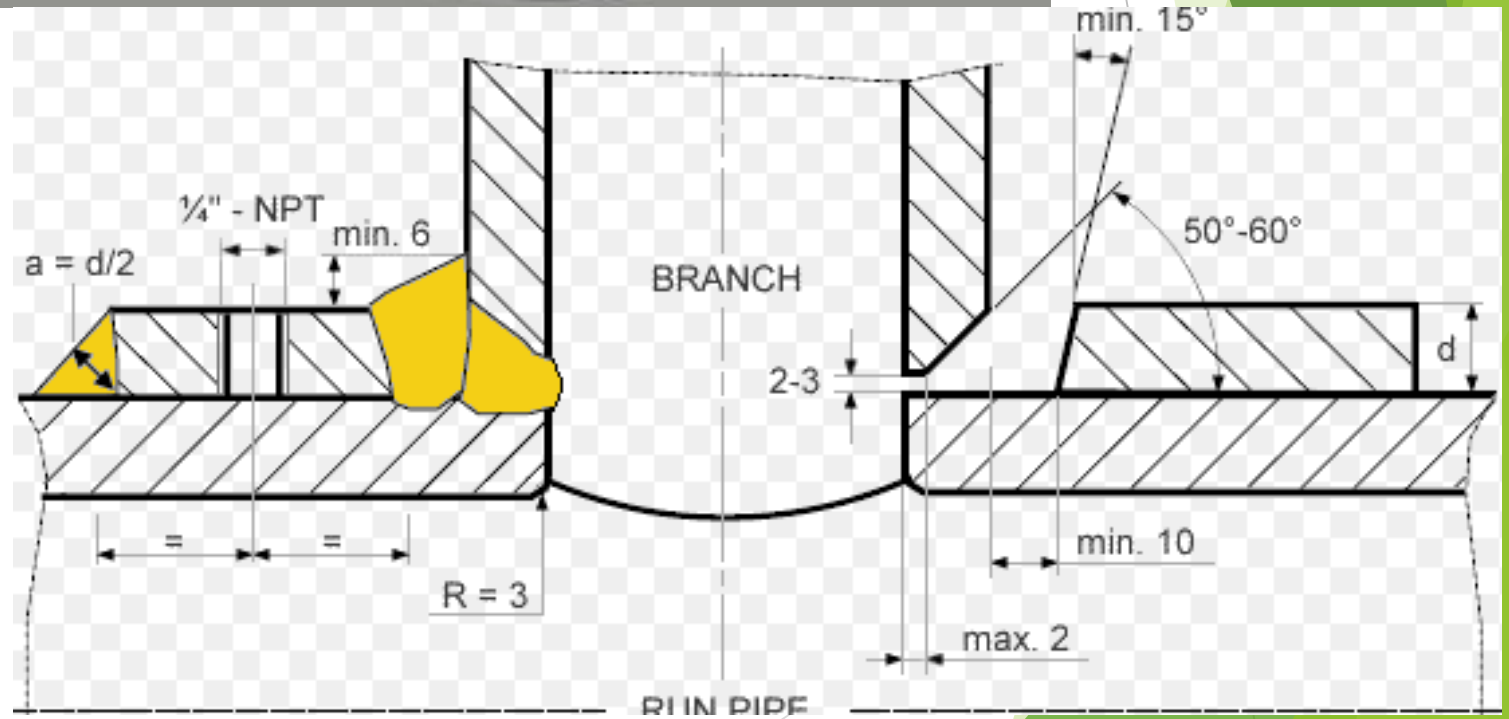

HIGH-LOW

► ASME B31.3-2016 PIPING

HIGH LOW IN HIGH PRESSURE PIPING SERVICE

FOR CIRCULAR AND LONGITUDINAL WELDING


FOR LONGITUDINAL AND CIRCULAR WELDING HIGH LOW IS $< 1.5 \text{ MM}$

K328.4.3 Alignment

(a) Girth Butt Welds

(1) Inside diameters of components at the ends to be joined shall be aligned within the dimensional limits in the welding procedure and the engineering design, except that no more than 1.5 mm ($1/16 \text{ in.}$) misalignment is permitted as shown in Fig. K328.4.3.


Fig. K328.4.3 Pipe Bored for Alignment: Trimming and Permitted Misalignment

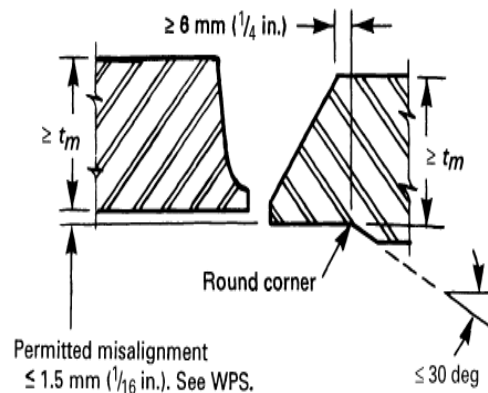

(c) Branch Connection Welds

(1) The dimension m in Fig. K328.5.4 shall not exceed $\pm 1.5 \text{ mm}$ ($1/16 \text{ in.}$).

(2) The dimension g in Fig. K328.5.4 shall be specified in the engineering design and the welding procedure.

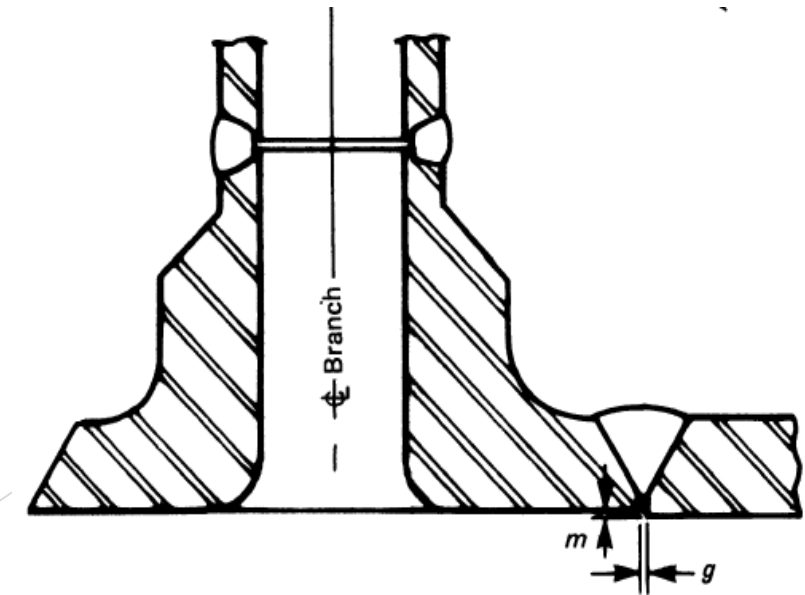

HIGH-LOW

► ASME B31.3-2016 PIPING

HIGH LOW IN HIGH PRESSURE PIPING SERVICE

نحوه انشعاب گیری در سرویس خطوط HIGH PRESSURE PIPING متفاوت است و نسبت به وضعیتم تفاوت هایی دارد:


ابعاد m نباید از $1/8$ میلیمتر بیشتر باشد.

ابعاد g باید طبق دستورالعمل جوشکاری بررسی گردد.

(c) Branch Connection Welds

(1) The dimension m in Fig. K328.5.4 shall not exceed ± 1.5 mm ($1/16$ in.).

(2) The dimension g in Fig. K328.5.4 shall be specified in the engineering design and the welding procedure.

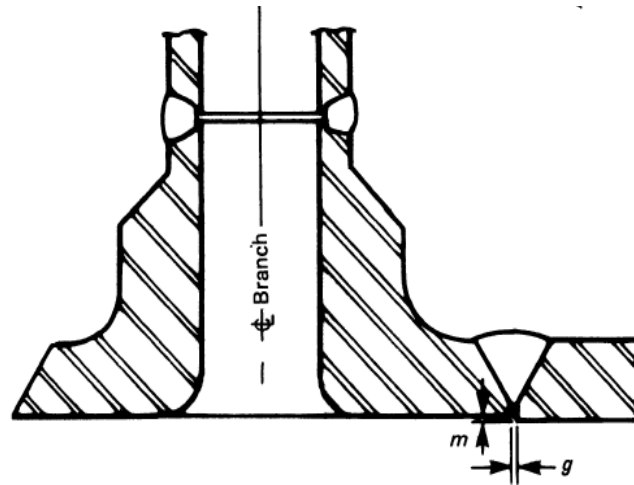

HIGH-LOW



▶ API 1104-2016

7.2 Alignment

The alignment of abutting ends shall minimize the offset between surfaces. For pipe ends of the same specified thickness, the offset should not exceed $\frac{1}{8}$ in. (3 mm). Larger variations are permissible provided the variation is caused by variations of the pipe end dimensions within the pipe purchase specification tolerances, and such variations have been distributed essentially uniformly around the circumference of the pipe. Hammering of the pipe to obtain proper lineup should be kept to a minimum.

برای هم محور کردن اتصالات مجاور بایستی میزان جابجایی سطوح آنها به حداقل ممکن برسد.
زمانیکه دو لوله در کنار یکدیگر دارای ضخامت یکسان باشند میزان high low آنها نباید از بیش از ۳ میلیمتر باشد

REINFORCEMENT

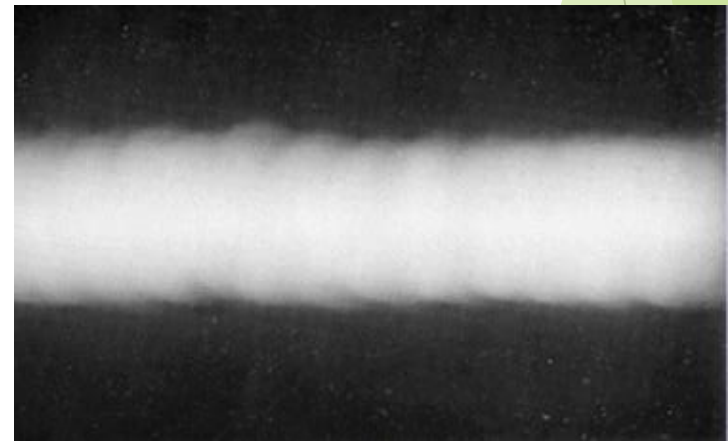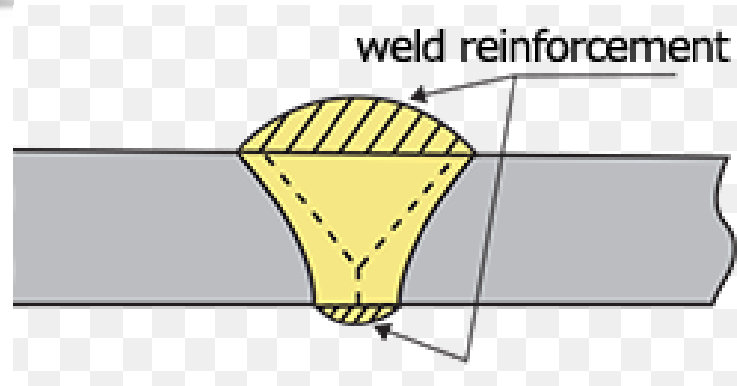

REINFORCEMENT IN ASME SEC VIII DIV 1

► UW 35

► برای اطمینان از جوش ، شیارها باید به طور کامل پر شوند. به نحوی که سطح فلز جوش در هر نقطه پایین تر از سطح فلز پایه نباشد. فلز جوش ممکن است به عنوان تقویت کننده جوش بر روی سطح جوش اضافه گردد . ضخامت گرده جوش نباید از هر طرف از مقادیر در جدول تجاوز نماید.

(d) To assure that the weld grooves are completely filled so that the surface of the weld metal at any point does not fall below the surface of the adjoining base materials,⁷³ weld metal may be added as reinforcement on each face of the weld. The thickness of the weld reinforcement on each face shall not exceed the following:

Material Nominal Thickness, mm	SI Units	
	Maximum Reinforcement, mm	
	Categories B and C Butt Welds	Other Welds
Less than 2.4	2.5	0.8
2.4 to 4.8, incl.	3	1.5
Over 4.8 to 13, incl.	4	2.5
Over 13 to 25, incl.	5	2.5
Over 25 to 51, incl.	6	3
Over 51 to 76, incl.	6	4
Over 76 to 102, incl.	6	5.5
Over 102 to 127, incl.	6	6
Over 127	8	8

REINFORCE MENT IN ASME B31.3 2016

16)


Table 341.3.2 Acceptance Criteria for Welds – Visual and Radiographic Examination

Criteria (A to M) for Types of Welds and for Service Conditions [Note (1)]										Weld Imperfection	Examination Methods	
Normal and Category M Fluid Service			Severe Cyclic Conditions			Category D Fluid Service					Visual	Radiography
Type of Weld			Type of Weld			Type of Weld						
Girth, Miter Groove & Branch Connection [Note (2)]	Longitudinal Groove [Note (3)]	Fillet [Note (4)]	Girth, Miter Groove & Branch Connection [Note (2)]	Longitudinal Groove [Note (3)]	Fillet [Note (4)]	Girth and Miter Groove	Longitudinal Groove [Note (3)]	Fillet [Note (4)]	Branch Connection [Note (2)]			
A	A	A	A	A	A	A	A	A	A	Crack	✓	✓
A	A	A	A	A	A	C	A	N/A	A	Lack of fusion	✓	✓
B	A	N/A	A	A	N/A	C	A	N/A	B	Incomplete penetration	✓	✓
E	E	N/A	D	D	N/A	N/A	N/A	N/A	N/A	Rounded Indications	...	✓
G	G	N/A	F	F	N/A	N/A	N/A	N/A	N/A	Elongated indications	...	✓
H	A	H	A	A	A	I	A	H	H	Undercutting	✓	✓
A	A	A	A	A	A	A	A	A	A	Surface porosity or exposed slag inclusion [Note (5)]	✓	...
N/A	N/A	N/A	J	J	J	N/A	N/A	N/A	N/A	Surface finish	✓	...
K	K	N/A	K	K	N/A	K	K	N/A	K	Concave surface, concave root, or burn-through	✓	✓
L	L	L	L	L	L	M	M	M	M	Weld reinforcement or internal protrusion	✓	...

REINFORCE MENT IN ASME B31.3 2016

	ضخامت اتصال جوش	ارتفاع گرده جوش
L	Height of reinforcement or internal protrusion [Note (8)] in any plane through the weld shall be within limits of the applicable height value in the tabulation at right, except as provided in Note (9). Weld metal shall merge smoothly into the component surfaces. For \bar{T}_w , mm (in.) ≤ 6 ($1/4$) > 6 ($1/4$), ≤ 13 ($1/2$) > 13 ($1/2$), ≤ 25 (1) > 25 (1)	Height, mm (in.) ≤ 1.5 ($1/16$) ≤ 3 ($1/8$) ≤ 4 ($3/32$) ≤ 5 ($1/16$)
M	Height of reinforcement or internal protrusion [Note (8)] as described in L. Note (9) does not apply.	Limit is twice the value applicable for L above

- ▶ ا: ارتفاع گرده جوش در ریشه یا در هر مقطعی از جوش باید در محدوده مجاز فوق قرار بگیرد:
- ▶ M: همان اطلاعات مربوط به توضیحات در ا می باشد.

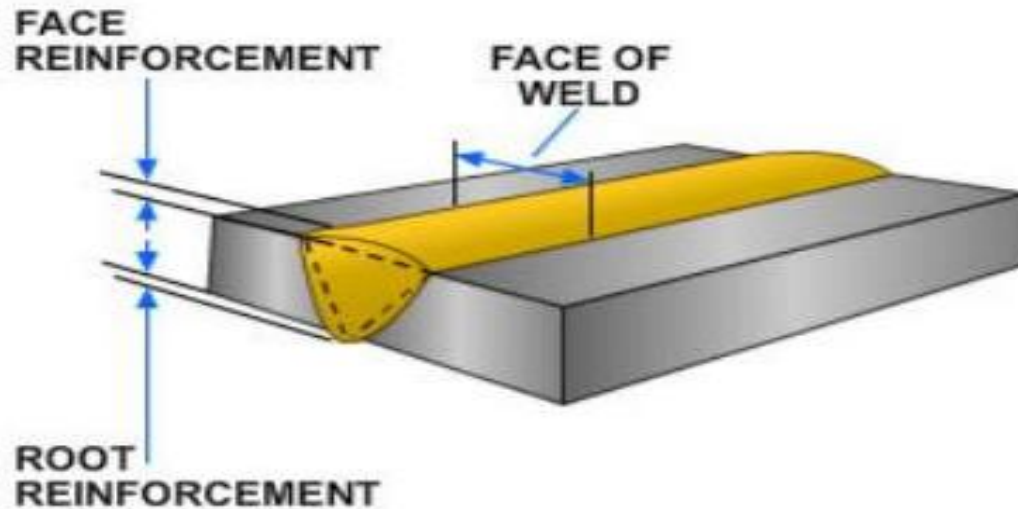

REINFORCE MENT IN API 620-2014

6.12 Reinforcement on Welds

6.12.1 Butt joints shall have complete joint penetration and complete fusion for the full length of the weld and shall be free from undercuts, overlaps, or abrupt ridges or valleys. To ensure that the weld grooves are completely filled so that the surface of the weld metal at any point does not fall below the surface of the adjoining plate, weld metal may be built up as reinforcement on each side of the plate. The thickness of the reinforcement on each side of the plate shall not exceed the thickness listed in Table 6-3, but the reinforcement need not be removed except when it exceeds the permissible thickness or when required in 7.15.1.

Table 6-3—Maximum Thickness of Reinforcement on Welds

Plate Thickness	Maximum Reinforcement	
	Vertical Joints	Horizontal Joints
$\leq 1/2$	$3/32$	$1/8$
$> 1/2$ thru 1	$1/8$	$3/16$
> 1	$3/16$	$1/4$

Dimensions in inches.

ضخامت جوش تقویت شده در هر طرف از ورق نباید از ضخامت لیست شده در جدول کم تر باشد. نیازی نیست که مقدار گرده جوش برداشته شود مگر اینکه در محدوده مجاز نباشد. ►

REINFORCE MENT IN API 650-2016

8.5 Visual Examination

- d) The reinforcement of the welds on all butt joints on each side of the plate shall not exceed the following thicknesses:

Plate Thickness mm (in.)	Maximum Reinforcement Thickness mm (in.)	
	Vertical Joints	Horizontal Joints
≤ 13 (1/2)	2.5 (3/32)	3 (1/8)
> 13 (1/2) to 25 (1)	3 (1/8)	5 (3/16)
> 25 (1)	5 (3/16)	6 (1/4)

گرده تمام جوش ها در اتصالات لب به لب در هر سمت از ورق نباید از ضخامت های فوق تجاوز نماید. گرده جوش نباید از سطح جوش برداشته شود مگر اینکه موارد فوق را برآورده نسازد.

REINFORCE MENT IN API ۱۱۰۴-2016

7.8.2 Filler and Finish Beads

For position welding, the number of filler and finish beads shall allow the completed weld a substantially uniform cross section around the entire circumference of the pipe. At no point shall the crown surface fall below the outside surface of the pipe, nor should it be raised above the parent metal by more than $1/16$ in. (1.6 mm).

▶ API 1104 مربوط به قوانین جوش و جوشکاری خطوط لوله انتقال سیالات مایع یا گاز می باشد.

▶ پاراگراف 7.8.2 : سطح گرده جوش در هیچ حالتی نباید از سطح لوله پایین تر باشد. همچنین در بالای سطح دائمی لوله نباید بیشتر از $1/6$ میلیمتر باشد.

REINFORCEMENT IN API 1104-2016

13.8.4 Rejection Based on Reinforcement

The ID weld reinforcement shall not be raised above the parent material by more than $1/16$ in. (2 mm). The OD weld reinforcement shall not be raised above the parent material by more than $1/8$ in. (3 mm).

مردود شدن بر اساس گرده جوش: در جوش های اتوماتیک گرده جوش داخلی نباید از ۲ میلیمتر و گرده جوش خارجی نباید از ۳ میلیمتر بیشتر باشد.

دانستن اندازه گرده جوش جهت انتخاب IQI در انجام عملیات رادیوگرافی مهم می باشد.

11.1.4 Type of IQIs

IQIs shall conform to the requirements of either ASTM E747 or ISO 19232-1 wire IQI. The company shall define which type of IQI (ASTM or ISO) is to be used. The IQI shall be made of a material that is radiographically similar to the material being welded.

11.1.5 Selection of IQIs

The IQI shall consist of either a series of six (6) wires for ASTM E747 wire type or a series of seven (7) wires for ISO 19232-1 wire type IQI, arranged in order of increasing diameter. The essential wire diameter to be used, based on the thickness of the weld is shown in Table 8 for ASTM E747 wire type IQI and Table 9 for ISO 19232-1 wire type IQI. At the option of the company, smaller wire diameter IQI than those specified above may be used, provided the required radiographic sensitivity is obtained. The radiographic images of the IQI identifying style number and ASTM set letter or ISO designation shall appear clearly. The image of the essential wire diameter shall appear clearly across the entire area of interest.

NOTE For purposes of IQI selection, when the SWE/SWV or DWE/SWV technique is used, the thickness of the weld means specified wall thickness plus the weld reinforcement (internal plus external combined). When the "elliptical" DWE/DWV technique is used, the thickness of the weld means twice the specified wall thickness plus the single weld reinforcement (internal plus external combined). When the "superimposed" DWE/DWV technique is used, the thickness of the weld means twice the specified wall thickness plus twice the weld reinforcement (internal plus external combined).

REINFORCE MENT IN AWS D1.1

5.23 Weld Profiles

All welds shall meet the visual acceptance criteria of Tables 6.1 and 9.16, and shall be free from cracks, overlaps, and the unacceptable profile discontinuities exhibited in Figure 5.4, Table 5.8, and Table 5.9, except as otherwise allowed in 5.23.1, 5.23.2, and 5.23.3.

5.23.3 Groove Welds. Groove weld reinforcement shall comply with Tables 5.8, and 5.9 and with the provisions below. Welds shall have a gradual transition to the plane of the base metal surfaces.

Table 5.8
Weld Profiles^a (see 5.23)

Weld Type	Joint Type					
	Butt	Corner—Inside	Corner—Outside	T-Joint	Lap	Butt with Shelf Bar
Groove (CJP or PJP)	Figure 5.4A	Figure 5.4B ^b	Figure 5.4C	Figure 5.4D ^b	N/A	Figure 5.4G
	Schedule A	Schedule B	Schedule A	Schedule B	N/A	See Note c
Fillet	N/A	Figure 5.4E	Figure 5.4F	Figure 5.4E	Figure 5.4E	N/A
	N/A	Schedule C	Schedule C or D ^d	Schedule C	Schedule C	N/A

^a Schedules A through D are given in Table 5.9.

^b For reinforcing fillet welds required by design, the profile restrictions apply to each groove and fillet, separately.

^c Welds made using shelf bars and welds made in the horizontal position between vertical bars of unequal thickness are exempt from R and C limitations. See Figures 5.4G and 5.4H for typical details.


^d See Figure 5.4F for a description of where Schedule C and D apply.

Table 5.9
Weld Profile Schedules (see 5.23)

Schedule A	(t = thickness of thicker plate joined for CJP; t = <u>weld size</u> for PJP)			
	t	R min.	R max.	
	≤ 1 in [25 mm]	0	1/8 in [3 mm]	
	> 1 in [25 mm], ≤ 2 in [50 mm]	0	3/16 in [5 mm]	
	> 2 in [50 mm]	0	1/4 in [6 mm] ^a	
Schedule B	(t = thickness of thicker plate joined for CJP; t = <u>weld size</u> for PJP; C = allowable convexity or concavity)			
	t	R min.	R max.	C max. ^b
	< 1 in [25 mm]	0	unlimited	1/8 in [3 mm]
	≥ 1 in [25 mm]	0	unlimited	3/16 in [5 mm]
Schedule C	(W = width of weld face or individual surface bead; C = allowable convexity)			
	W	C max. ^b		
	≤ 5/16 in [8 mm]	1/16 in [2 mm]		
	> 5/16 in [8 mm], < 1 in [25 mm]	1/8 in [3 mm]		
	≥ 1 in [25 mm]	3/16 in [5 mm]		
Schedule D	(t = thickness of thinner of the exposed edge dimensions; C = allowable convexity; see Figure 5.4F)			
	t	C max. ^b		
	any value of t	t/2		

^a For cyclically loaded structures, R max. for materials > 2 in [50 mm] thick is 3/16 in [5 mm].

^b There is no restriction on concavity as long as minimum weld size (considering both leg and throat) is achieved.

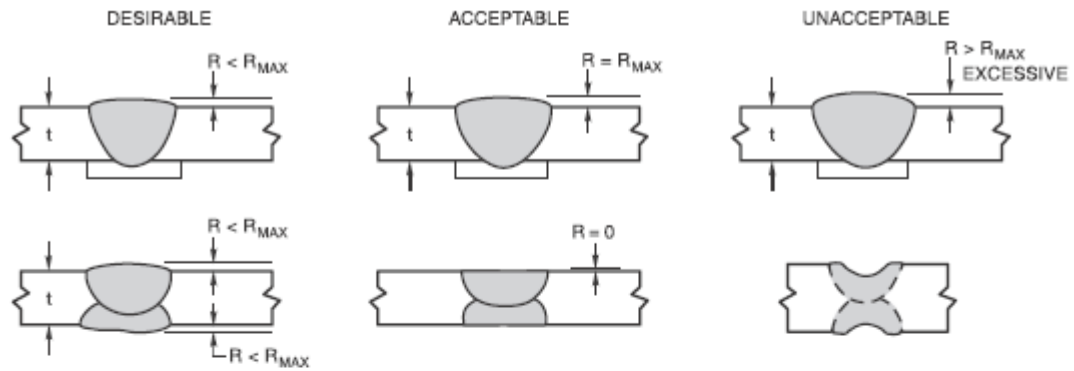

(A) WELD PROFILES FOR BUTT JOINTS



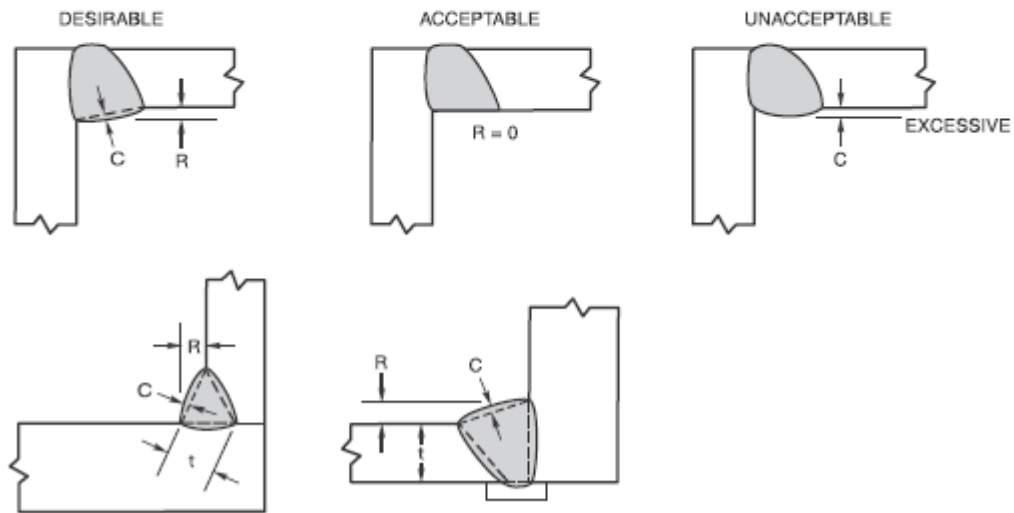


Figure 5.4—Requirements for Weld Profiles (see Tables 5.8 and 5.9)

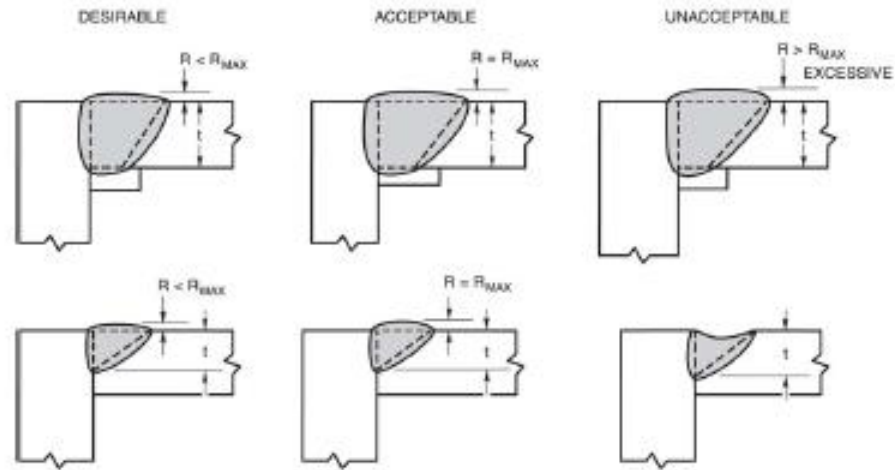


(C) GROOVE WELD PROFILES OUTSIDE CORNER JOINTS

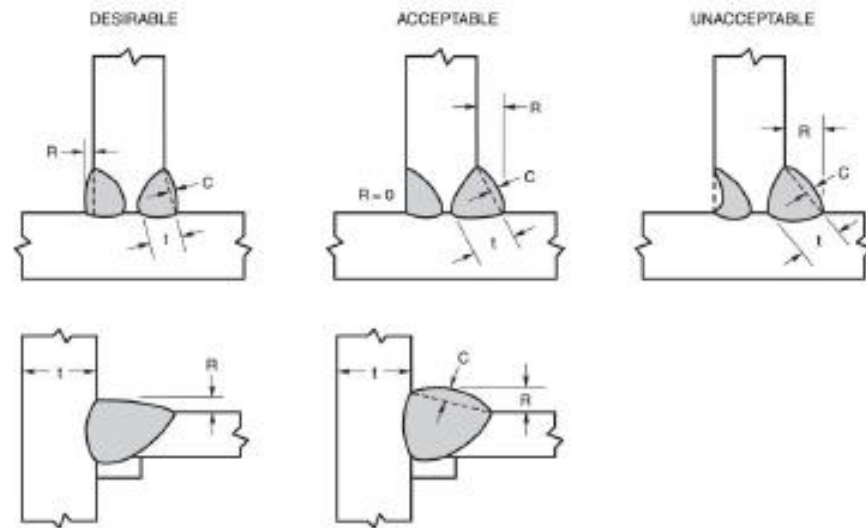


(D) GROOVE WELD PROFILES IN T-JOINTS

Figure 5.4 (Continued)—Requirements for Weld Profiles (see Tables 5.8 and 5.9)

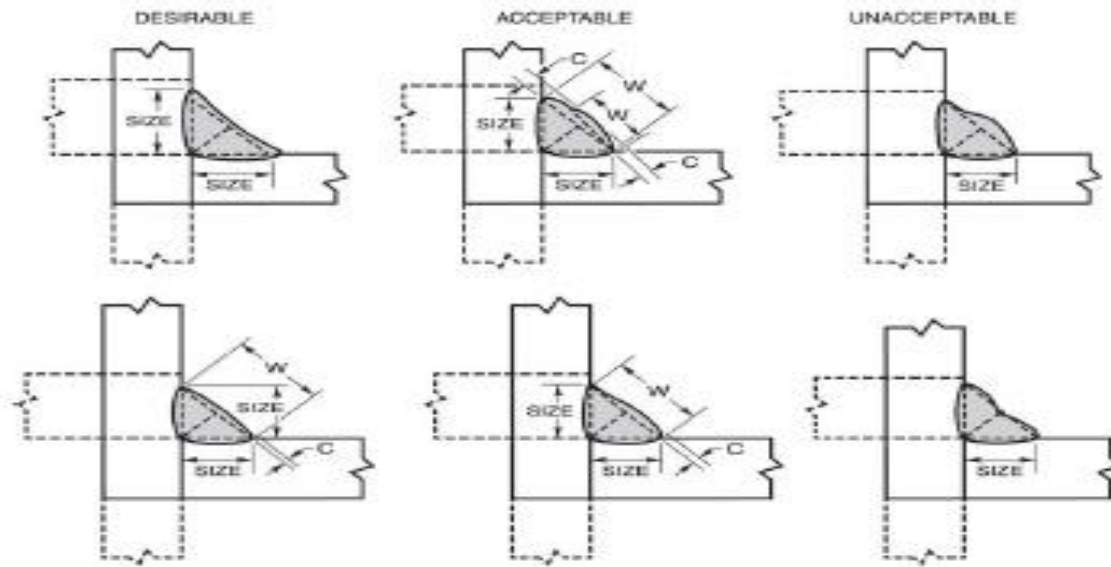


(E) FILLET WELD PROFILES FOR INSIDE CORNER JOINTS, LAP JOINTS, AND T-JOINTS

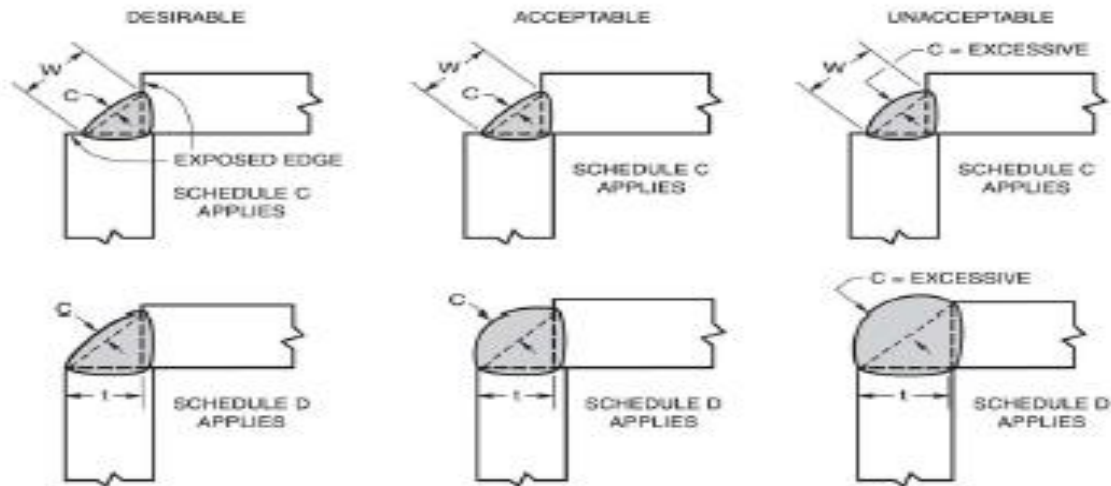


(F) FILLET WELD PROFILES FOR OUTSIDE CORNER JOINTS

Figure 5.4 (Continued)—Requirements for Weld Profiles (see Tables 5.8 and 5.9)

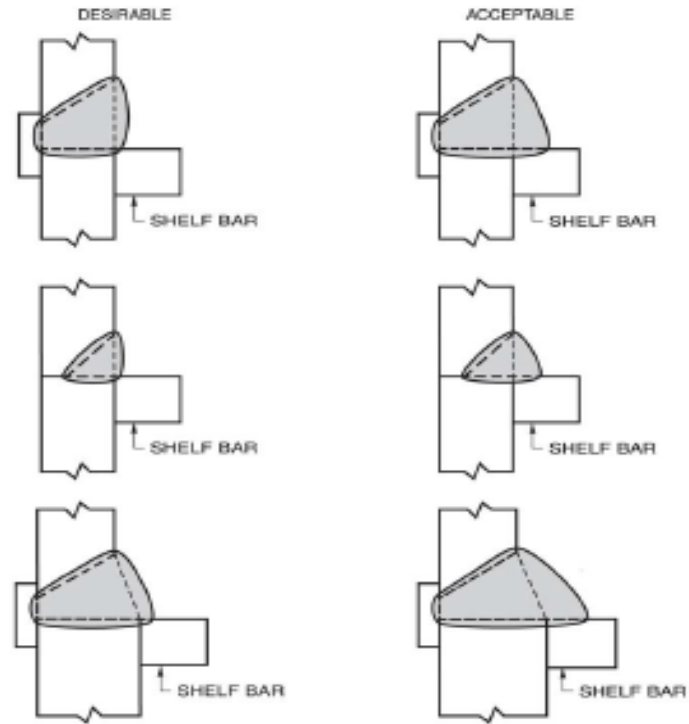

(G) TYPICAL SHELF BAR DETAILS

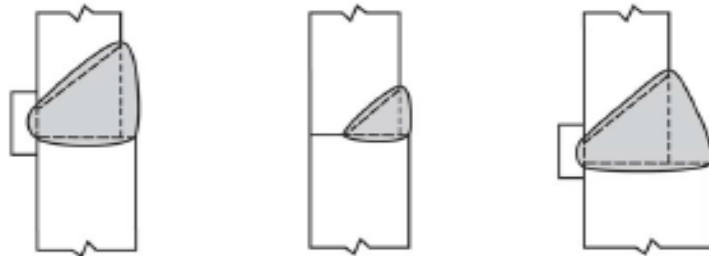

(H) TYPICAL PROFILES FOR BUTT WELDS BETWEEN UNEQUAL THICKNESSES

Figure 5.4 (Continued)—Requirements for Weld Profiles (see Tables 5.8 and 5.9)

Legend for Figures 3.2 and 3.3

Symbols for joint types

- B — butt joint
- C — corner joint
- T — T-joint
- BC — butt or corner joint
- TC — T- or corner joint
- BTC — butt, T-, or corner joint

Symbols for base metal thickness and penetration

- P — PJP
- L — limited thickness-CJP
- U — unlimited thickness-CJP

Symbol for weld types

- 1 — square-groove
- 2 — single-V-groove
- 3 — double-V-groove
- 4 — single-bevel-groove
- 5 — double-bevel-groove
- 6 — single-U-groove
- 7 — double-U-groove
- 8 — single-J-groove
- 9 — double-J-groove
- 10 — flare-bevel-groove
- 11 — flare-V-groove

Symbols for welding processes if not SMAW

- S — SAW
- G — GMAW
- F — FCAW

Welding processes

- SMAW — shielded metal arc welding
- GMAW — gas metal arc welding
- FCAW — flux cored metal arc welding
- SAW — submerged arc welding

Welding positions

- F — flat
- H — horizontal
- V — vertical
- OH — overhead

Dimensions

- R = Root Opening
- α, β = Groove Angles
- f = Root Face
- r = J- or U-groove Radius
- S, S₁, S₂ = PJP Groove Weld
Depth of Groove
- E, E₁, E₂ = PJP Groove Weld
Sizes corresponding to S, S₁, S₂, respectively

Joint Designation


The lower case letters, e.g., a, b, c, etc., are used to differentiate between joints that would otherwise have the same joint designation.

Symbols	Joint Types	اتصال
B	Butt Joint	اتصال سر به سر
C	Corner Joint	اتصال گوشه ای
T	T - Joint	اتصال به شکل T
BC	Butt or Corner Joint	اتصال سر به سر و گوشه
TC	T- or Corner Joint	اتصال گوشه ای و T
BTC	Butt, T- or Corner Joint	اتصال سر به سر ، T و گوشه ای
Symbols	Base Metal Thickness and Penetration	نفوذ جوش و ضخامت فلز پایه
L	Limited Thickness - Compeled Joint Penetration	ضخامت محدود - نفوذ کامل جوش
U	Unlimited Thickness - Compelete Joint Penetration	ضخامت نامحدود - نفوذ کامل جوش
P	Partial Joint Penetration	نفوذ ناقص جوش

AWS D1.1

**Figure 3.2 (Continued)—Prequalified PJP Groove Welded Joint Details
(see 3.12) (Dimensions in Millimeters)**


Square-groove weld (1)
Butt joint (B)

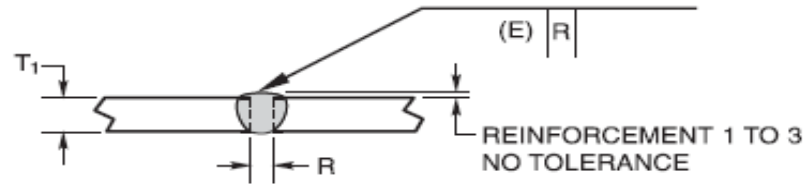

ALL DIMENSIONS IN mm

Welding Process	Joint Designation	Base Metal Thickness (U = unlimited)		Groove Preparation			Allowed Welding Positions	Weld Size (E)	Notes
		T ₁	T ₂	Root Opening	Tolerances				
					As Detailed (see 3.12.3)	As Fit-Up (see 3.12.3)			
SMAW	B-P1a	3	—	R = 0 to 2	+2, -0	±2	All	T ₁ - 1	b
	B-P1c	6 max.	—	R = $\frac{T_1}{2}$ min.	+2, -0	±2	All	$\frac{T_1}{2}$	b
GMAW FCAW	B-P1a-GF	3	—	R = 0 to 2	+2, -0	±2	All	T ₁ - 1	b, e
	B-P1c-GF	6 max.	—	R = $\frac{T_1}{2}$ min.	+2, -0	±2	All	$\frac{T_1}{2}$	b, e

Square-groove weld (1)
Butt joint (B)

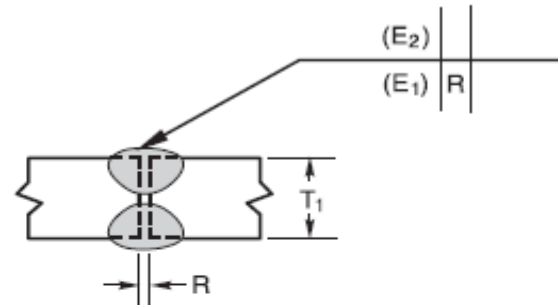


E₁ + E₂ MUST NOT EXCEED $\frac{3T_1}{4}$

ALL DIMENSIONS IN mm

Welding Process	Joint Designation	Base Metal Thickness (U = unlimited)		Groove Preparation			Allowed Welding Positions	Total Weld Size (E ₁ + E ₂)	Notes
		T ₁	T ₂	Root Opening	Tolerances				
					As Detailed (see 3.12.3)	As Fit-Up (see 3.12.3)			
SMAW	B-P1b	6 max.	—	R = $\frac{T_1}{2}$	+2, -0	±2	All	$\frac{3T_1}{4}$	
GMAW FCAW	B-P1b-GF	6 max.	—	R = $\frac{T_1}{2}$	+2, -0	±2	All	$\frac{3T_1}{4}$	e


Single-bevel-groove weld (4)
 Butt joint (B)
 T-joint (T)
 Corner joint (C)

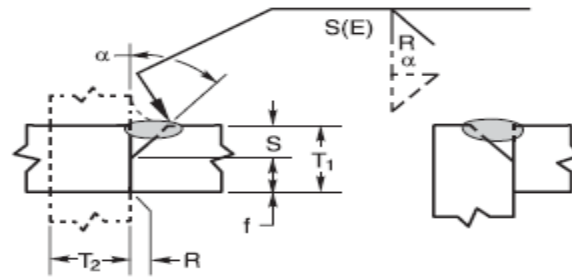

ALL DIMENSIONS IN mm

Welding Process	Joint Designation	Base Metal Thickness (U = unlimited)		Groove Preparation			Allowed Welding Positions	Weld Size (E)	Notes
		T ₁	T ₂	Root Opening Root Face Groove Angle	Tolerances				
					As Detailed (see 3.12.3)	As Fit-Up (see 3.12.3)			
SMAW	BTC-P4	U	U	R = 0 f = 3 min. α = 45°	+2, -0 +U -0 +10°, -0°	+3, -2 ±2 +10°, -5°	All	S-3	b, e, f, g, j, k
GMAW FCAW	BTC-P4-GF	6 min.	U	R = 0 f = 3 min. α = 45°	+2, -0 +U -0 +10°, -0°	+3, -2 ±2 +10°, -5°	F, H V, OH	S S-3	a, b, f, g, j, k
SAW	TC-P4-S	11 min.	U	R = 0 f = 6 min. α = 60°	±0 +U, -0 +10°, -0°	+2, -0 ±2 +10°, -5°	F	S	b, f, g, j, k


Double-bevel-groove weld (5)
 Butt joint (B)
 T-joint (T)
 Corner joint (C)

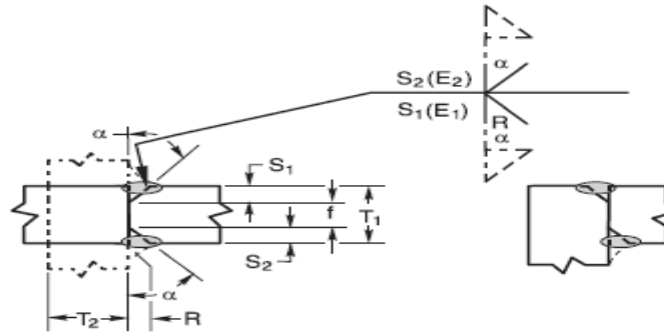


ALL DIMENSIONS IN mm

Welding Process	Joint Designation	Base Metal Thickness (U = unlimited)		Groove Preparation			Allowed Welding Positions	Total Weld Size (E ₁ + E ₂)	Notes
		T ₁	T ₂	Root Opening Root Face Groove Angle	Tolerances				
					As Detailed (see 3.12.3)	As Fit-Up (see 3.12.3)			
SMAW	BTC-P5	8 min.	U	R = 0 f = 3 min. α = 45°	+2, -0 +U -0 +10°, -0°	+3, -2 ±2 +10°, -5°	All	S ₁ + S ₂ -6	e, f, g, i, j, k
GMAW FCAW	BTC-P5-GF	12 min.	U	R = 0 f = 3 min. α = 45°	+2, -0 +U -0 +10°, -0°	+3, -2 ±2 +10°, -5°	F, H V, OH	S ₁ + S ₂ S ₁ + S ₂ -6	a, f, g, i, j, k
SAW	TC-P5-S	20 min.	U	R = 0 f = 6 min. α = 60°	±0 +U, -0 +10°, -0°	+2, -0 ±2 +10°, -5°	F	S ₁ + S ₂	f, g, i, j, k

See NOTES on Page 65

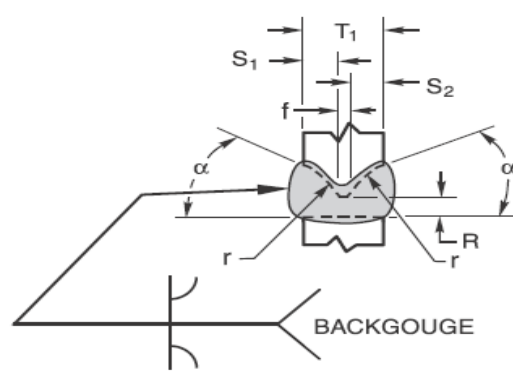Double-J-groove weld (9) Butt joint (B)		Base Metal Thickness (U = unlimited)		Groove Preparation				Tolerances		
								As Detailed (see 3.13.1)	As Fit-Up (see 3.13.1)	
 <p>ALL DIMENSIONS IN mm</p>		R = +2, -0	+2, -3							
		$\alpha = +10^\circ, -0^\circ$	+10°, -5°							
		f = +2, -0	Not Limited							
		r = +3, -0	±2							
Welding Process	Joint Designation	T ₁	T ₂	Root Opening	Groove Angle	Root Face	Bevel Radius	Allowed Welding Positions	Gas Shielding for FCAW	Notes
SMAW	B-U9	U	—	R = 0 to 3	$\alpha = 45^\circ$	f = 3	r = 10	All	—	c, d, e, h, j
GMAW FCAW	B-U9-GF	U	—	R = 0 to 3	$\alpha = 30^\circ$	f = 3	r = 10	All	Not required	a, c, d, h, j

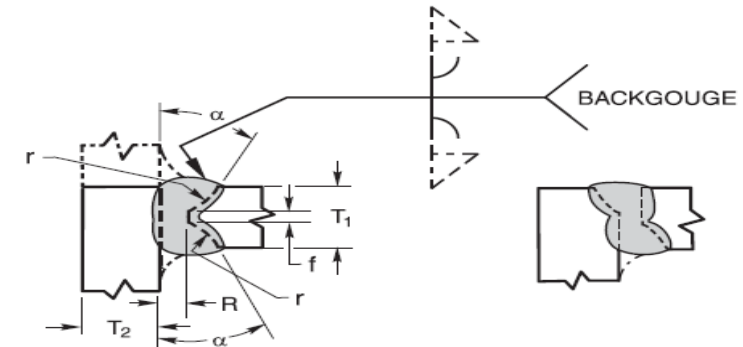Double-J-groove weld (9) T-joint (T) Corner joint (C)		Base Metal Thickness (U = unlimited)		Groove Preparation				Tolerances		
								As Detailed (see 3.13.1)	As Fit-Up (see 3.13.1)	
 <p>ALL DIMENSIONS IN mm</p>		R = +2, -0	+2, -3							
		$\alpha = +10^\circ, -0^\circ$	+10°, -5°							
		f = +2, -0	Not Limited							
		r = 3, -0	±2							
Welding Process	Joint Designation	T ₁	T ₂	Root Opening	Groove Angle	Root Face	Bevel Radius	Allowed Welding Positions	Gas Shielding for FCAW	Notes
SMAW	TC-U9a	U	U	R = 0 to 3	$\alpha = 45^\circ$	f = 3	r = 10	All	—	d, e, g, h, j, k
				R = 0 to 3	$\alpha = 30^\circ$	f = 3	r = 10	F, OH	—	d, e, g, h, j, k
GMAW FCAW	TC-U9a-GF	U	U	R = 0 to 3	$\alpha = 30^\circ$	f = 3	r = 10	All	Not required	a, d, g, h, j, k



WELD JOINT GEOMETRY AND WELDING SYMBOL



WELDING DETAILS

- ▶ WELDING JOINTS
- ▶ WELDING SYMBOL
- ▶ SUPPLEMENTRY SYMBOL
- ▶ WELD SYMBOL DIMENSIONING
- ▶ KEY TERM DEFINITION

INTRODUCTION

مشخص نمودن سائز جوش و نوع جوش و طرح اتصال به عهده مهندسين طراح می باشد
اما پرسنل ساخت و بازرسی باید جهت اجرای صحیح اتصالات نسبت به تفسیر آن علائم و
واژه ها اقدام نمایند.

AWS A3.0M/A3.0:2010
An American National Standard





 

 

 


Standard Welding Terms and Definitions

Including Terms for Adhesive
Bonding, Brazing, Soldering,
Thermal Cutting, and
Thermal Spraying





 

 







Basic Welding Symbols and Their Location Significance

Location Significance	Fillet	Plug or Slot	Spot or Projection	Stud	Seam	Back or Backing	Surfacing	Edge
Arrow Side								
Other Side				Not Used			Not Used	
Both Sides		Not Used	Not Used	Not Used	Not Used	Not Used	Not Used	
No Arrow Side or Other Side Significance	Not Used	Not Used		Not Used		Not Used	Not Used	Not Used
Location Significance	Groove							Scarf for Brazed Joint
	Square	V	Bevel	U	J	Flare-V	Flare-Bevel	
Arrow Side								
Other Side								
Both Sides								
No Arrow Side or Other Side Significance		Not Used	Not Used	Not Used	Not Used	Not Used	Not Used	Not Used











APPLICABLE WELDS and WELD SYMBOL

 Bevel-Groove	 U-Groove
 Flare-Bevel-Groove	 V-Groove
 Flare-V-Groove	 Edge Weld
 J-Groove	 Scarf (for braze joint)
 Square-Groove	











APPLICABLE WELDS and WELD SYMBOL

 Fillet	 Edge Weld
 Bevel-Groove	 Plug
 Flare-Bevel-Groove	 Slot
 Flare-V-Groove	 Spot
 J-Groove	 Seam
 Square-Groove	 Projection
 U-Groove	 V-Groove

 APPLICABLE WELDS and WELD SYMBOL



 

 
 
 

 
 Fillet	 Slot
 Bevel-Groove	 Spot
 Flare-V-Groove	 Seam
 J-Groove	 Projection
 Square-Groove	 Plug

APPLICABLE WELDS and WELD SYMBOL

 Fillet	 Slot
 Bevel-Groove	 Spot
 Flare-V-Groove	 Seam
 J-Groove	 Projection
 Square-Groove	
 Plug	

*Braze


APPLICABLE WELDS and WELD SYMBOL

 Bevel-Groove	 U-Groove
 Flare-Bevel-Groove	 V-Groove
 Flare-V-Groove	 Edge
 J-Groove	 Seam
 Square-Groove	


Types of Welding Joints




Butt Joint

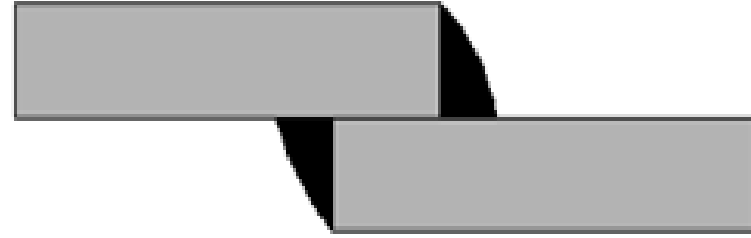


Lap Joint

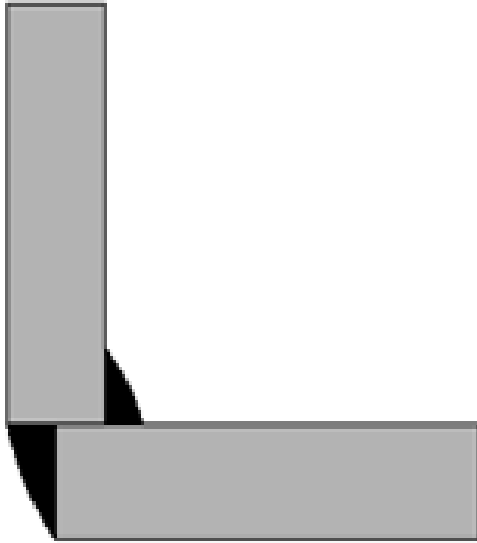

Corner Joint

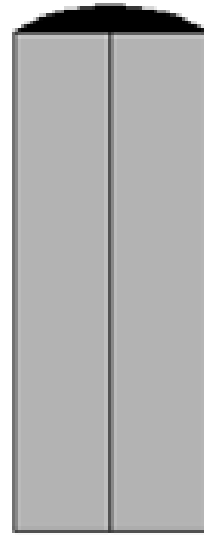

Edge Joint

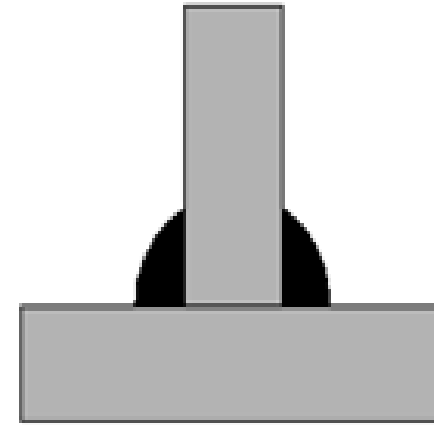




Tee Joint



FLANGED JOINTS






(A) FLANGED BUTT JOINTS

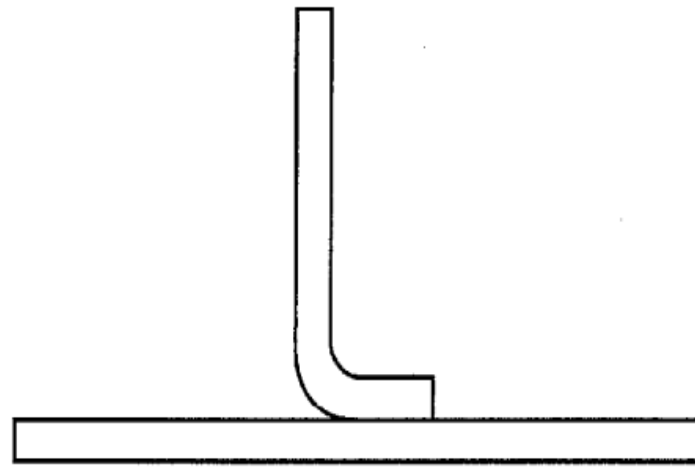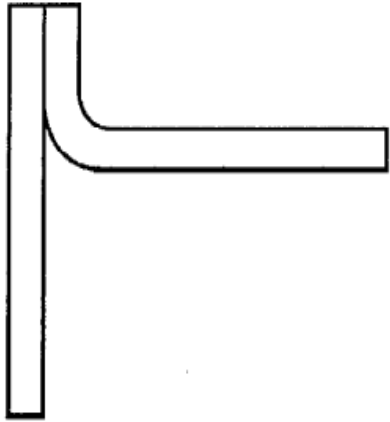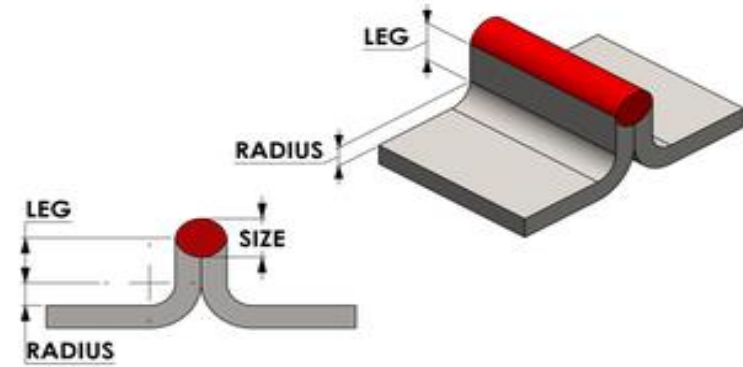



(B) FLANGED CORNER JOINT

(C) FLANGED T-JOINT

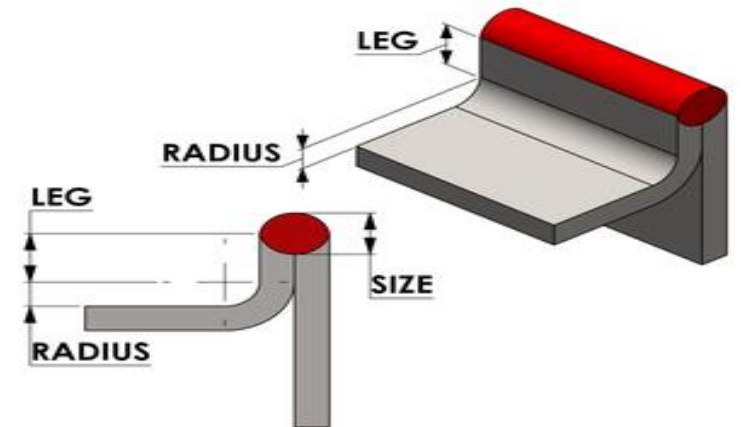

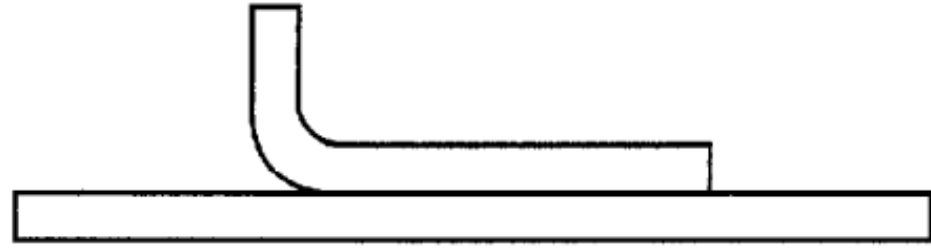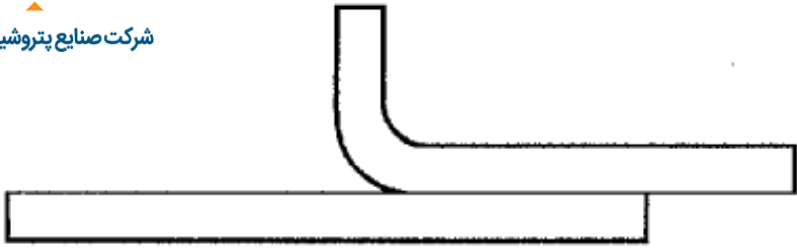

(D) FLANGED LAP JOINTS

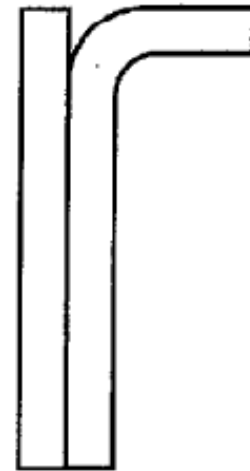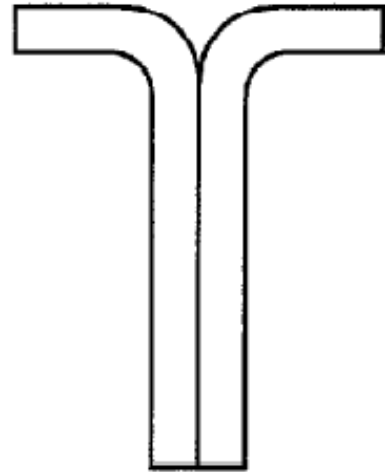

(E) FLANGED EDGE JOINTS




SPELICED JOINT

عضوی از اتصال می باشد که به صورت وصله ای بوده است و بر روی هر دو قطعه مورد نظر جوشکاری قرار میگیرد و به آنها جوشکاری میگردد:






SPLICED JOINT

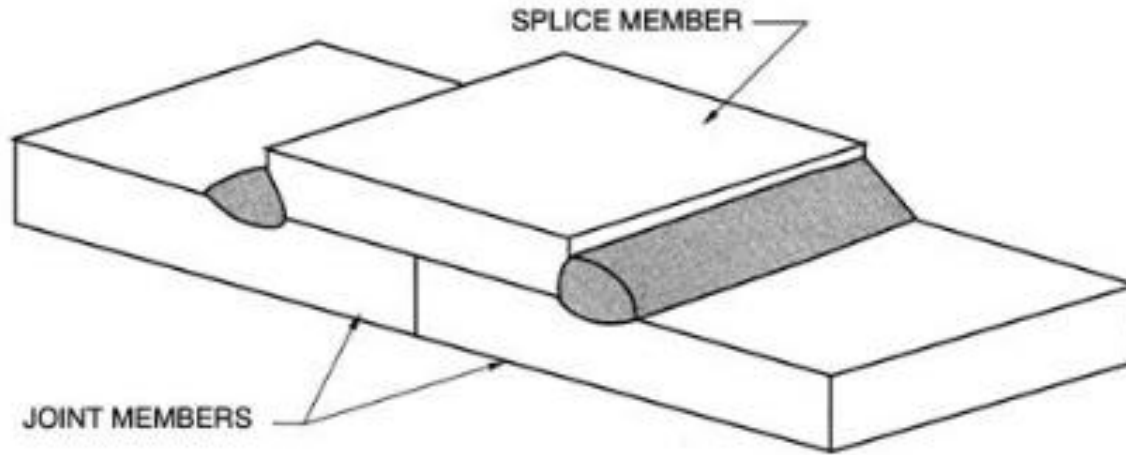

**Single-spliced
butt joint**

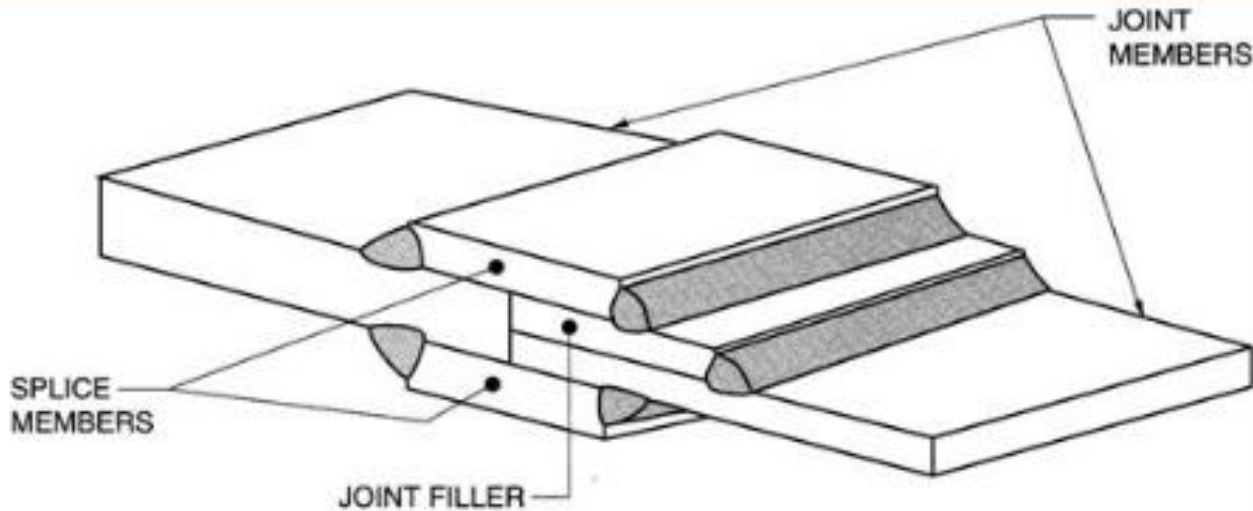


**Double-spliced
butt joint with
joint filler**




عضو سر به سر و غیر سر به سر در اتصال

- ▶ عضو سر به سر عضوی از اتصال است که امکان حرکت آن توسط عضو دیگر در جهت عمود بر راستای ضخامت مهار میگردد؛
- ▶ عضو غیر سر به سر که امکان حرکت آن عضو عمود بر راستای ضخامت میسر می باشد.

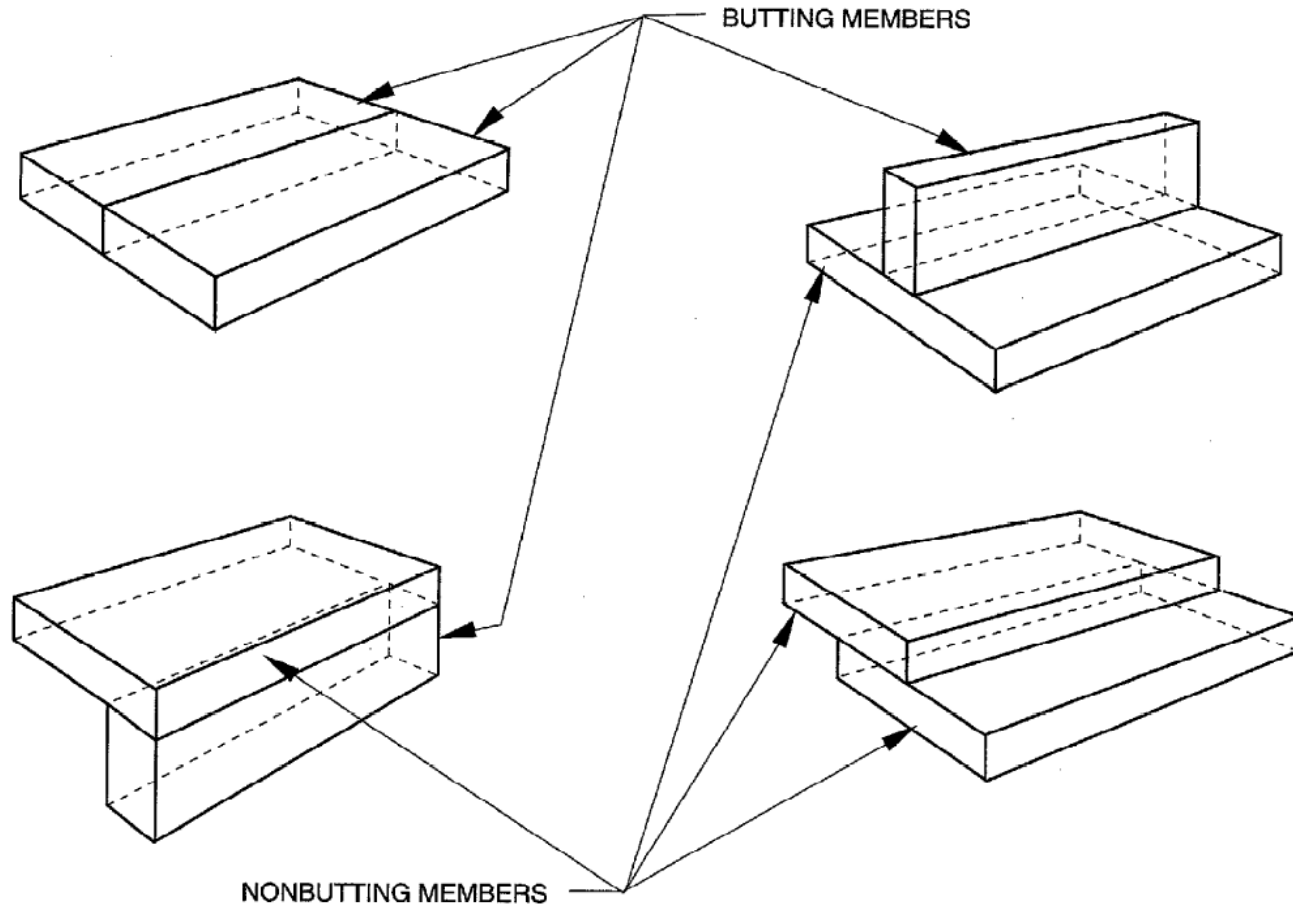




انواع لبه اتصال

 

(A) SQUARE EDGE SHAPE

APPLICABLE WELDS

- Double-Bevel-Groove
- Double-Bevel-Flare-Groove
- Double-J-Groove
- Single-Bevel-Groove
- Single-Flare-Bevel-Groove

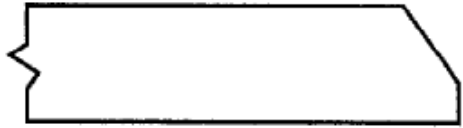

(B) SINGLE-BEVEL EDGE SHAPE

APPLICABLE WELDS


- Single-Bevel-Groove
- Single-V-Groove



(C) DOUBLE-BEVEL EDGE SHAPE

APPLICABLE WELDS


- Double-Bevel-Groove
- Double-V-Groove

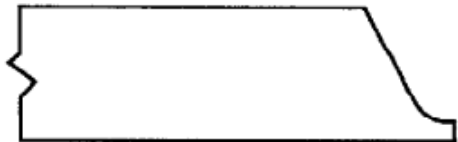

(D) SINGLE-J-GROOVE EDGE SHAPE

APPLICABLE WELDS


- Single-J-Groove
- Single-U-Groove

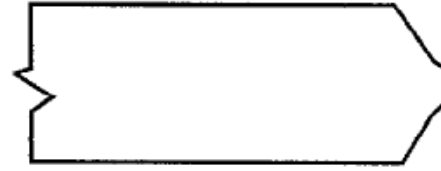

(E) DOUBLE-J-GROOVE EDGE SHAPE

APPLICABLE WELDS

 - Double-J-Groove
- Double-U-Groove



(F) FLANGE EDGE SHAPE

APPLICABLE WELDS

- Double-Flare-Bevel-Groove
- Single-Flare-V-Groove
- Edge
- Fillet











(G) ROUND EDGE SHAPE

APPLICABLE WELDS

- Double-Flare-Bevel-Groove
- Double-Flare-V-Groove




آماده سازی لبه ها در اتصال سر به سر

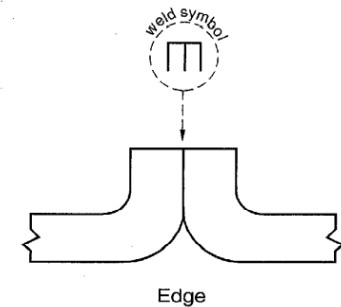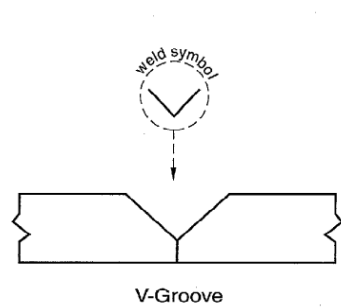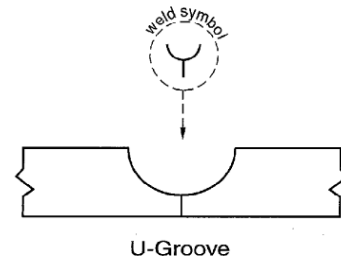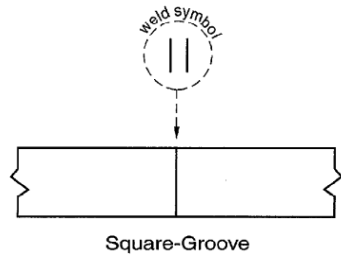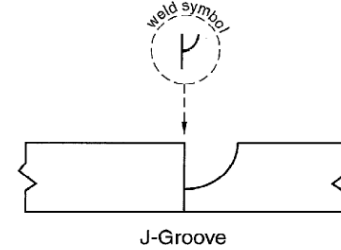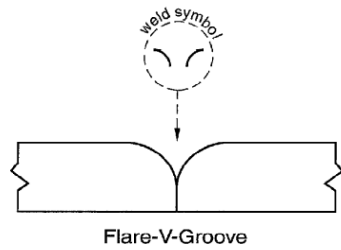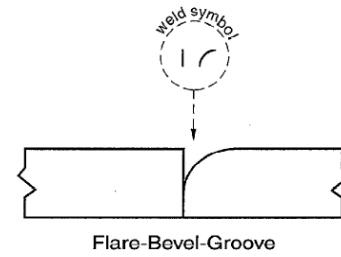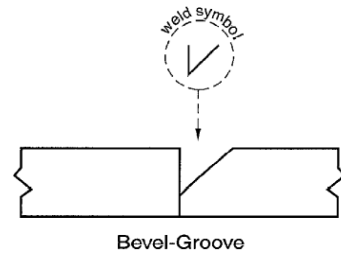




آماده سازی لبه ها در اتصال گوشه

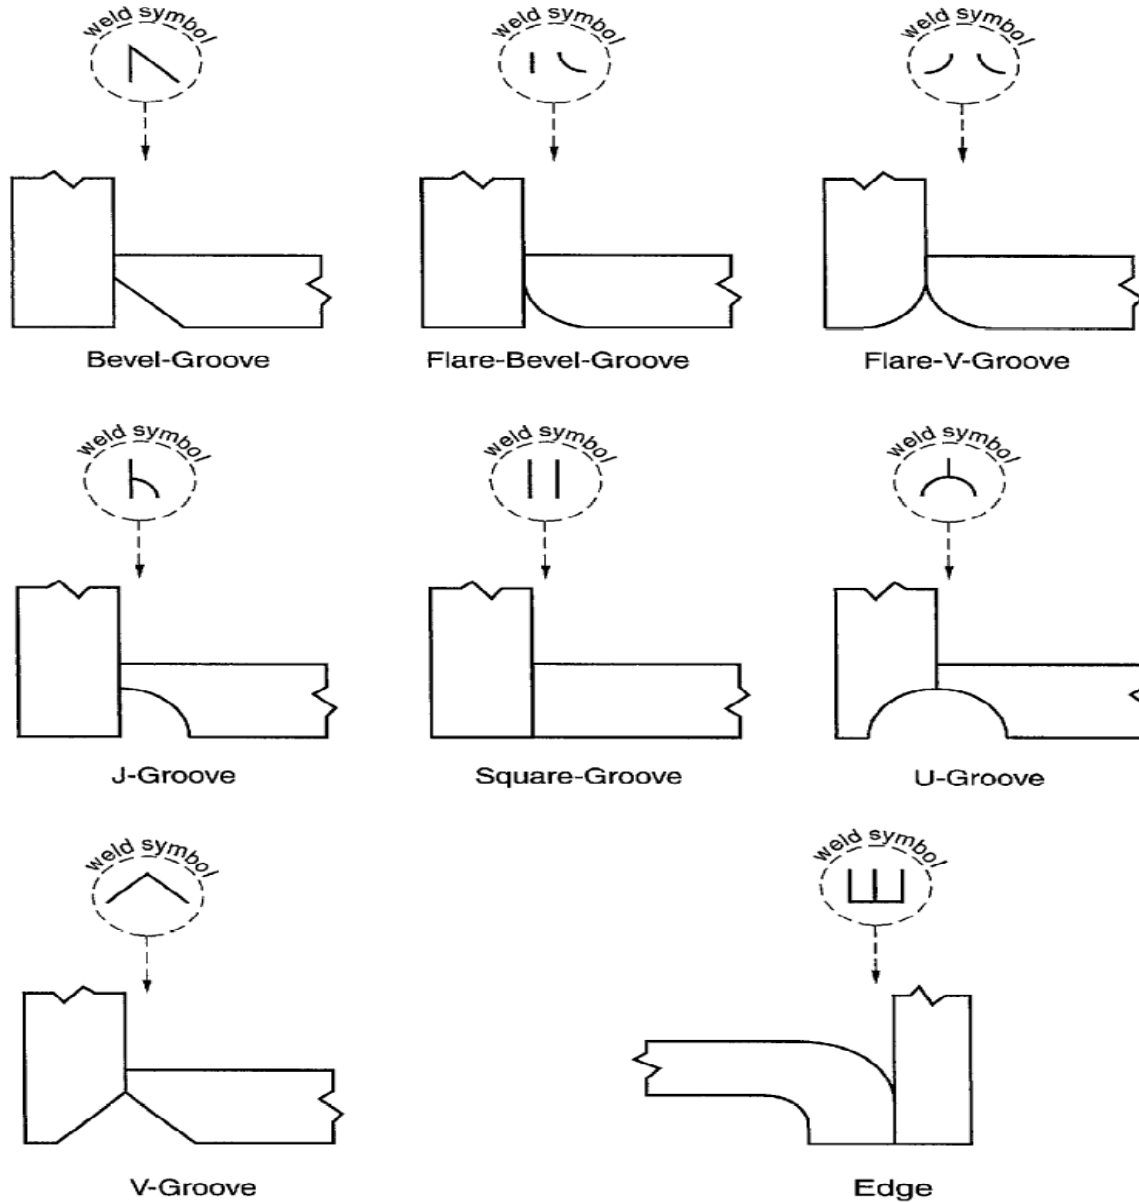








آماده سازی لبه ها در اتصال سپری

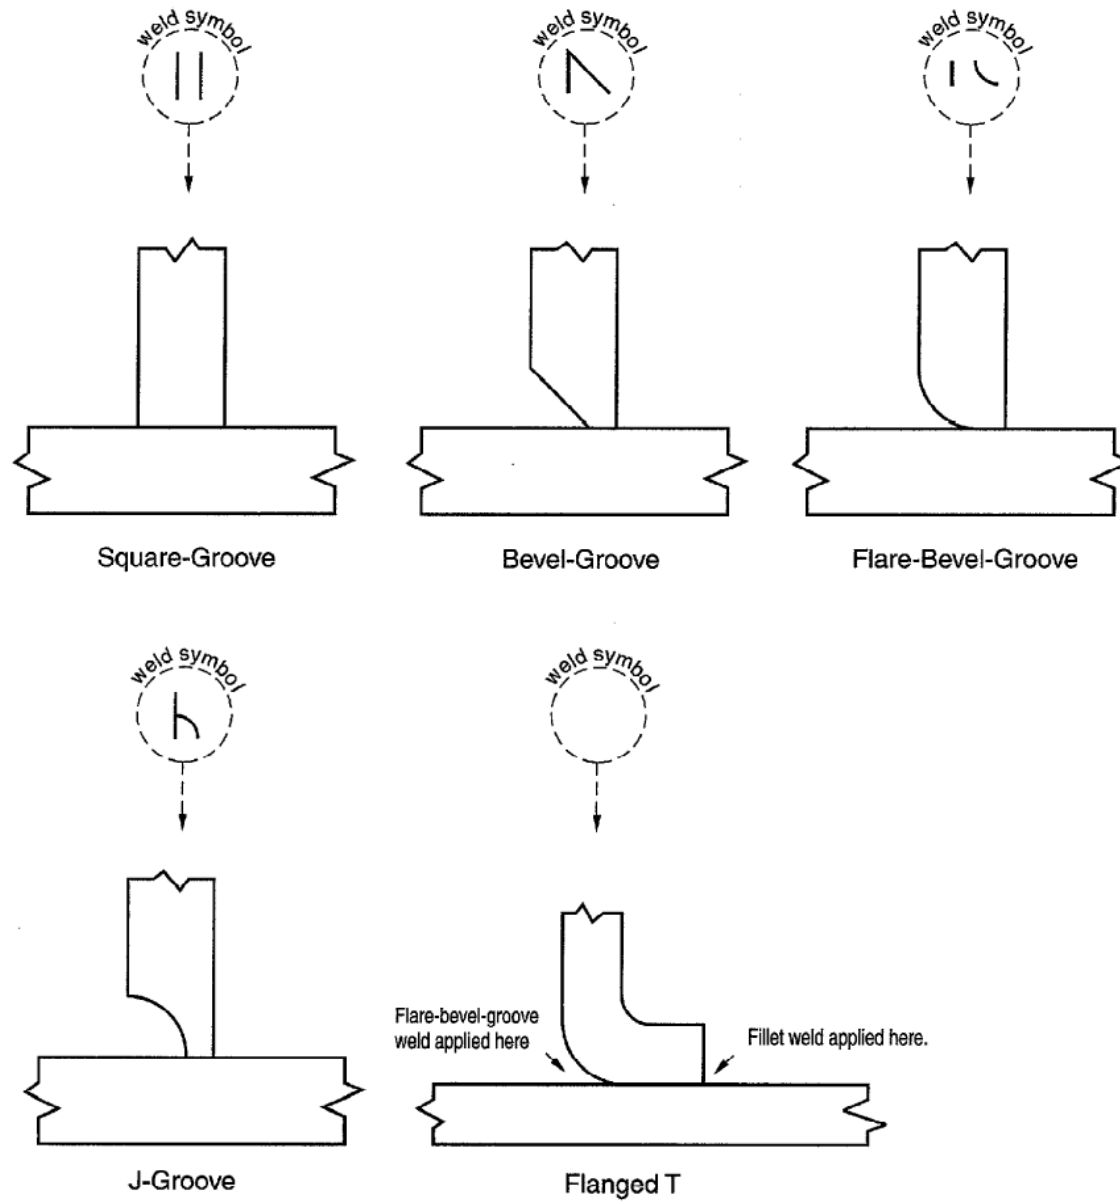




آماده سازی لبه ها در اتصال لب رویهم

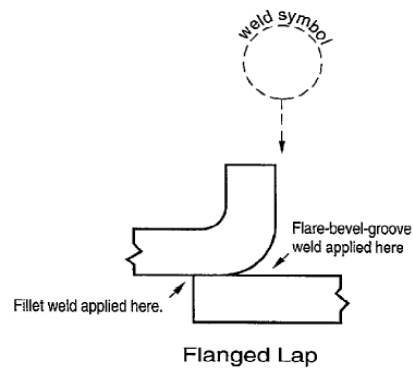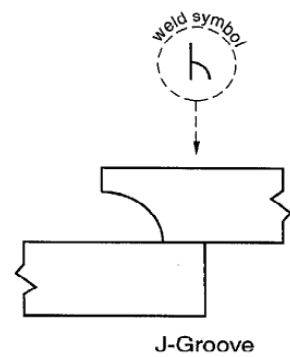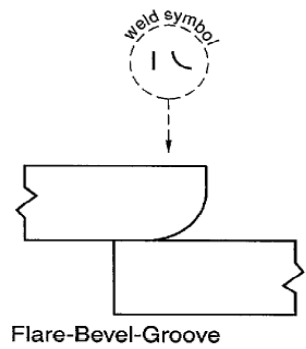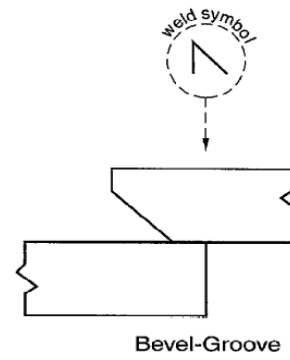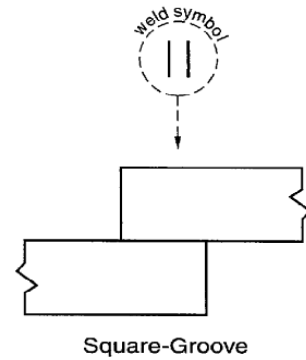




آماده سازی لبه ها در اتصال لبه ای

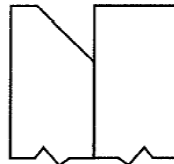


Bevel-Groove

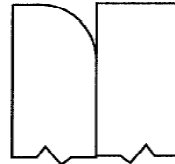


Flare-Bevel-Groove




Flare-V-Groove

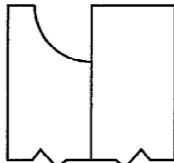

J-Groove

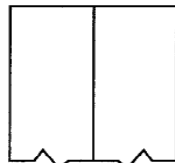


Square-Groove

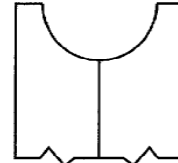

U-Groove



V-Groove

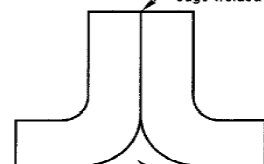


Flanged Edge

edge welded on this side

Flare-v-groove weld applied here




ریشه در اتصالات مختلف

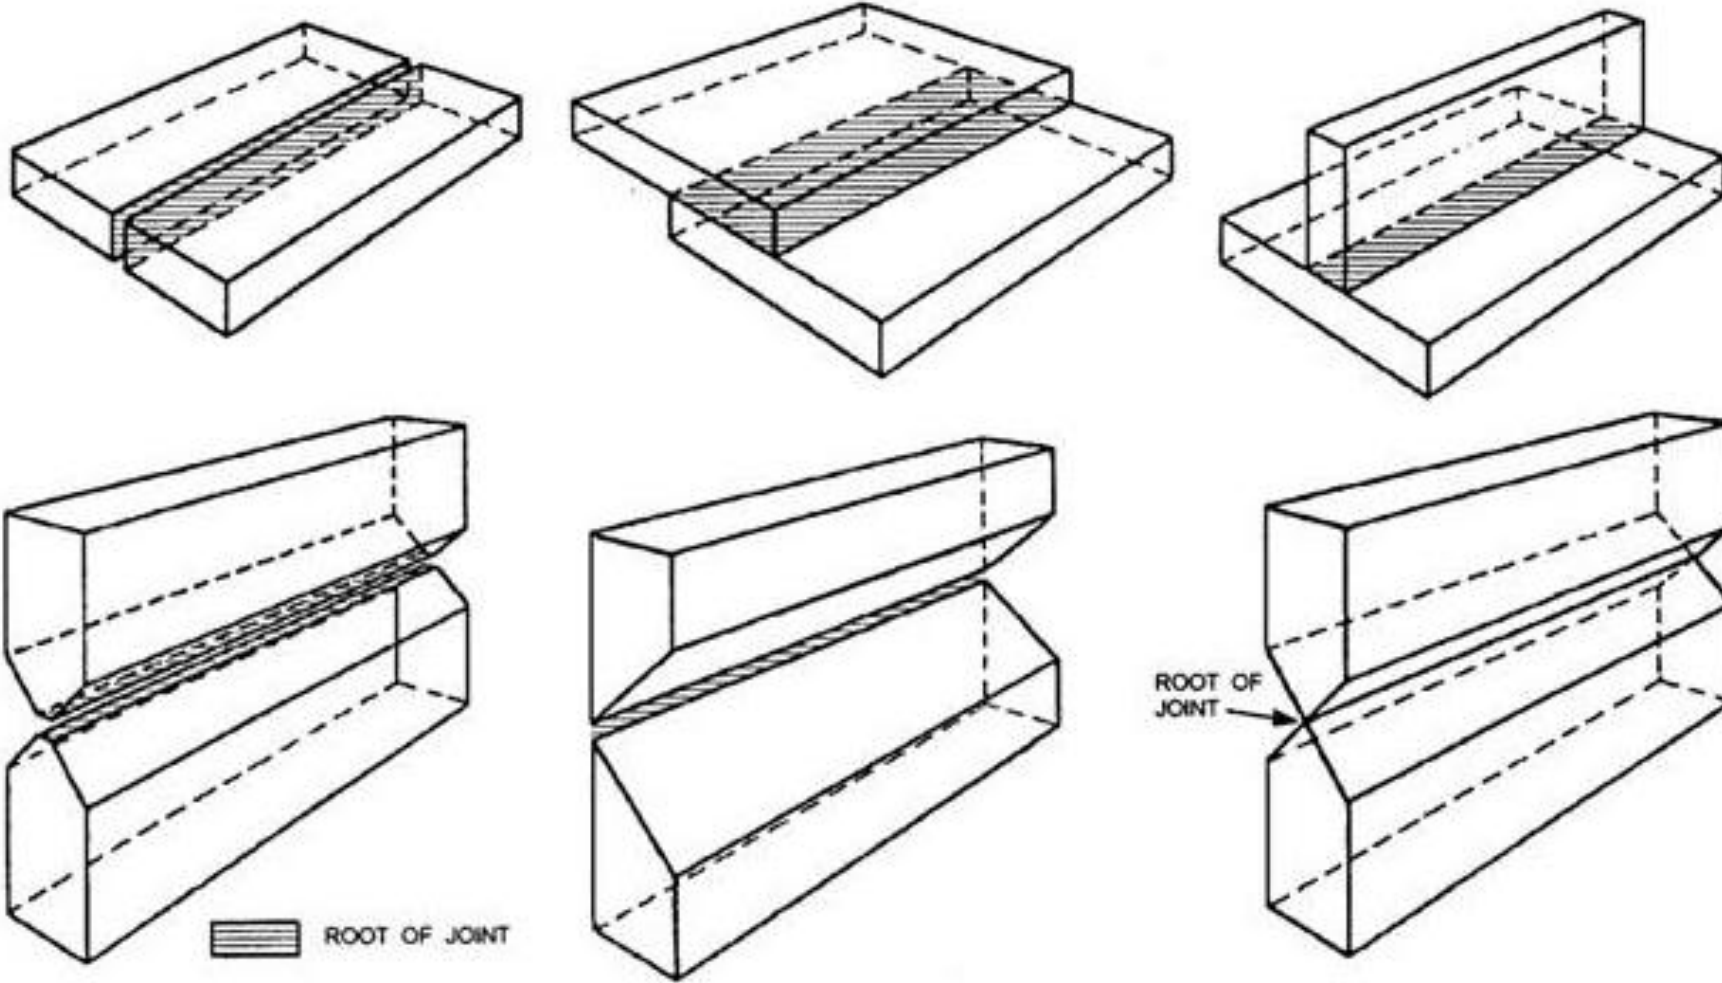




سطح شیار ، پاشنه و لبه ریشه

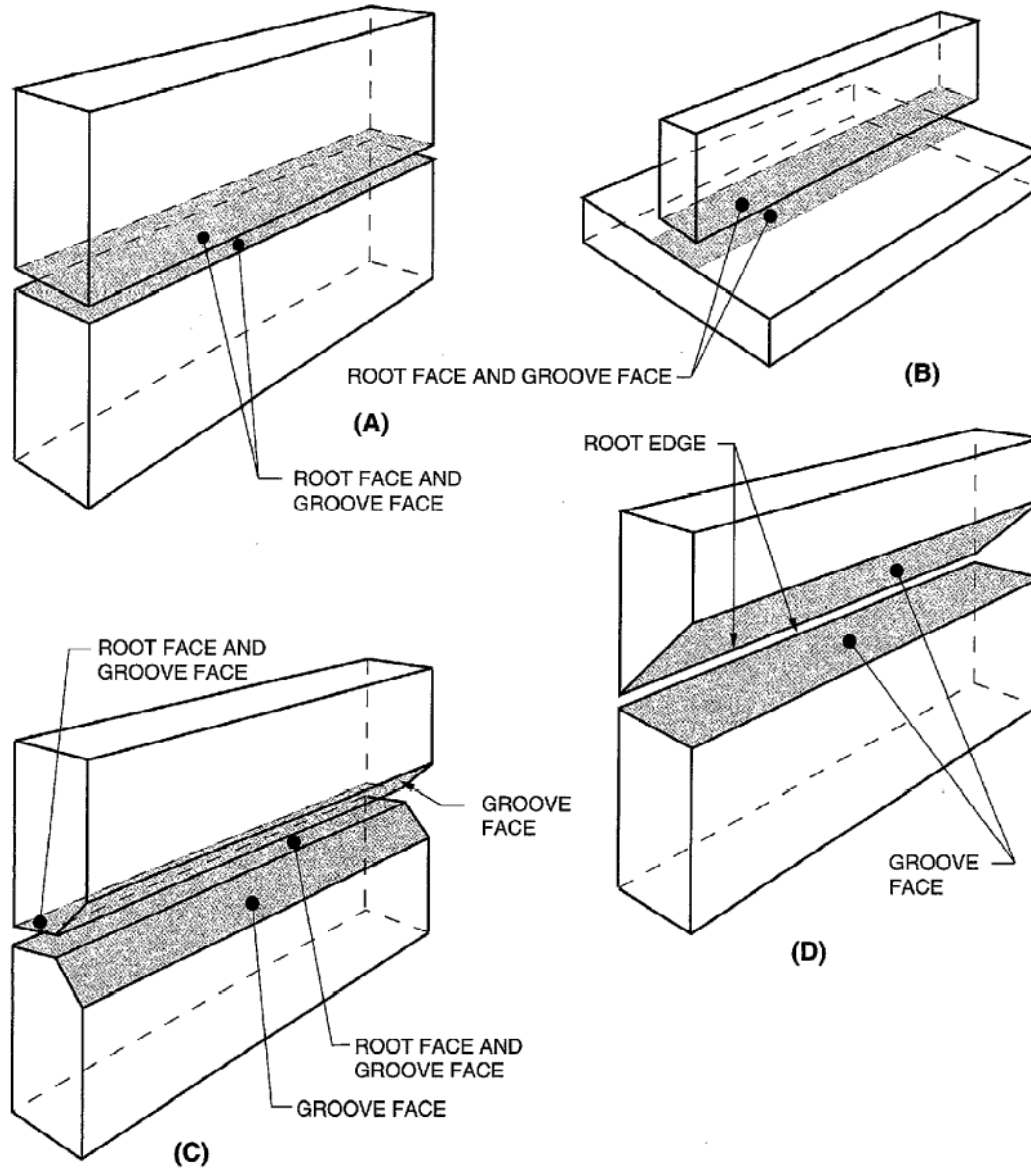


زاویه پخ ، عمق پخ ، زاویه شیار ، شعاع شیار و فاصله ریشه

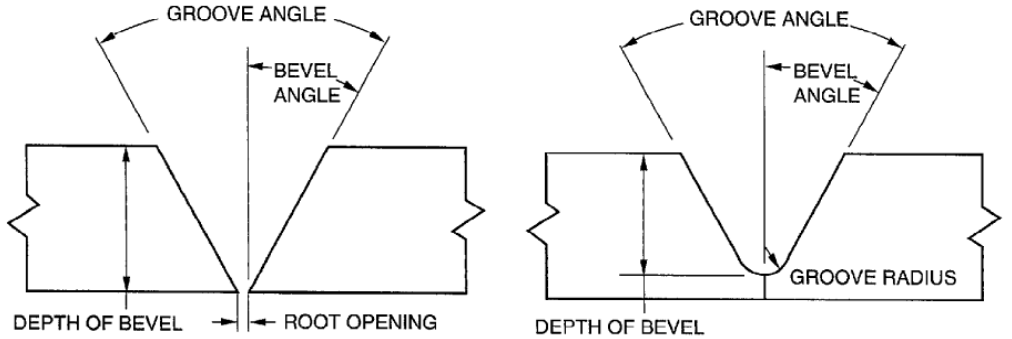


(A)

(B)

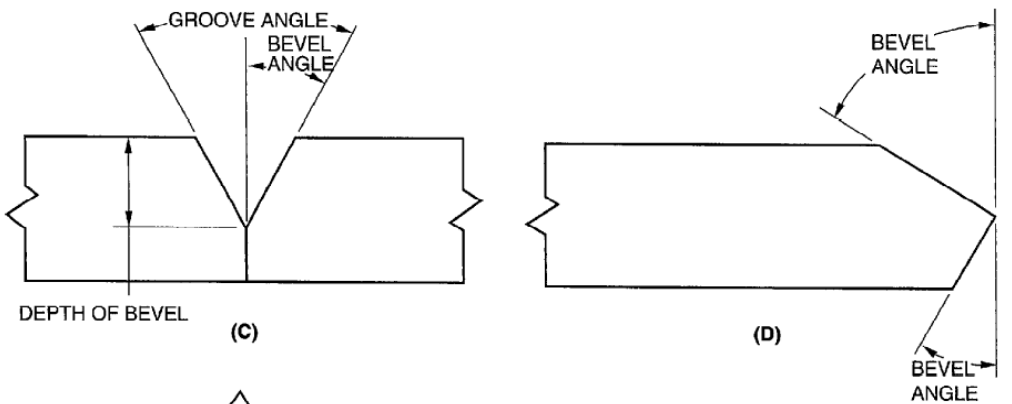

(C)

(D)

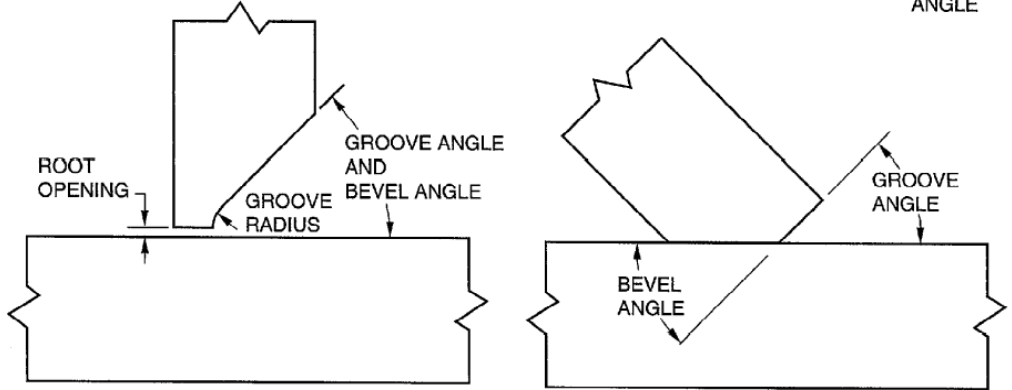

(E)

(F)

انواع جوش

- GROOVE WELDS جوش های شیاری ▶
- FILLET WELDS جوش های نبشی ▶
- PLOG OR SLOT WELDS جوش های کام یا دکمه ای ▶
- STUD WELDS جوش های زائده ای ▶
- SPOT OR PROJECTION WELDS جوش های نقطه ای ▶
- SEAM WELDS جوش های نواری ▶
- BACK OR BACKING WELDS جوش های پشتی یا پشت بند ▶
- SURFACE WELDS جوش های سطحی ▶
- EDGE WELDS جوش های لبه ای ▶

AWS A2.4:2012
An American National Standard

**Standard Symbols
for Welding,
Brazing, and
Nondestructive
Examination**

جوشهای شیاری GROOVE WELD

شیاری لبه گونیایی SQUARE GROOVE

شیاری لبه اریب SCARF

شیاری V شکل یا جناقی V GROOVE

شیاری نیم جناقی BEVEL GROOVE

شیاری U شکل یا لاله U GROOVE


شیاری J شکل یا نیم لاله J GROOVE

شیاری جناقی لبه گرد FLARE V GROOVE

شیاری نیم جناقی لبه گرد FLARE BEVEL GROOVE




GROOVE WELDS

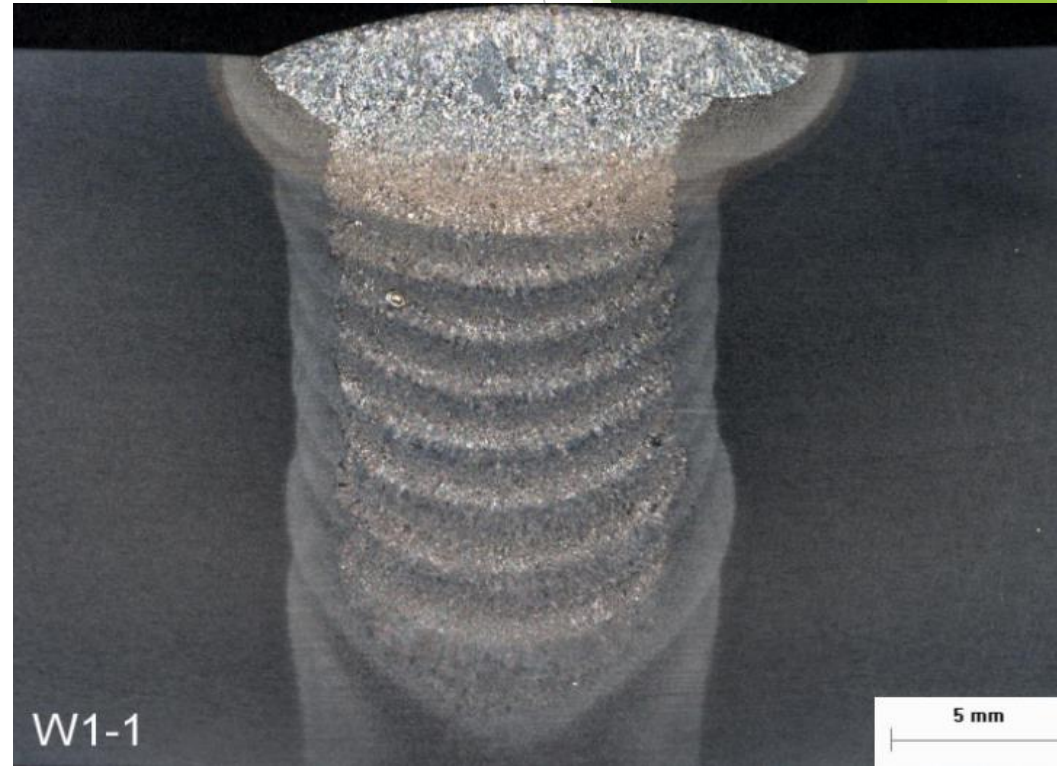





SINGLE AND DOUBLE BEVEL GROOVE

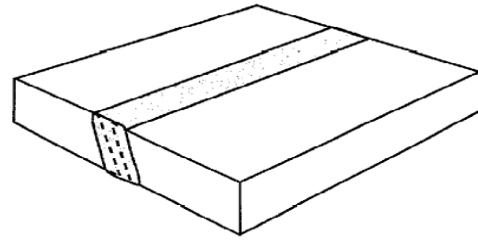


(A) Single-Scarf-Groove Weld (often used for brazing)

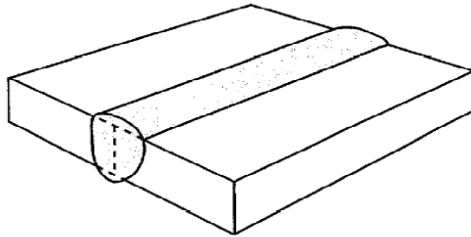


(B1) Single-Square-Groove Weld

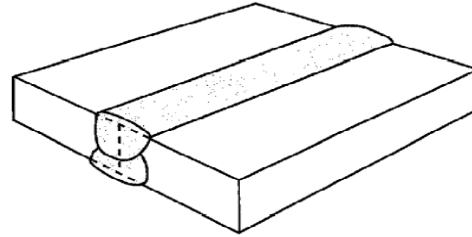


(B2) Double-Square-Groove Weld

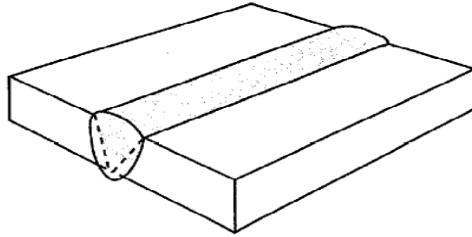


(C1) Single-V-Groove Weld

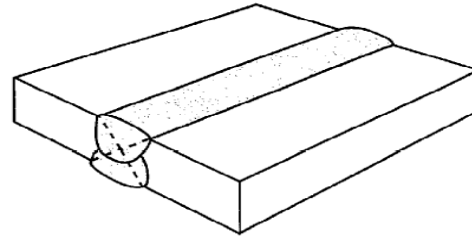

(C2) Double-V-Groove Weld

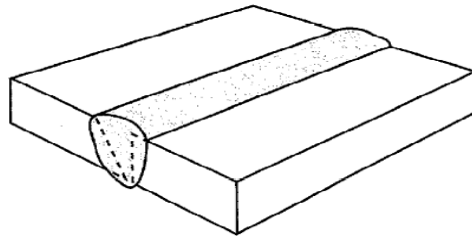


(D1) Single-Bevel-Groove Weld

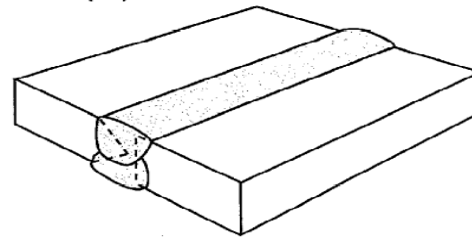


(D2) Double-Bevel-Groove Weld

SCARFGROOVE WELD

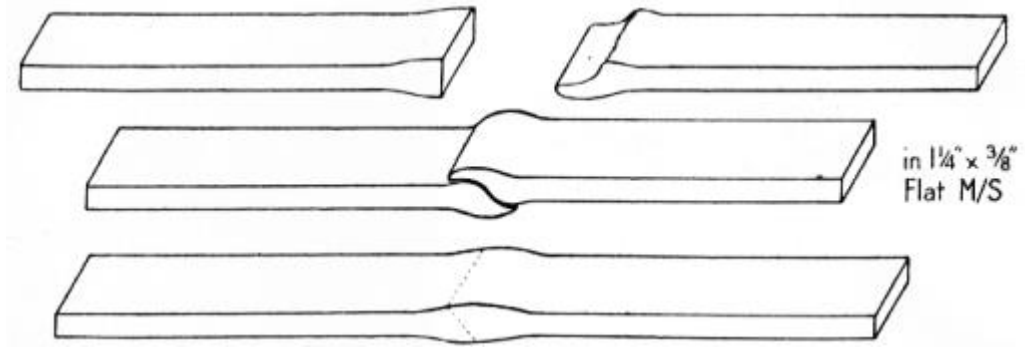





SINGLE AND DOUBLE BEVEL GROOVE

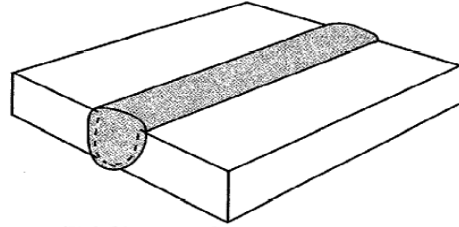


(E1) Single-U-Groove Weld

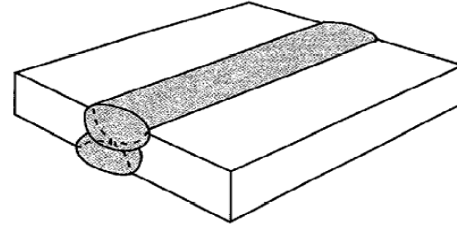


(E2) Double-U-Groove Weld

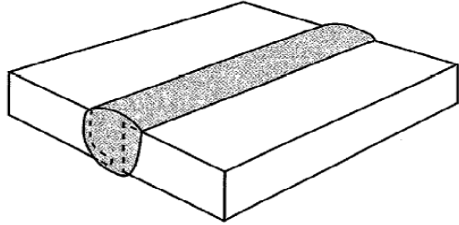


(F1) Single-J-Groove Weld

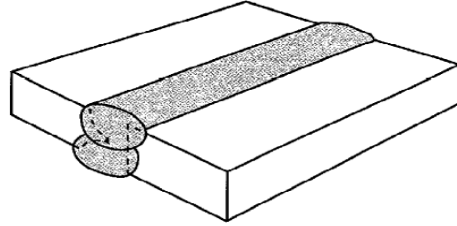


(F2) Double-J-Groove Weld

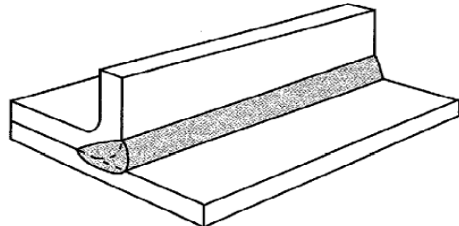


(G1) Single-Flare-Bevel-Groove Weld

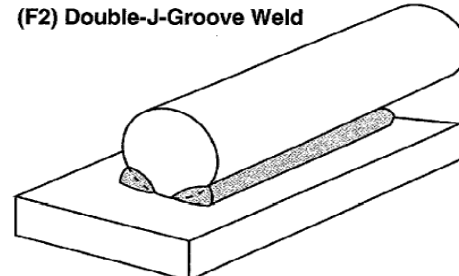

(G2) Double-Flare-Bevel-Groove Weld

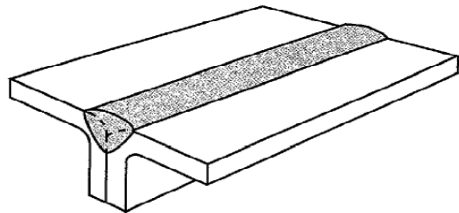


(H1) Single-Flare-V-Groove Weld

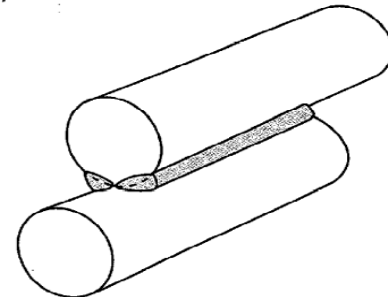

(H2) Double-Flare-V-Groove Weld



FILLET WELDS

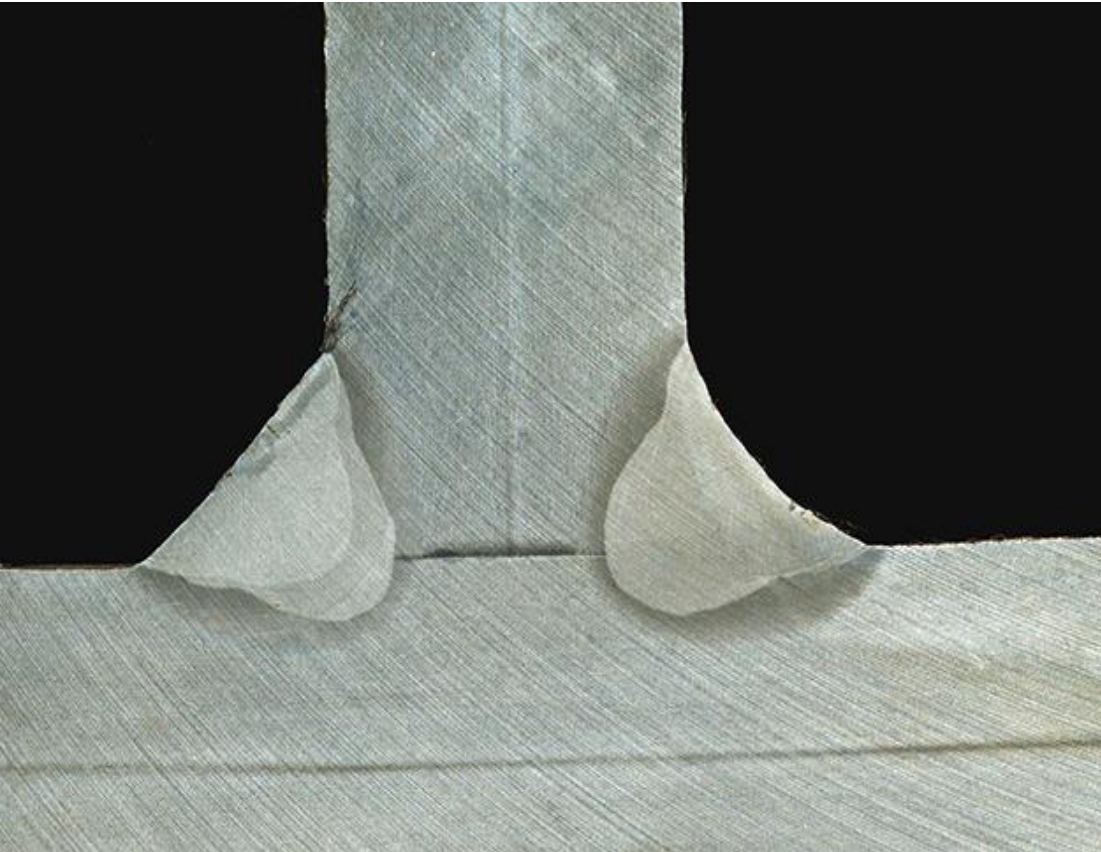


FILLET WELDS


- ▶ جوش های نبشی عبارت است از جوش مقطع مثلثی شکل که دو سطح تقریبا بر هم عمود هستند مانند اتصال لب رویهم / گوشه / T شکل
- ▶ چنانچه محدودیتی در طراحی نداشته باشیم جوشهای گوشه از لحاظ اقتصادی و اجرایی در اولویت می باشد.
- ▶ جوشهای نبشی میتوانند به صورت مقطع ضربدری یا مقطع روبروی هم باشند.




FILLET WELDS

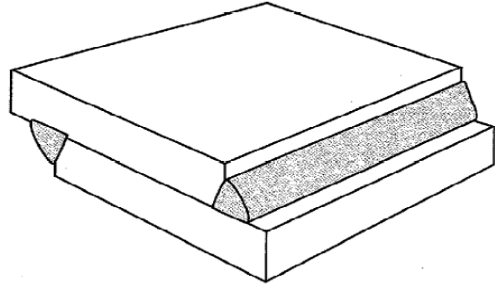


(A) Double Sided - Single Pass Fillet Welds on a Lap Joint

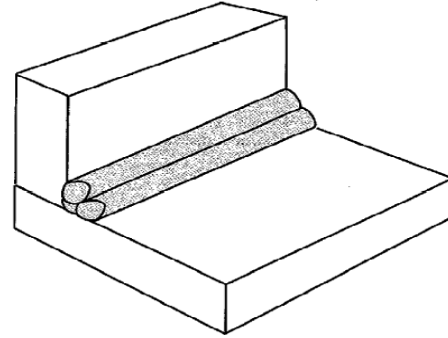


(B) Single Sided - Multiple Pass Fillet Welds on a Corner Joint

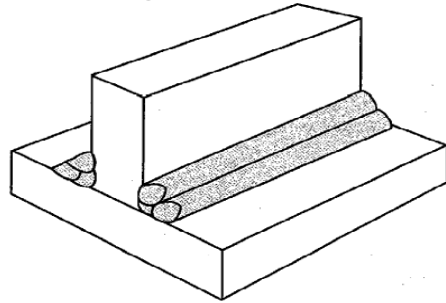


(C) Double Sided - Multiple Pass Fillet Welds on a T-Joint

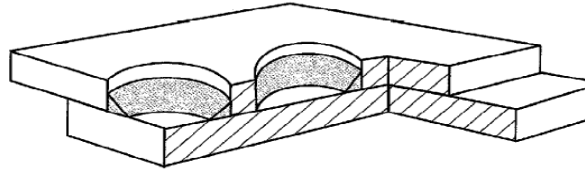

(D) Fillet Welds around the diameter of a hole

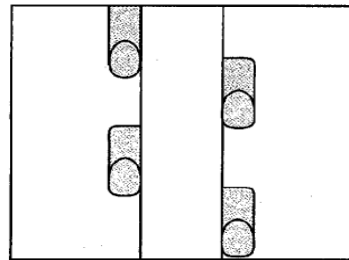


(E) Staggered Intermittent Fillet Welds Top View

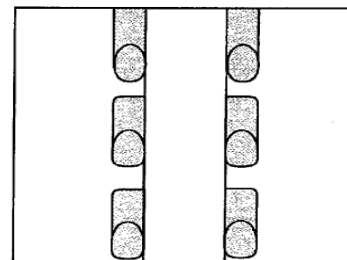

(F) Chain Intermittent Fillet Welds Top View

جوش های پشتی و پشت بند BACK AND BACKING WELD



این اتصالات در پشت جوش ایجاد میگردند و اصولاً دارای تفاوت هایی هستند. طبق AWS A3.0 جوش BACK WELD جوشی است که در پشت یک جوش شیاری و پس از تکمیل شدن طرف اصلی آن اجرا میگردد. اما BACKING WELD جوشی است که به عنوان پشت بند به منظور جلوگیری از ریزش مذاب رخ می دهد و قبل از اجرای جوش اصلی اجرا میگردد.

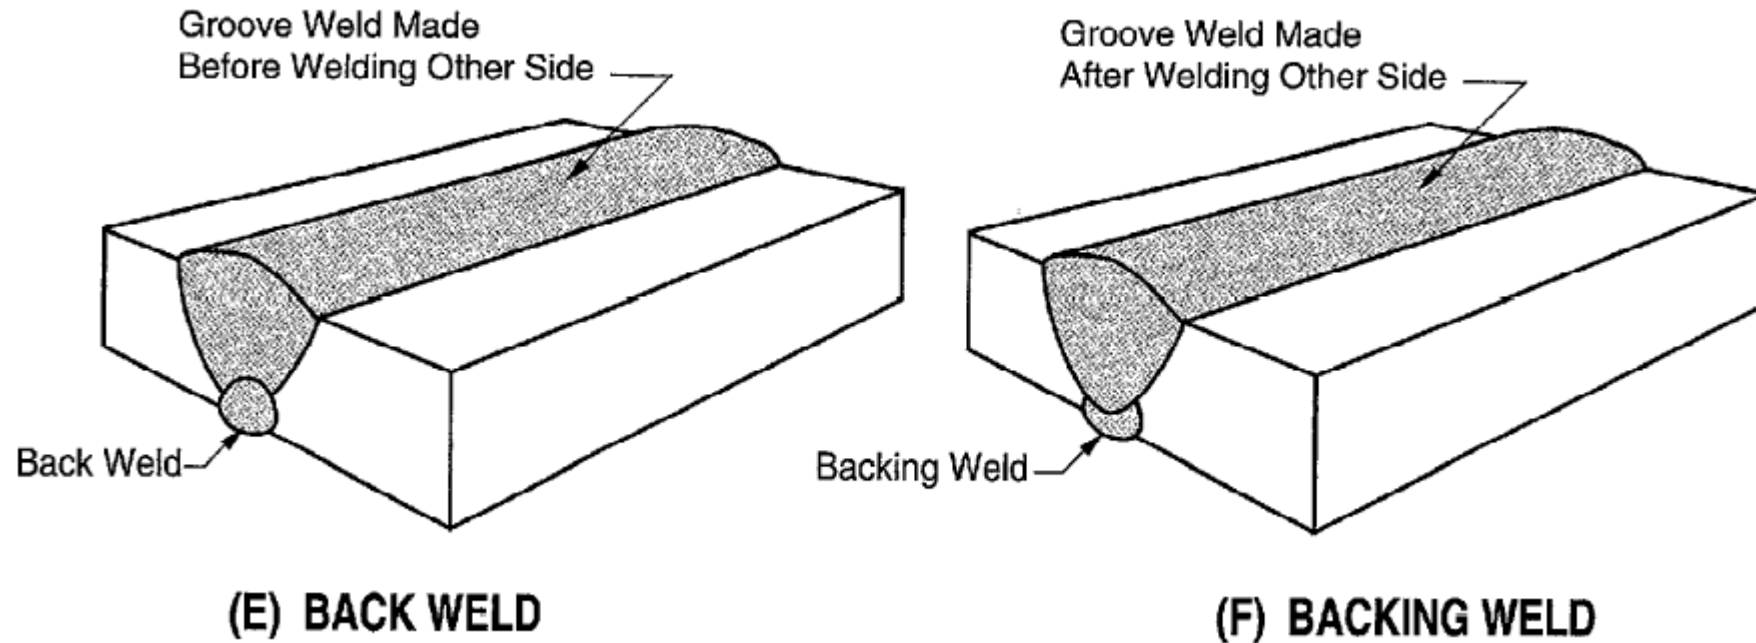

جوش های سطحی SURFACING WELDS




- ▶ جوش سطحی جوشی است که روی سطح قطعات به منظور دستیابی به خواص یا ابعاد مورد نظر اجرا میگردد.
- ▶ در این جوش اتصال مدنظر نمی باشد.
- ▶ ترمیم BUILT UP: جوشکاری به منظور تامین ابعاد اولیه
- ▶ آسترکاری BUTTERING: عملیات جوشکاری جهت رساندن خواص متالورژیکی قطعات غیر هم جنس و سپس جوشکاری قطعات به یکدیگر
- ▶ روکش کاری CLADDING: ایجاد سطوح جهت ایجاد مقاومت به خوردگی
- ▶ سخت کردن سطحی HARDFACING: انجام عملیات جوشکاری به منظور سخت نمودن سطوح و کاهش میزان سایش

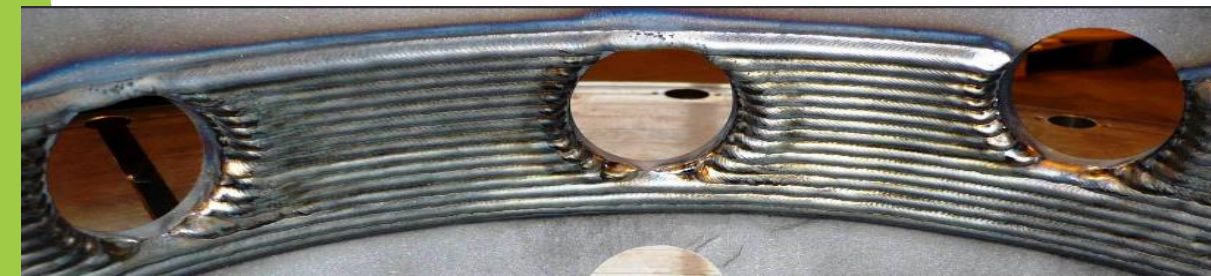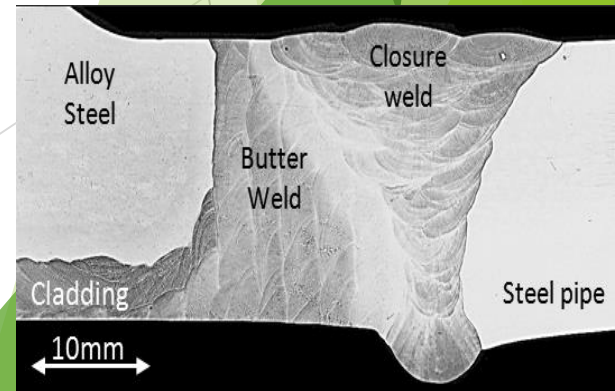


جوش لبه ای EDGE JOINT


جوش لبه ای جوشی است که در اتصال لبه ای اتصال سر به سر لبه برگشتی و اتصال گوشه ای لبه برگشته اجرا میشود. به نحوی که کل ضخامت قطعه ذوب گردد.

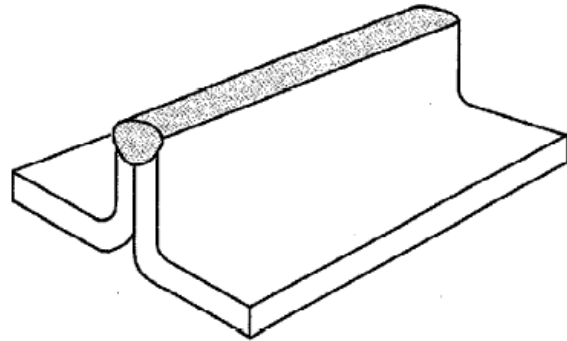

(A) Edge Weld in a Flange Butt Joint

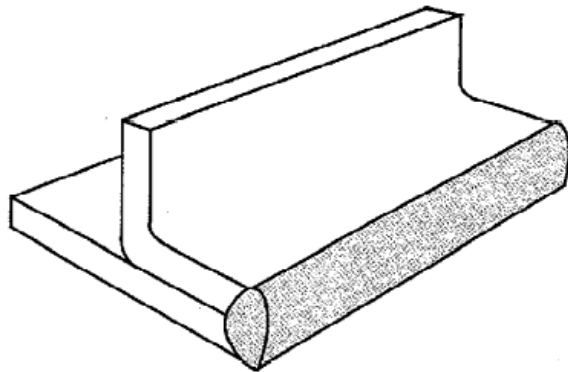

(B) Edge Weld in a Flange Corner Joint

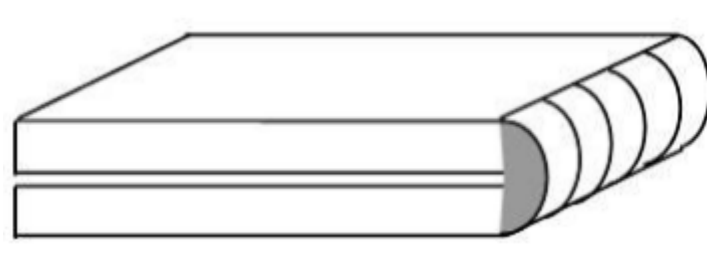

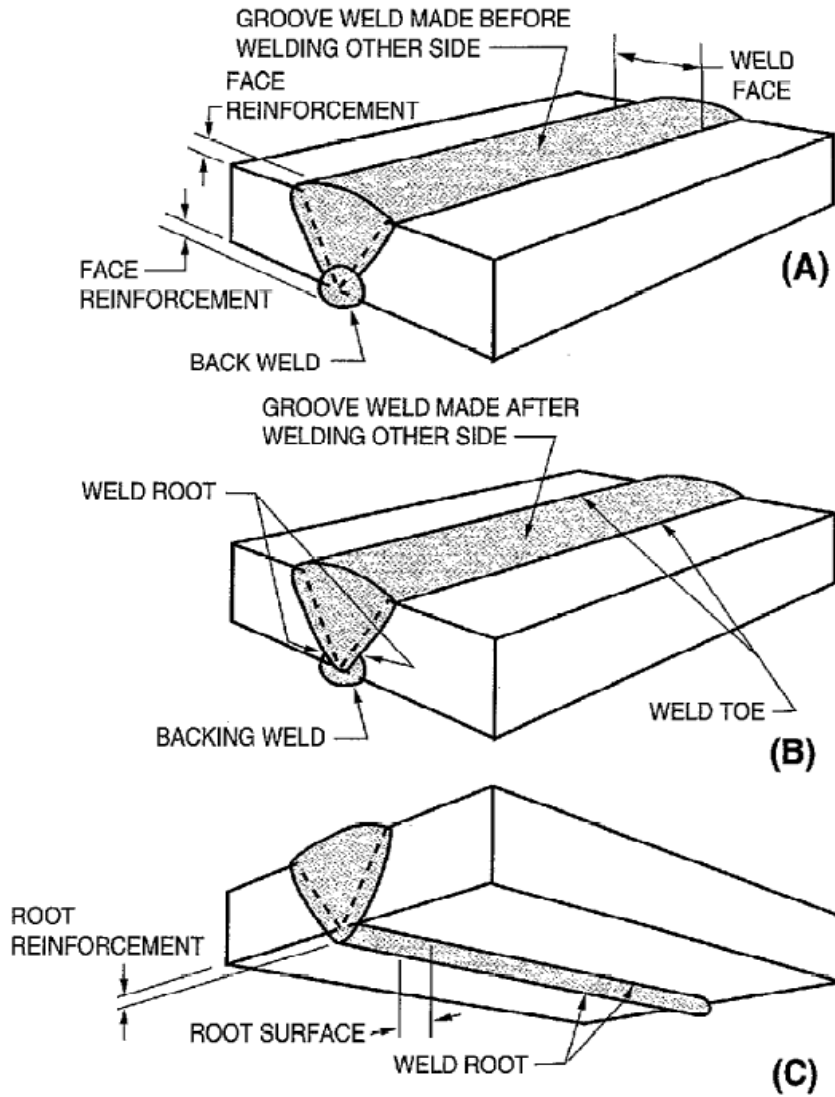


Figure 4.21—Completed Groove Weld Terms

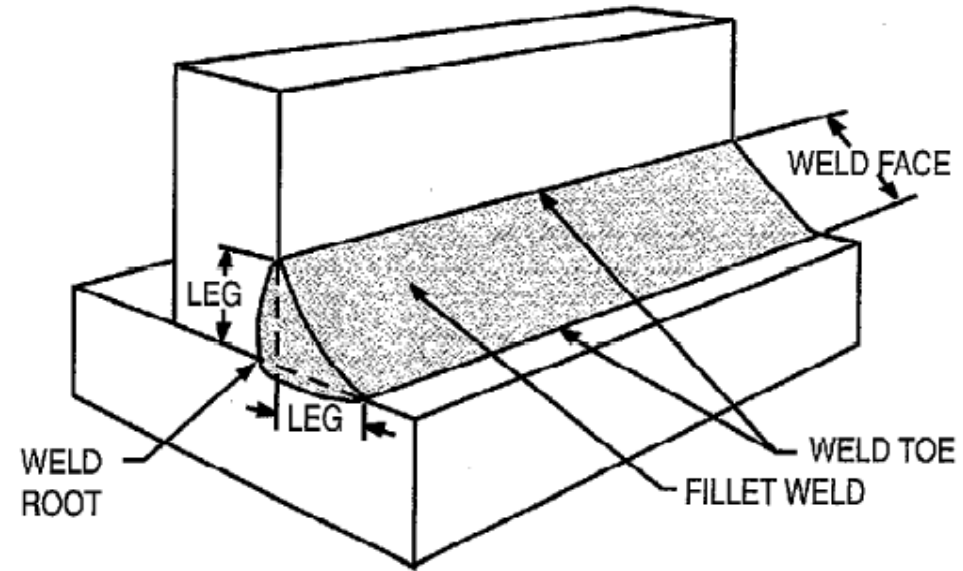


Figure 4.22—Completed Fillet Weld Terms



اصطلاحات مربوط به ذوب و نفوذ


FUSION AND PENETRATION TERMINOLOGY

در اثر حرارت ناشی از عملیات جوشکاری دیواره های پخ ذوب شده و تا اندازه ای فلز جوش در فلز پایه نفوذ میکند یعنی محدوده انتهایی ذوب عمیق تر از سطح اولیه شیار خواهد بود. در این شرایط مرز ایجاد شده بین فلز جوش و فلز پایه مرز جوش یا WELD INTERFACE گفته می شود. همچنین به فاصله عمودی میان مرز جوش و سطح اولیه شیار را عمق ذوب DEPTH OF FUSION میگویند.


این تعریف در مورد جوشهای نبشی و سطحی می باشد.

نفوذ اتصال به فاصله بین عمیق ترین قسمت جوش تا سطح فلز پایه و از آنجا که استحکام اتصال تابعی از نفوذ جوش می باشد. لذا به این فاصله سائز جوش می گویند.

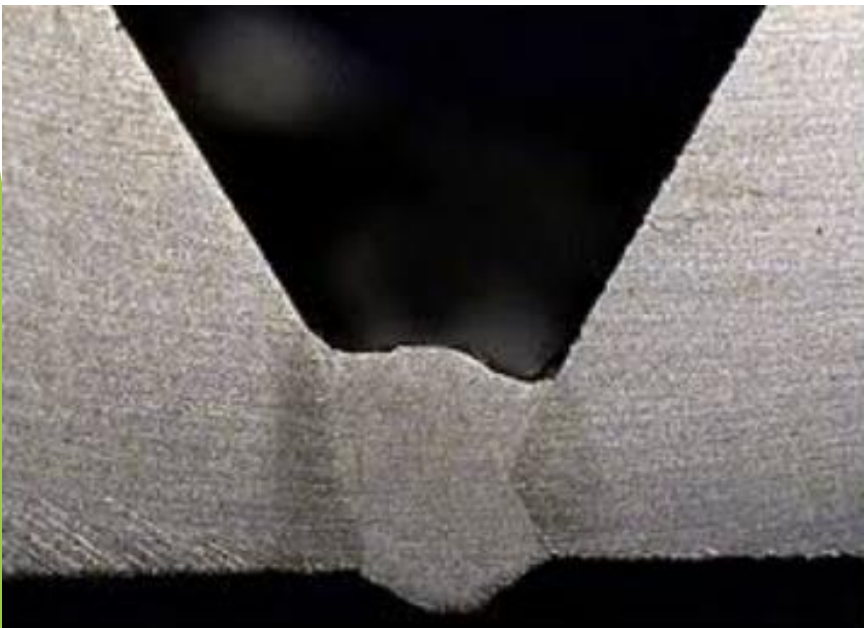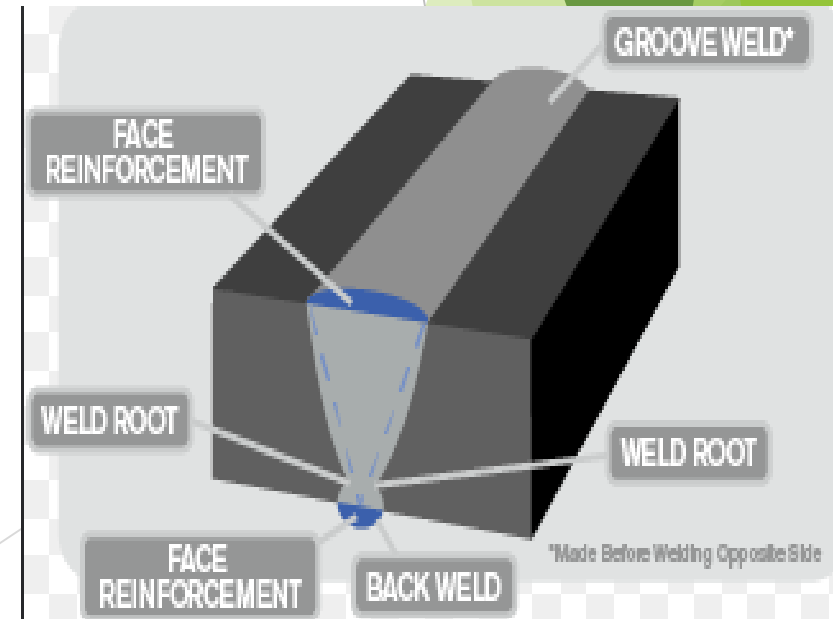


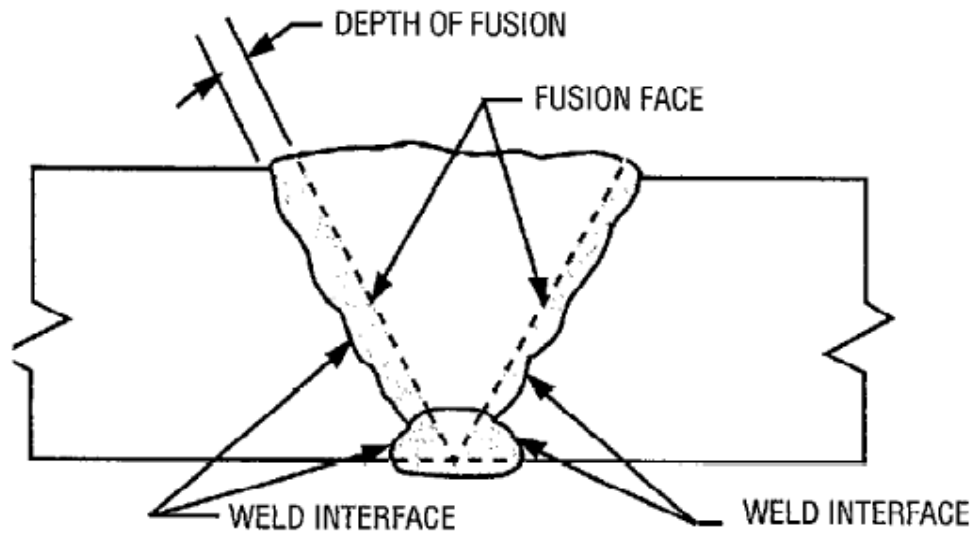

(A) Groove Weld

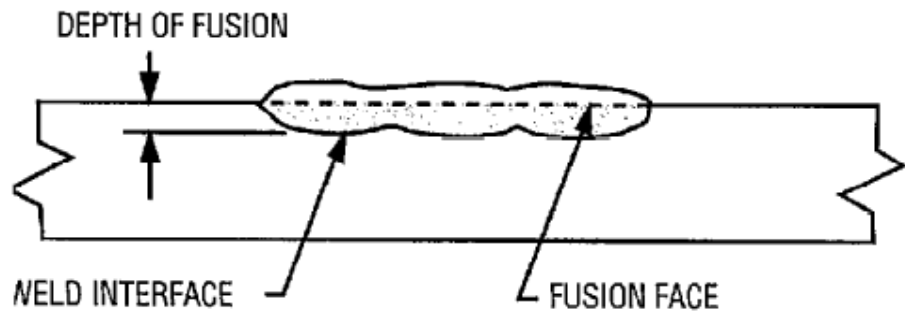

(B) Surfacing Weld

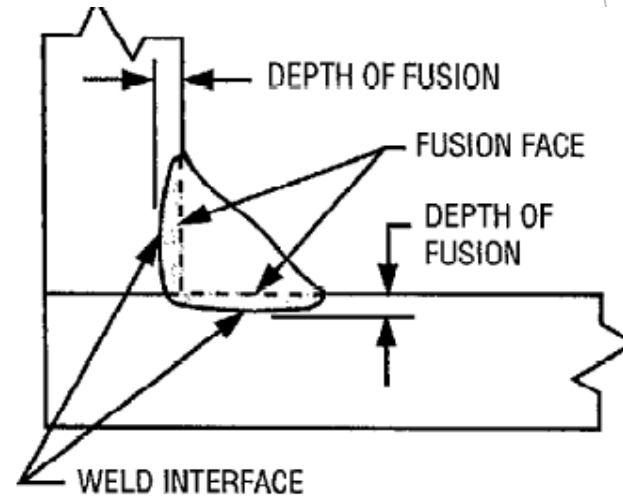

(C) Fillet Weld


Note: Fusion zones indicated by shading.

Figure 4.23—Fusion Terminology

اصطلاحات مربوط به سایز جوش


WELD SIZE TERMINOLOGY

- ▶ در جوش شیاری یک طرفه نفوذ اتصال همان سایز جوش می باشد اما در جوش های با نفوذ ناقص مجموع مقادیر نفوذ ها در هر دو طرف بیانگر سایز جوش می باش.
- ▶ در یک جوش شیاری با نفوذ کامل سایز جوش برابر است با ضخامت عضو نازکتر بدون در نظر گرفتن گرده جوش

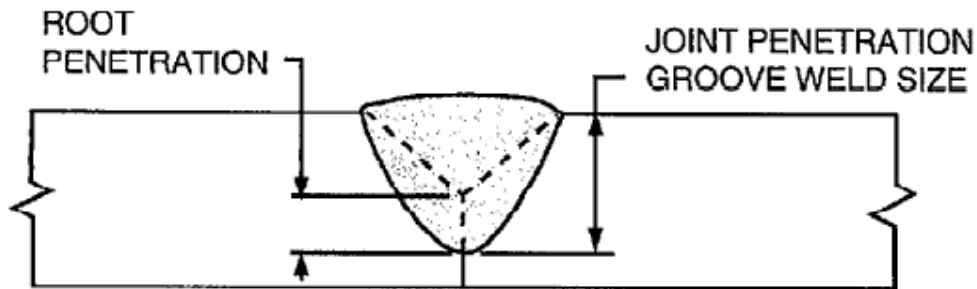


Incomplete Joint Penetration

Figure 4.24—Penetration Terminology

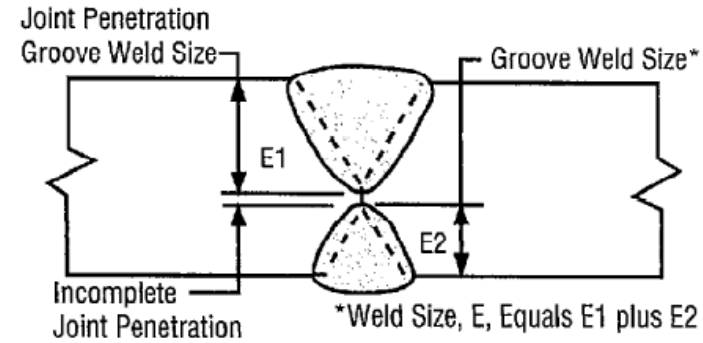

(A) Incomplete Joint Penetration

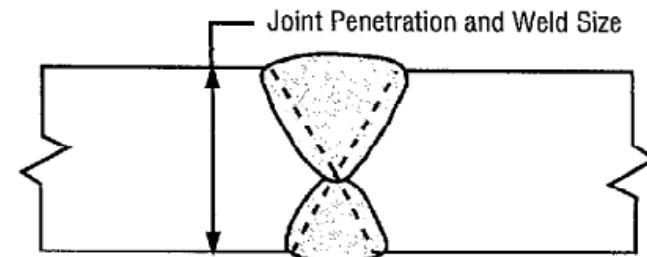

(B) Complete Joint Penetration

Figure 4.26—Penetration and Weld Size


WELD SIZE TERMINOLOGY

تخت


محدب

مقعر

- ▶ در یک جوش نبشی منظور از سایز جوش بزرگترین ساق مثلث متساوی الساقین که در مقطع جوش نبشی احاطه شده است.
- ▶ در جوش های نبشی محدب مقدار ساق جوش LEG و اندازه جوش SIZE با یکدیگر برابر هستند.
- ▶ در حالیکه در جوش های مقعر سایز کوچکتر از ساق جوش می باشد.

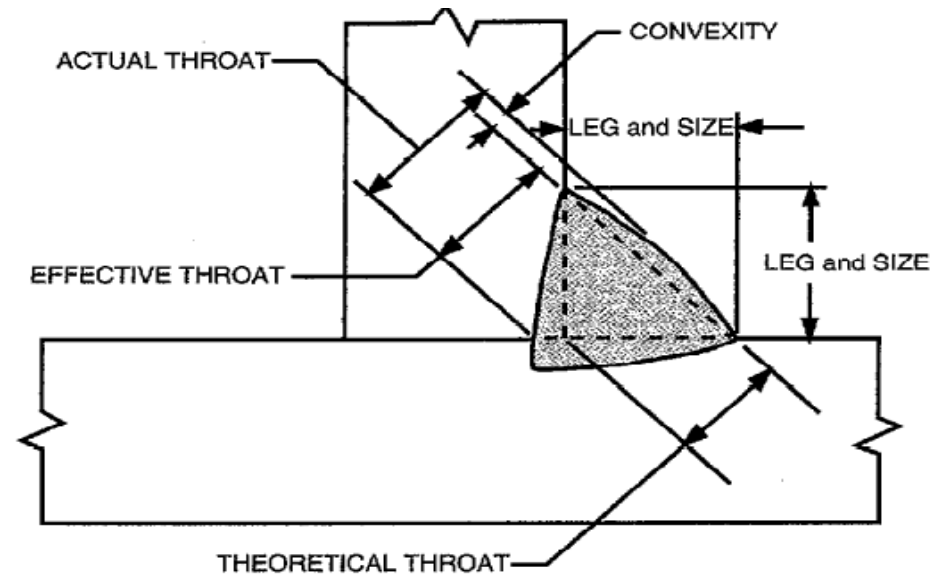

CONVEX FILLET WELD

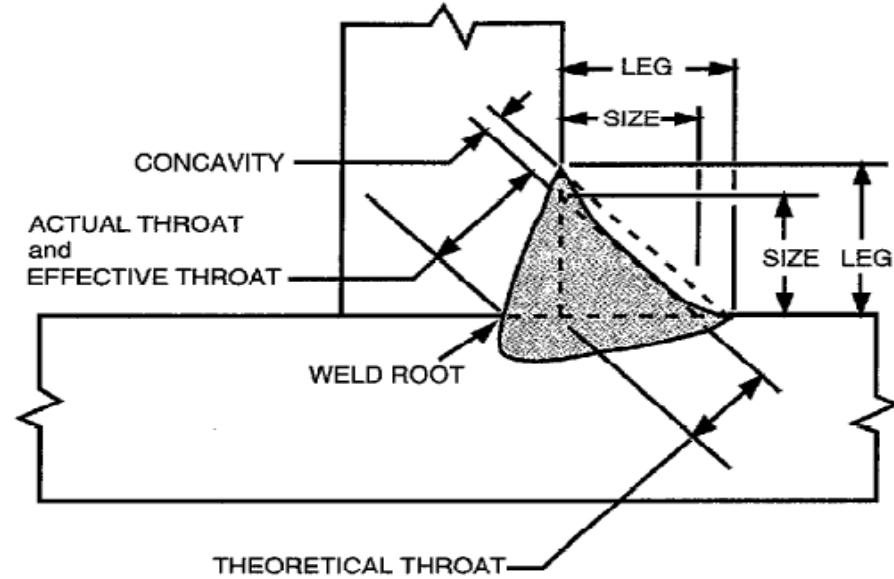


CONCAVE FILLET WELD

Figure 4.27—Fillet Weld Size


گلوپی در جوش گوشه THROAT

- ▶ گلوپی موثر کوتاهترین فاصله از ریشه جوش ROOT WELD تا سطح آن بدون در نظر گرفتن مقدار تحدب می باشد.
- ▶ گلوپی واقعی کوتاهترین فاصله از ریشه جوش تا سطح جوش بدون در نظر گرفتن تحدب می باشد.
- ▶ در جوش های مقعر مقدار گلوپی موثر و واقعی برابر می باشد. اما در حالیکه جوش های محدب گلوپی موثر کوچکتر از گلوپی واقعی می باشد.

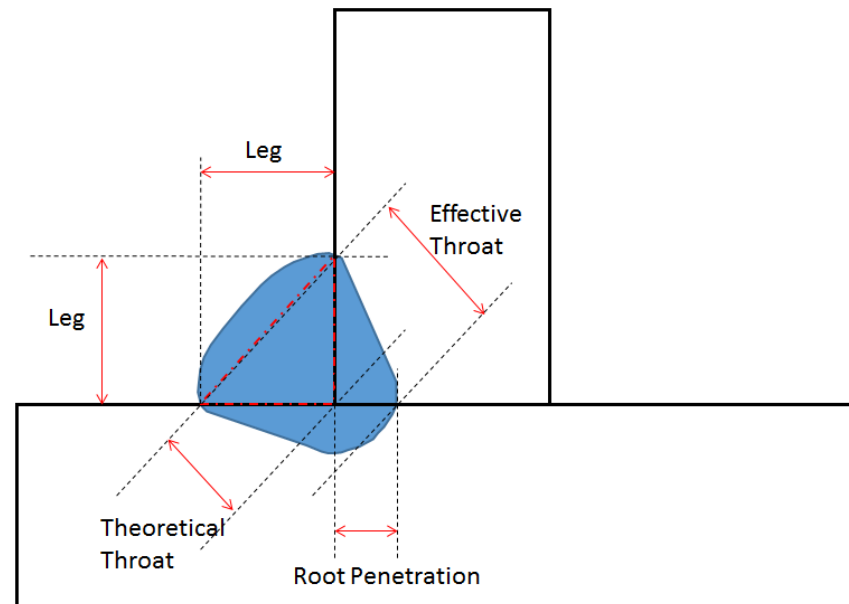

BOXING TECHNIQUE IN WELDING

چنانچه در جوش نبشی در قسمت جوش گوشه عضو، به منظور تقویت بیشتر ادامه می یابد به این تکنیک BOXING می گویند.

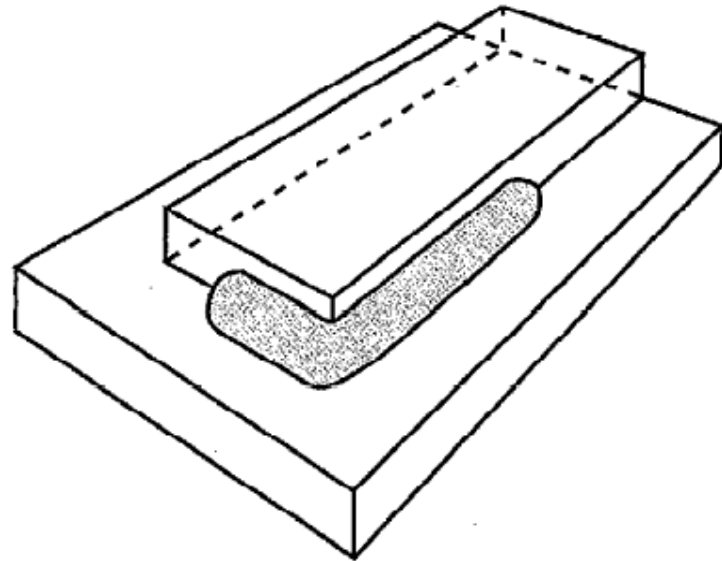


BOXING


Figure 4.34—Boxing Technique




تکنیک یک گام به عقب BACK STEP WELDING

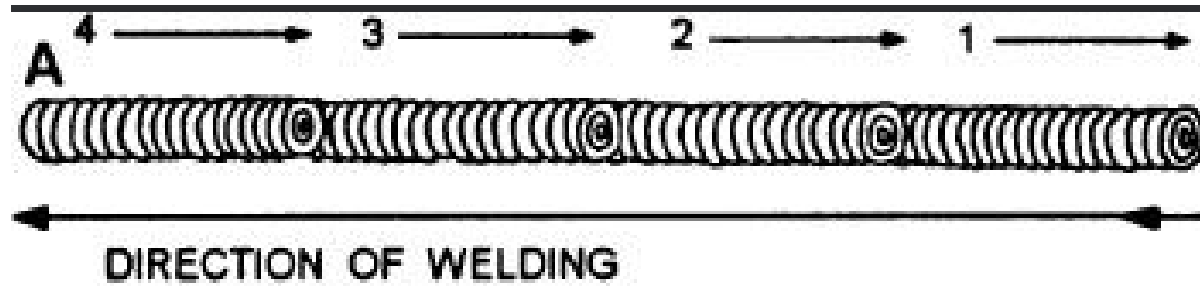

جهت پیشرفت هر پاس خلاف جهت جوشکاری می باشد.

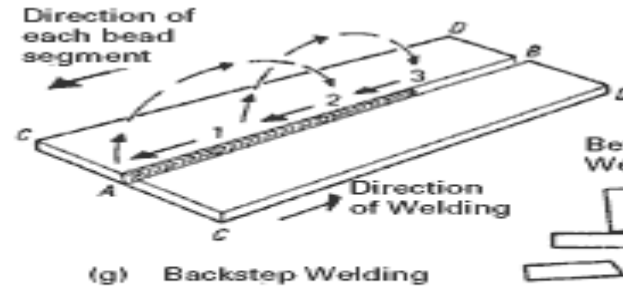

(g) Backstep Welding

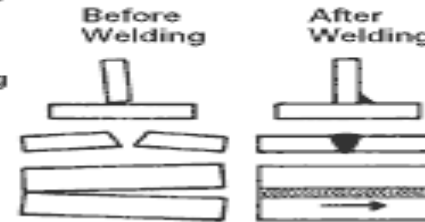

(h) Presetting Parts

تکنیک پله ای BLOCK SEQUENCE

ترکیبی از جوش طولی و پله ای در جوشهای چند پاسه.

به طوری که در قسمت های جداگانه به طور کامل و ناقص به شکل پله ای در مقطع قبل از پرکردن فواصل میان آنها جوشکاری میشوند.

در تکنیک پله ای هر جوش کوتاهتر از جوش قبلی می باشد.




تکنیک آبشاری CASCAD SEQUENCE IN WELDING

► در این تکنیک هر پاس جوش بلندتر از پاس قبلی می باشد. به طوریکه هر پاس ، پاس قبلی را مدفون میکند





WELDING SYMBOL

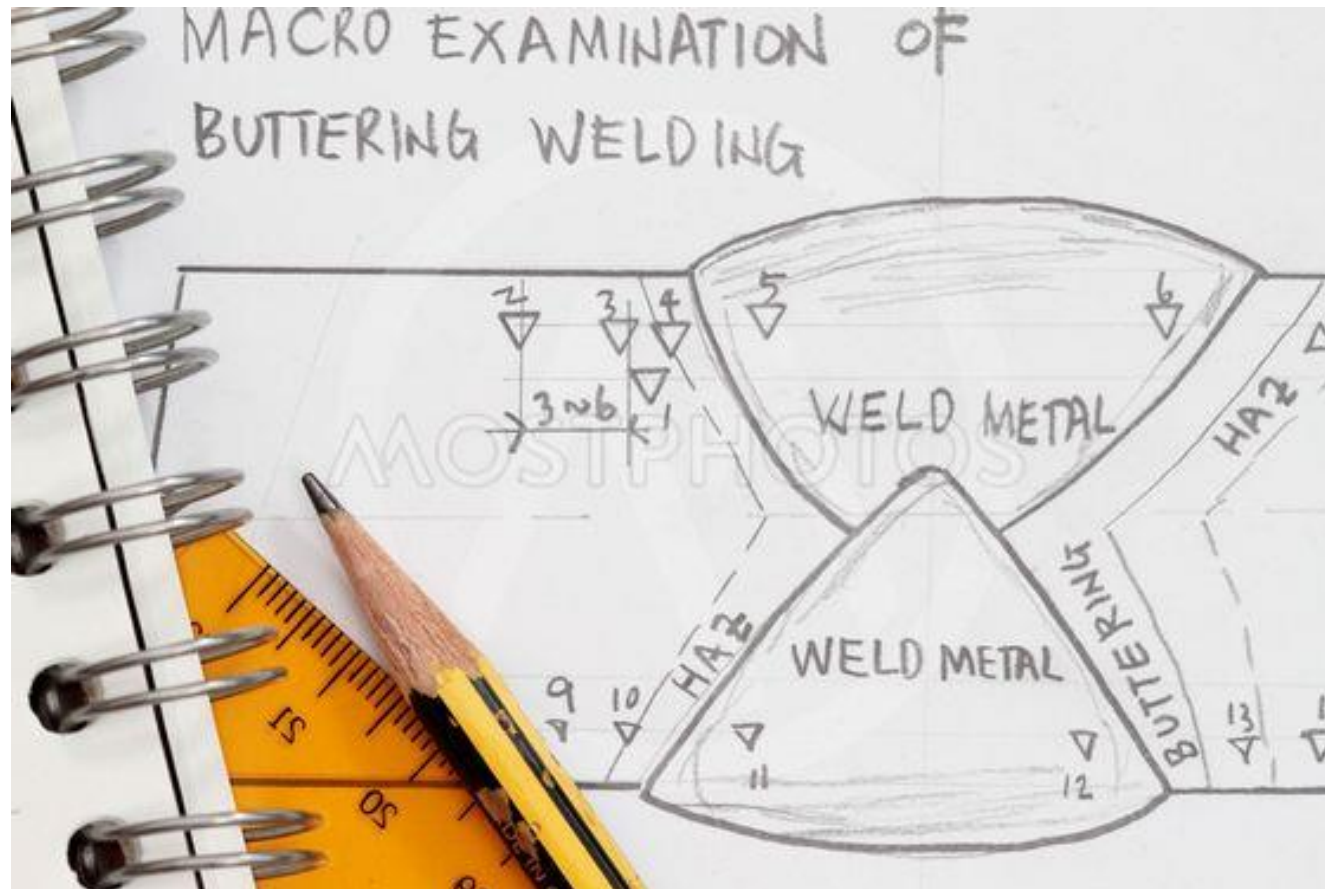


DIFFERENCE BETWEEN WELD SYMBOL AND WELDING SYMBOL

GROOVE							
SQUARE	SCARF	V	BEVEL	U	J	FLARE-V	FLARE BEVEL
FILLET	PLUG OR SLOT	STUD	SPOT OR PROJECTION	SEAM	BACK OR BACKING	SURFACING	EDGE



WELDING SYMBOL

Location of Elements of a Welding Symbol

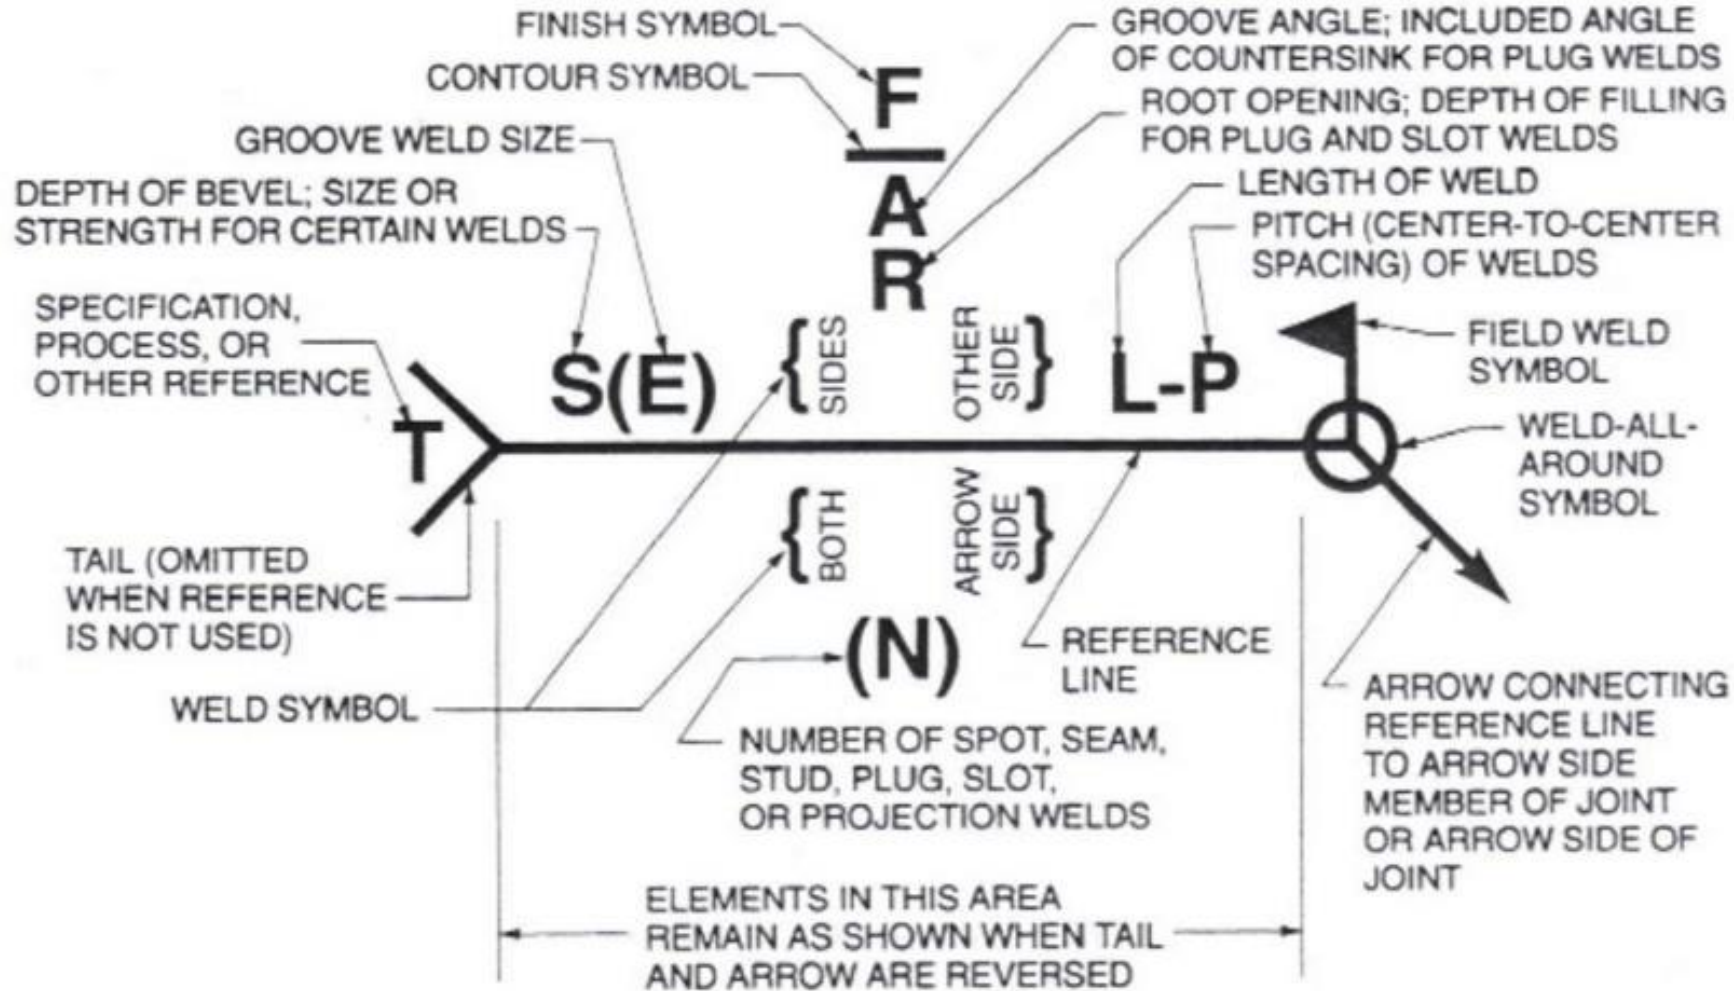



WELDING SYMBOL

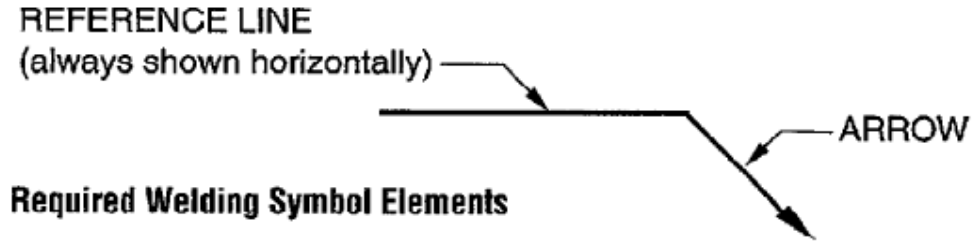


Figure 4.37—Reference Line and Arrow

به جز خط مرجع و فلش که ضروری می باشد بقیه موارد اختیاری است: ▶

خط مرجع REFERENCE LINE (a)

فلش ARROW (b)

دم TAIL (c)

علائم پایه ای جوش BASIC WELD SYMBOL (d)

ابعاد و سایر اطلاعات (e)


علائم مکمل جوش SUPPLEMENTARY SYMBOL (f)

علائم پایانی FINISH SYMBOLS (g)




WELDING SYMBOL

- ▶ خط مرجع همیشه به صورت افقی رسم شده است و علائم جوش به آن اضافه میگردد.
- ▶ طرف پایین خط مرجع بیانگر طرف فلش شده است ARROW SIDE
- ▶ سمت بالای خط مرجع بیانگر طرف دیگر OTHER SIDE
- ▶ تغییر در جهت فلش تغییری در موضوع فوق ایجاد نمیکند.
- ▶ میتوان از چند خط مرجع استفاده کرد.

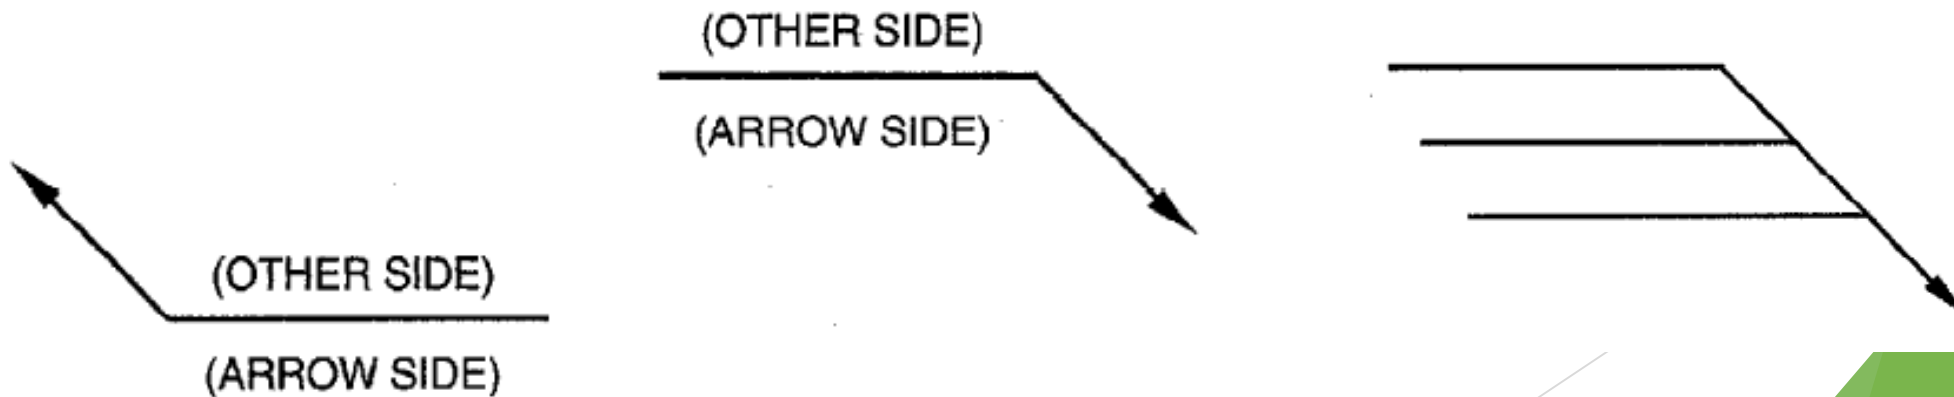


WELDING SYMBOL

- ▶ فلش خط مرجع را به محل اتصال مربوط می سازد. ممکن است با یا بدون شکستگی باشد.
- ▶ زمانیکه فلش با شکستگی همراه باشد همیشه به سمت عضوی می باشد که باید آماده باشد.
- ▶ گاهی به منظور نشان دادن جوش در محل های مختلف از فلش های چندگانه استفاده می گردد.

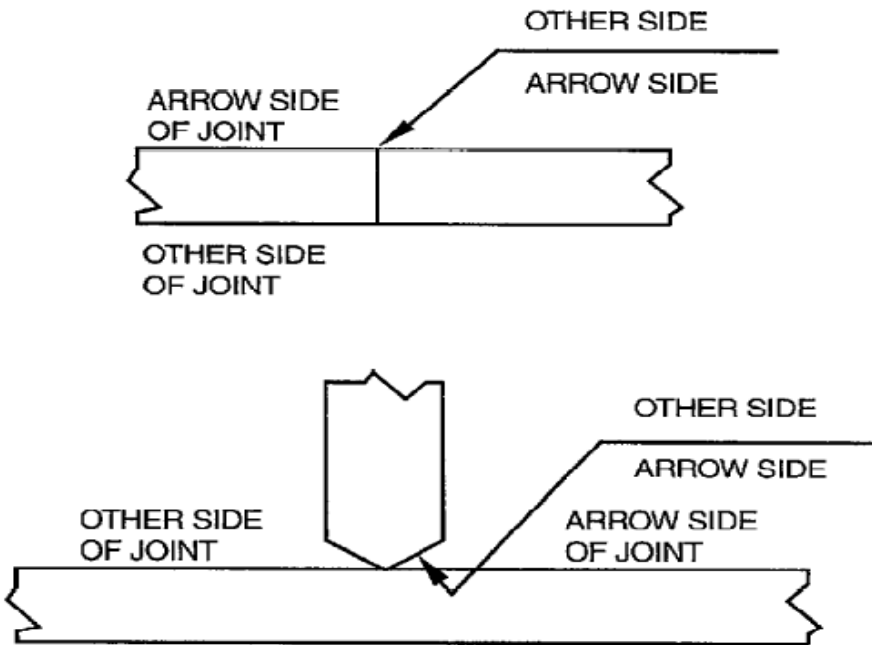

Note: Break in the arrow pointing to member to be prepared.

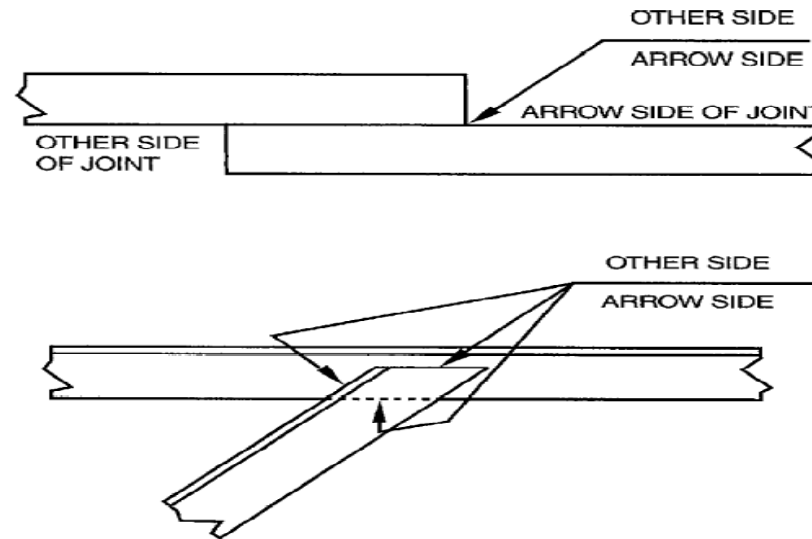

Note: Multiple arrows pointing to areas to be welded.

Figure 4.42—Placement and Location Significance of Arrow



WELDING SYMBOL - TAIL

کلیه اطلاعات اضافی از قبیل فرایند برشکاری یا جوشکاری یا مشخصات جوشکاری قسمت دم می آید.

در صورت عدم نیاز به درج اطلاعات فوق دم حذف می گردد.

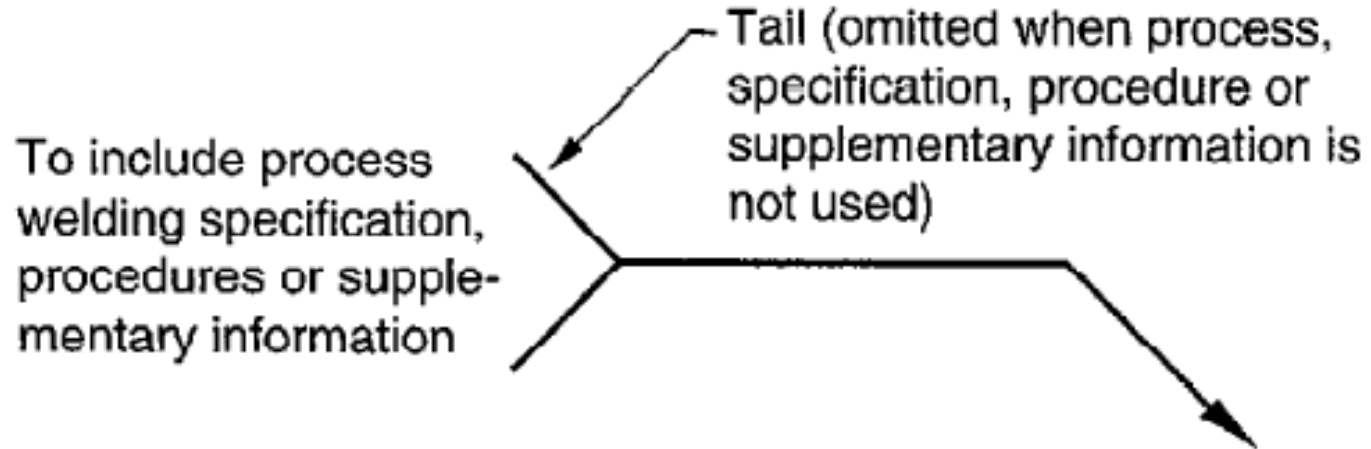

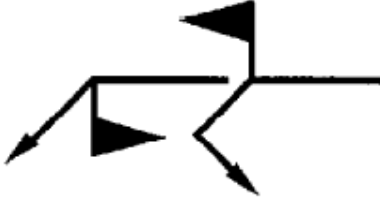

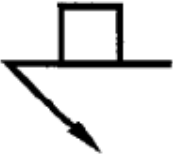
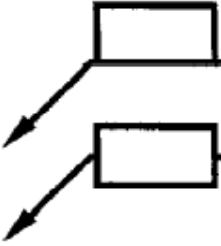





Figure 4.43—Conventions for use of a Tail

SUPPLEMENTARY SYMBOLS علائم مکمل

علائم مکمل اغلب با علائم اصلی جوش همراه شده و اندازه نفوذ جوش ، ظاهر جوش و نحوه آماده سازی سطوح و محل اجرای جوشکاری

WELD-ALL AROUND	FIELD WELD	MELT THROUGH	CONSUMABLE INSERT (SQUARE)	BACKING OR SPACER (RECTANGLE)	CONTOUR		
					FLUSH OR FLAT	CONVEX	CONCAVE
							



روش های پرداخت کاری FINISHING METHOD

علائمی که بیاگر سطح جوش می باشد.

این علائم زمانیکه سطح تخت محدب مقعر مد نظر می باشد استفاده میگردد.

معمولا به منظور تعیین روش پرداخت سطوح از علائم خاص استفاده میگردد.


زمانیکه حرف U نوشته میشود یعنی پرداخت سطوح نیاز می باشد اما روش آن مشخص نمی باشد.

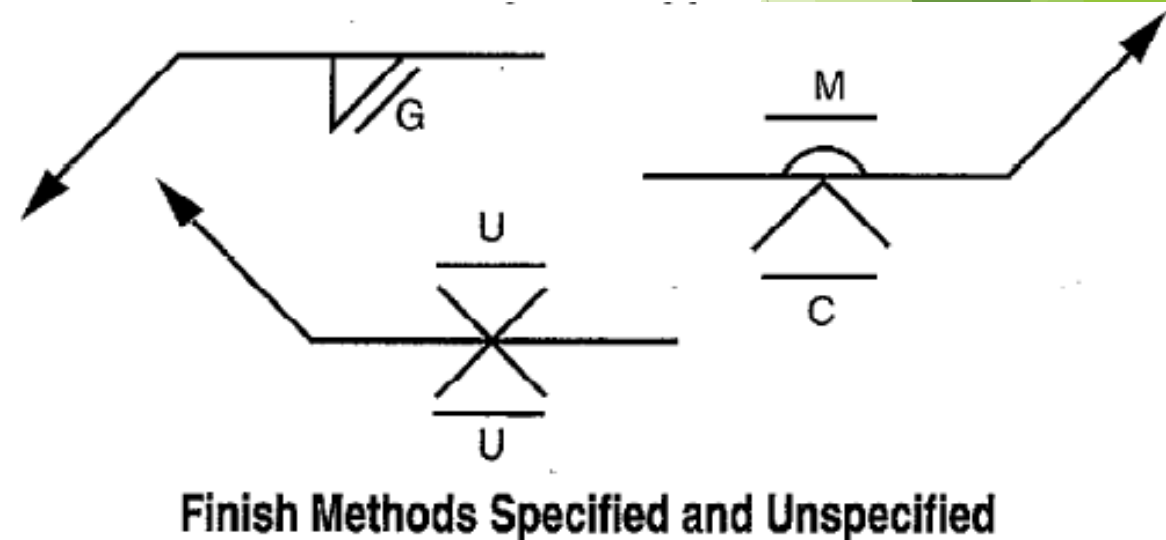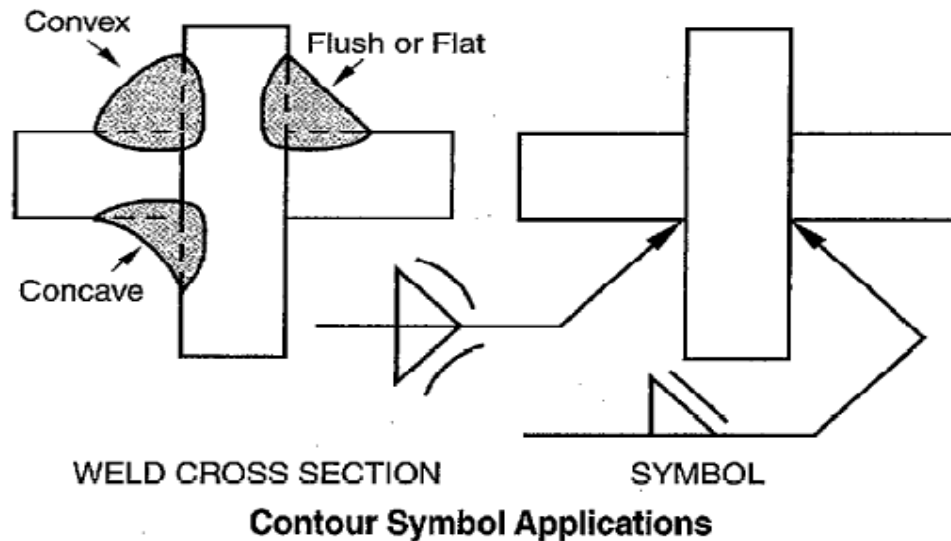

FIELD WELD SYMBOL

▶ جوش های محل نصب ، جوش هایی می باشند که نباید در محل مونتاژ و یا ساخت اولیه اجرا شوند. علامت مشخص کننده این دسته از جوش ها یک پرچم سیاه می باشد و

▶ این پرچم سیاه به صورت عمودی در محل تلاقی خط مرجع و فلش قرار گرفته و ممکن است پایین و یا بالای خط مرجع قرار گیرد.

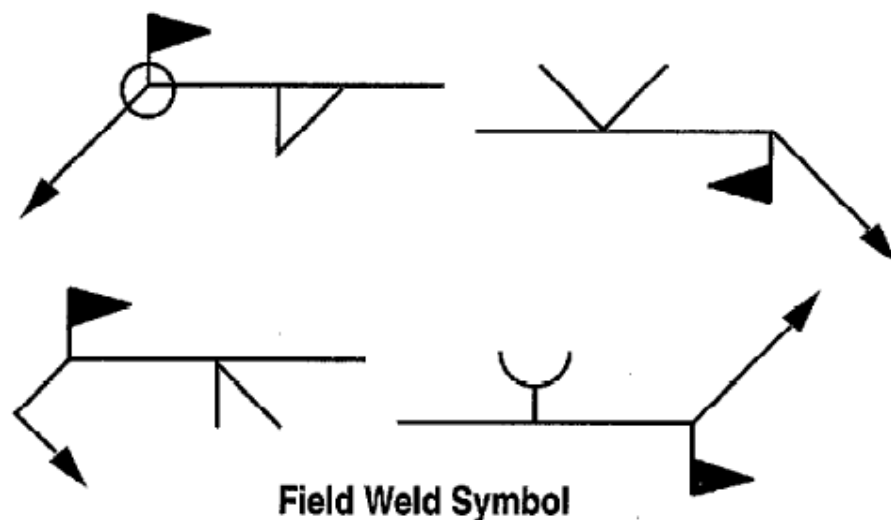

**Figure 4.53—Contour, Finish,
and Field Weld Symbols**



علائم عبور ذوب FIELD WELD SYMBOLS

- ▶ علامت عبور ذوب فقط جهت اتصالات جوشکاری شده از یک طرف با نفوذ کامل جوش قابل رویت باشد.
- ▶ این علامت در جهتی مقابل علامت روی خط مرجع قرار میگیرد.
- ▶ میزان ارتفاع نفوذ جوش با استفاده از یک عدد در سمت چپ علامت عبور ذوب مشخص می گردد.



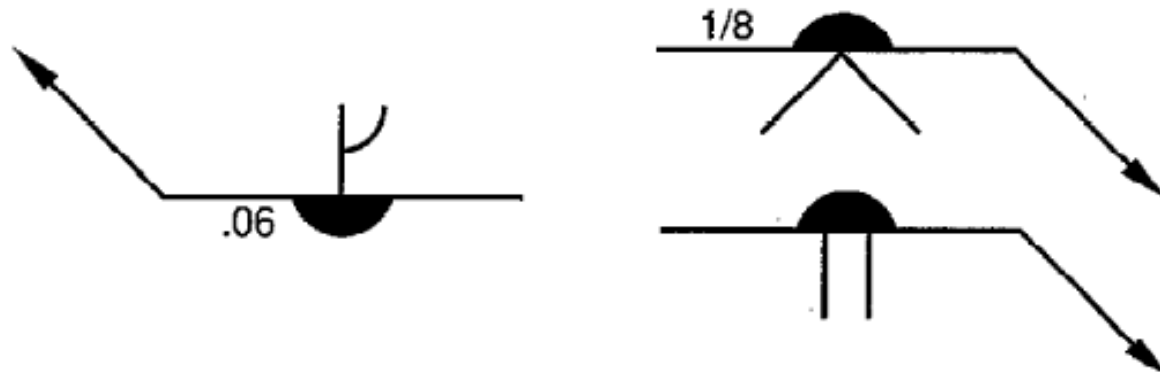


Figure 4.54—Melt-Through Symbol Use

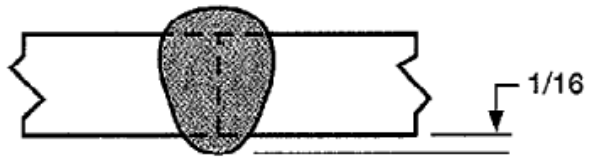


WELD CROSS SECTION

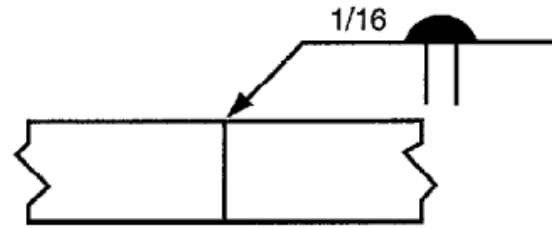


SYMBOL

(A) SQUARE-GROOVE WELD

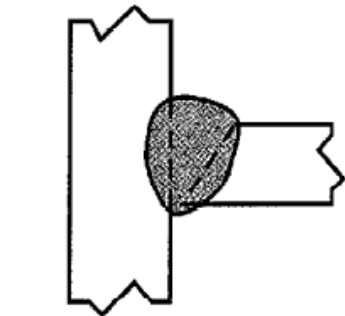

WELD CROSS SECTION

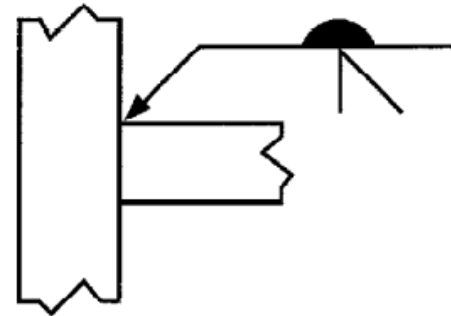


SYMBOL

(B) SINGLE-BEVEL-GROOVE WELD




WELD CROSS SECTION

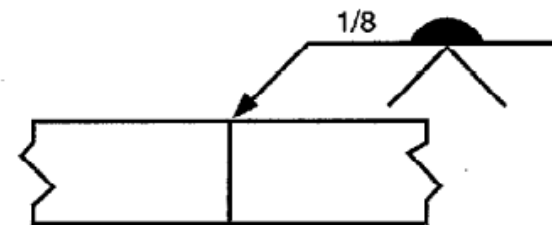


SYMBOL

(C) SINGLE-V-GROOVE WELD

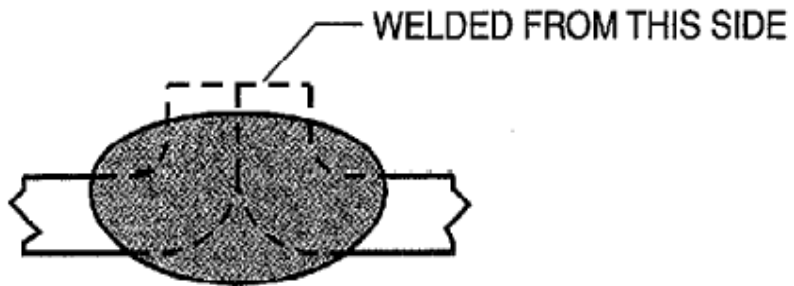


WELD CROSS SECTION

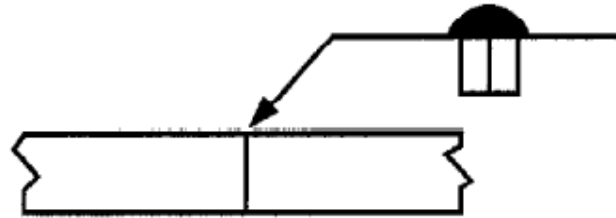


SYMBOL


(D) EDGE WELD

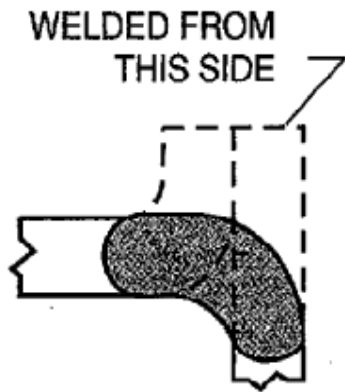

WELD CROSS SECTION

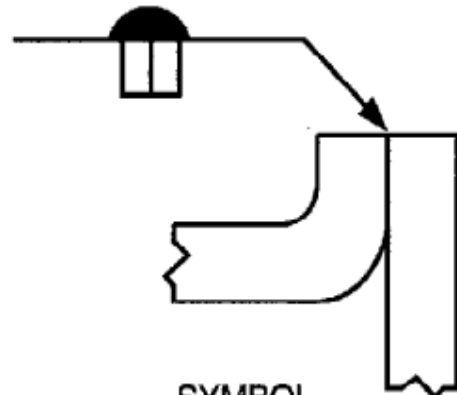

SYMBOL
JOINT DETAILED

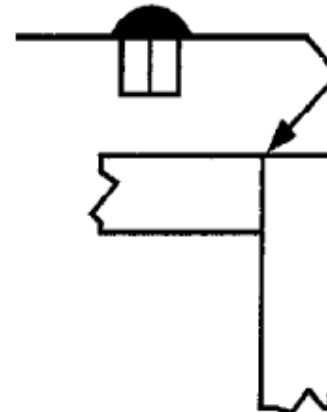

SYMBOL
JOINT NOT DETAILED

(E) EDGE WELD

علامت اجرای جوشکاری دور تا دور WELD AROUND SYMBOL

- ▶ زمانیکه اجرای جوشکاری در دور تا دور محل اتصال مورد نیاز می باشد از این علائم استفاده می گردد.
- ▶ علامت اجرای جوشکاری دور تا دور با یک دایره در محل تلاقی خط مرجع با فلش مشخص می گردد.



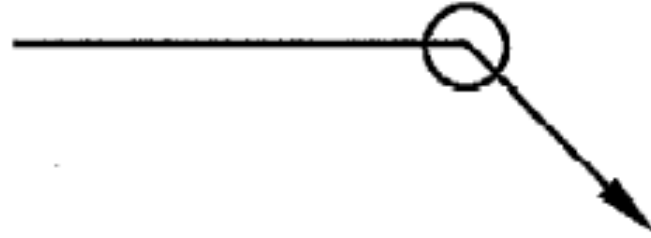


Figure 4.59—Weld-All-Around Symbol




FILLET WELDS

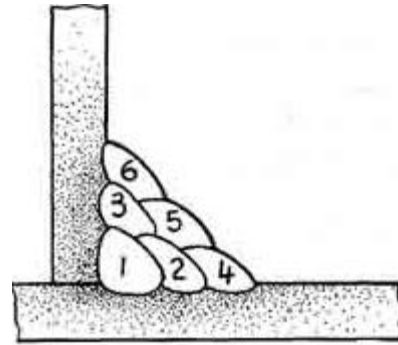


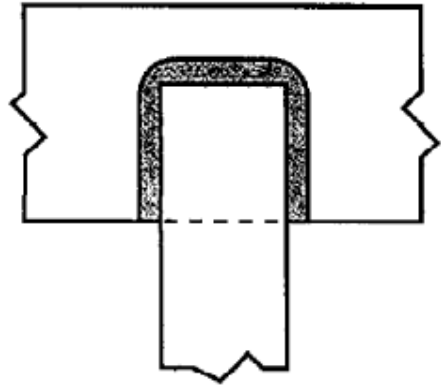


WELDS

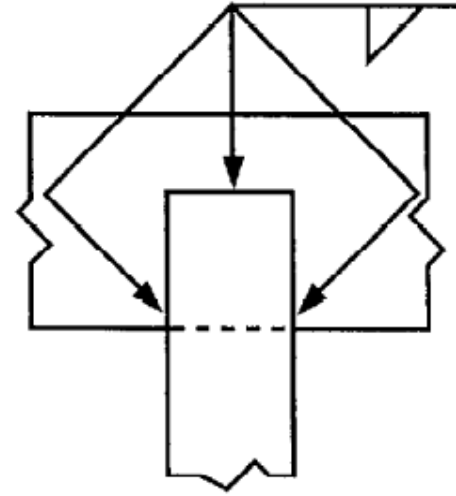


SYMBOLS

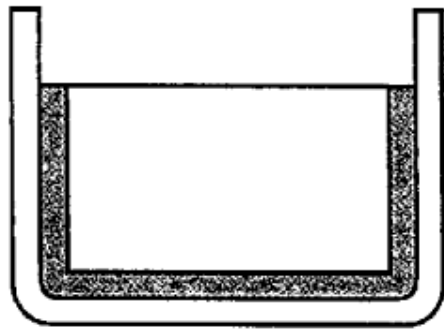


WELDS

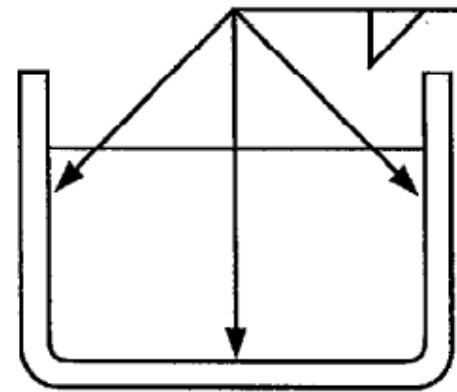

SYMBOLS

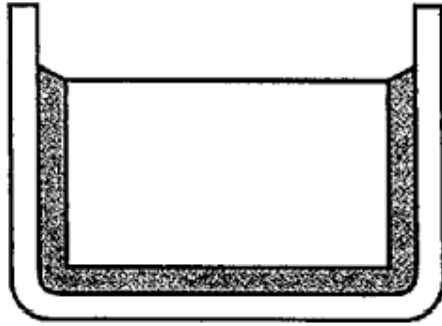


WELDS


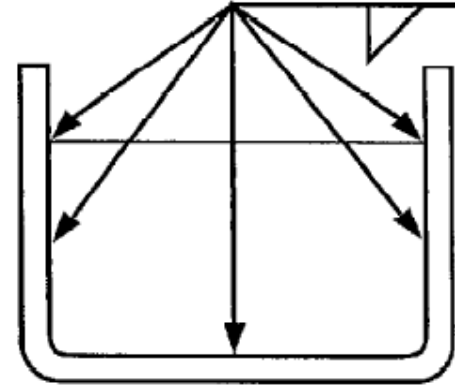


SYMBOLS


(A) WELDS WITH ABRUPT CHANGES IN DIRECTION

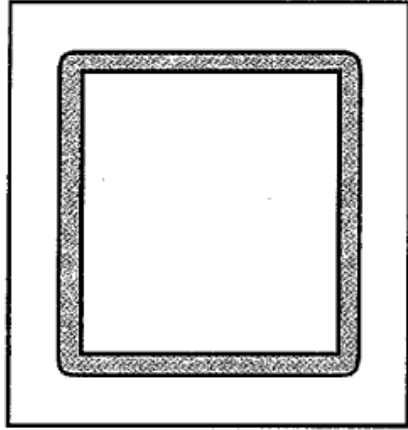


WELDS

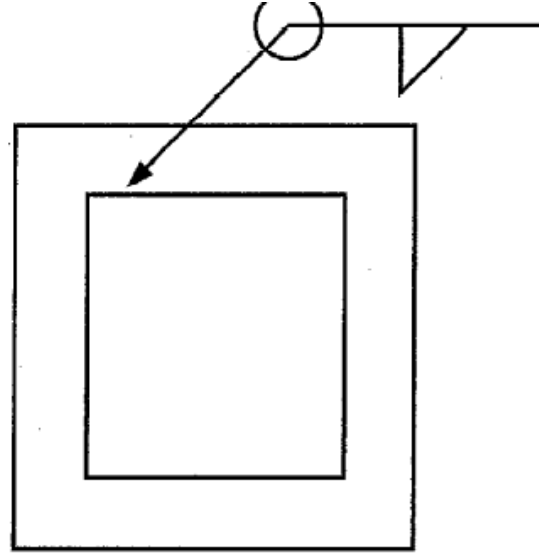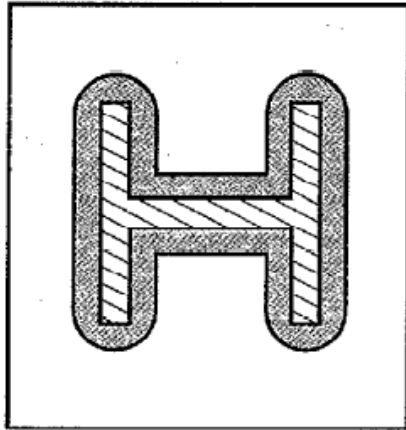


SYMBOL

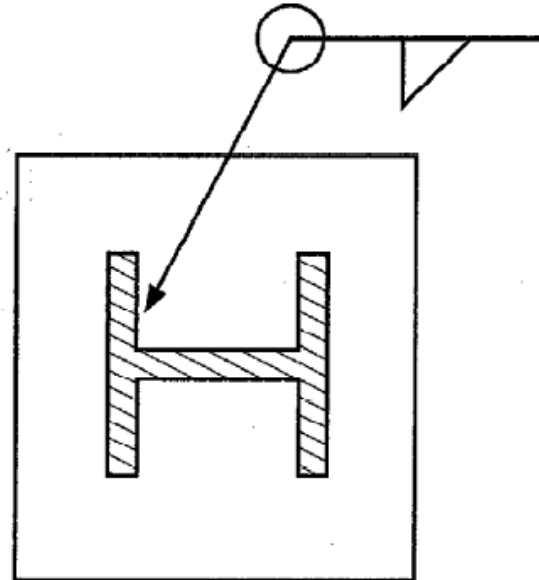


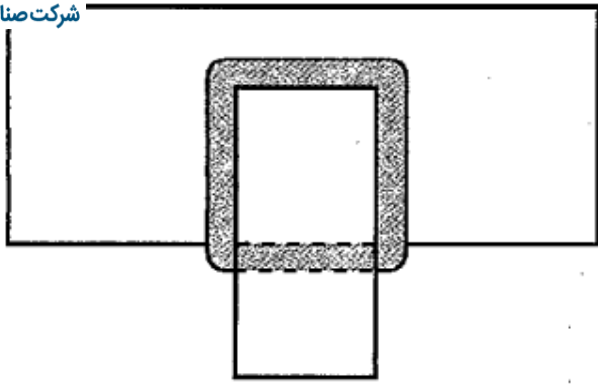

WELDS

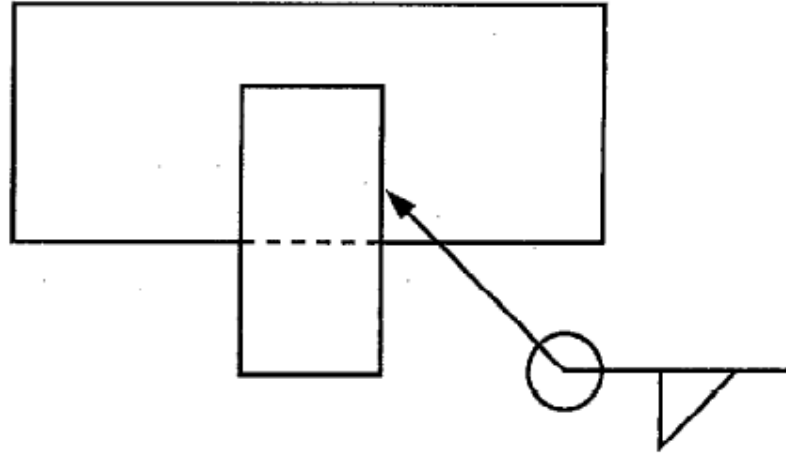

SYMBOL

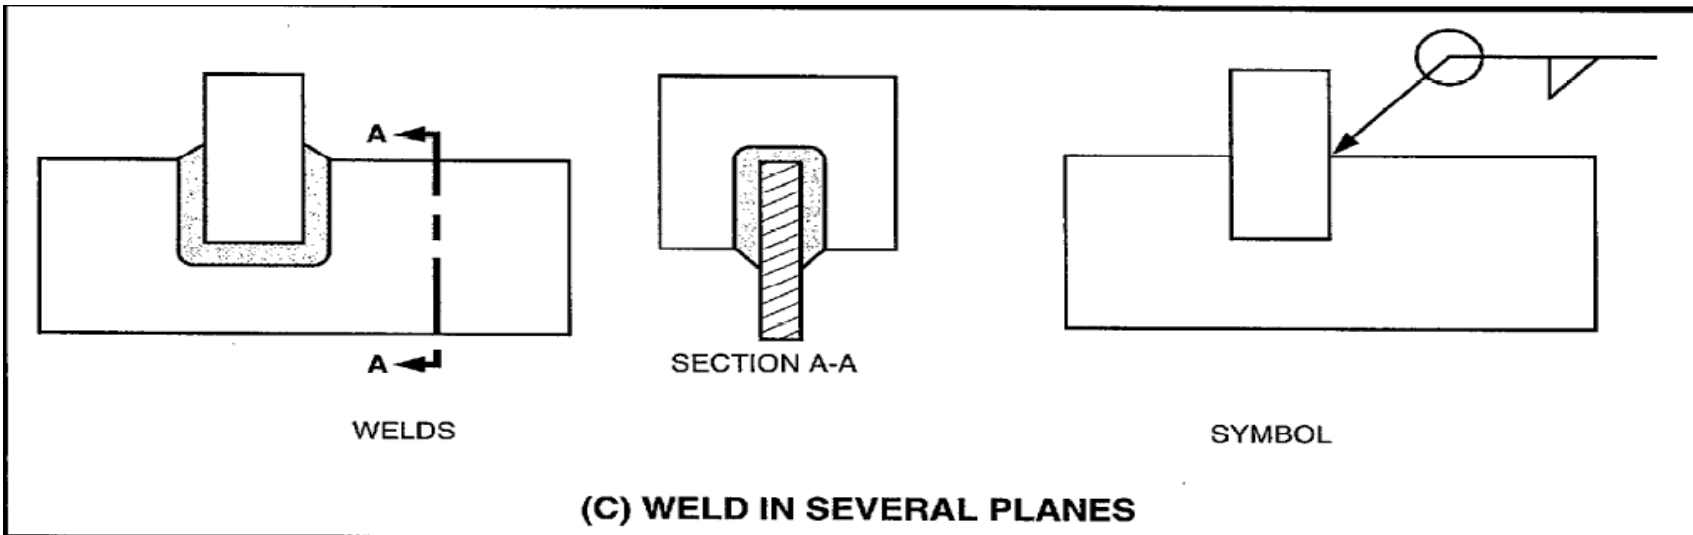


WELDS


SECTION A-A

SYMBOL

(C) WELD IN SEVERAL PLANES


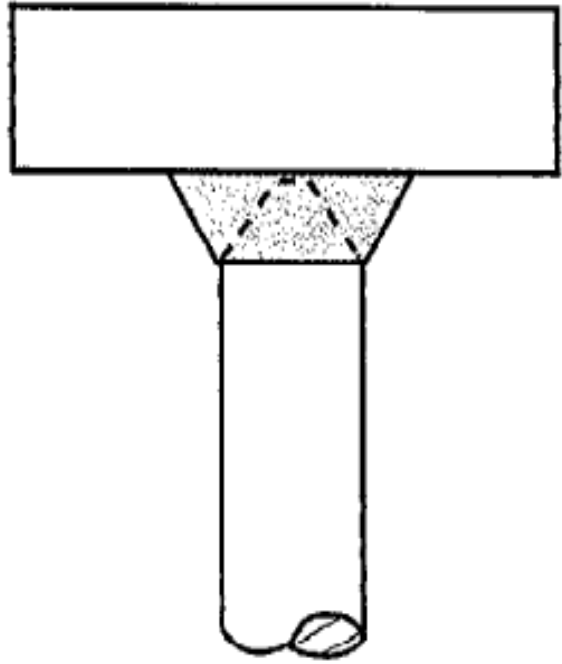


WELD

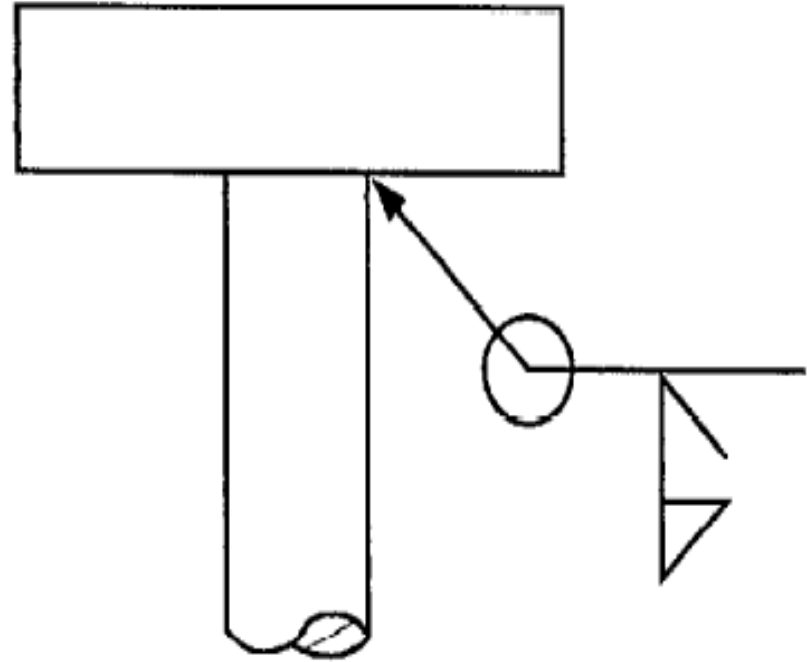


SYMBOL

(D) WELD AROUND A SHAFT

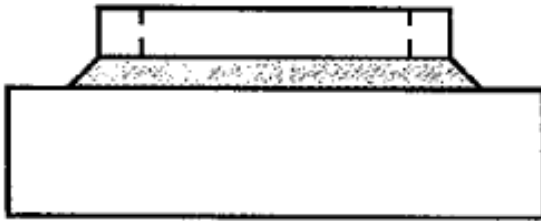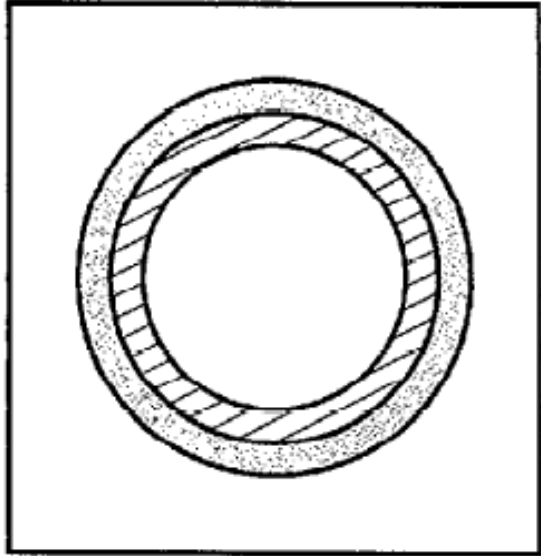

WELD

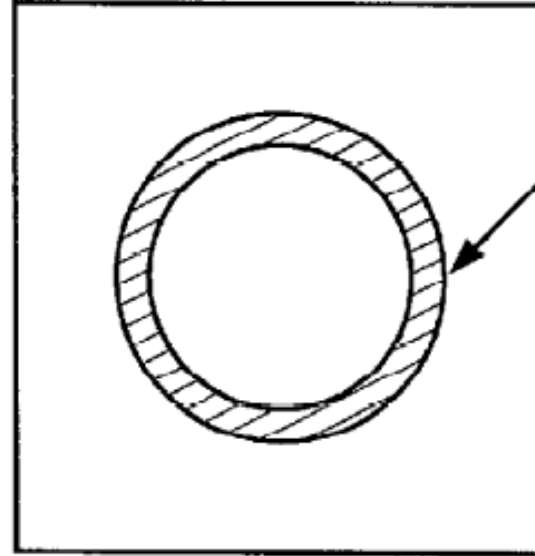

1/8

SEAL
WELD

SYMBOL

(E) SEAL WELD

FILLET WELDS

▶ جوش های نبشی بر مبنای سایز - اندازه ساق - طول و فضای خالی میان ۲ جوش اندازه گذاری میشوند.

▶ مورد فوق زمانیکه در نقشه ها نیامده باشد میتواند مورد اشاره قرار گرفته باشد.

▶ سایز جوش های نبشی با استفاده از یک عدد در سمت چپ علامت جوش قرار میگیرد نمایش داده میشود.

▶ طول جوش های نبشی با استفاده از یک عدد در سمت راست علامت جوش تعیین میگردد. این عدد اگر جوش در کل اتصال اجرا گردد عددی در این محل قید نمیگردد.

▶ زمانیکه به جوش منقطع نیاز باشد فاصله مرکز دو جوش PITCH DIMENSION با ذکر یک عدد در سمت راست طول به همراه یک خط تیره میان آن دو معین می گردد.

FILLET WELDS

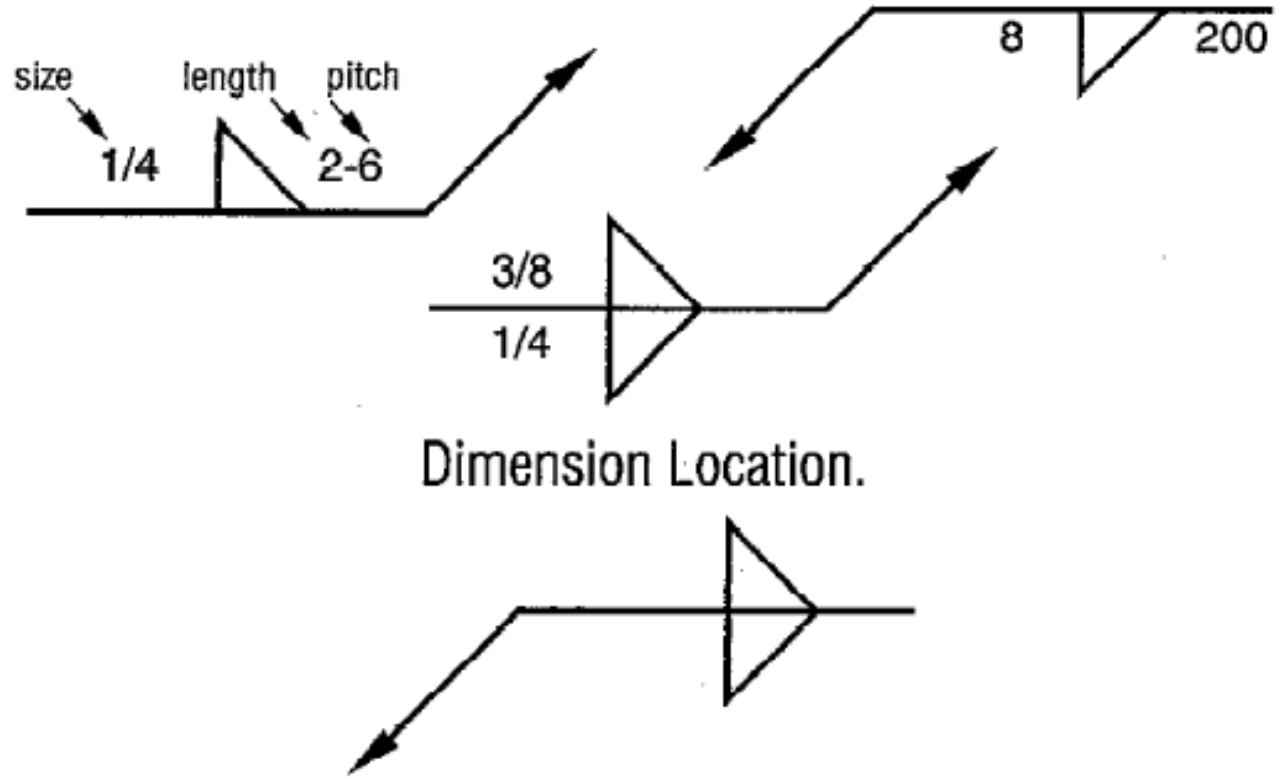


Figure 4.63—Fillet Weld Dimensions



FILLET WELDS

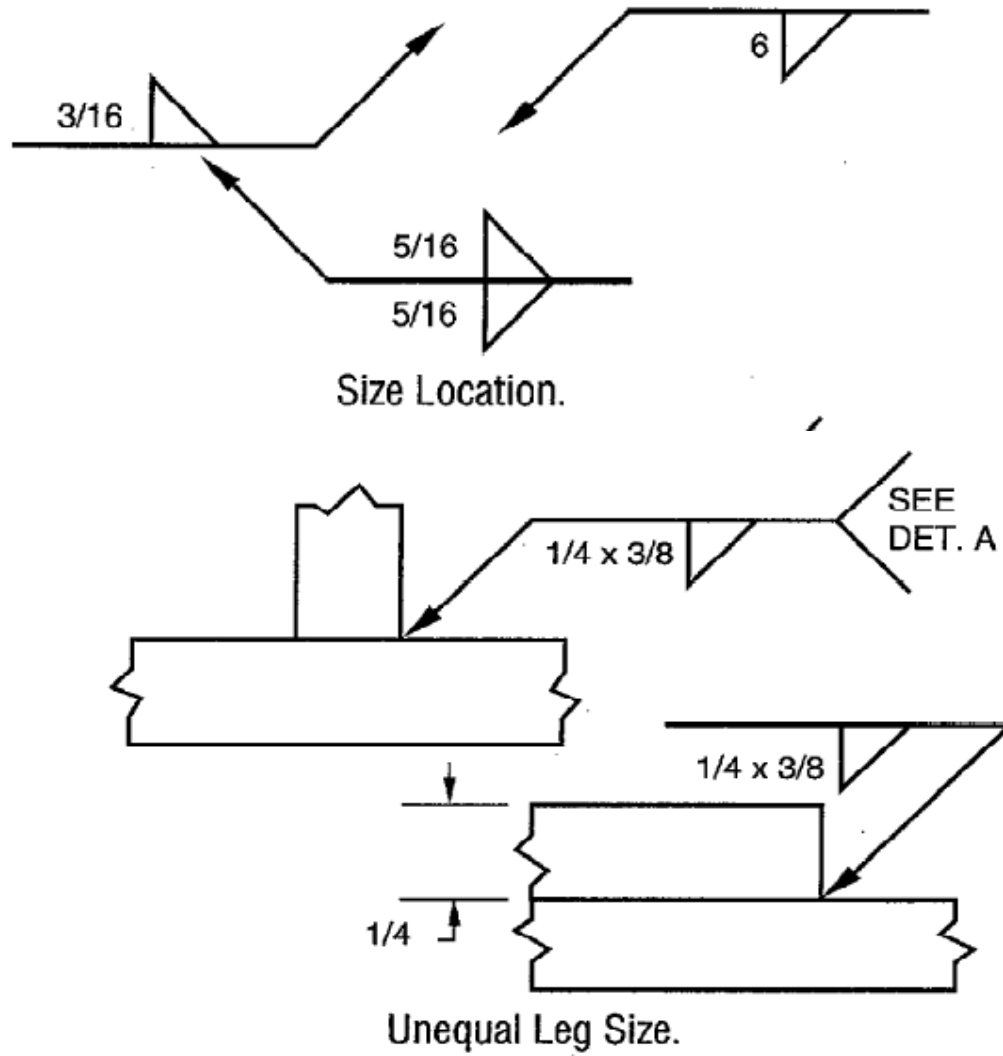


Figure 4.64—Size—Unequal Leg Fillet Welds



FILLET WELDS

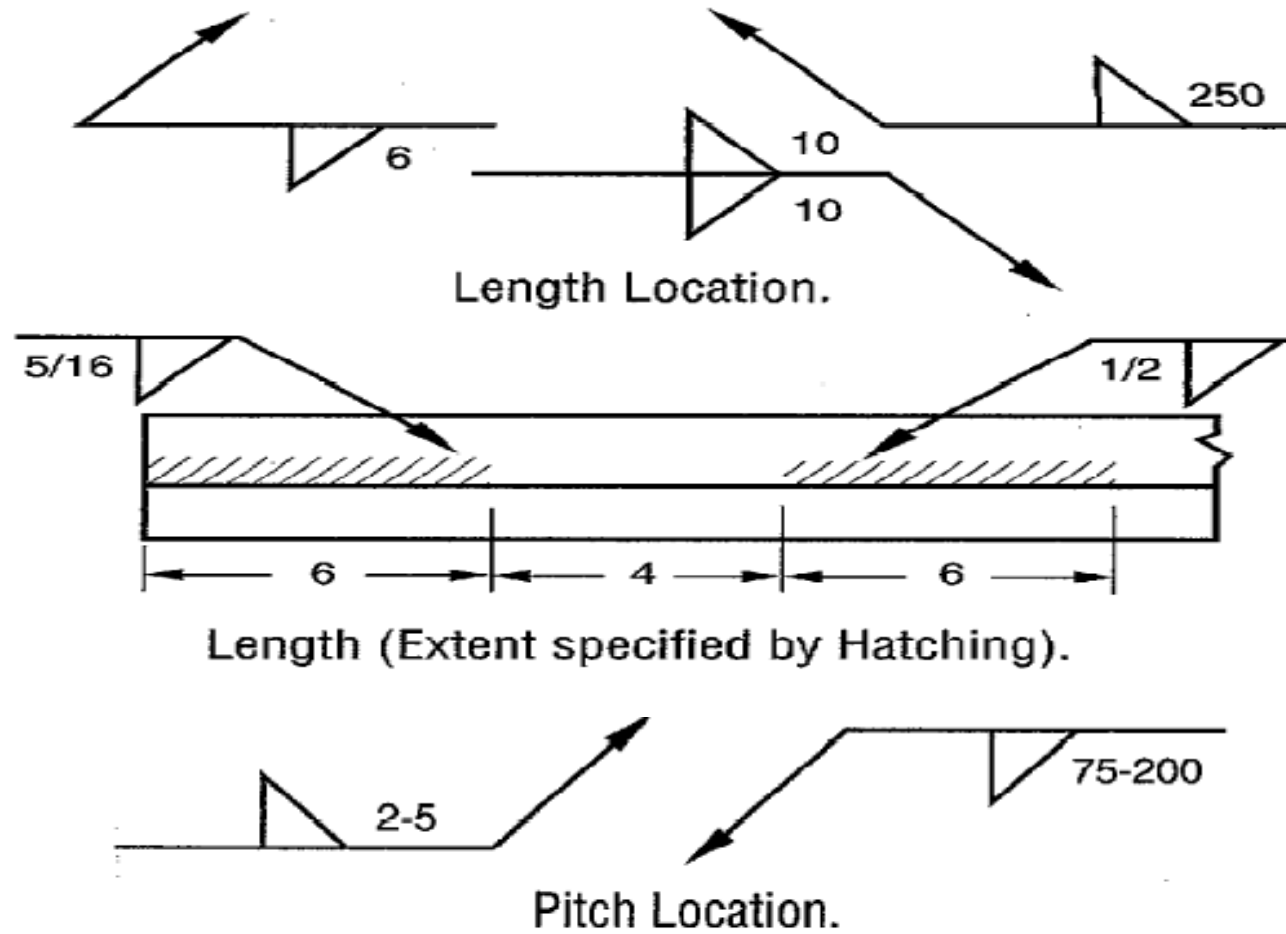


Figure 4.65—Length, Pitch Fillet Welds



FILLET WELDS



Figure 4.65—Length, Pitch Fillet Welds



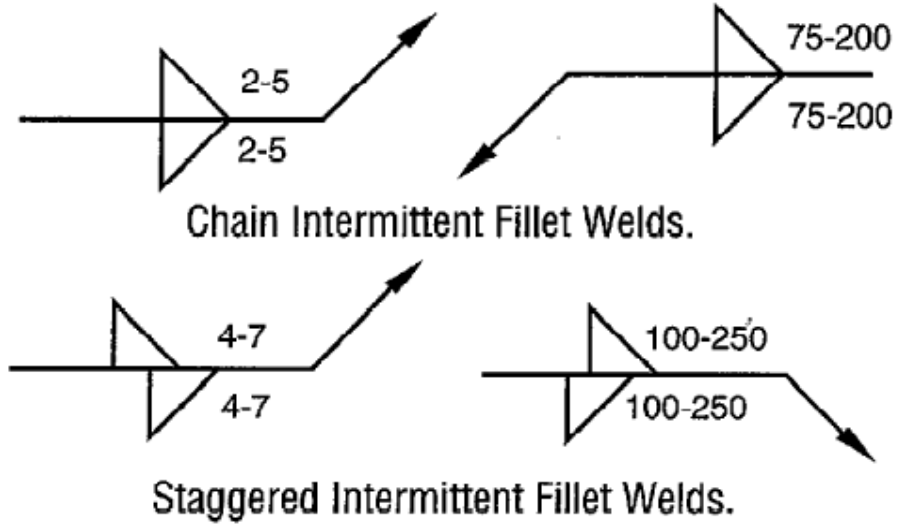


Figure 4.66—Intermittent Fillet Welds

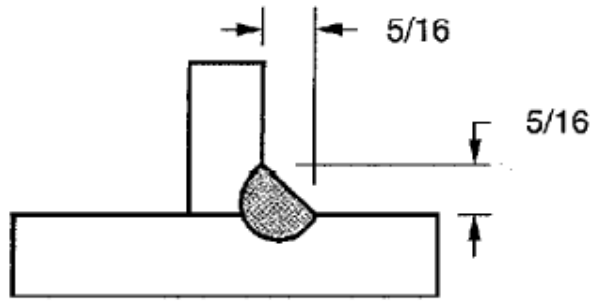


WELD CROSS SECTION

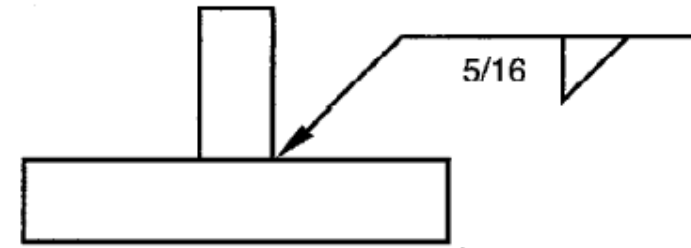


SYMBOL

(A) SIZE OF SINGLE-FILLET WELD

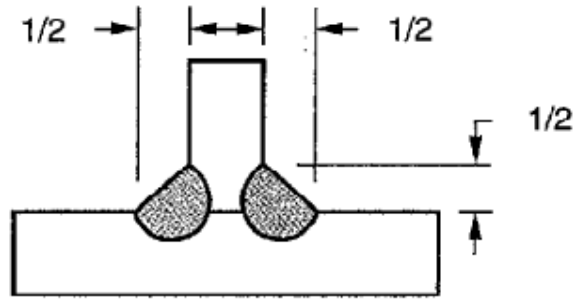


WELD CROSS SECTION

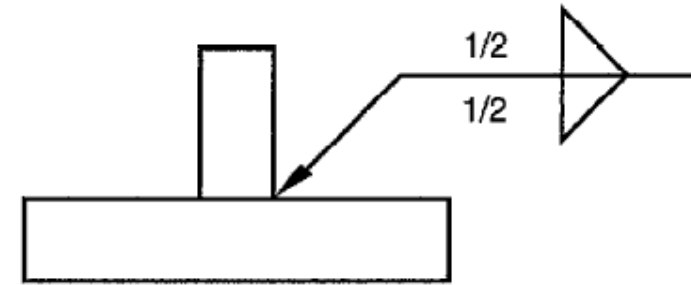


SYMBOL

(B) SIZE OF EQUAL DOUBLE-FILLET WELDS

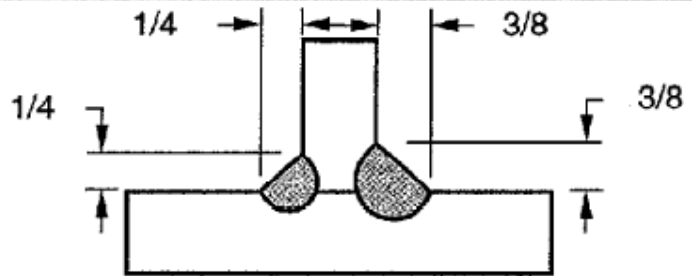


WELD CROSS SECTION

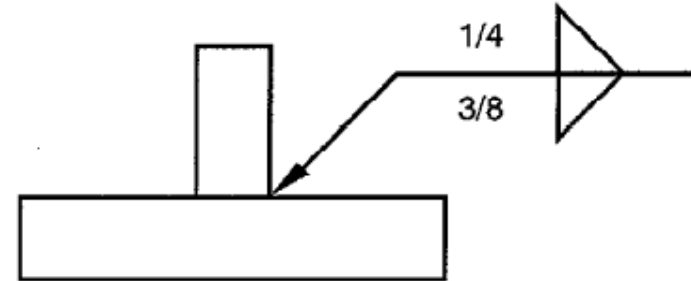


SYMBOL

(C) SIZE OF UNEQUAL DOUBLE-FILLET WELDS

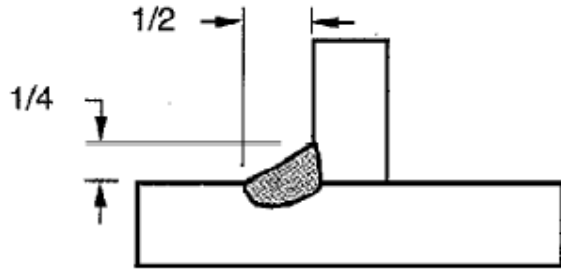


WELD CROSS SECTION

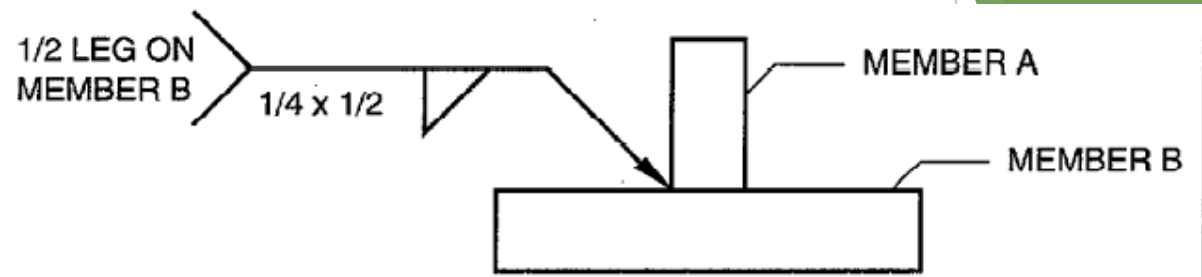


SYMBOL

(D) SIZE OF UNEQUAL LEG FILLET WELD


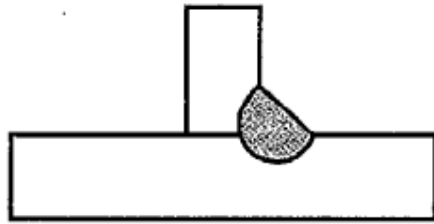


WELD CROSS SECTION

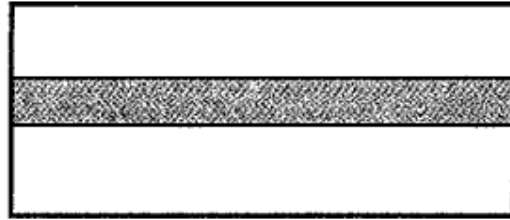


SYMBOL

(E) CONTINUOUS FILLET WELD

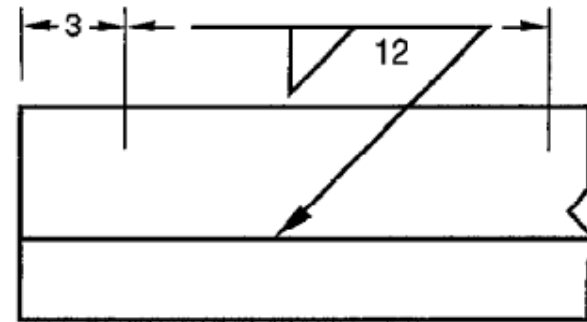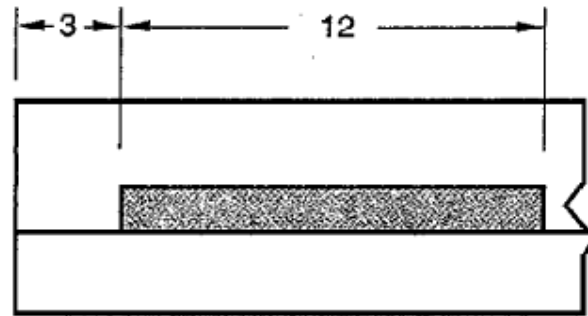




WELDS

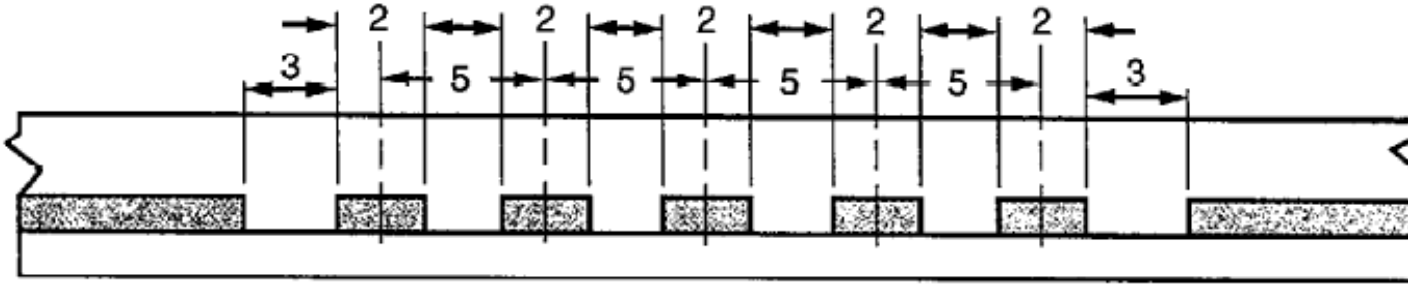


SYMBOLS

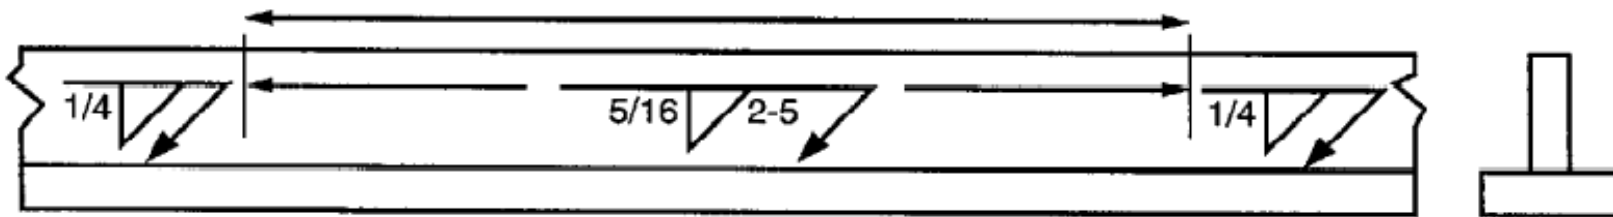


(A) COMBINED INTERMITTENT AND CONTINUOUS WELDS (ONE SIDE OF JOINT)


WELDS

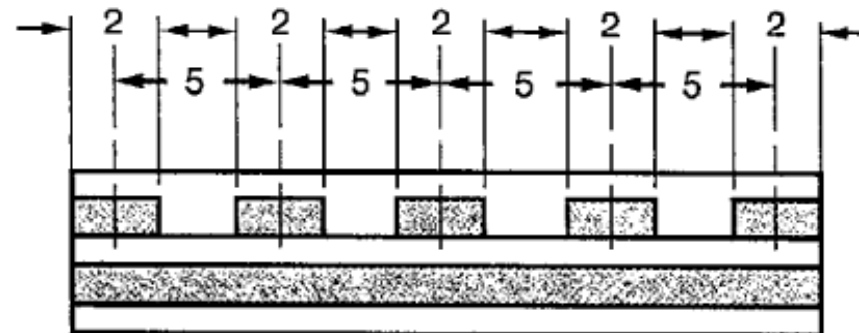


SYMBOLS

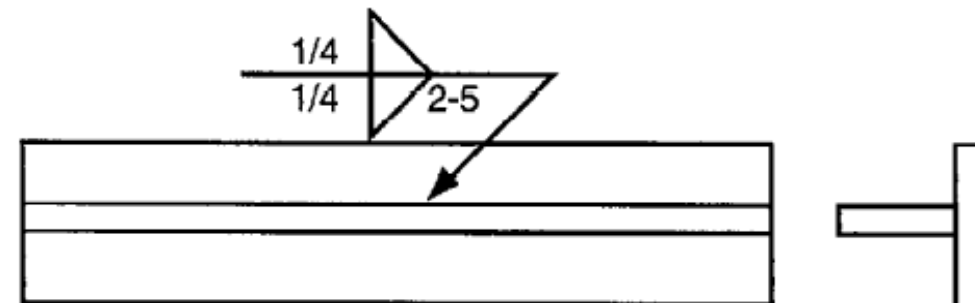

(B) COMBINED INTERMITTENT AND CONTINUOUS WELDS (BOTH SIDES OF JOINT)

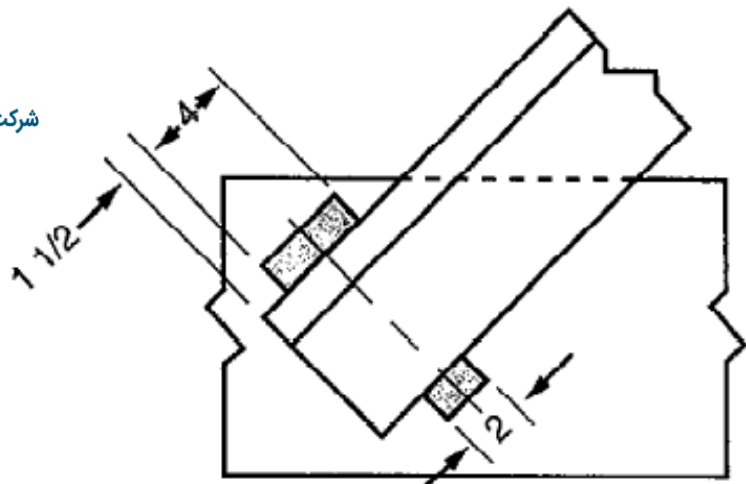


WELDS

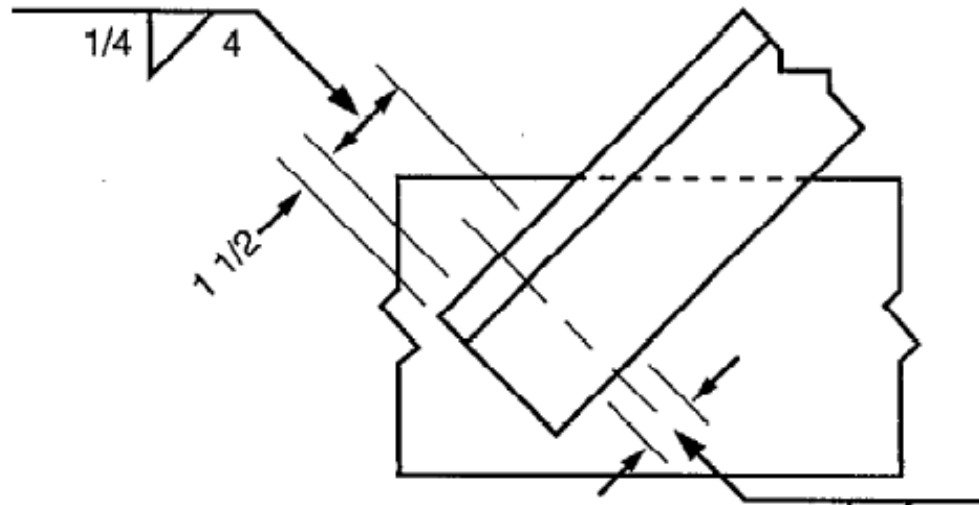


SYMBOLS 1/4 2

(C) WELDS DEFINITELY LOCATED

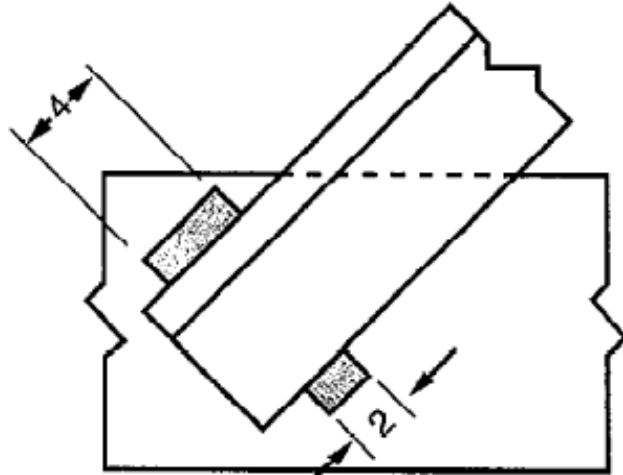



WELDS

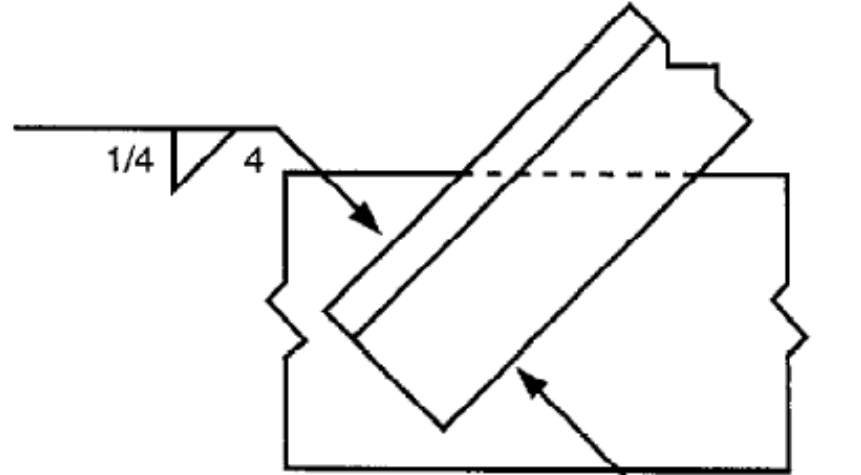


SYMBOLS 1/4 2

(D) WELDS APPROXIMATELY LOCATED

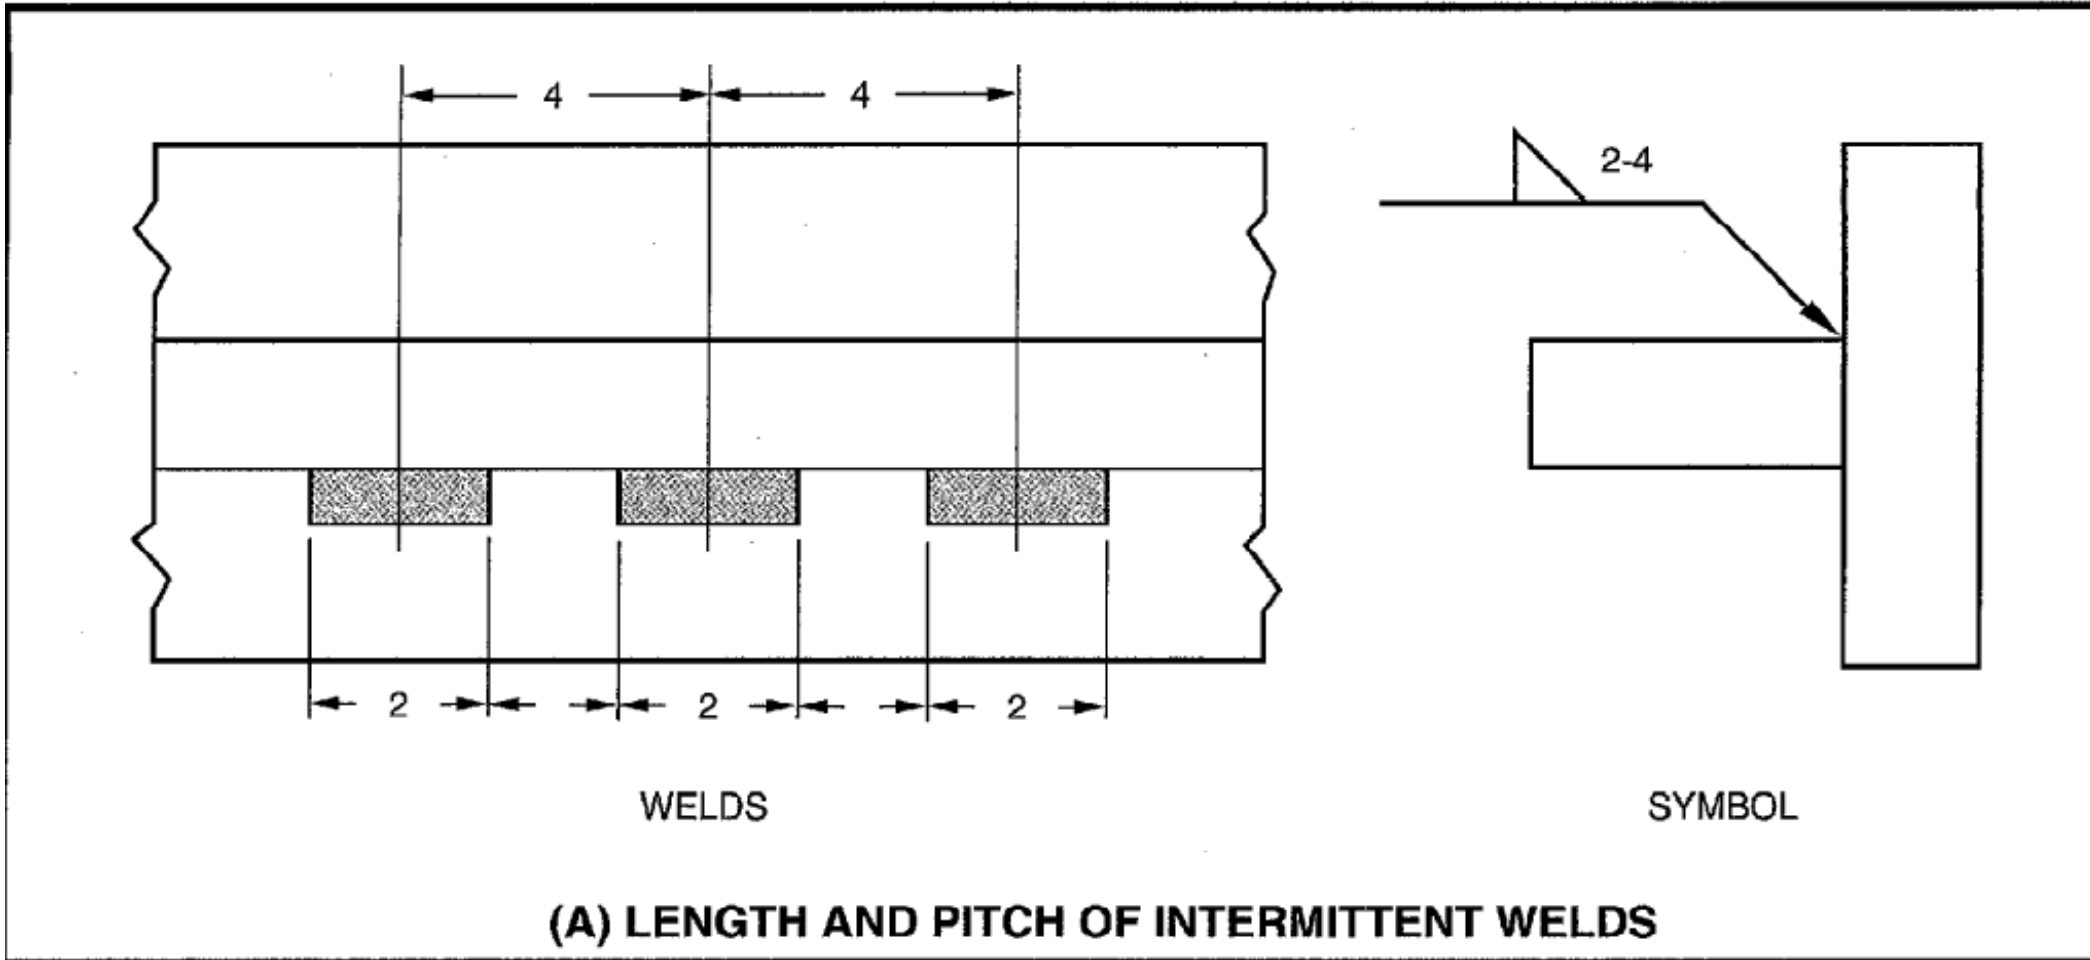

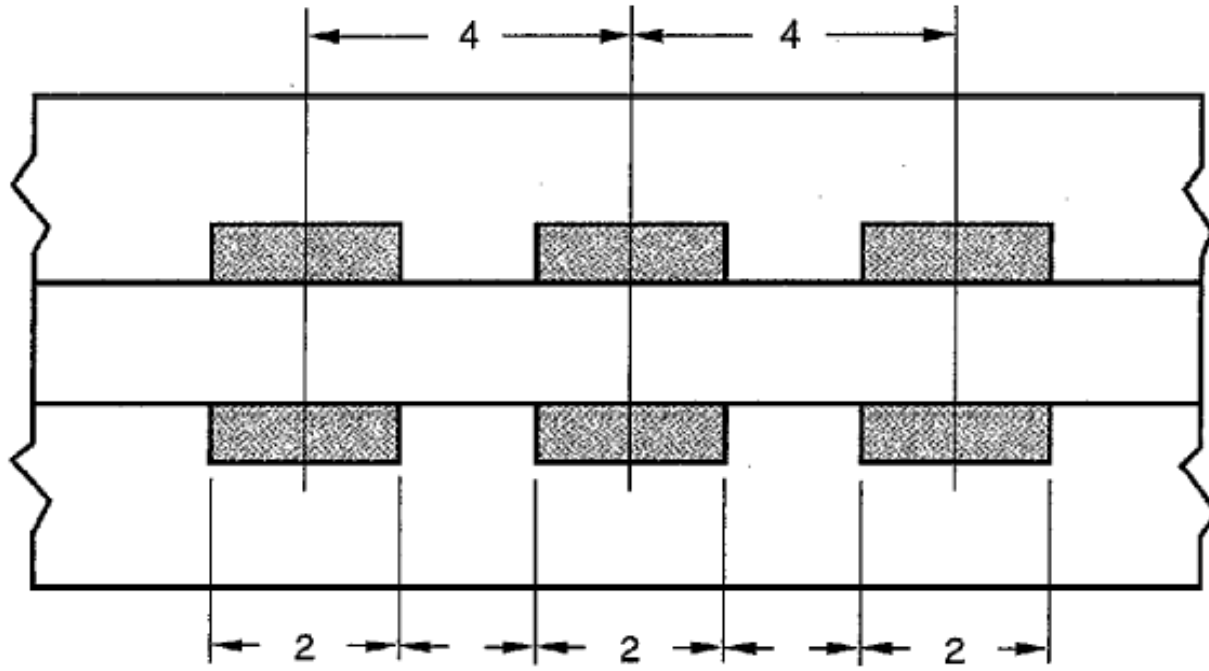


WELDS

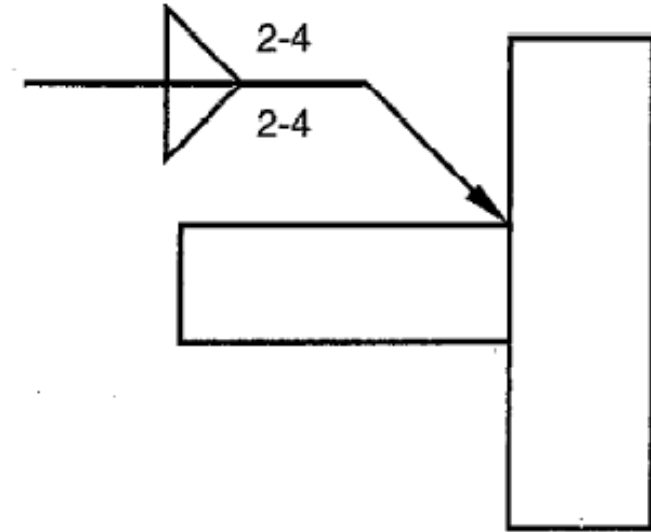


SYMBOL

(B) LENGTH AND PITCH OF CHAIN INTERMITTENT WELDS

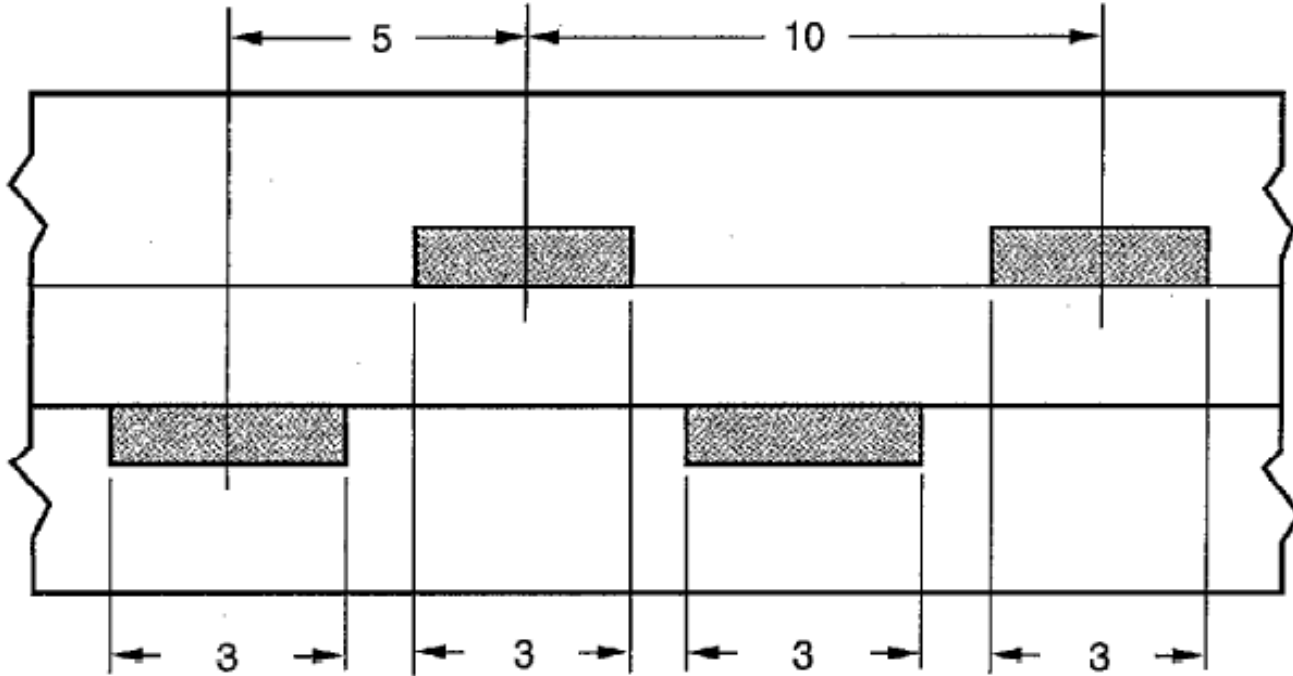



WELDS

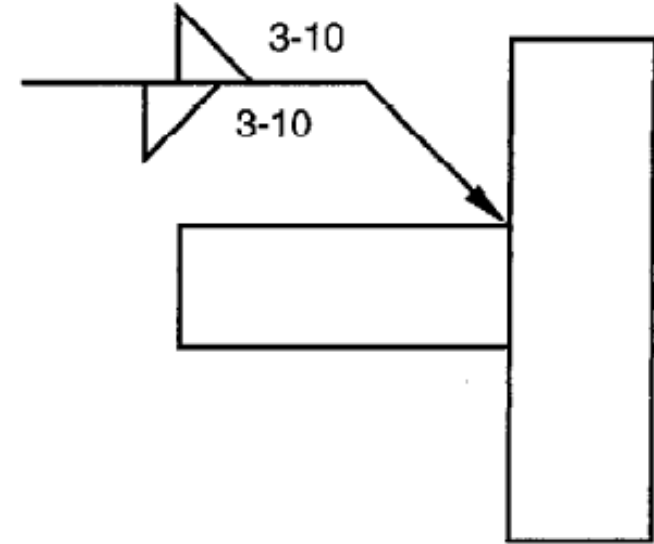

SYMBOL




(C) LENGTH AND PITCH OF STAGGERED INTERMITTENT WELDS

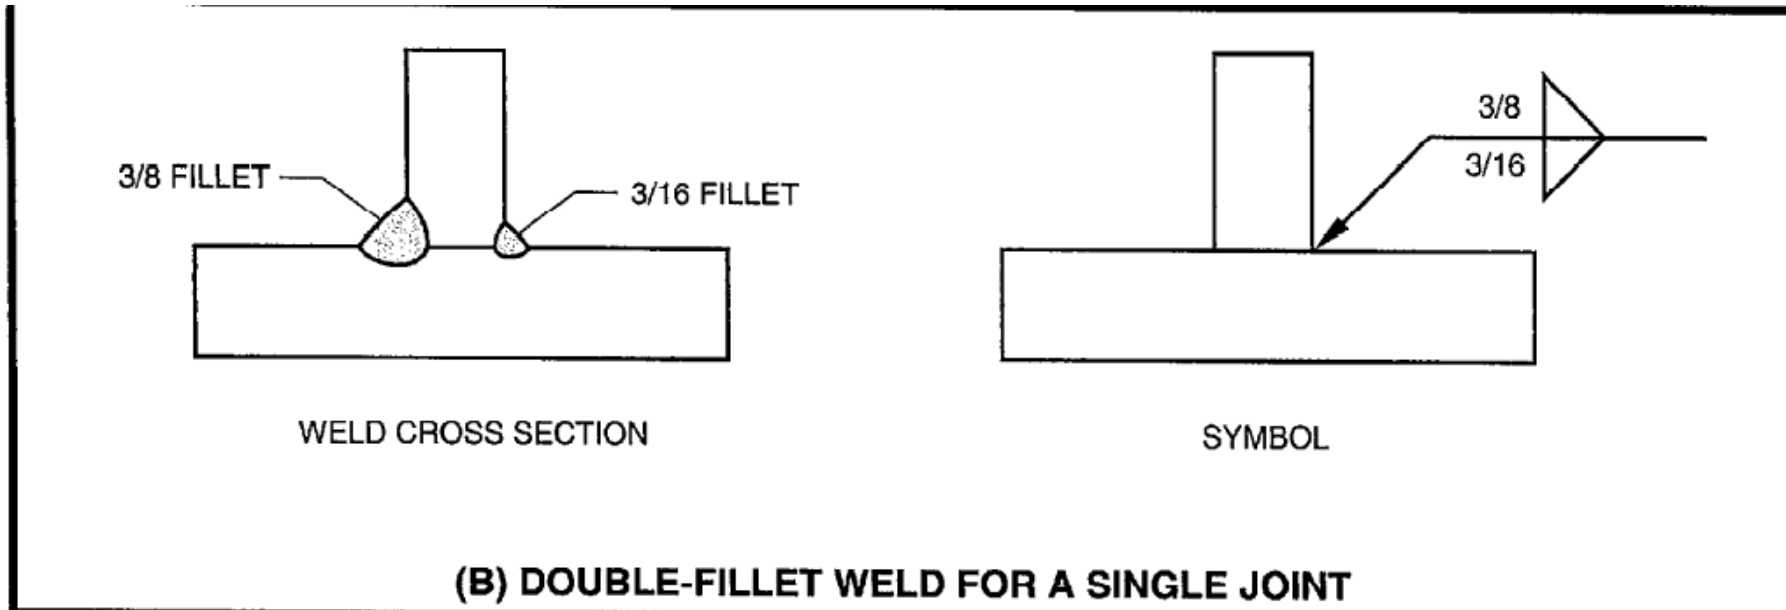


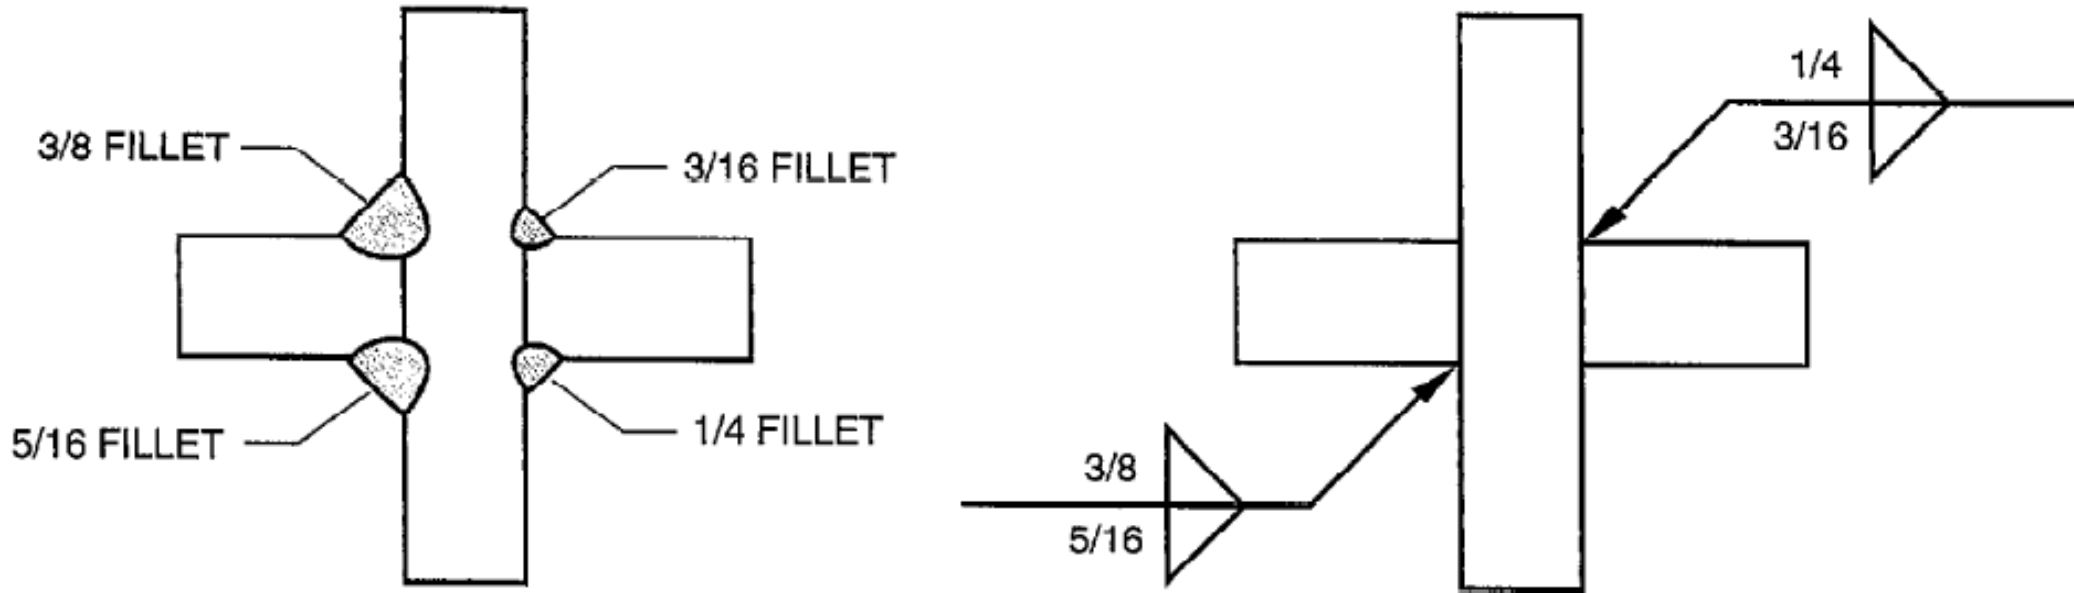


(C) DOUBLE-FILLET WELD SYMBOLS FOR TWO JOINTS



WELDING GUAGE

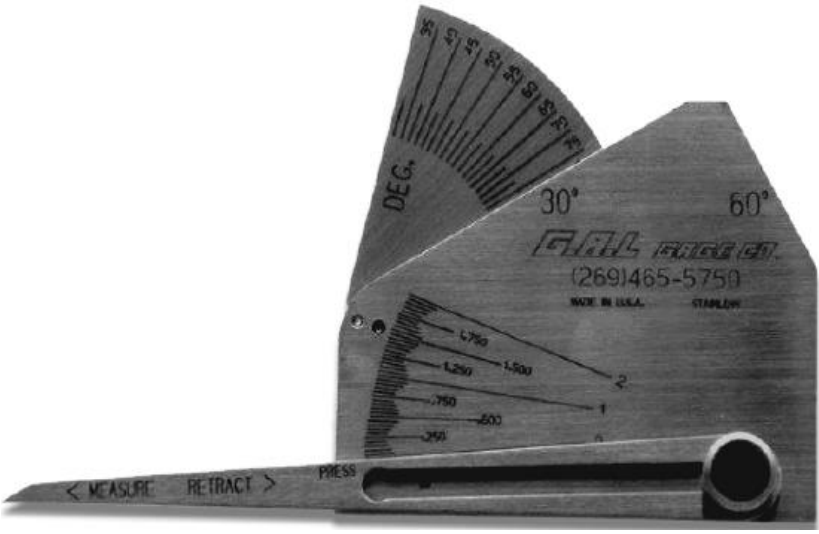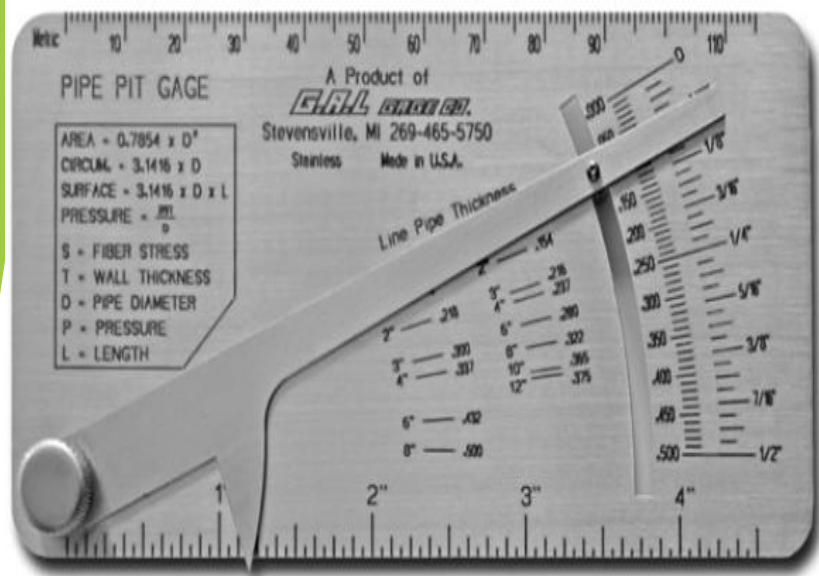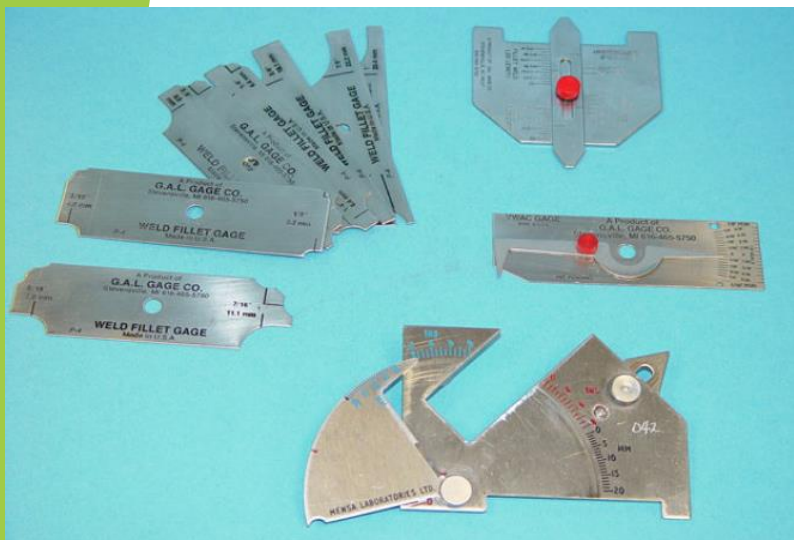


1.1: Gage

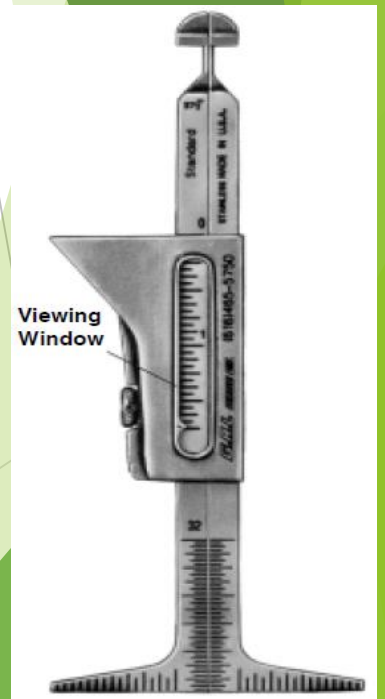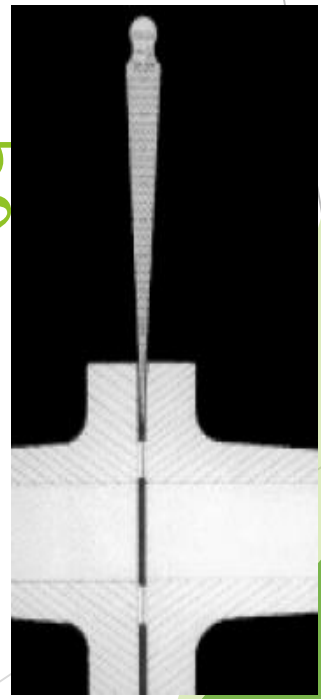

BRIDGE CAM GAUGE

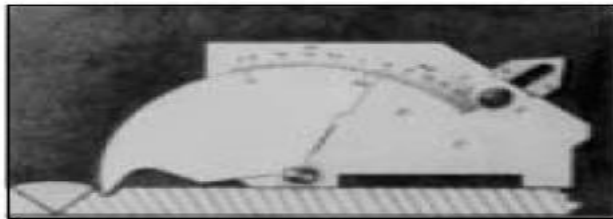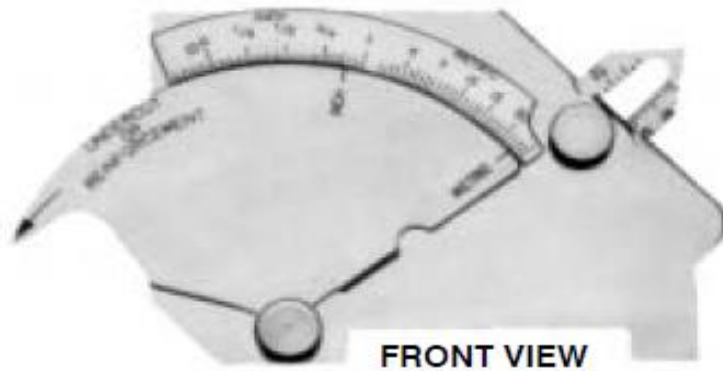


UNDERCUT

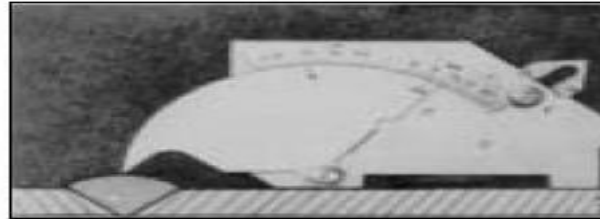

EXCESS WELD METAL




FILLET LEG LENGTH

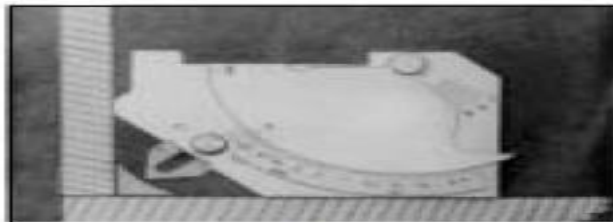

FILLET WELD THROAT



ANGLE OF PREPARATION

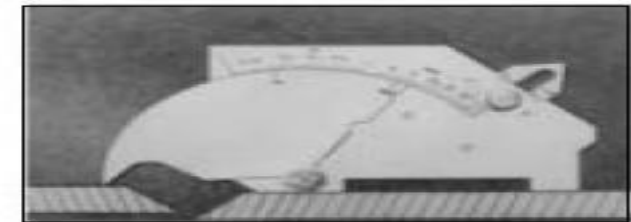




MISALIGNMENT

The following measurements are possible either in inches or millimetres.

Angle of preparation, 0° to 60°
Excess weld metal (capping size)
Depth of undercut
Depth of pitting

Fillet weld throat size
Fillet weld length
Misalignment (high-low)


General linear measurements up to 60 mm or 2 inches.

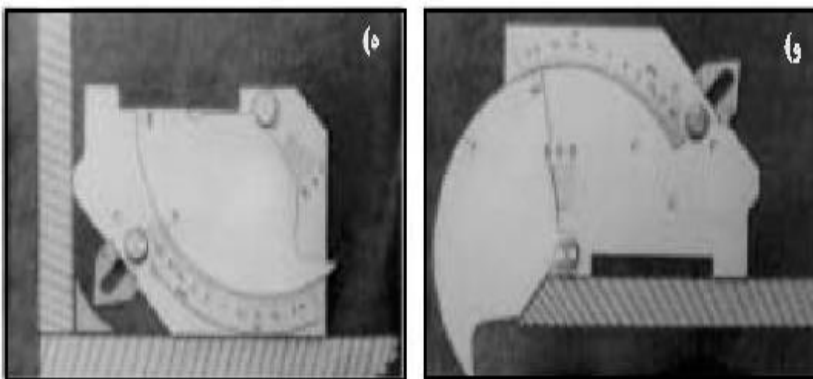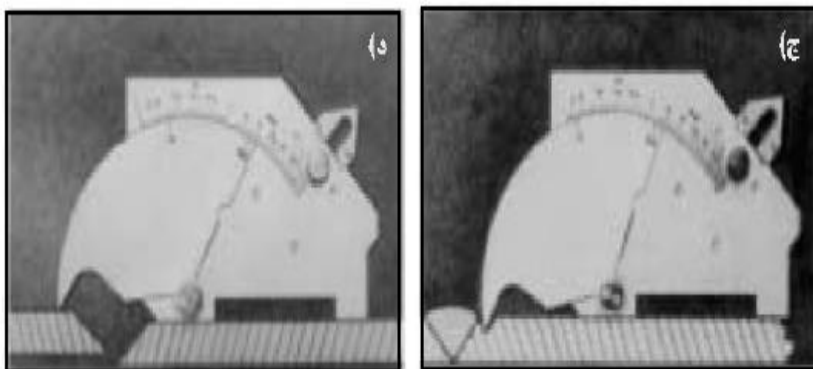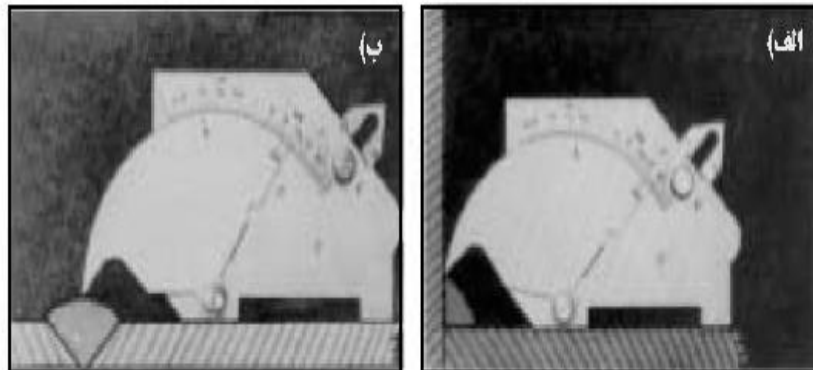


این ابزار نیز از جنس فولادهای زنگ نزن و دارای دقت اندازه‌گیری تا $1/32$ اینچ برای بریدگی‌های کناره جوش و یا تحدب و ارتفاع گرده جوش است. می‌توان گفت که این ابزار اندازه‌گیری بدلیل کارایی‌های گوناگون دارای کاربرد فراوان در صنعت جوش و فعالیت‌های مرتبط با بازرسی جوش است. اندازه‌گیری‌های زیر را می‌توان در مقیاس اینچ یا به میلی‌متر انجام داد:


- زاویه اتصال آماده شده از 0° تا 60°
- فلز جوش اضافی (گرده یا تحدب جوش)
- عمق بریدگی یا سوختگی کناره جوش
- عمق سوراخ با حفرات
- اندازه گلویی جوش‌های گوشه
- اندازه ساق جوش‌های گوشه
- میزان عدم انطباق‌ها یا ناهمترازی‌ها (High-Low)


روش اندازه‌گیری الف) طول ساق جوش گوشه، ب) فلز جوش اضافی یا تحدب جوش، ج) بریدگی کناره یا سوختگی کناره، د) عدم انطباق یا همترازی اجزای اتصال، و) زاویه آماده سازی شده، ه) ضخامت گلویی جوش گوشه.

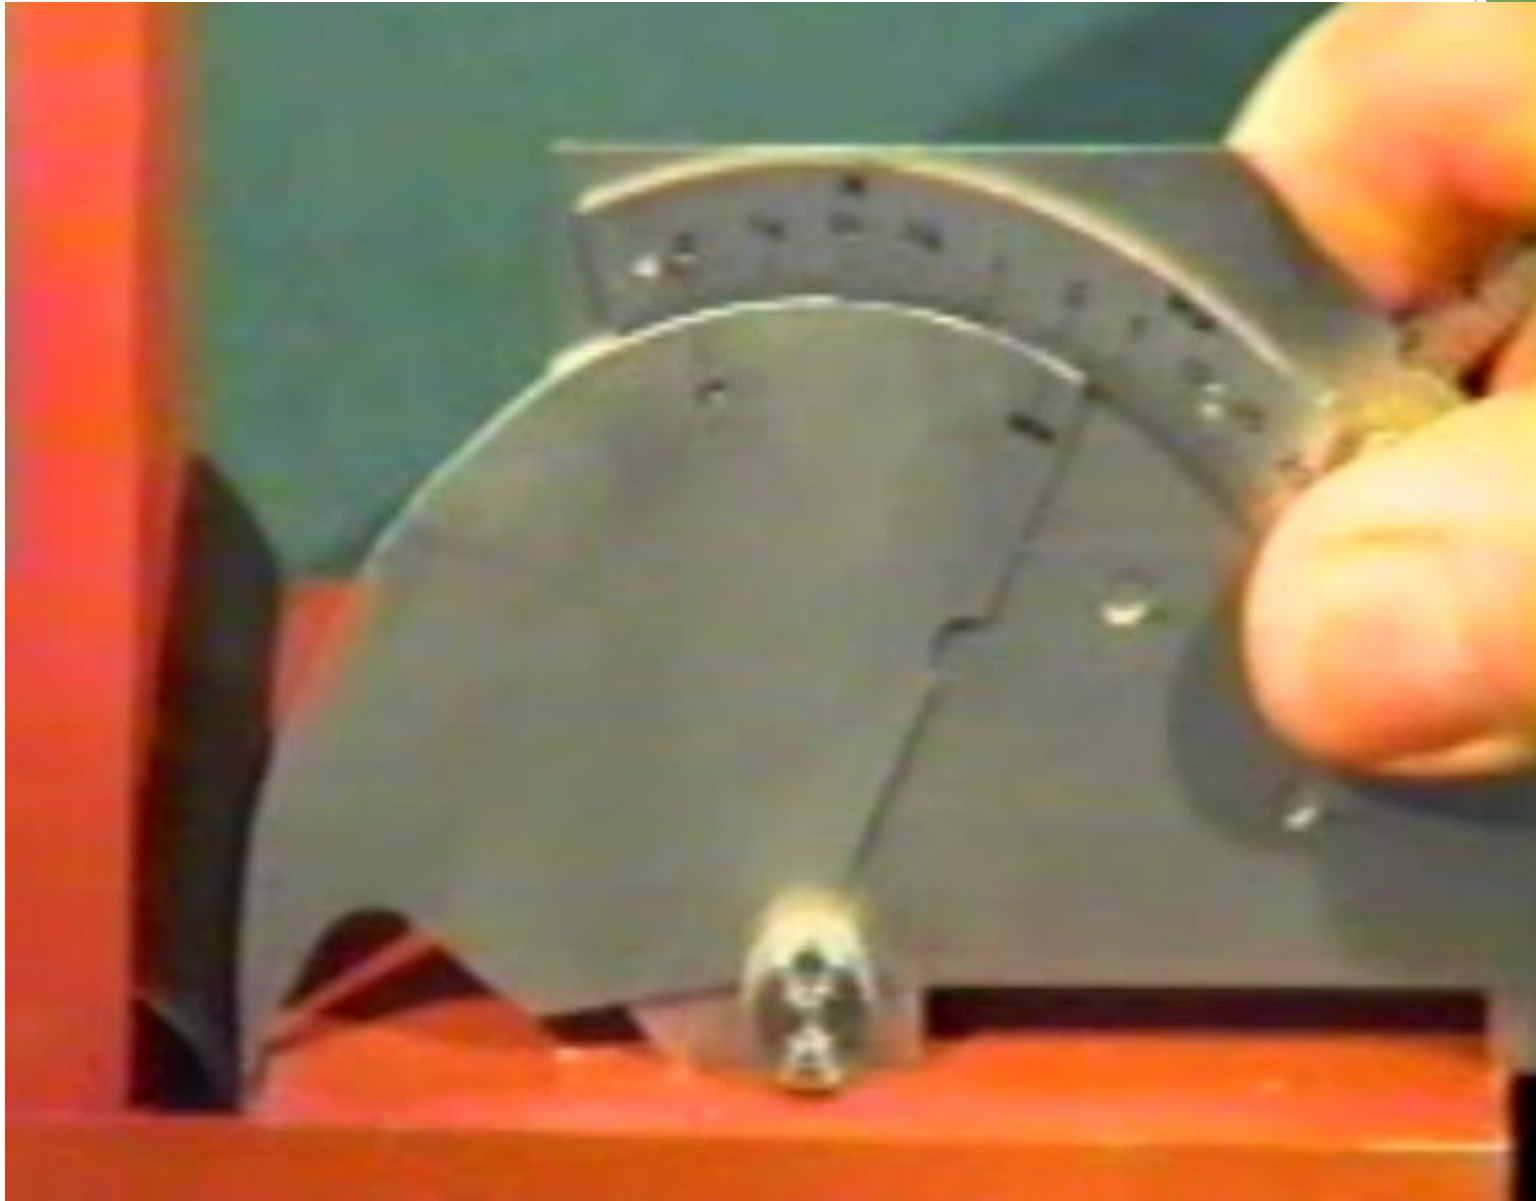


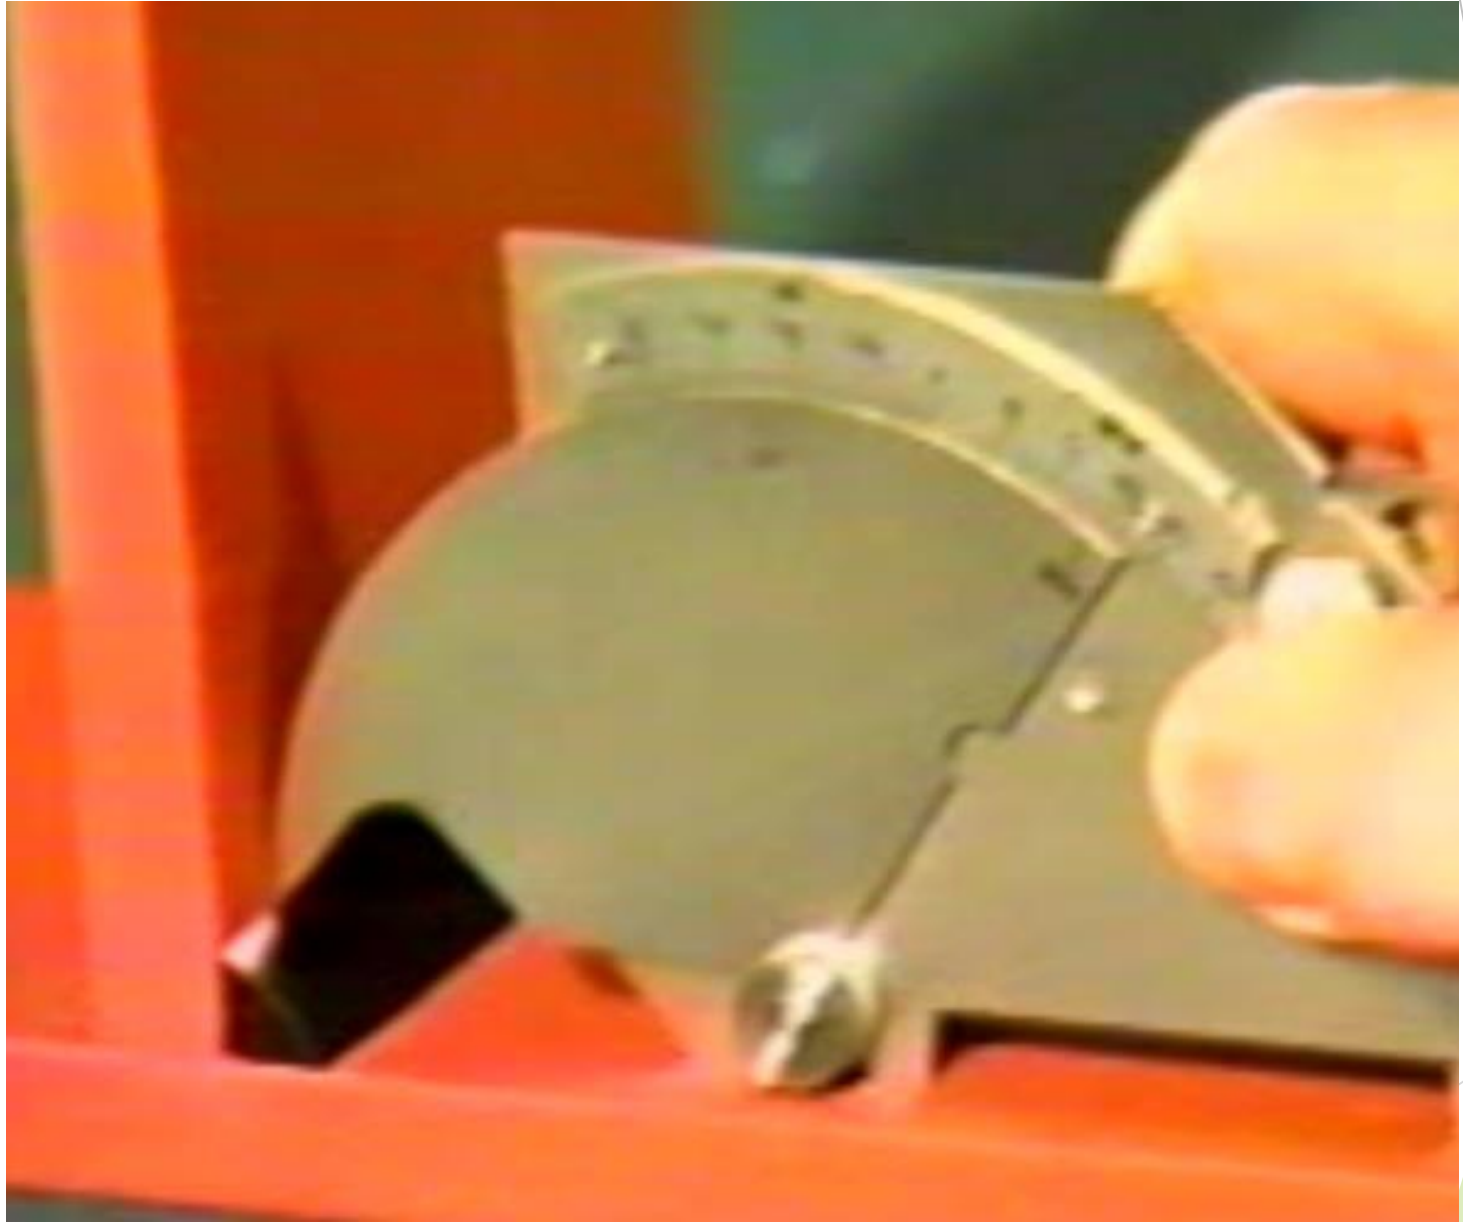




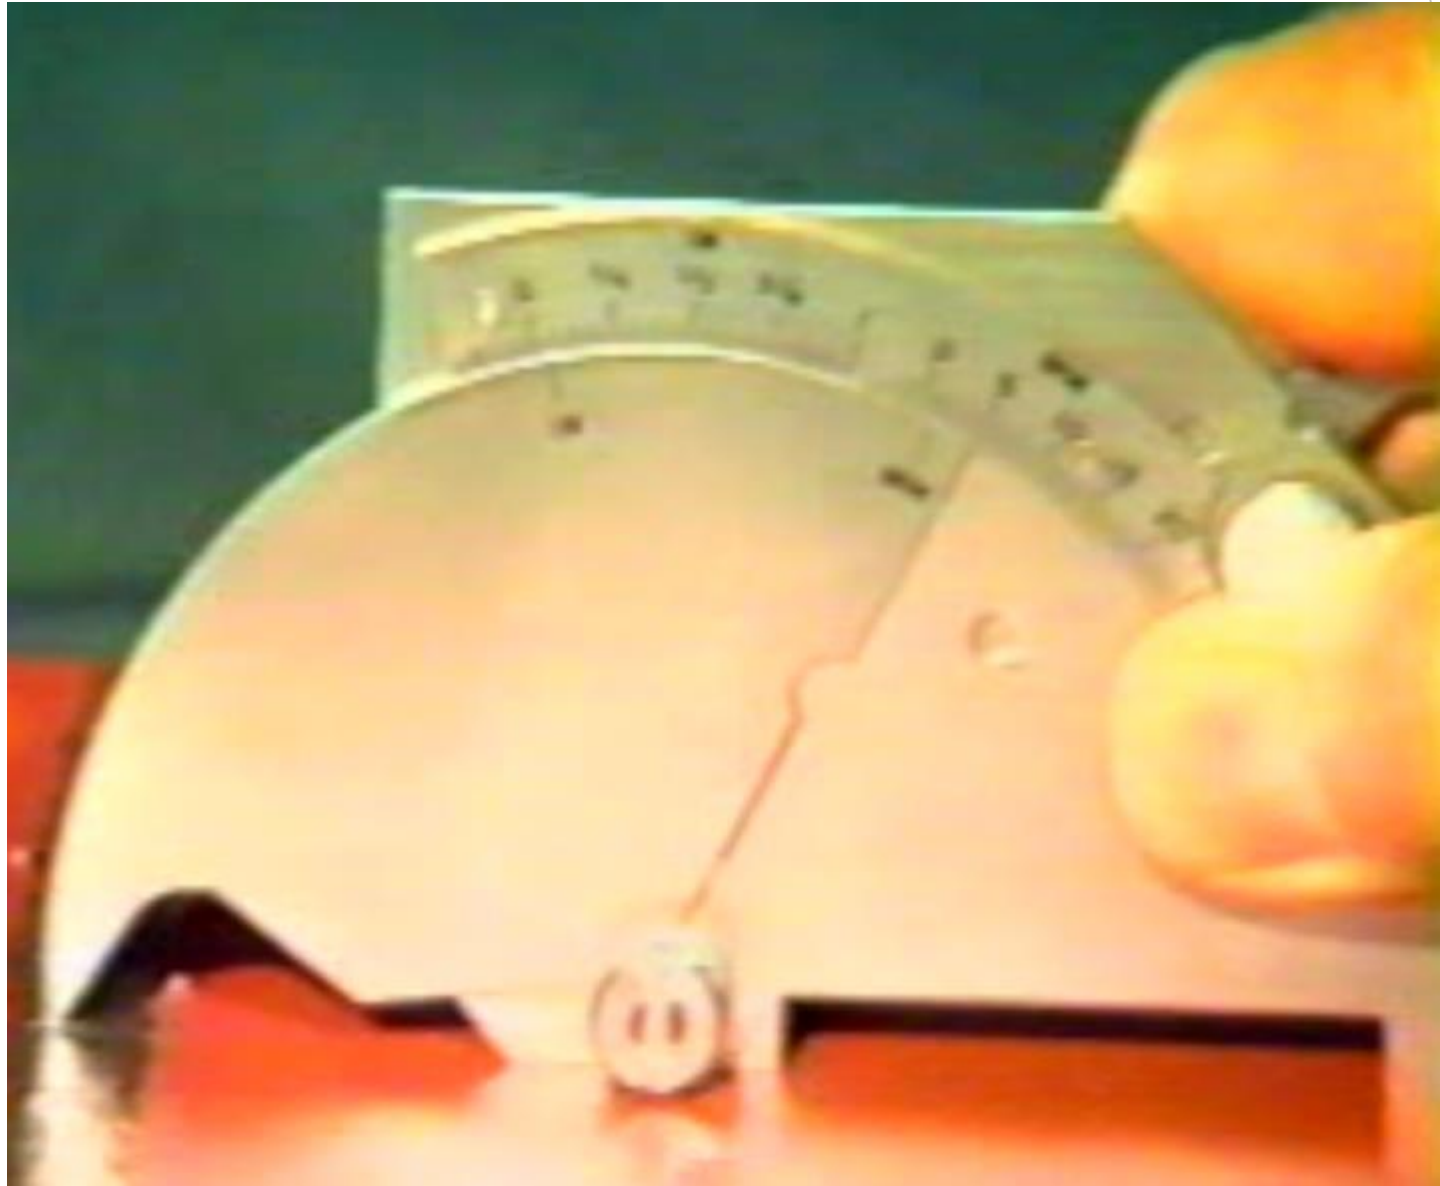

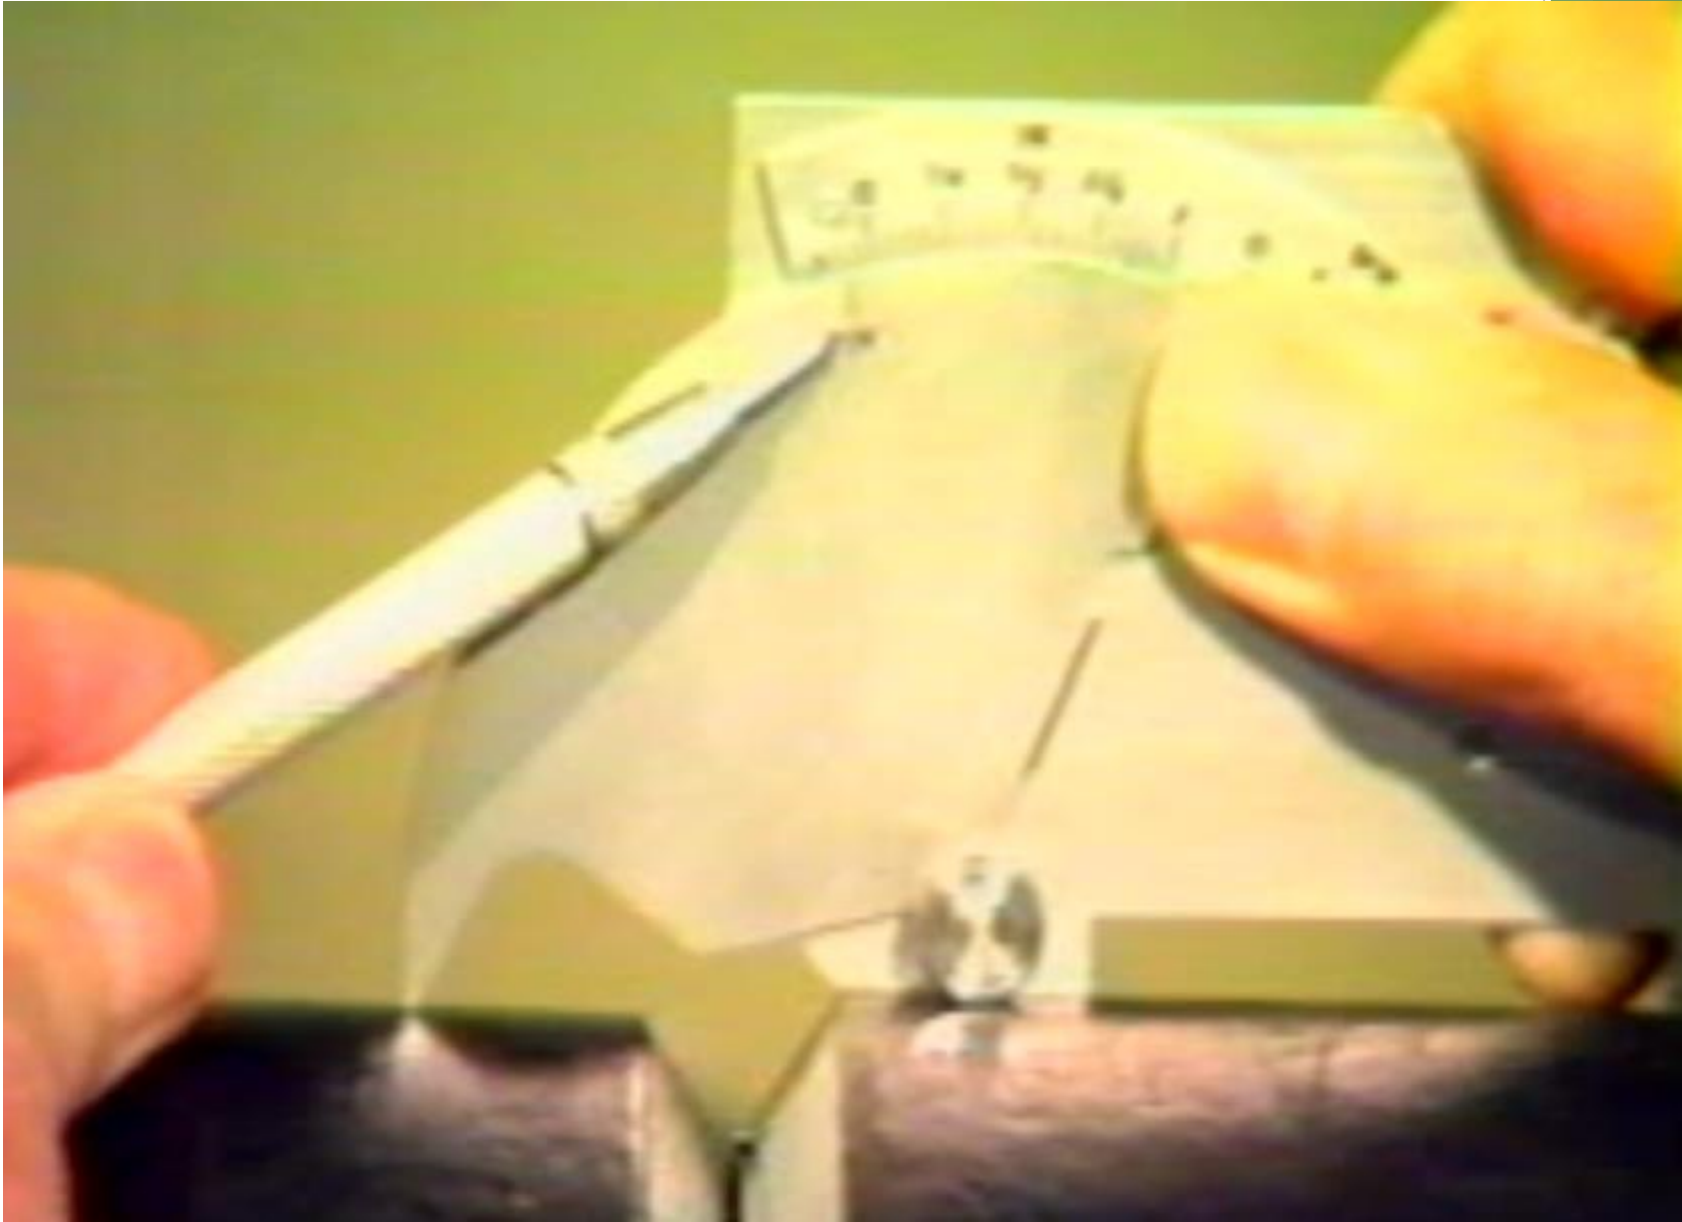

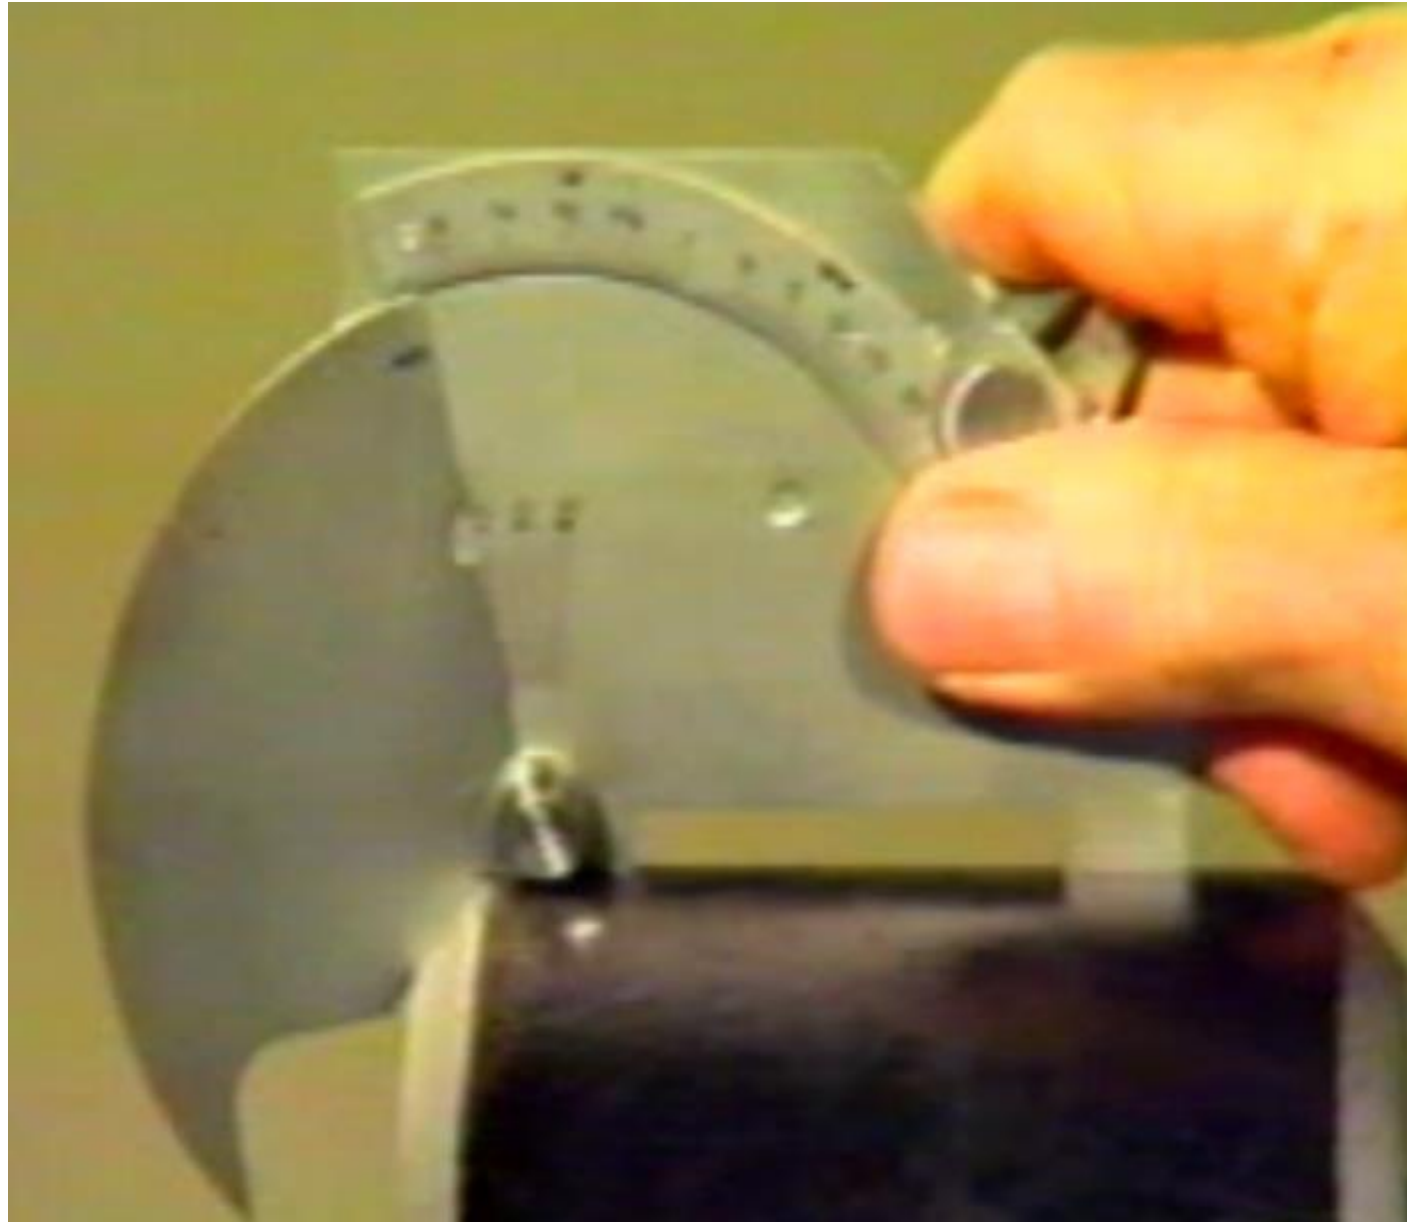

SINGLE PURPOSE HI-LO WELDING GAUGE

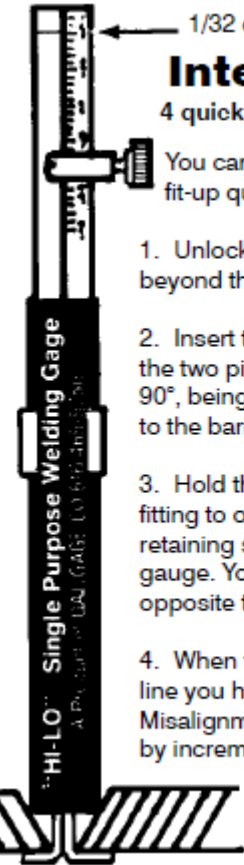

1/32 or Zero Line

Internal HI-LO Gauge

4 quick steps check internal alignment


You can check the internal alignment of your fit-up quickly with the G.A.L. HI-LO gauge.

1. Unlock the retaining screw. Press the gauge legs beyond the barrel.
2. Insert the legs (wires) into the root gap space or the two pieces of pipe to be fitted. Turn the gauge 90°, being careful to apply a constant back pressure to the barrel.
3. Hold the gauge as square as possible with the fitting to obtain an accurate reading. Lock the retaining screw. Reverse the 90° turn and remove the gauge. You're now ready to read the increment opposite the red line.
4. When the red line aligns with the 1/32 increment line you have a good internal alignment and fit-up. Misalignment can be determined from the zero line by increment markings of 1/16 inch.

Rootweld Spacing Gauge


Easy operation determines rootweld spacing.

1. Unlock the retaining screw and insert the gauge interior alignment stops between the two pieces of pipe to be fitted.
2. Insert the leg with the longer taper into the root gap until it makes contact with both sides of the gap.
3. Re-lock the retaining screw, remove the gauge and read it.
4. The scale is calibrated in fractional dimensions from 1/32 to 3/16 in 1/16 inch increments. The read-out you receive represents the amount of rootweld gap.

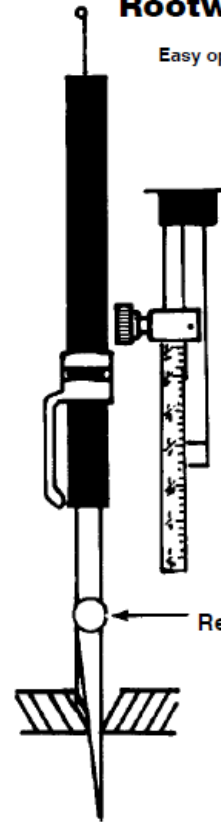


Retainer Lock Screw

Eliminates rejects, improves productivity

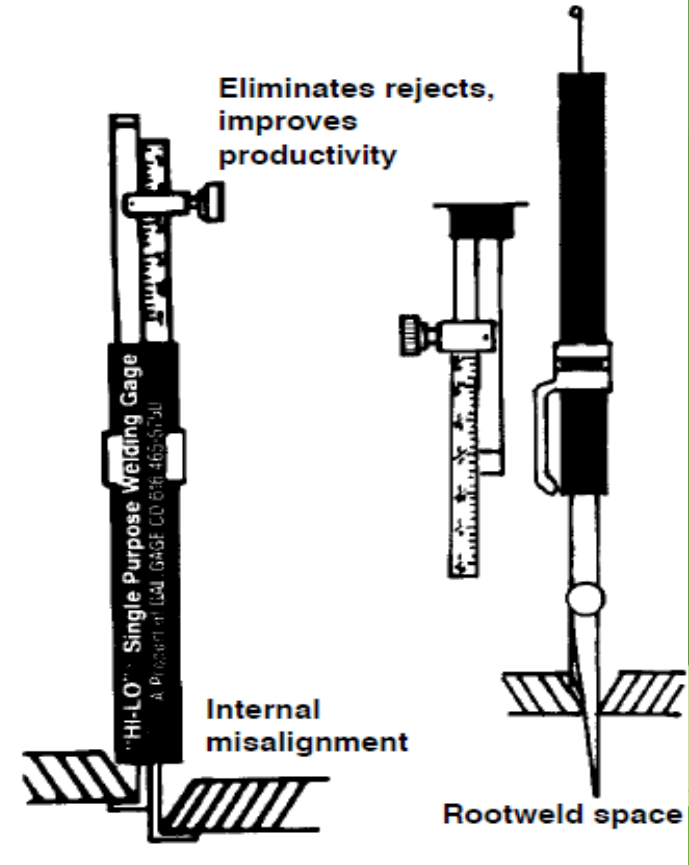

Internal misalignment

Rootweld space

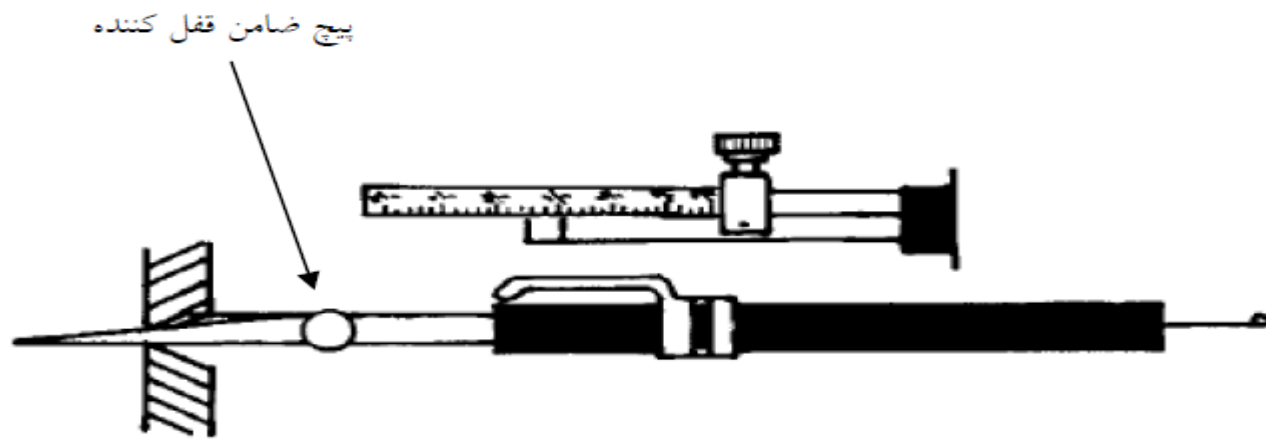

اندازه گیری فاصله ریشه جوش

نحوه استفاده:

- پیچ قفل نگهدارنده را با چرخاندن باز کنید.
- ابزار را از جهت مشخص شده در شکل، روی اتصال ثابت کنید.
- پایه‌ای را که دارای نوک تیز و بلندتری است را به داخل فاصله ریشه و تا جایی که توسط هر دو طرف اتصال ثابت شود، وارد کنید.
- مجدداً پیچ قفل کننده را برای ثابت نگهداشتن پایه‌ها بچرخانید و ابزار را از اتصال خارج کنید.
- عدد تعیین شده توسط شاخص اندازه‌گیری را بخوانید.
- مقیاس اندازه‌گیری در ابعادی از $1/32$ تا $3/16$ اینچ افزایش می‌یابد. عدد بازخوانی شده از روی گیج، میزان فاصله ریشه جوش است.





7 Piece Fillet Weld




Use for:

- Checking Fillet Leg Size
- Checking Fillet Throat Size


۱- پیدا کردن مقدار ساق جوش

۲- بررسی تحدب و تقعر ماکزیمم توسط این گیج


۳- تخمین مقدار گلویی جوش

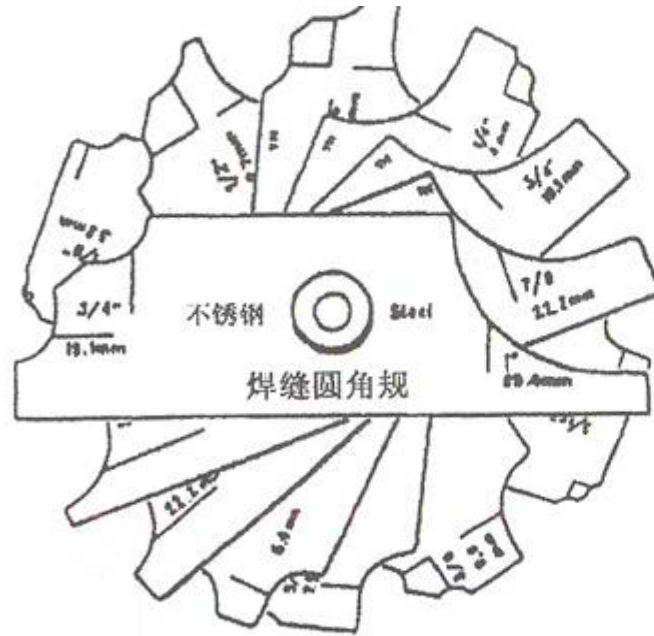


能快速而准确地测量大多数一般焊缝的尺寸，
用英制：1/8" - 1" 及公制：(3.2-25.4mm) 表示
所有尺寸及数值都刻在表面上，清晰而易读出。

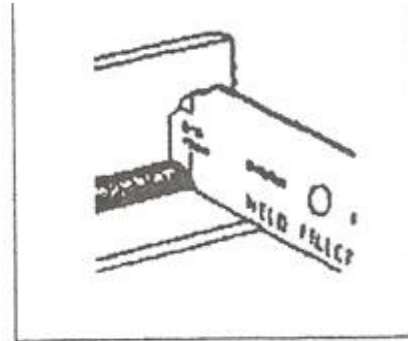

پیدا کردن ساق جوش

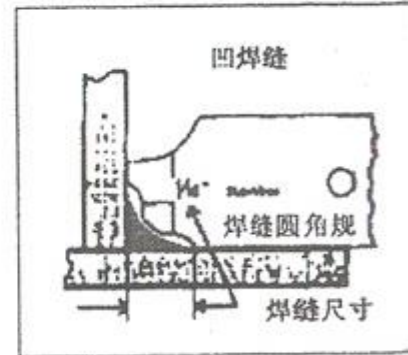

پیدا کردن تقعر جوش

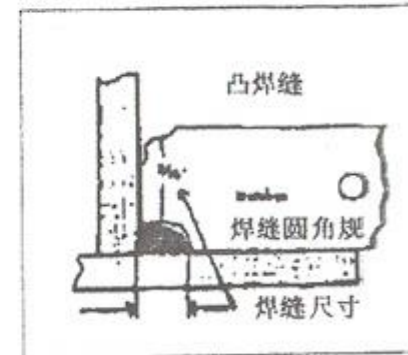

پیدا کردن تحدب جوش



WELDING GAUGE HJC60



规格: HLD60 焊接检测尺



规格: HLD40 焊接检测尺



HJC40 Welding Inspection Ruler

I. The uses, measurement range and technical parameters of welding calipers are as shown in the table below


Measuring Items		Range	Tolerance for Indicating Value
Height	Flat Height		0.2
	Height of Fillet Weld	0-12	0.2
	Height of Fillet Weld	0-15	0.2
Width		0-40	0.3
Depth of Weld Undercut		0-5	0.1
Depth of Weld Undercut		$\leq 150^\circ$	30'
Gap Size		0.5-5	0.1

MEASUREMENT OF HEIGHT OF FLAT WELD

- ▶ ۱- ابتدا گیج under cut را بر روی صفر قرار می دهیم.
- ▶ ۲- بعد از آن گیج گرده جوش را حرکت داده تا گرده را حس کند.
- ▶ بعد از آن عدد ارتفاع گرده جوش را برداشت می کنیم.

1. Instructions for Use


Measure the height of a flat weld: first align the undercut gauge and the depth gauge to zero and fix the screw; and then move the height gauge to touch the welding spot and see the indicating value of the height gauge for the height of the weld (Diagram 1).

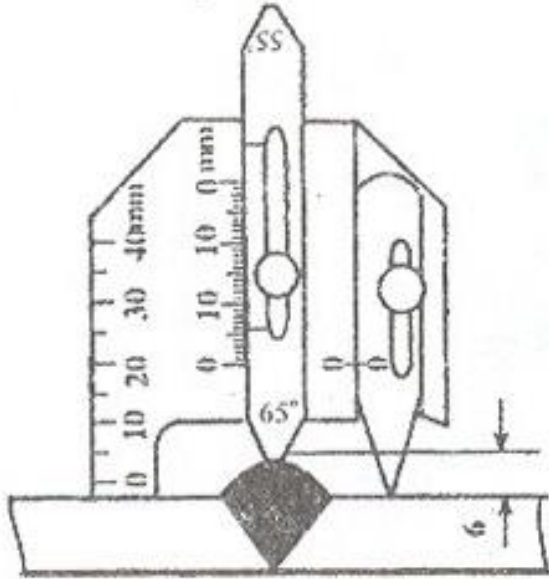

MEASUREMENT OF HEIGHT OF FILLET WELD

- ▶ لبه صاف گیج را بر روی بال عمودی جوش قرار می دهیم.
- ▶ گیج اندازه گیری ارتفاع را جابجا میکنیم
- ▶ از روی درجه بندی ارتفاع ساق جوش با ارتفاع گرده جوش را برداشت میکنیم.

Measure the height of a fillet weld: move the height gauge to touch the other side of the weldment and see the indicating line of the height gauge for the height of the fillet weld (Diagram 2).

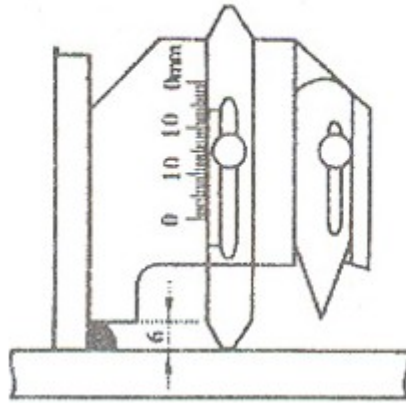


图

二

MEASUREMENT OF WELDING THROAT

- ▶ ۱- در ابتدا همه نشانگرها را به عقب کشانده تا در مسیر قرارگیری گیج نباشد.
- ▶ ۲- دولبه پخ خورده گیج را بر روی جان و بال قطعه قرار میدهیم.
- ▶ و در آخر نشانگر گلویی را به گرده جوش فیلت نزدیک میکنیم.

Measure the fillet weld: the welding spot at 45 degrees is the thickness of the fillet weld. First close up the working face of the main body to the weldment; move the height gauge to touch the welding spot; and see the indicating value of the height gauge for the thickness of the fillet weld (Diagram 3).

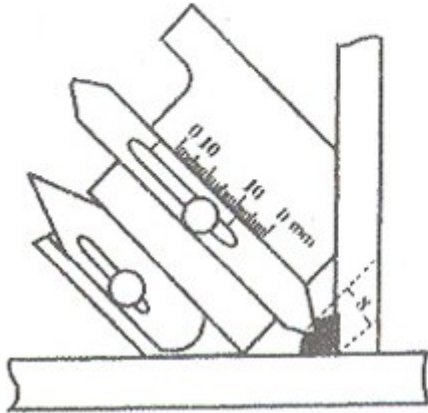

图

三

MEASUREMENT THE UNDERCUT

- ▶ پایه اندازه گیری گیج را بر روی صفر قرار میدهم .
- ▶ نشانگر UNDER CUT را بر روی بریدگی کناره جوش قرار داده و عدد را برداشت میکنیم.

Measure the undercut depth of the weld: first align the height gauge to zero and fix the screw; and use the undercut gauge to measure the undercut depth and see the indicating value of the undercut gauge for the undercut depth (Diagram 4).


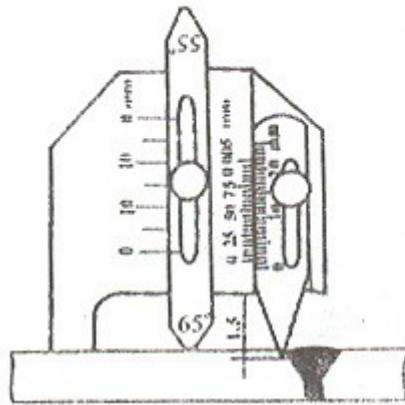


图
四

MEASUREMENT THE GROOVE ANGLE

Measure the groove angle of the weldment: coordinate the main ruler with the multi-purpose gauge in accordance with the required groove angle of the weldment. See the angle formed by the working face of the main ruler and the multi-purpose gauge. See the indicating value of the multi-purpose gauge for the groove angle (Diagram 5).

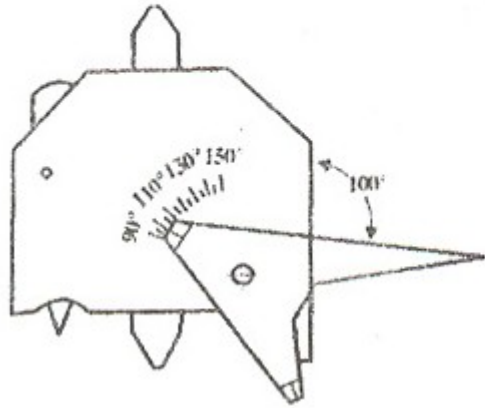

图

五

MEASUREMENT THE WIDTH OF WELD

Measure width of the weld: close up the main measuring angle to one side of the weld firstly; then rotate the measure angle of the multi-purpose gauge to close up to the other side of the weld; and see the indicating value of the multi-purpose gauge for the width of the weld (Diagram 6).

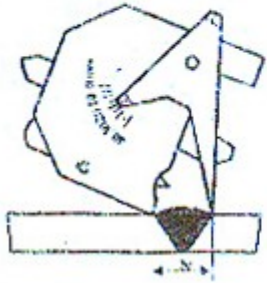


图
六

MEASUREMENT THE GAP

Measure a fit-up gap: insert the multi-purpose gauge between two weldments; and see the indicating value of the gap gauge on the multi-purpose gauge for the gap value (Diagram 7).



WELDING GAUGE HJC40




HJC40-B Welding Inspection Ruler

I. The uses, measurement range and technical parameters of welding calipers are as shown in the table below

Measuring Items		Range	Tolerance for Indicating Value
Welding Thickness		0-40	± 0.2
Weld Line Height	Multigauge	0-20	± 0.3
	Slider	0-20	± 0.2
Weld Gap		1-3	± 0.2
Weldment Bevel Angle		0° - 90°	$30'$


MEASUREMENT OF SIZE FILLET WELD

The slider is used to measure the height of fillet welds. The indicator on the slider corresponding to the scale on the main scale is the height of the fillet weld.

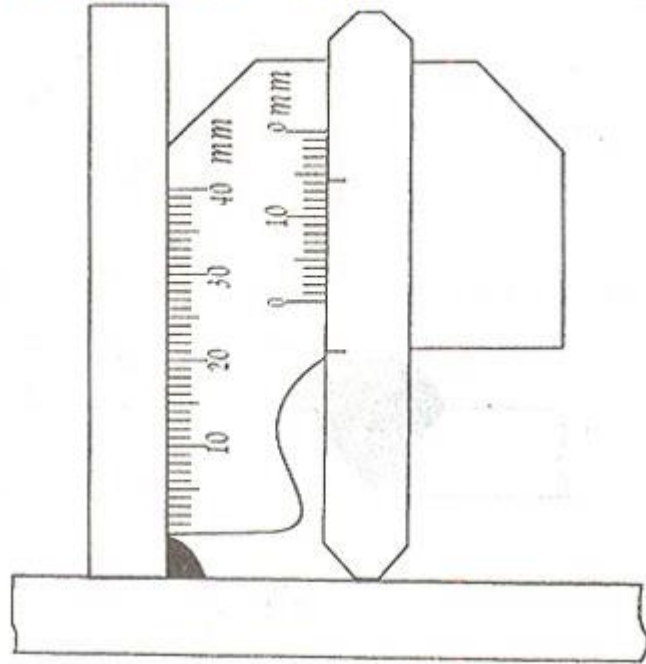


MEASUREMENT OF REINFORCEMENT

The slider is used to measure the height of fillet welds. The indicator on the slider corresponding to the scale on the main scale is the height of the fillet weld.

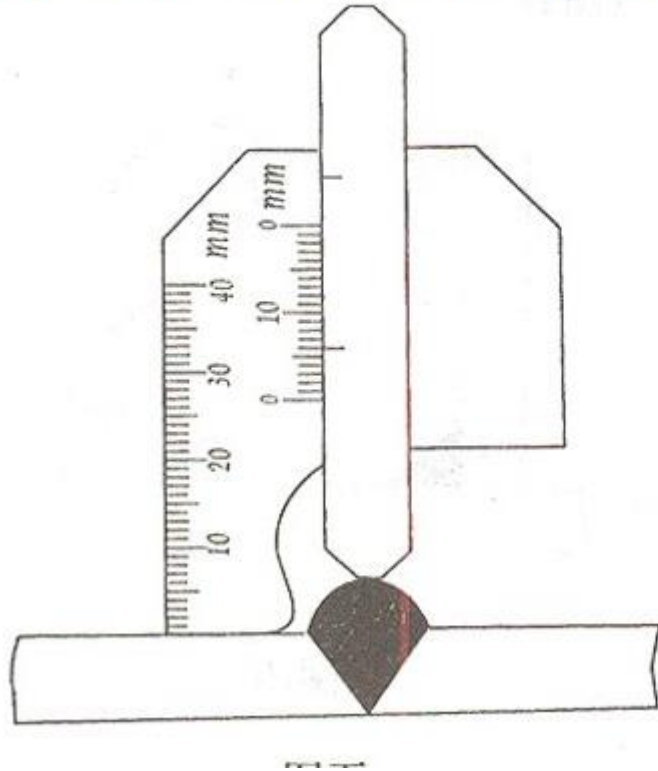

MEASUREMENT OF THRAT FILLET


In measuring the height of 45-degree-angle weld lines, the indicator on the slider corresponding to the scale on the main scale is the height of the 45-degree-angle weld line.

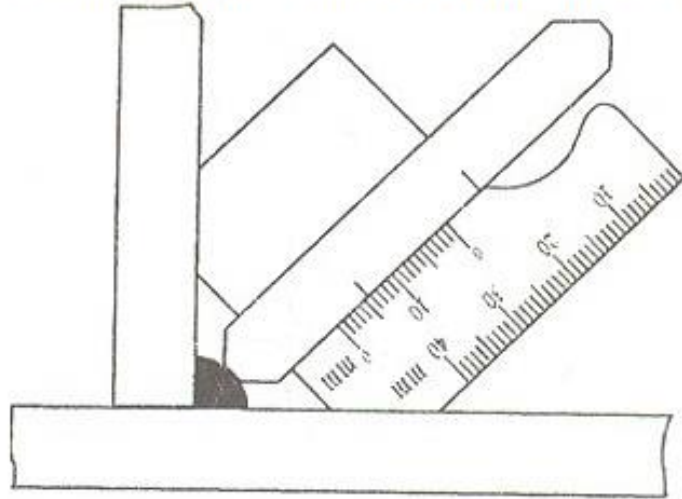

图六

MEASUREMENT OF BEVEL ANGLE


In measuring the height of 45-degree-angle weld lines, the indicator on the slider corresponding to the scale on the main scale is the height of the 45-degree-angle weld line.

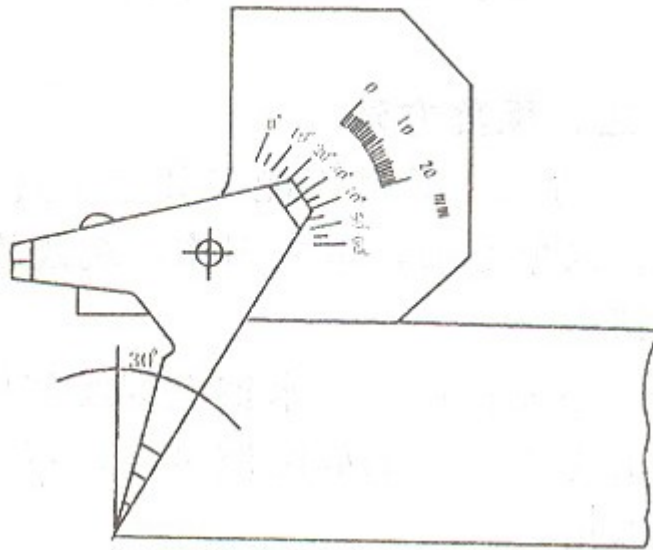

图七

MEASUREMENT OF ROOT OPENING

In measuring the gap of weldments, the indicator on the multi-purpose gauge corresponding to the scale on the main scale is the gap of the weldment.

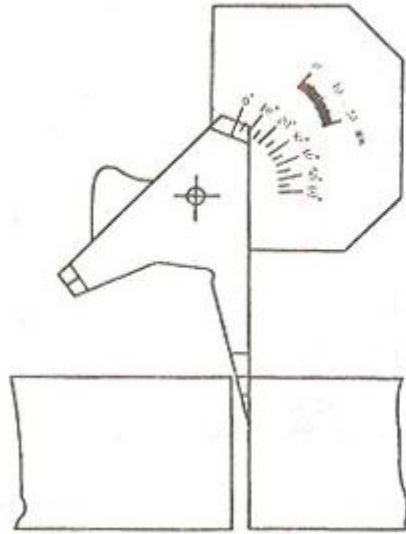


图八


WELDING GAUGE HJC30



MEASUREMENT REINFORCEMENT

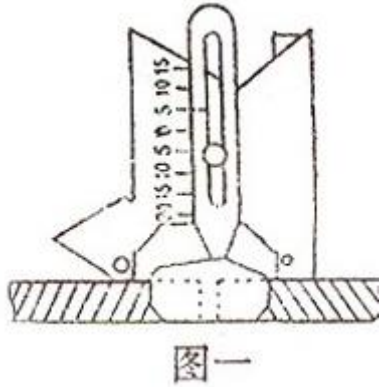

MEASUREMENT FILLET SIZING

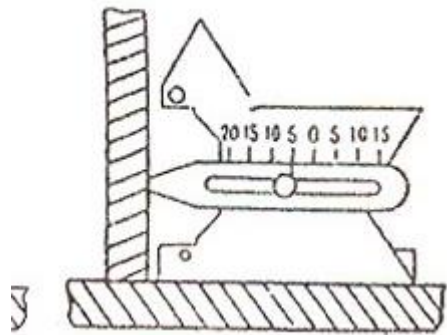

MEASUREMENT ROOT OPENING


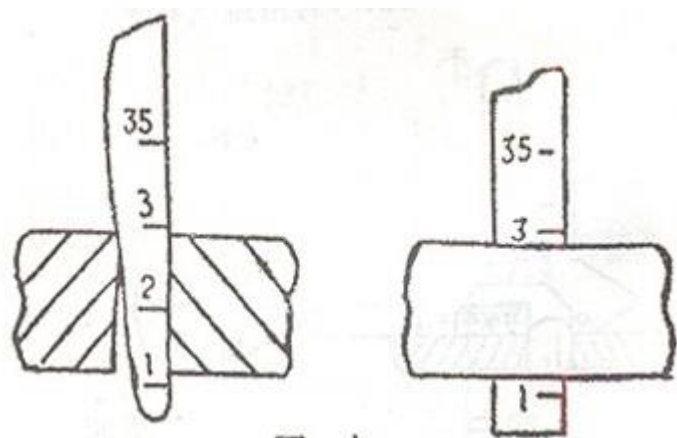


图 七

MEASUREMENT WELD WIDTH

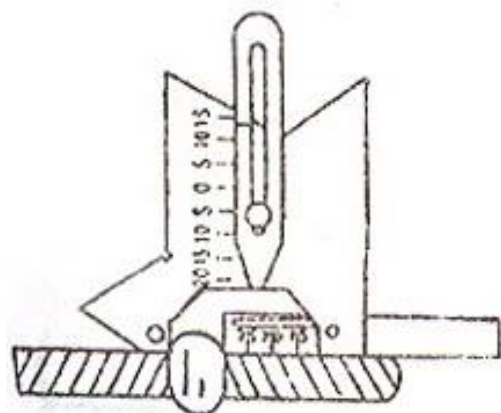

图三


HI-LO WELDING GAGE

MEASURES INTERNAL ALIGNMENT


of pipe after fit-up / alignment, cuts radiographic rejects.

Measures internal misalignment of pipe before and after tacking.


Measurements read in standard one side, and metric on the opposite side.

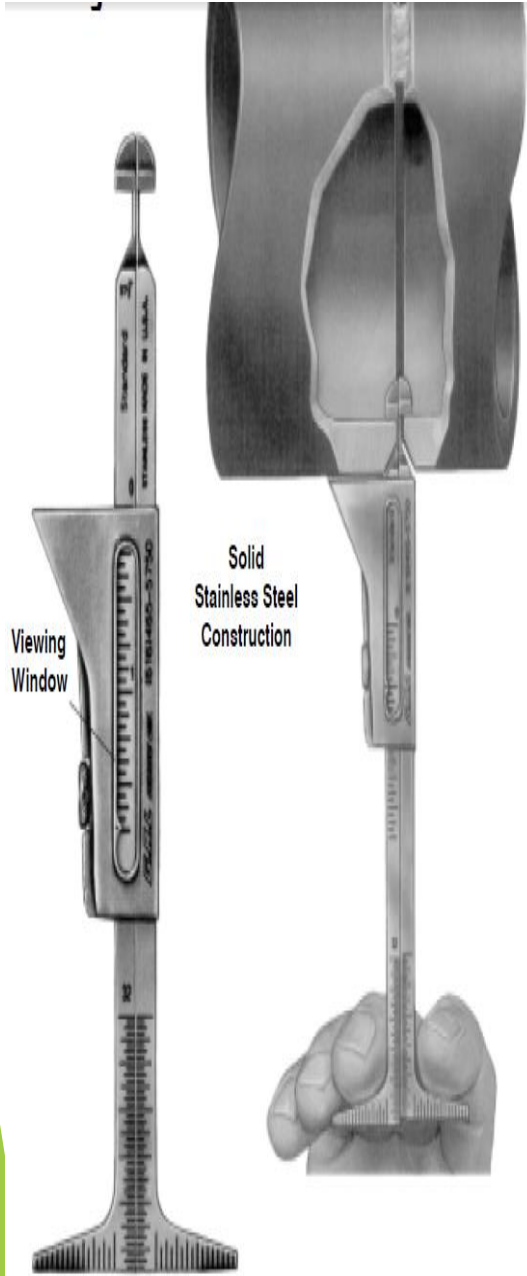

Measure internal mismatch, pipe wall.

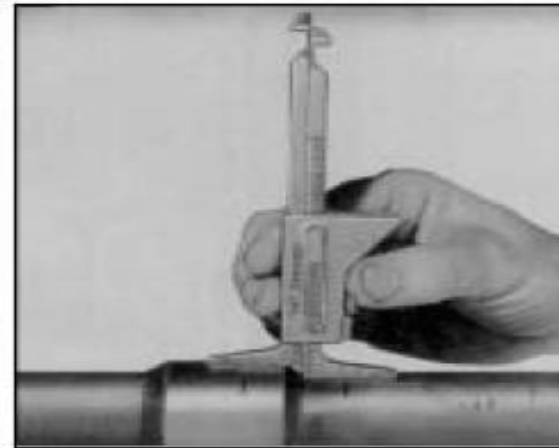


Measure scribe lines, weld fillet.

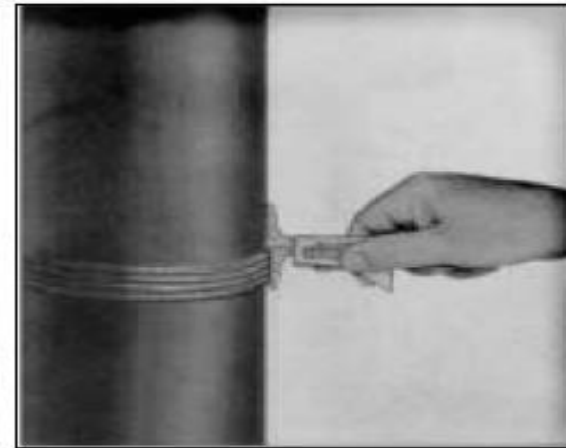

Measure crown height.

- قابلیت تغییر از سیستم استاندارد به سیستم متریک، کاربری آسان و قابلیت چرخش ابزار در داخل اتصال
- قابلیت اندازه‌گیری عدم همترازی‌های داخل قطعه که امکان مشاهده چشمی ندارند
- قابلیت اندازه‌گیری فاصله ریشه اتصال مونتاژ شده
- قابلیت اندازه‌گیری سطح اریب و پخ خورده آماده شده
- قابلیت اندازه‌گیری ارتفاع تاج و یا میزان تحدب گرده جوش
- قابلیت اندازه‌گیری جوش گوشه
- قابلیت اندازه‌گیری میزان تغییرات در هم‌راستایی سطح اتصال
- ابزاری مورد تأیید استانداردهای مختلفی مثل ASME, ANSI, API و اکثر استانداردهای نظامی برای کنترل و اطمینان از مونتاژ رضایت‌بخش اتصالات

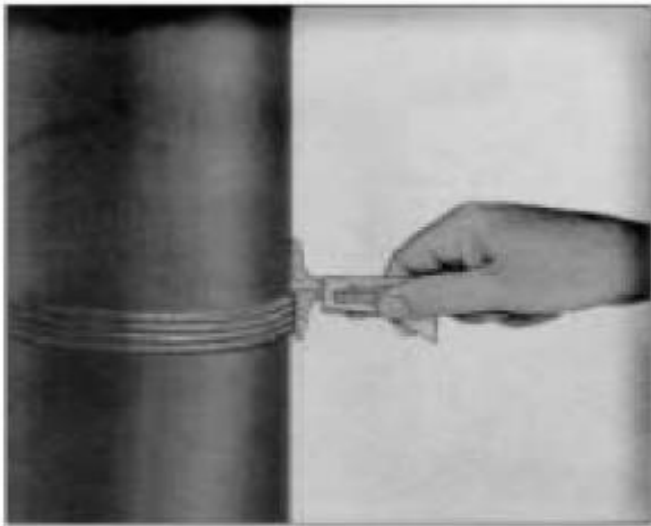

اندازه‌گیری ارتفاع گرده جوش‌های لب بلب

پیچ قفل کننده را شل کنید. انتهای تخت یکی از پایه‌ها را روی قطعه (لوله یا ورق) و پایه دیگر را روی گرده جوش قرار دهید. حال می‌توان ارتفاع گرده را از روی مقاس‌های محور عمودی خواند.

اندازه‌گیری تحدب گرده جوش

اندازه‌گیری ضخامت دیواره لوله‌ها


پیچ قفل کننده را شل کنید. متوقف کننده‌ها را از داخل اتصال وارد قطعه کنید و به قطر داخلی لوله تماس دهید، در این هنگام بدنه لغزنده گیج در مقابل قطر خارجی لوله قرار خواهد گرفت. پیچ قفل کننده را سفت کرده و آنرا از اتصال خارج کنید. حال می‌توان ضخامت قطعه را با کمک شاخص اندازه‌گیری ضخامت مواد بدست آورد.

اندازه‌گیری فاصله مونتاژ

متوقف کننده‌های این گیج دارای دقت مناسبی برای اندازه‌گیری فاصله بین لوله‌های مونتاژ شده دارد. بدین منظور گیج را از پهلو چرخانده و در فاصله بین لوله‌ها قرار دهید. متوقف کننده‌ها قادر به اندازه‌گیری $1/16$ اینچ ($1/6\text{mm}$) در بالا و $3/32$ اینچ ($2/3\text{mm}$) در پایین هستند. اگر گیج نتواند در فضای بین لوله‌ها قرار گیرد، از $1/6\text{mm}$ کمتر است. اما اگر بخشی از فضای مونتاژ را اشغال کند، فاصله بین لوله‌ها بین $1/6\text{mm}$ تا $2/3\text{mm}$ است و اگر بتواند آزادانه به فاصله لوله‌ها وارد و از آن خارج شود، فاصله مونتاژ از $2/3\text{mm}$ بیشتر است.


اندازه‌گیری عدم همترازی و عدم انطباق داخلی اتصال

پیچ قفل‌کننده را شل کنید. گیج را از پهلو وارد اتصال کرده و سپس آنرا ۹۰ درجه چرخانده و به سمت قطعه بکشید. انگشتان خود را بالای پایه‌های گیج قرار داده و آنها را تا جاییکه متوقف‌کننده‌ها با لبه‌های داخلی اتصال مماس شوند، به سمت پایین هدایت کنید. پیچ قفل‌کننده را ببندید و گیج را با ۹۰ درجه چرخش از اتصال خارج کنید. مقادیر عدم همترازی را از روی مقیاس عمودی $32nds$ به میلیمتر بخوانید.

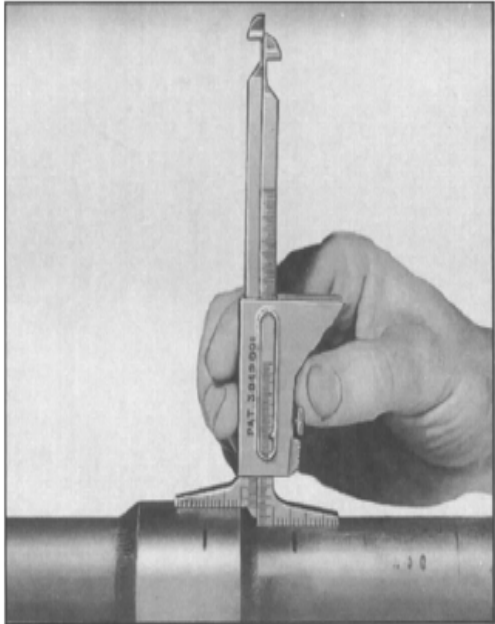

اندازه‌گیری ساق جوش‌های گوشه

هنگامی که ساق‌های یک جوش گوشه مساوی هستند، برای تعیین اندازه ساق جوش‌ها ابتدا بایستی بعد از باز کردن پیچ قفل‌کننده، یکی از پایه‌ها را کاملاً مماس با سطح قطعه قرار دهید. با کمک انگشتان دست، پایه دیگر را جابجا کنید تا لبه آن، لبه بالای جوش گوشه را لمس کند. حال می‌توان از روی مقیاس موجود بر پایه عمودی $32nds$ و افقی $16ths$ خواند.

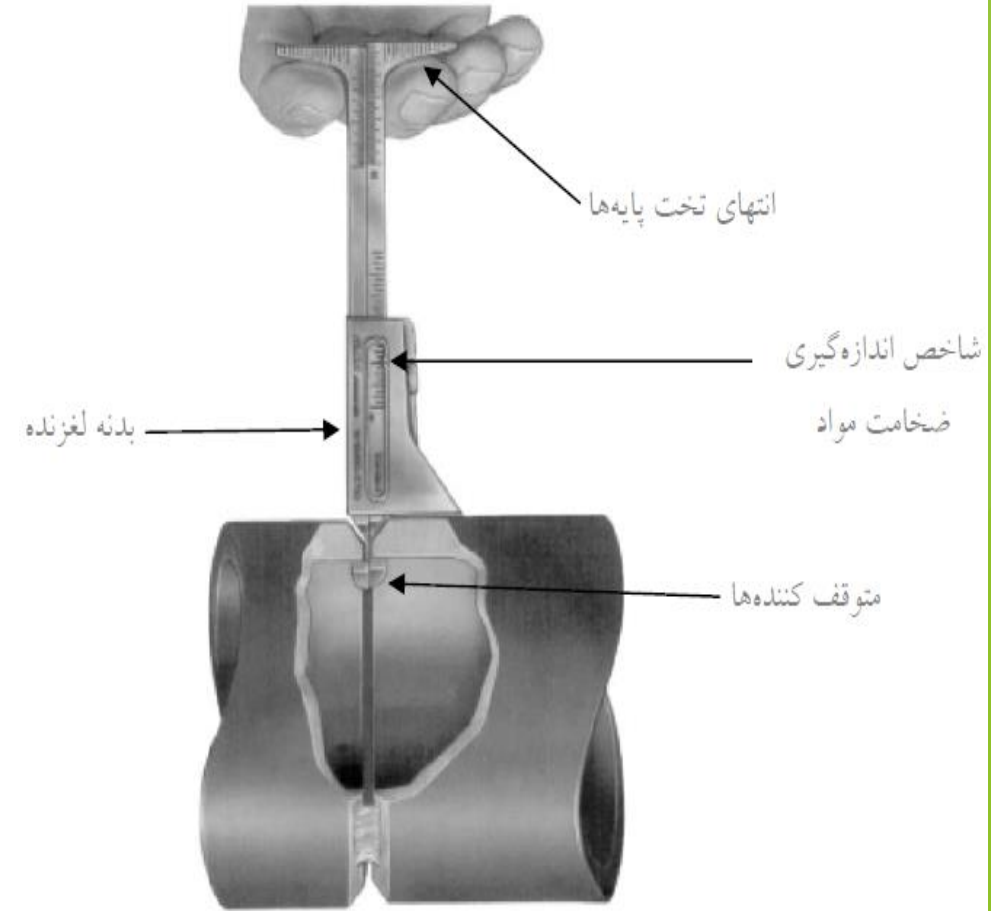

اندازه‌گیری عدم انطباق دیواره داخلی لوله



Plav (Space)





ADJUSTABLE FILLET WELD GAUGE

Measure any fillet weld to 1/32" accuracy with just one simple to use gauge.

Measuring fillet welds used to be a trial with complicated or inaccurate gauges. Not any more. Now you can measure fillet welds from 1/8" to 1" (with $\pm 1/32$ " accuracy) with one economical, simple to understand gauge.


The G.A.L. Adjustable Fillet Weld Gauge uses an offset arm which slides at a 45° angle to make fillet weld length measurements. Simply adjust the arm until it touches the toe of the vertical leg. The gauge is calibrated to 32nds, with metric equivalents given, so you get more accurate readings. Four screws hold the offset arm in position for future adjustments.

This gauge also measures weld throat thickness to 1/16" by adjusting a pointer until it touches the centre of the weld. A thumb screw holds the pointer in position for future reference. If the weld is concave, more filler material can be added to build the weld throat up to standard.


G.A.L. Adjustable Weld Gauge measures both leg lengths and weld throat fillet weld thickness.

The G.A.L. Adjustable Fillet Weld Gauge is made of durable, rust resistant stainless steel. Its 2 1/4 x 3" slim design weighs only 1 1/2 oz., fits easily into a shirt pocket. And because there is just one gauge needed to make all measurements, the chance of losing essential fillet weld gauge blades is eliminated. Fumbling through seven different, inaccurate gauge blades is also eliminated.


Adjustable Fillet Weld Gauge is easy to use

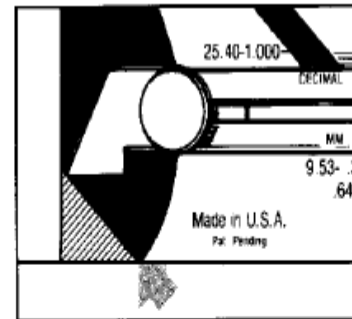


To measure fillet welds, place irregular curve edge flush to horizontal toe of weld so the straight edge is in line with the horizontal member.

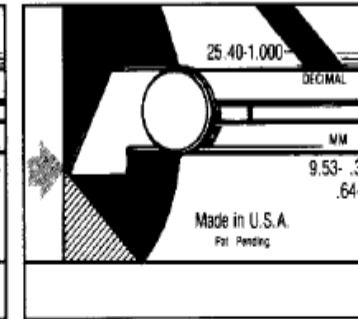


Adjust the offset arm up or down along the diagonal slots until the tip of the arm touches the top of the weld.

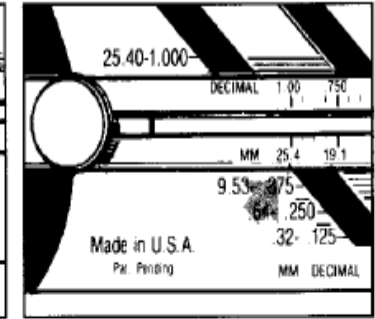


Read the weld size indicated. The increments are in 1/32" and 1/8" markings up to 1". All numerals are etched into the surface and filled for easier reading.

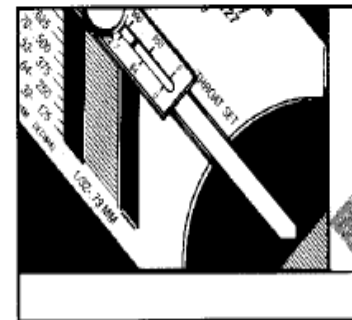


To measure weld throat thickness, place the 45° angle flush to the horizontal and vertical members. Loosen the thumb screw and slide the pointer until it touches the face of the weld.

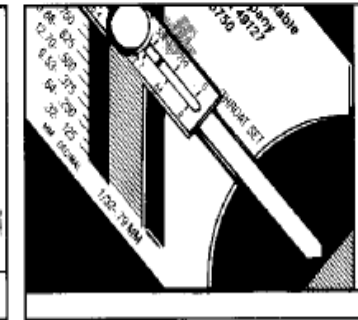

Tighten the thumb screw and read the measurement from the 1/16" calibrations along the pointer. A quick, sure way to find convex or concave welds and to correct them with additional filler material to meet standards.

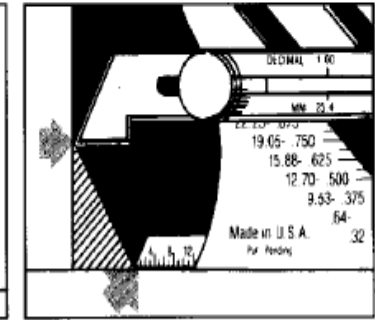

NEW! Measure unequal weld leg lengths by sliding the base measurement scale so it is flush to the horizontal toe of the weld. Adjust offset arm to touch top of weld. Add or subtract to obtain length of each leg.

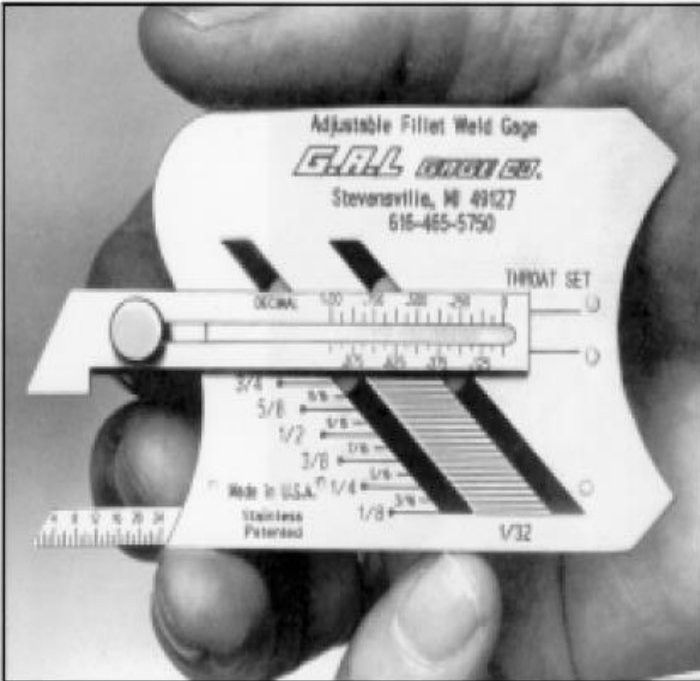

Part No.	Description
WG-3	Standard Gauge
WG-3M	Metric Gauge

ابزار اندازه‌گیری قابل تنظیم برای جوش‌های گوشه با مشخصه ساق‌های نامساوی


با این ابزار اندازه‌گیری، می‌توان جوش‌های گوشه را تا دقت $1/32$ اینچ اندازه‌گیری کرد. با این ابزار اندازه‌گیری مقرون بصره، ساده و قابل کاربری آسان، می‌توان جوش‌های گوشه از $1/8$ اینچ تا 1 اینچ را با دقت $1/32$ اینچ اندازه‌گیری کرد.

گیج قابل تنظیم جوش‌های گوشه با استفاده از یک بازوی متحرک که قابلیت لغزش تا زاویه 45° دارد، برای اندازه‌گیری ساق جوش‌های گوشه استفاده می‌شود. این بازو را می‌توان تا تماس با پنجه جوش ساق عمودی به آسانی تنظیم کرد. چهار پیچ، بازوی متحرک را در وضعیت‌های تنظیم شده مختلف نگه می‌دارند.


همچنین این ابزار ضخامت گلویی جوش را تا $1/16$ اینچ توسط تنظیم شاخص اندازه‌گیری تا تماس آن با مرکز جوش تعیین کرد. شاخص اندازه‌گیری در وضعیتی مشخص برای اندازه‌گیری‌های متعدد توسط یک پیچ نگه داشته شده است. اگر جوش مقعر باشد، می‌توان با افزودن فلز جوش بیشتر ضخامت گلویی را تا رسیدن به حد استاندارد افزایش داد.

با گیج قابل تنظیم جوش‌های گوشه، می‌توان ساق جوش و ضخامت گلویی جوش را اندازه‌گیری کرد.

این ابزارها از جنس فولادهای زنگ‌نزن بادوام و مقاوم و برای سهولت در استفاده و جابجایی، در ابعاد کوچک ساخته می‌شوند.

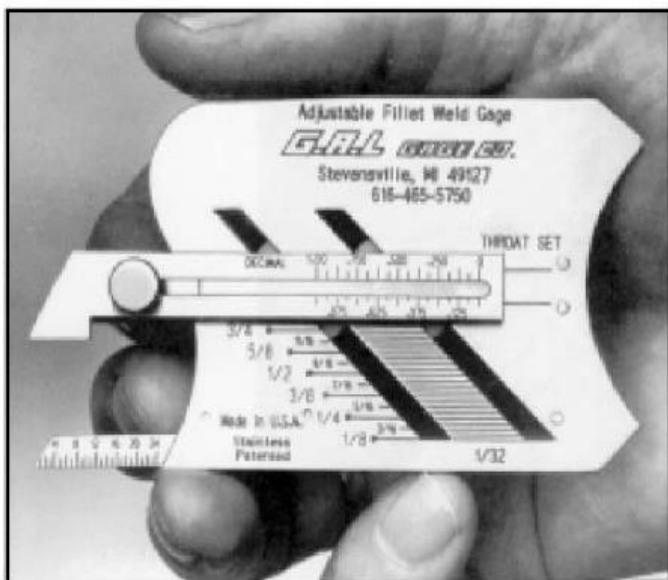


نمونه‌ای از گیج قابل تنظیم جوش‌های گوشه

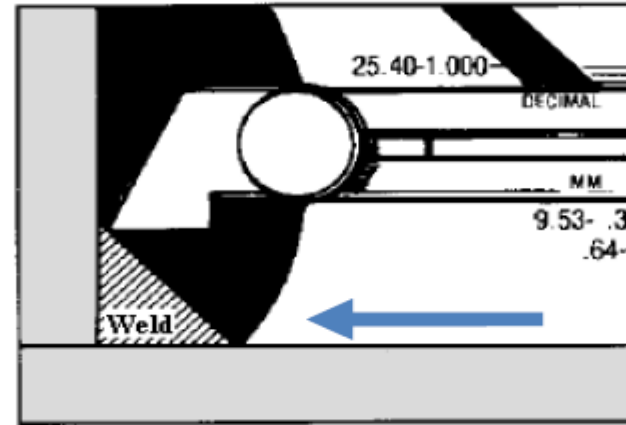


اندازه گیری ساق جوش گوشه

در اندازه‌گیری جوش‌های گوشه، لبه ابزار را که دارای انحنايي بی‌قاغده می‌باشد را در تراز با سطح قطعه افقی تا برخورد با پنجه جوش (در جهت پیکان) حرکت دهید. حال با کمک شاخص اندازه‌گیری ابزار، ساق عمودی جوش قابل اندازه‌گیری است.

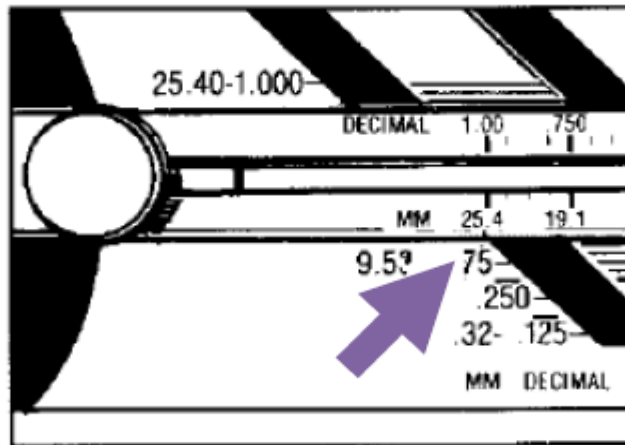


نحوه خواندن اندازه بدست آمده

اندازه جوش نشان‌داده شده را از روی شاخص می‌توان خواند. اعداد از $1/32$ اینچ تا $1/8$ اینچ تا 1 اینچ افزایش یافته‌اند. همه اعداد در سطح گیج حک شده و برای مشاهده آسان‌تر رنگی شده‌اند.

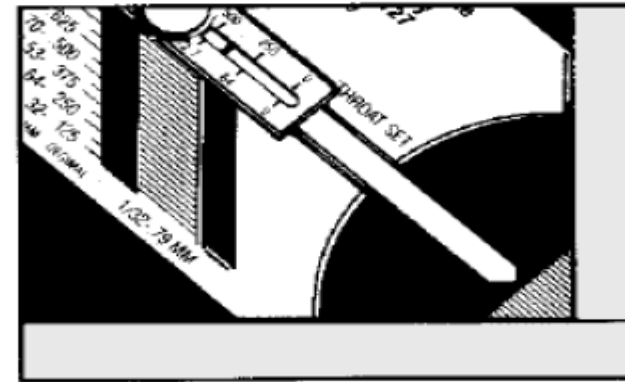

اندازه‌گیری ضخامت گلوبی جوش


برای اندازه‌گیری ضخامت گلوبی جوش، ابزار را مطابق شکل فوق در زاویه 45° نسبت به اعضا نگه داشته و با باز کردن پیچ شاخص اندازه‌گیری، امکان لغزش آن را تا تماس با سطح جوش فراهم می‌کنیم. پیچ را سفت کرده و عدد بدست آمده از روی شاخص اندازه‌گیری را می‌خوانیم. این روش راهی مطمئن و سریع برای یافتن جوش‌های مقعر و محدب است.

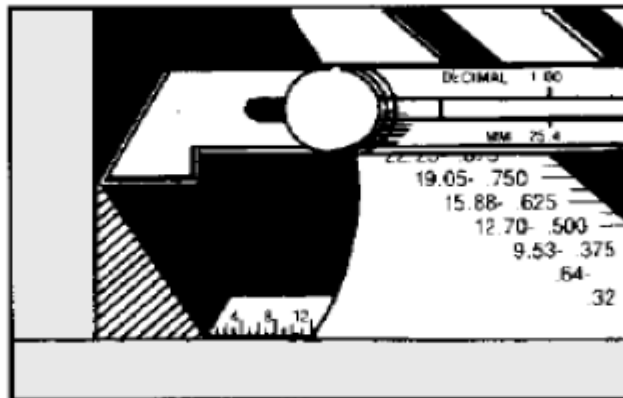

اندازه‌گیری ساق جوش‌های نابرابر


در این حالت، برای اندازه‌گیری همزمان ساق جوش‌های نابرابر لازم است تا علاوه بر لغزاندن شاخص اندازه‌گیری، پایه مقیاس اندازه‌گیری را که هم‌تراز سطح افقی است را به میزان اختلاف اندازه جوش‌ها از گیج، خارج و اندازه‌ها را با استاندارد تطابق داد.

.707 X Leg Length

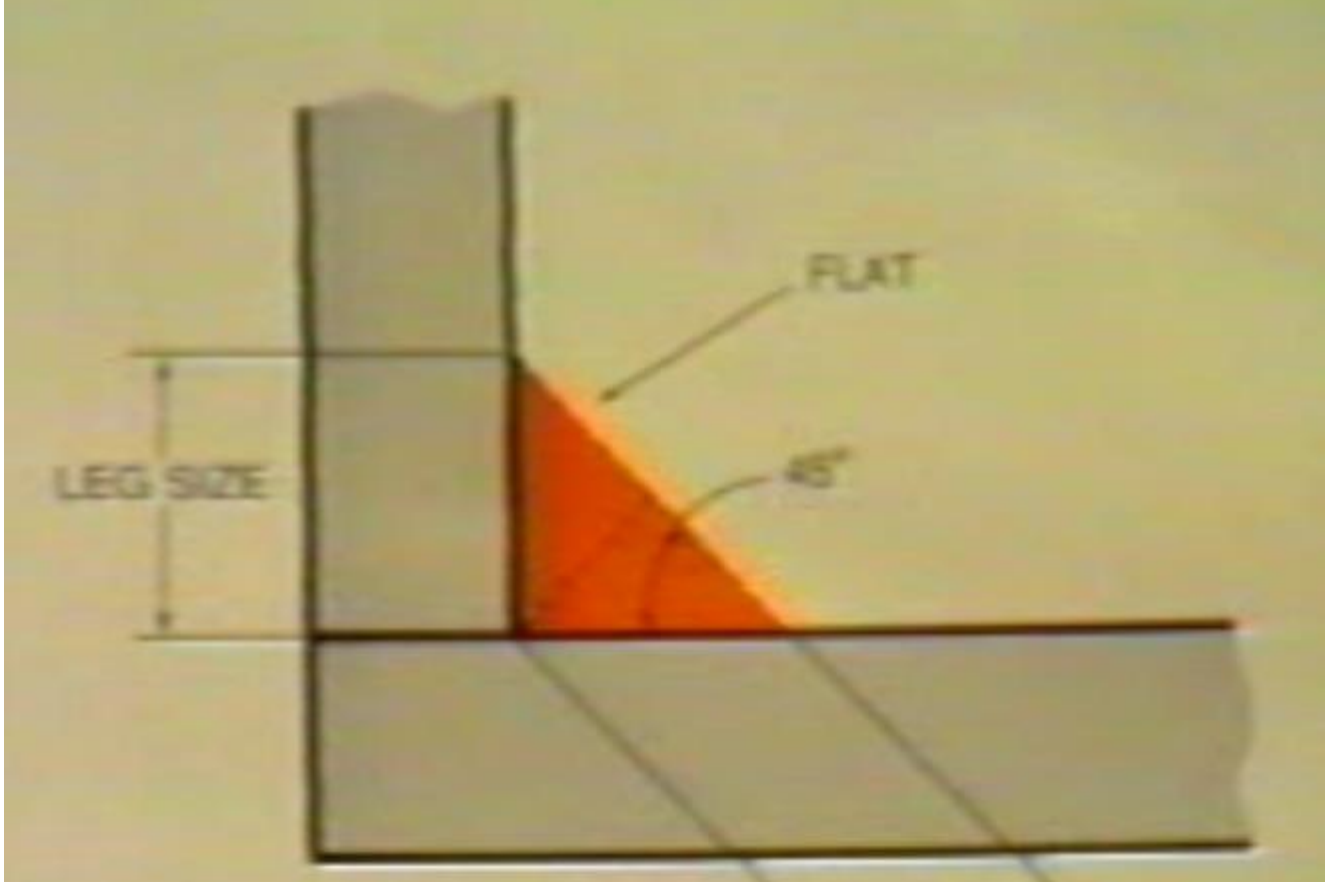





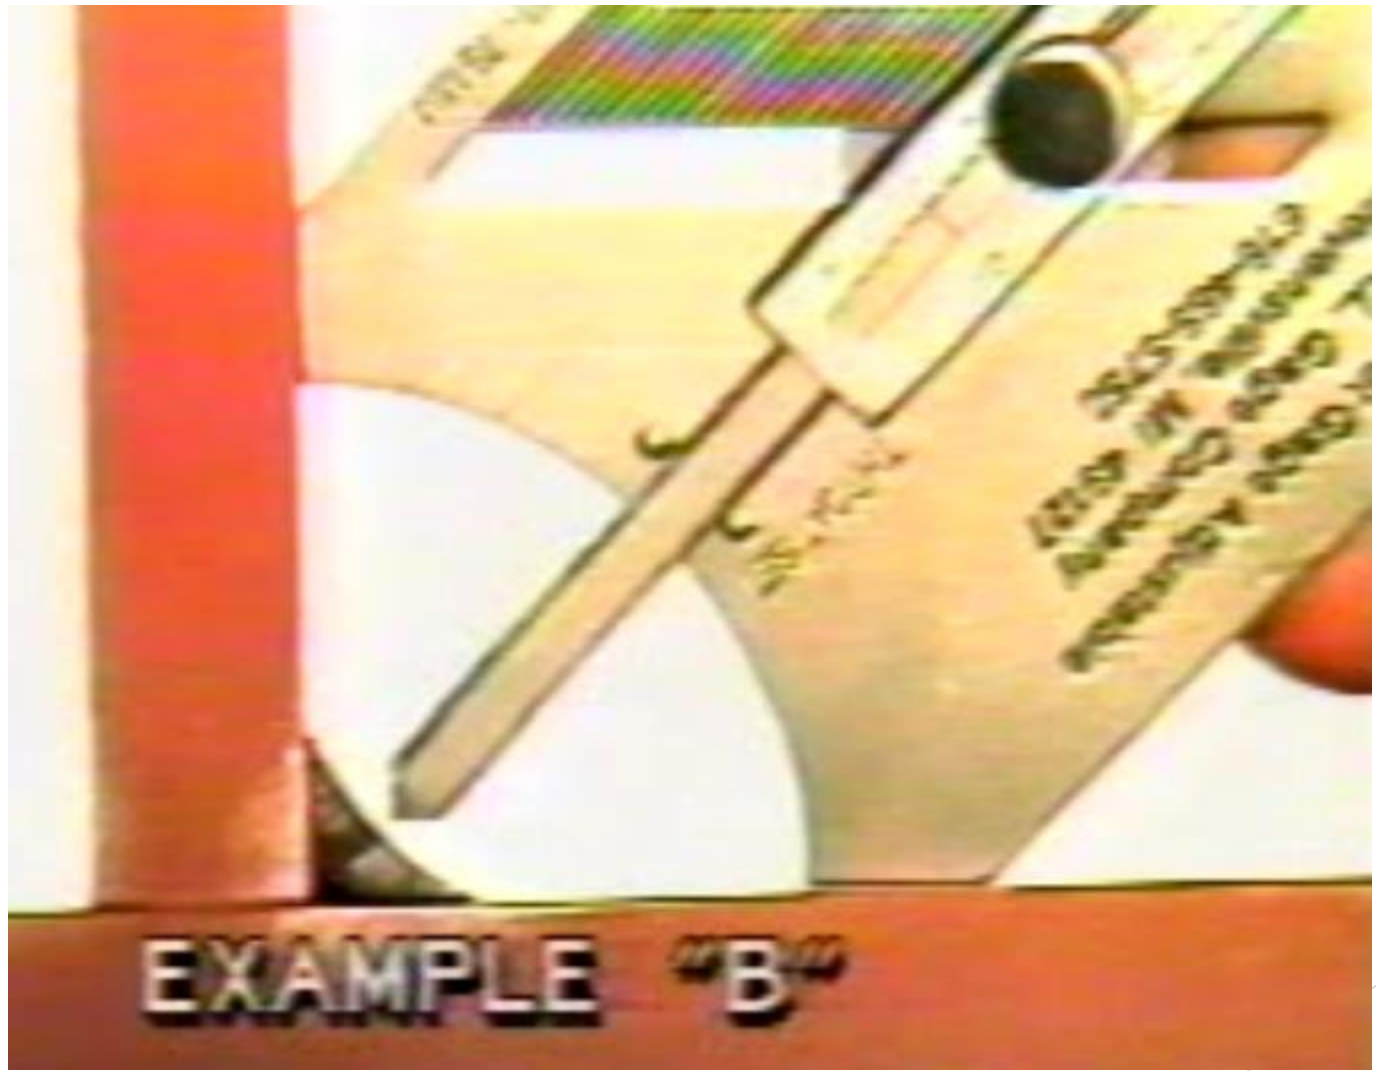

EXAMPLE "B"



World's Best Gauge Adjustable
G.A.L. Gauge Company
Simsbury, CT 06422
860-465-5776

7.40 100


0.05 375
1.64 20
32 175

Made in USA
Patent

EXAMPLE °C


AUTOMATIC WELD SIZE GAUGE

1. To Determine the Size of a Fillet Weld

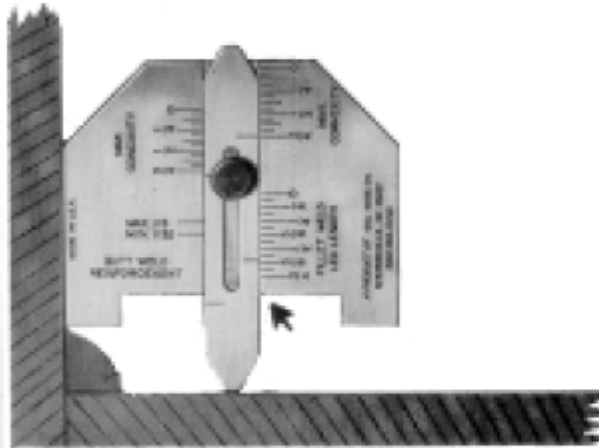


Place the gauge against the toe of the fillet weld and slide pointer out until it touches structure as shown. Read "Size of the Fillet Weld" on the face of gauge as indicated by arrow.

2. To Check the Permissible Tolerance of Convexity

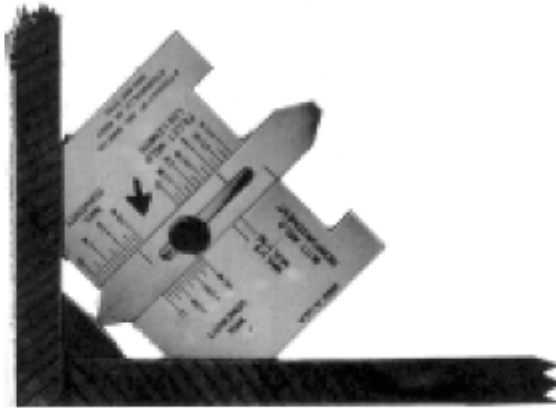


After the size of a convex weld has been determined, place the gauge against the structure and slide pointer until it touches face of fillet weld as shown. The maximum convexity should not be greater than indicated by "Maximum Convexity Scale" as indicated by arrow for the size of fillet being checked.

3. To Check the Permissible Tolerance of Concavity and Underfill

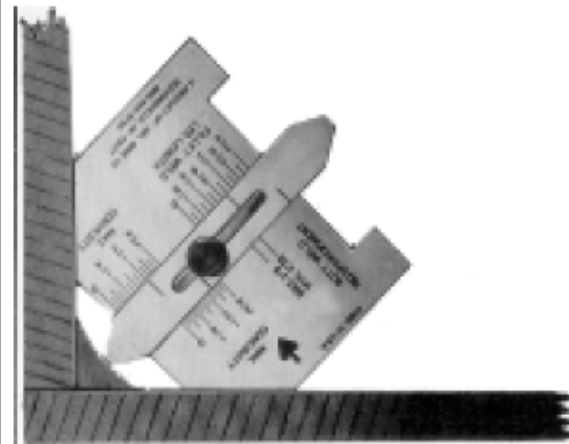


Place gauge against structure and slide pointer out until it touches the face of the fillet weld as shown. If the pointer does not touch as shown, the fillet requires additional weld metal.


4. To Check the Permissible Tolerance of Reinforcement

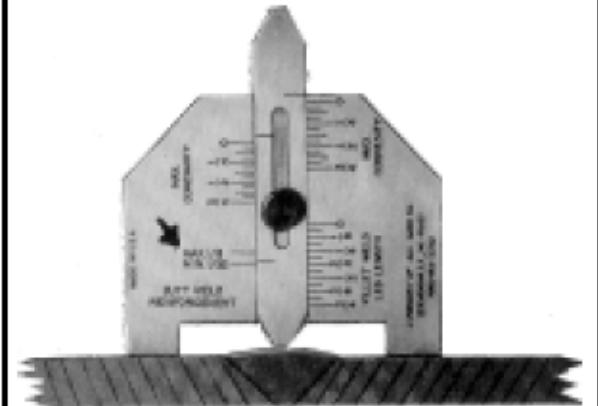

Place gauge so that reinforcement will come between legs of gauge and slide pointer out until it touches the face of weld as shown.

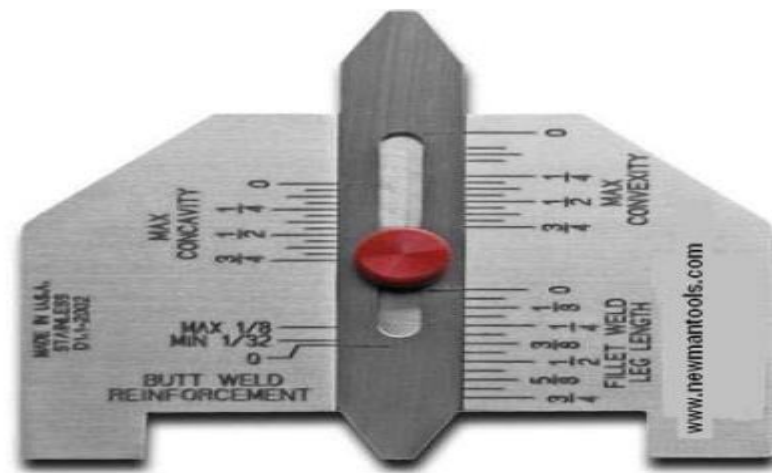

این ابزار، وسیله‌ای مناسب برای اطمینان از کالیبراسیون و تطابق اتصالات جوشکاری شیاری و گوشه است. گاهی به آن سنجه AWS (AWS Gauge) نیز می‌گویند. در تصاویر زیر نحوه اندازه‌گیری تقعر و تحدب جوش‌های گوشه‌ای و شیاری نشان داده شده است.

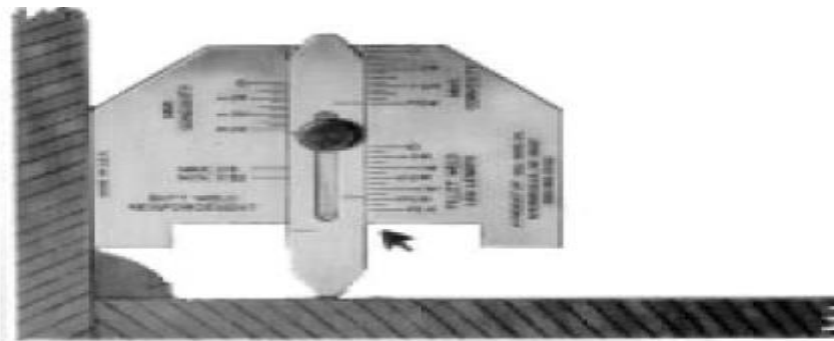


تعیین اندازه جوش گوشه

برای این کار لازم است تا ابزار سنجش را هم سطح با یکی از اعضای اتصال، در تماس با پنجه جوش قرار داده و سپس شاخص اندازه‌گیری را تا جایی که با عضو دیگر اتصال برخورد کند، حرکت می‌دهیم. حال می‌توان اندازه ساق جوش را از روی سطح ابزار (مشخص شده با پیکان) مشاهده کرد.




اندازه‌گیری ضخامت گلویی گوش گوشه

برای تعیین میزان تقعر و تحدب جوش، مطابق شکل بالا، ابزار را در مقابل جوش قرار داده و شاخص اندازه‌گیری را تا جایی که با رویه جوش برخورد کند، باید حرکت داد. سپس می‌توان با خواندن ضخامت گلویی بدست آمده و مقایسه آن با مقادیر مشخص شده در نقشه‌ها، میزان خروج از حالت ایده‌آل را مشخص و با استانداردهای مربوطه ارزیابی کرد.

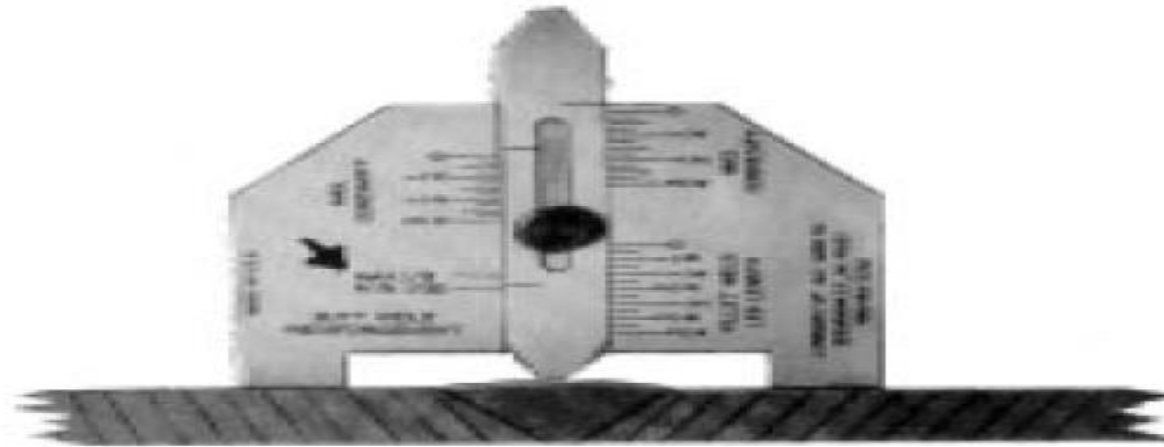


اندازه‌گیری تقعر یا تحدب جوش‌های شیاری


برای اندازه‌گیری تقعر یا تحدب جوش‌های شیاری باید ابزار را مطابق شکل فوق بنحوی روی سطح قرار داد تا خط جوش در بین دو پایه سنج قرار گیرد. سپس سنج را تا تماس شاخص اندازه‌گیری با سطح جوش حرکت می‌دهیم. سپس میزان جابجایی شاخص را بعنوان میزان تقعر یا تحدب جوش از روی سطح ابزار می‌خوانیم.

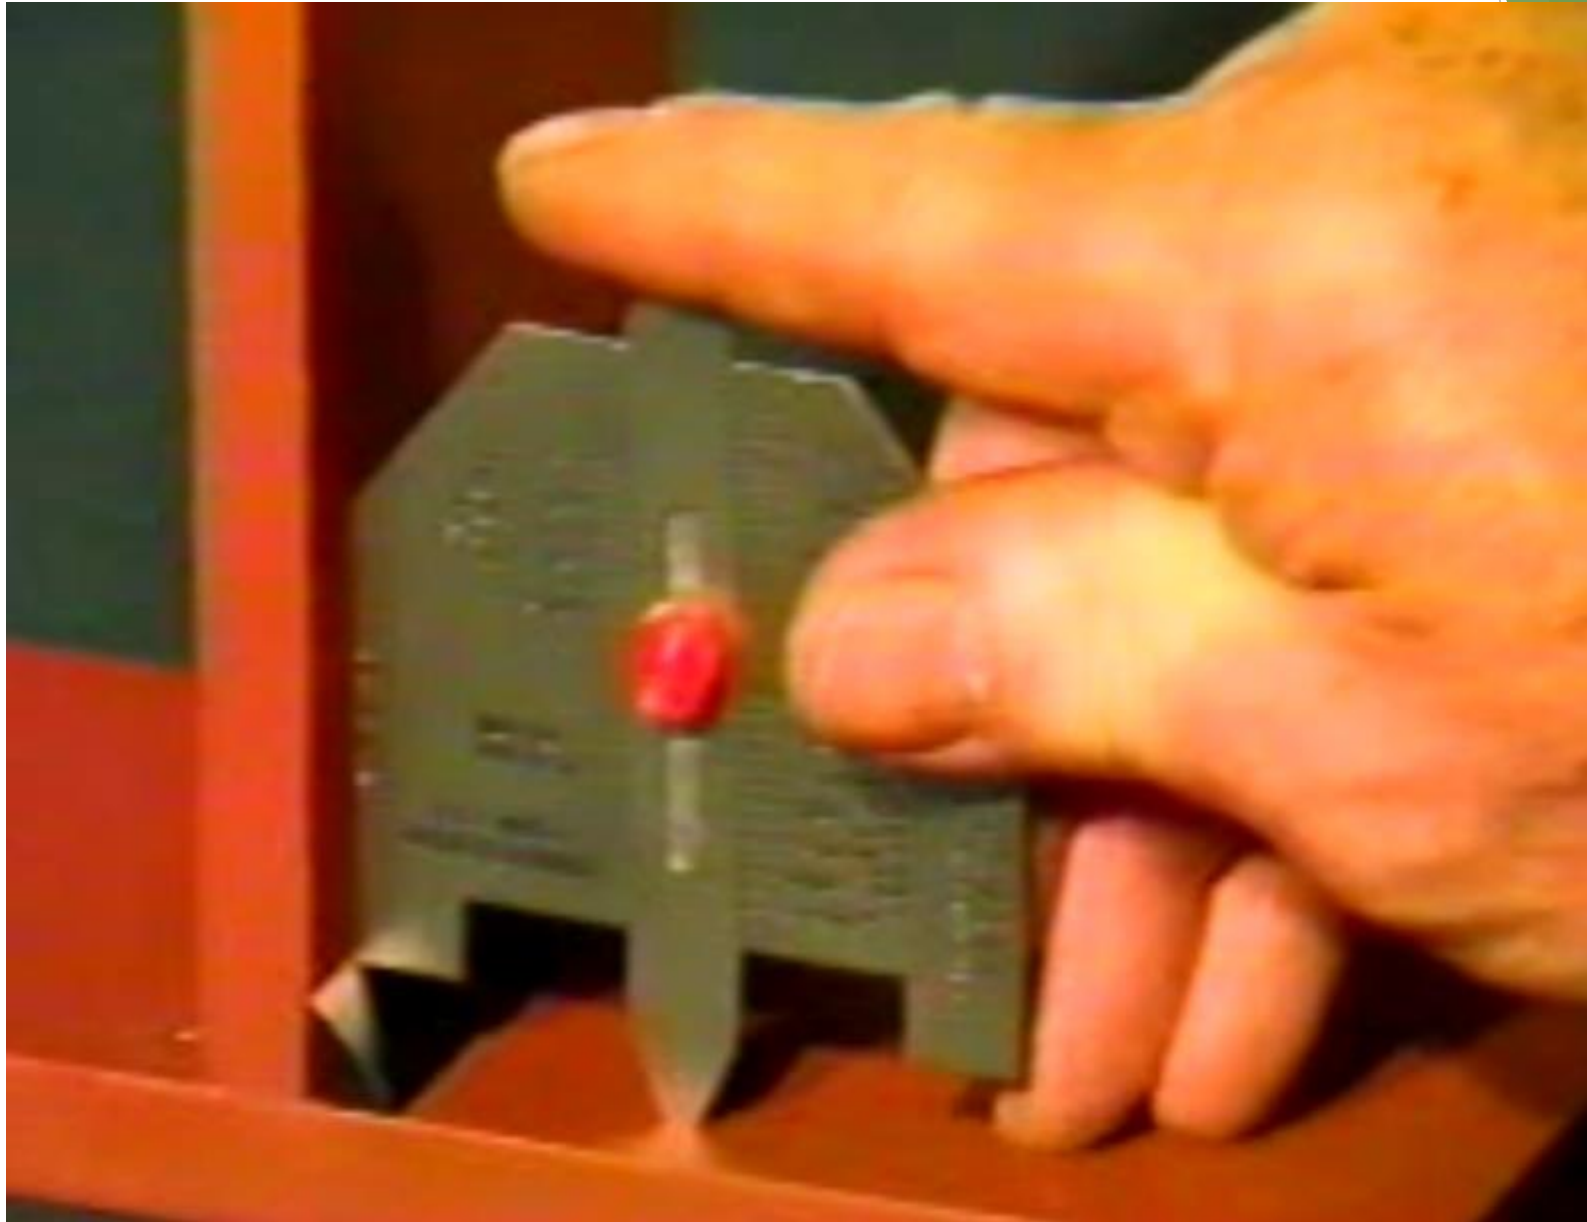



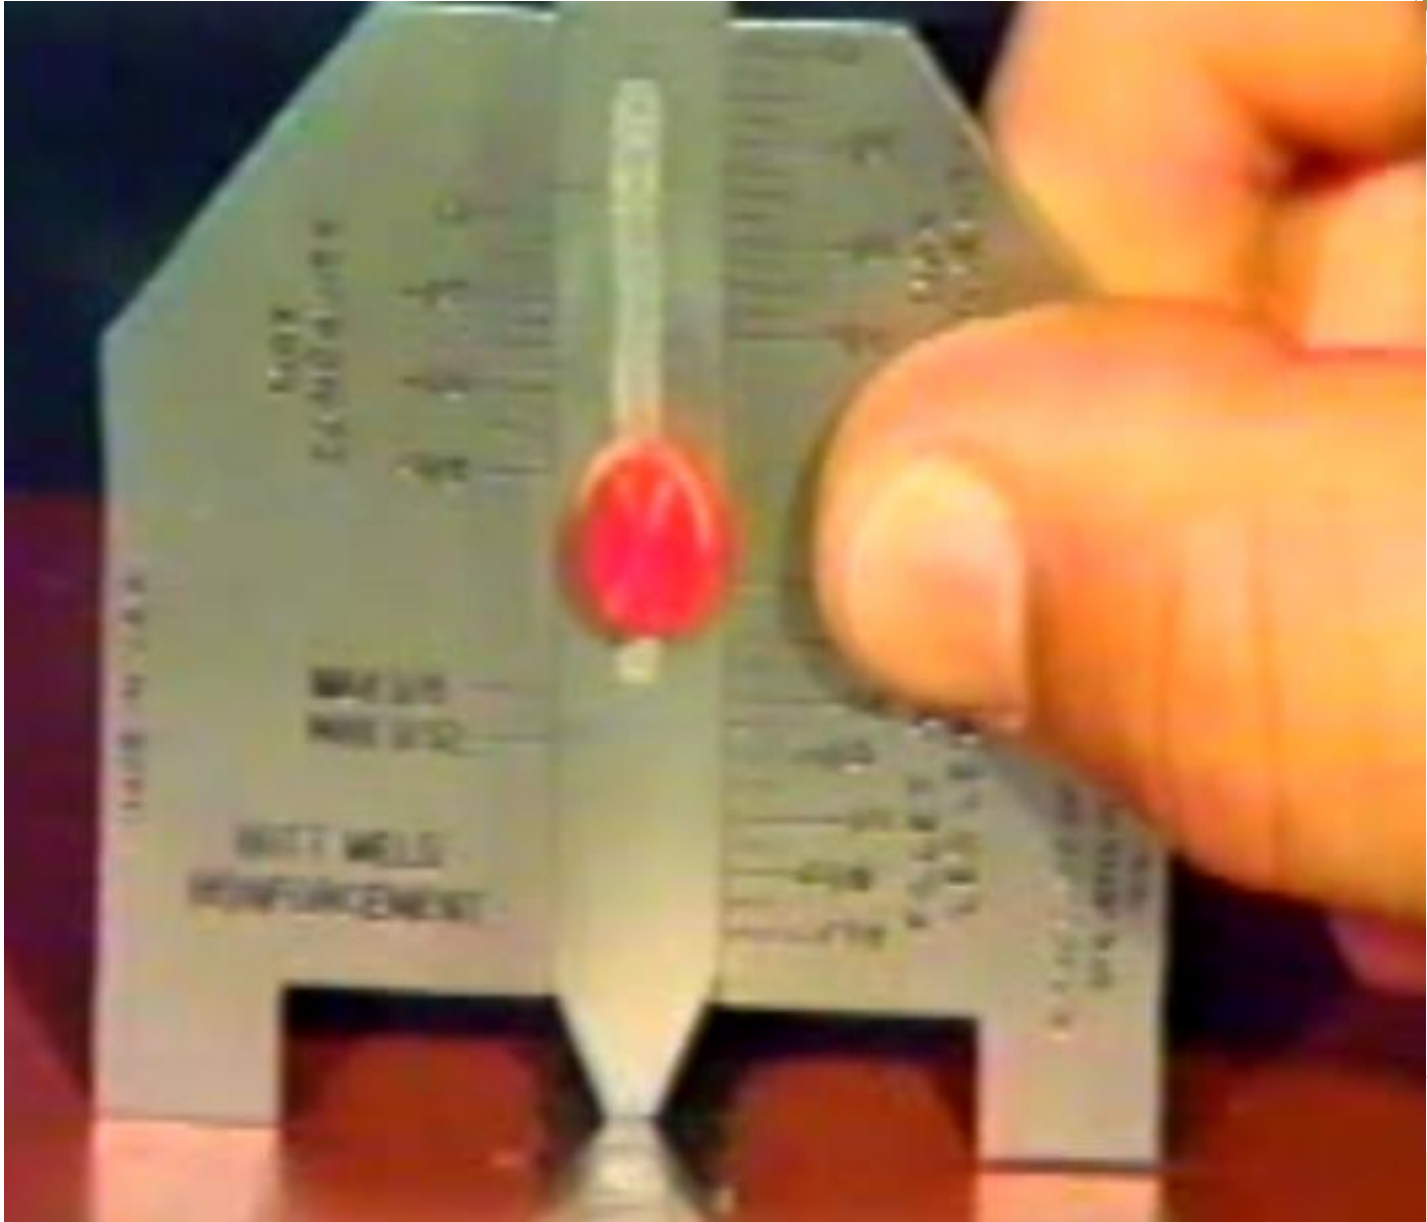

Weld Gauge / Calculator

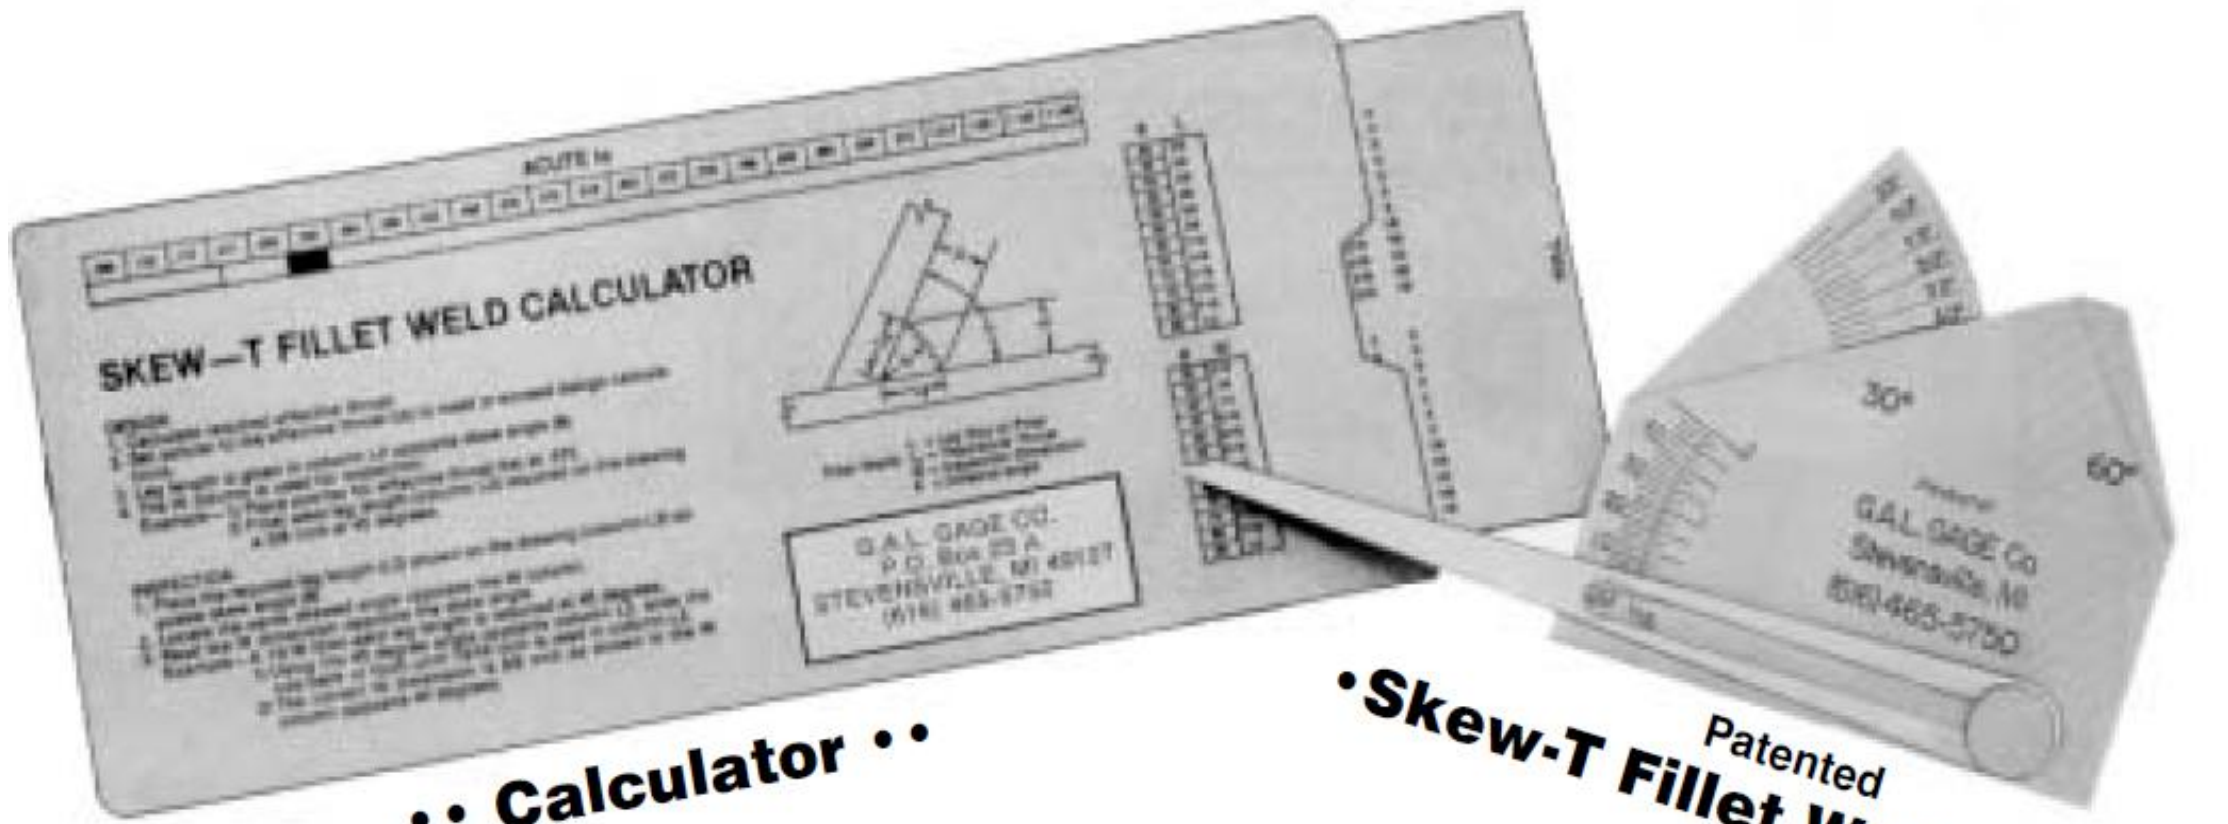

•• Calculator ••

Patented
• Skew-T Fillet Weld Gauge •

A handy compilation of mathematical relationships between leg length, throats, skew angles and inspection dimensions. A must for designers and inspectors. The perfect companion to the GAL Weld Gauge.




**Gauge with
Pointer Retracted**




**Checking Angle of
Vertical Member**



**Gauge with
Pointer Extended**

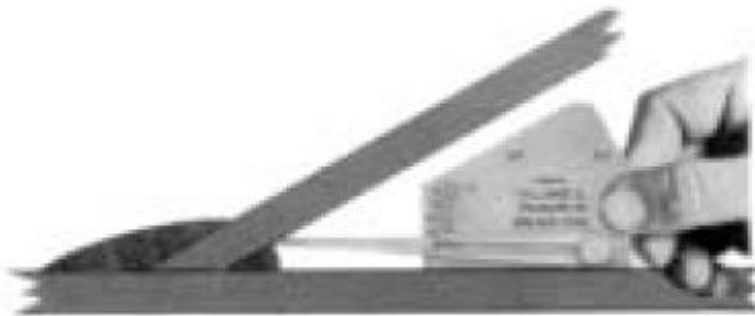

Acute

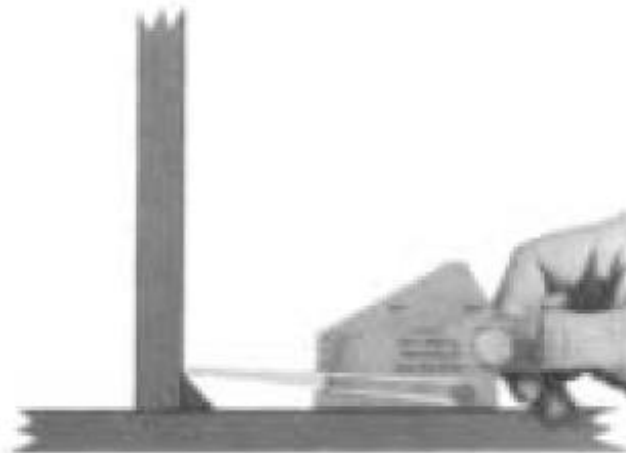

90 Degrees



Obtuse

این ابزار علاوه بر ایجاد امکان اندازه‌گیری مشخصات ظاهری جوش، روابط ریاضی بین طول ساق‌ها، گلوئی‌ها، زوایای اریب و ابعاد بازرسی نیز گردآوری و برای تسهیل استفاده توسط طراحان و بازرسان، روی آن منقوش گردیده‌اند.



نمایی از گیج‌های جوشکاری در حالت‌هایی که شاخص اندازه‌گیری جمع شده و بیرون زده است.



نحوه استفاده از گیج برای بررسی زاویه قطعات مورب و اعضای متقاطع یک اتصال

اندازه‌گیری ابعاد جوش موجود در زوایای حاد





اندازه‌گیری ابعاد جوش موجود در زوایای قائم



اندازه‌گیری ابعاد جوش موجود در زوایای منفرجه



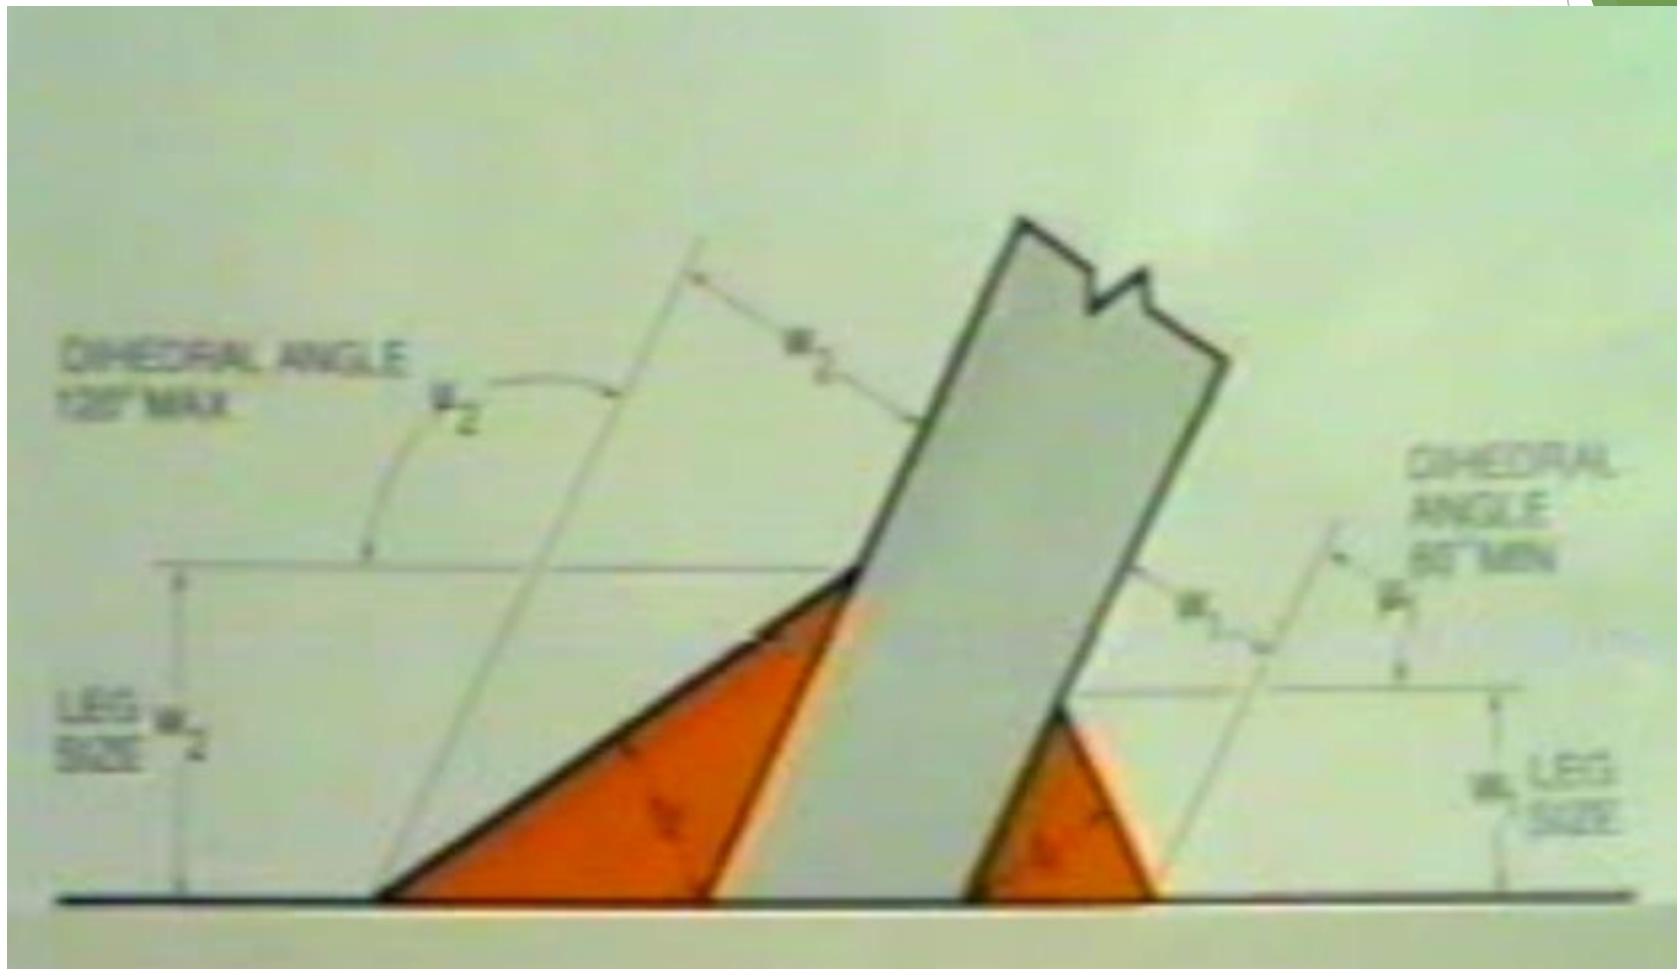


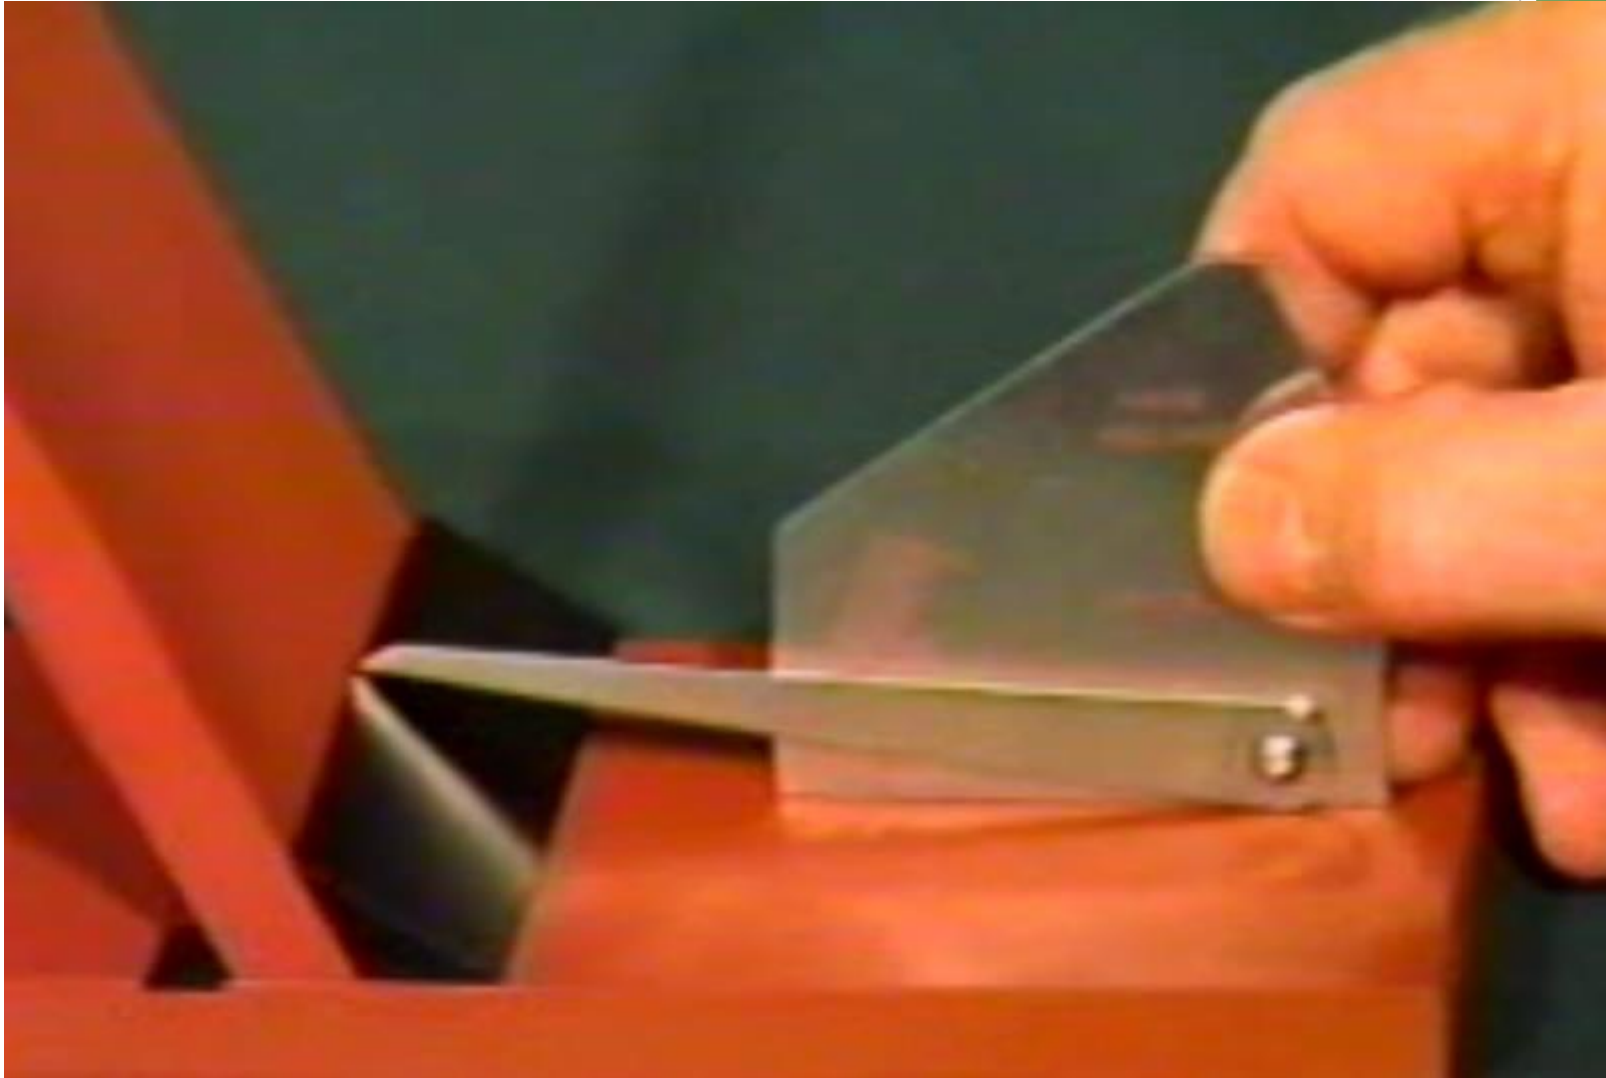






Taper Gauge

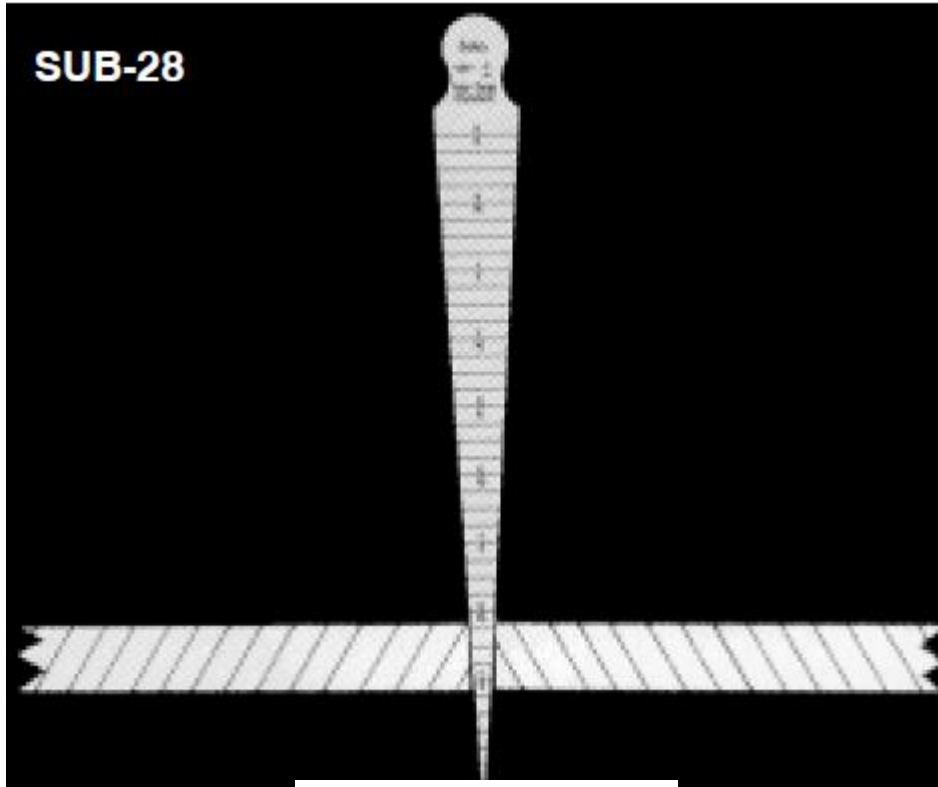


Check Plate Fit-Up

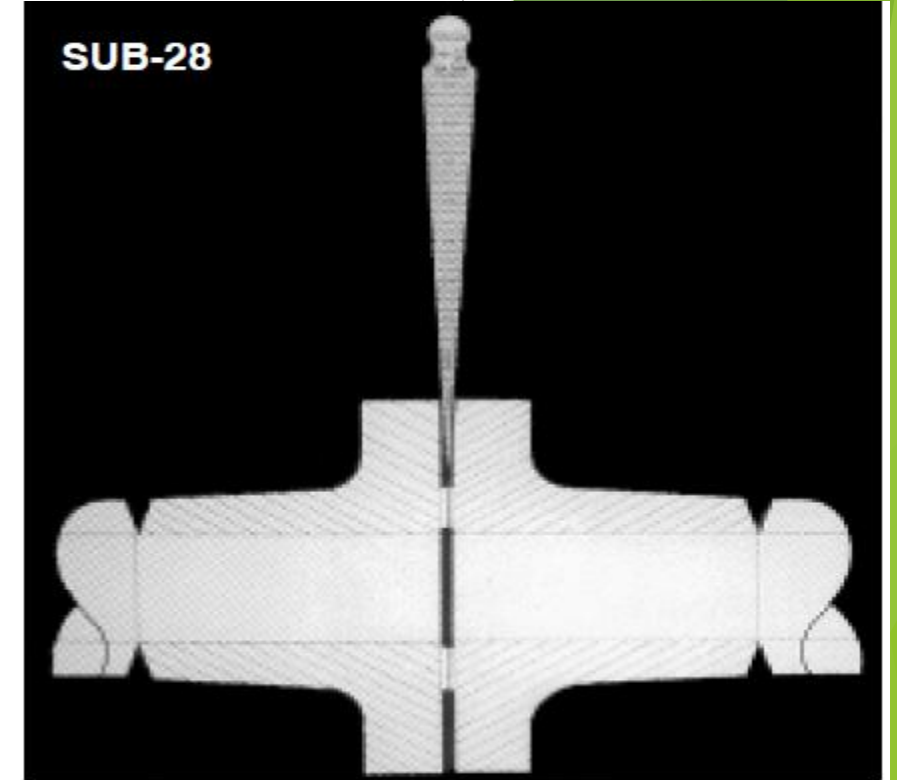

Check Flange Fit-Up

این گیج، ابزاری مناسب برای اندازه‌گیری فاصله ریشه جوش‌ها، بررسی مونتاژ ورق‌ها و یا کنترل مونتاژ فلنج‌ها هستند. ابعاد اندازه‌گیری شده با داخل کردن گیج در فاصله مونتاژ شده و خواندن عدد درج شده روی ابزار انجام می‌شود.

Pipe Pit Gauge

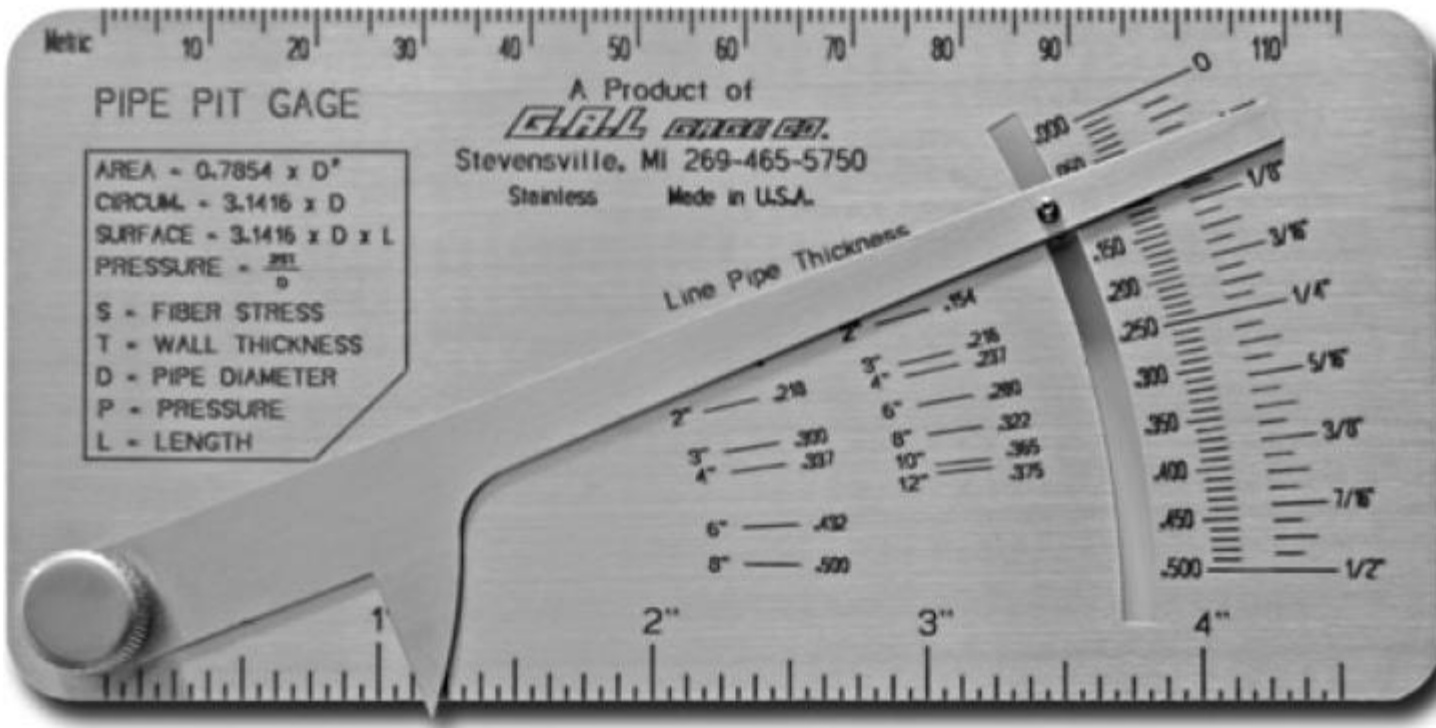

✓ ابزاری مناسب و با دقت بالا برای اندازه‌گیری عمق حفرات و تخلخل‌های بوجود آمده در قطعات

✓ دارای محدوده اندازه‌گیری از صفر تا ۱۲/۵ میلیمتر با دقت ۰/۰۴ میلیمتر

✓ بازوی متحرک را می‌توان در اندازه‌گیری‌ها در هر جایی قفل کرد

✓ باید از جنس فولاد زنگ‌نزن باشد

✓ فرمول‌های محاسباتی نیز برای دسترسی آسان‌تر روی گیج چاپ شده‌اند

DIGITAL WELDING GAUGE



قابلیت‌ها:

- ✓ قابلیت اندازه‌گیری تمامی مقادیر در هر وضعیتی
- ✓ قابلیت انتقال داده‌های اندازه‌گیری شده به رایانه یا پرینتر
- ✓ علاوه بر استفاده از کلید ON/OFF، با جابجایی محور اصلی نیز بطور خودکار روشن می‌شود
- ✓ علاوه بر استفاده از کلید ON/OFF، در صورت عدم استفاده برای ۴ دقیقه نیز بطور خودکار خاموش می‌شود
- ✓ قابلیت اندازه‌گیری فلز جوش اضافی جوش‌های شیاری
- ✓ قابلیت اندازه‌گیری گلویی جوش‌های گوشه